DES Waste Management Division
29 Hazen Drive; PO Box 95
Concord, NH 03302-0095

PHASE I ENVIRONMENTAL SITE ASSESSMENT

FORMER STANLEY MILL
93-119 MEMORIAL STREET
FRANKLIN, NEW HAMPSHIRE

NHDES Site No. 198606087
Project No. 33501

Prepared For:

City of Franklin
316 Central Street
Franklin, New Hampshire 03235

BY
NOBIS GROUP®
18 CHENELL DRIVE
CONCORD, NH 03301

(603) 224-4182

Clarence "Tim" Andrews, P.G.
TAndrews@nobis-group.com

Nobis Project No. 100400.000
October 20, 2022

Digitally signed by
Meghan Benincasa
Date: 2023.10.30
14:42:01 -04'00'

October 20, 2022
File No. 100400.000

Ms. Judie Milner
City Manager
City of Franklin
316 Central Street
Franklin, New Hampshire 03235

Re: Phase I Environmental Site Assessment
Former Stanley Mill
Map 117, Lot 142
93 Memorial Street
Franklin, New Hampshire

Dear Ms. Milner:

Nobis Engineering, Inc. d/b/a Nobis Group® (Nobis) is pleased to present this Phase I Environmental Site Assessment (ESA) for the above-referenced property. This work was performed within the context of ASTM International (ASTM) E 1527-13, "Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process".

In the signing of this document, we declare that, to the best of our professional knowledge and belief, we meet the definition of Environmental Professional as defined in 312.10 of 40 Code of Federal Regulations (CFR) 312 and we have the specific qualifications based on education, training, and experience to assess a property of the nature, history, and setting of the subject property. We have developed and performed all appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312. This report is subject to the limitations in Appendix A.

Thank you for the opportunity to be of service to you. Please do not hesitate to contact us if you have any questions.

Sincerely,

NOBIS GROUP®

Karina Zawilinski
Staff Scientist

Clarence "Tim" Andrews, PG | Associate
Director of State & Municipal Services

Attachment
c: File No. 100400.000 (w/attach.)

Nobis Group®
18 Chenell Drive
Concord, NH 03301
T (603) 224-4182

TABLE OF CONTENTS
PHASE I ENVIRONMENTAL SITE ASSESSMENT
FORMER STANLEY MILL
FRANKLIN, NEW HAMPSHIRE

SECTION **PAGE**

SUMMARY 1

1.0 INTRODUCTION 3
- 1.1 Purpose 3
- 1.2 Detailed Scope-of-Services 4
- 1.3 Significant Assumptions 5
- 1.4 Limitations and Exceptions 5
- 1.5 Special Terms and Conditions 5
- 1.6 User Reliance 5
- 1.7 User Obligations 5
- 1.8 Data Gaps 6

2.0 SUBJECT PROPERTY DESCRIPTION 6
- 2.1 Location and Legal Description 6
- 2.2 Previous Environmental Investigations 7
- 2.3 Site and Vicinity General Characteristics 10
- 2.4 Current Use of the Site 10
- 2.5 Descriptions of Structures, Roads, Other Improvements on Site 10
- 2.6 Current Use of Adjoining Properties 11
- 2.7 Subject Property Physical Setting 11

3.0 USER PROVIDED INFORMATION 12
- 3.1 Environmental Liens 12
- 3.2 Activity and Use Restrictions 12
- 3.3 Specialized Knowledge 12
- 3.4 Valuation Reduction for Environmental Issues 12
- 3.5 Commonly Known or Reasonably Ascertainable Information 12
- 3.6 Obviousness of Presence of Contamination 12
- 3.7 Reason for Performing Phase I 12

4.0 RECORDS REVIEW 12
- 4.1 Standard Environmental Record Sources 12
- 4.2 Vapor Encroachment Screening 17
- 4.3 Additional Environmental Sources 18
- 4.4 Historical Use Information on the Site 21
- 4.5 Historical Use Information on Adjoining Properties 26

TABLE OF CONTENTS (cont.)
PHASE I ENVIRONMENTAL SITE ASSESSMENT
FORMER STANLEY MILL
FRANKLIN, NEW HAMPSHIRE

SECTION **PAGE**

5.0 SITE RECONNAISSANCE....26
5.1 Methodology and Limiting Conditions....26
5.2 General Site Setting....27
5.3 Exterior Observations....27
5.4 Interior Observations....28

6.0 INTERVIEWS....28
6.1 Interview with Current Property Owner....28
6.2 Interviews with Occupants....28
6.3 Interviews with Local Government Officials....28
6.4 Interviews with Others....29

7.0 FINDINGS....29

8.0 OPINION....30

9.0 CONCLUSIONS....32

10.0 DEVIATIONS....32

11.0 ADDITIONAL SERVICES....32

12.0 REFERENCES....33

13.0 QUALIFICATIONS OF ENVIRONMENTAL PROFESSIONALS....34

TABLE OF CONTENTS (cont.)
PHASE I ENVIRONMENTAL SITE ASSESSMENT
10-12 HIGGINS PLACE
FRANKLIN, NEW HAMPSHIRE

FIGURES

1 Site Locus
2 Site Area Plan
3 Site Photographs

APPENDICES

A Limitations
B User Questionnaire
C Historical and Environmental Documentation
D EDR Database Reports
E Municipal File Review

SUMMARY

Nobis Engineering, Inc. d/b/a Nobis Group® (Nobis) has completed a Phase I Environmental Site Assessment (ESA) of the property located at 93 Memorial Street in Franklin, Merrimack County, New Hampshire (*subject property*). The parcel comprising the subject property is identified by the City of Franklin Assessor's office as Lot 142 on Tax Map 117.

The subject property encompasses a 1.2-acre lot developed with a former mill building which operated as a hacksaw manufacturing facility from the early 1900s to circa 1980, and a former armory which has been historically used for storage. The property was transferred to the current owners, Ferrari Franklin Falls Realty, LLC in 1986. Currently, the subject property is unoccupied.

Currently unoccupied commercial properties are located to the east of the subject property along Memorial Street. Residential properties and a community center are located to the south of subject property along Memorial Street. A public park is located to the west of the subject property. The Merrimack River borders the subject property to the north. According to City of Franklin Zoning Map, the subject property and surrounding area are located within the Franklin Falls Historic District.

Nobis conducted a site reconnaissance on September 28, 2022. Significant site observations included three (3) drums in poor condition in the armory building and evidence of urban fill and discarded solid waste, including hacksaw blades, throughout the northern portion of the site. The mill building was inaccessible as the municipal safety officials have condemned the building due to significant structural and safety issues.

Historical data including topographic maps, aerial photographs, Sanborn maps, and municipal records suggest that the property was developed as a hacksaw manufacturing facility in the late 1800s or early 1900s and operated as such until circa 1980. The former armory was constructed circa 1920 and operated as a storage facility until the 1980s. Historical maps show that the surrounding area was developed by the late 1800s and primarily used for industrial purposes, including metals manufacturing and hydroelectric power.

The several environmental records were found to be associated with the subject property. The subject property has undergone several environmental investigations, and there is record of polycyclic aromatic hydrocarbons, volatile organic compounds, naphthalene, and metals contamination exceeding state regulatory action levels as well as the presence of hazardous building materials onsite.

One hundred and three (103) environmental records (NH ALLSITES, NH Aqueous Foam, AST, Brownfields, Drycleaners, ECHO, EDR Hist. Cleaner, EDR MGP, FINDS, ICEC, LUST, Manifest (RI, NY), PFAS, RCRA-nongen, VSQG, SHWS, US Brownfields, UST) were identified with twenty-four (24) properties within a 1/8-mile radius of the subject property. Because of their distance, hydrogeologic location, and/or closed regulatory status, none of the records/sites are expected to adversely impact the subject property.

Nobis has completed a Phase I ESA of the property at 93 Memorial Street, Franklin, New Hampshire. This work was performed in accordance with ASTM E 1527-13, "Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process". This assessment has identified five (5) Recognizable Environmental Conditions (*RECs*), one (1) Historical REC (HREC), and a Vapor Encroachment Condition (VEC). No Controlled RECs (CRECs) or de minimus conditions (DMCs) were identified in association with the subject property.

The five (5) RECs identified were as follows:

- REC #1: improperly disposed of waste/industrial fill in the northern portion of the property.
- REC #2: Soil contamination above applicable standards onsite.
- REC #3: Groundwater contamination above applicable standards onsite.
- REC #4: CVOC vapors above indoor screening levels in soil gas onsite.
- REC #5: The presence of drums containing unknown substances in poor condition onsite.

The one (1) HREC identified was:

- HREC#1: a former UST was identified proximal to the former armory building. The UST was properly closed with no evidence of a release identified.

1.0 INTRODUCTION

Nobis Engineering, Inc. d/b/a Nobis Group® (Nobis) has completed a Phase I Environmental Site Assessment (ESA) for the property identified by the City of Franklin's Assessor's office as Lot 142 on Tax Map 117 located in Franklin, Merrimack County, New Hampshire (subject property). This work was performed in accordance with American Society for Testing and Materials (ASTM) E 1527-21, "Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process". This Phase I ESA was completed as part of due diligence requirements in connection with potential purchase and sale of the subject property. ASTM E 1527-21 was published by ASTM in November 2021 but has not yet been adopted by the Environmental Protection Agency (EPA). EPA still references ASTM E 1527-13. This report meets the criteria for both the current ASTM standard (1527-21) and the standard that is still used by EPA (1527-13). The updated standard includes all of the provisions of the historical standard; therefore, 1527-21 meets all the criteria set forth in 1527-13.

1.1 Purpose

The objective of this Phase I ESA was to assess environmental conditions at the subject property and vicinity for Recognized Environmental Conditions (RECs), historical RECs (HRECs), Controlled RECs (CRECS) and de minimis conditions associated with the presence of *petroleum products* or *hazardous substances* in conformance with ASTM E 1527-21, "Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process". The ASTM Standard Practice E 1527-21 defines these terms as follows:

> *RECs are the presence or likely presence of any hazardous substances or petroleum products in, on, or at a property: (1) The presence of hazardous substances or petroleum products in, on, or at the subject property due to a release to the environment; (2) the likely presence of hazardous substances or petroleum products in, on, or at the subject property due to a release or likely release to the environment; or (3) the presence of hazardous substances or petroleum products in, on, or at the subject property under conditions that pose a material threat of a future release to the environment.*
>
> *HRECs are a past release of any hazardous substances or petroleum products that has occurred in connection with the property and has been addressed to the satisfaction of the applicable regulatory authority or meeting unrestricted use criteria established by a regulatory authority, without subjecting the property to any required controls.*
>
> *CRECs are a recognized environmental condition resulting from a past release of hazardous substances or petroleum products that has been addressed to the satisfaction of the applicable*

regulatory authority, with hazardous substances or petroleum products allowed to remain in place subject to the implementation of required controls.

De minimis conditions (DMCs) are those situations that do not present a material risk of harm to public health or the environment and generally would not be subject to enforcement action if brought to the attention of the regulating authority.

In addition, a Tier I vapor encroachment screening (VES) was completed as part of this assessment. This screening is conducted in general accordance with ASTM E2600-15, *Standard Guide for Vapor Encroachment Screening on property Involved in Real Estate Transactions* dated October 2015.

1.2 Detailed Scope-of-Services

To meet the objectives of the Phase I ESA, Nobis performed the following tasks:

- Reviewed New Hampshire Department of Environmental Services (NHDES) and EPA regulatory database listings concerning environmental conditions at, and in the vicinity of the subject property, as provided by Environmental Data Resources, Inc. (EDR).

- Contacted officials of the City of Franklin, New Hampshire to obtain information pertaining to present and historical environmental conditions at the subject property and adjacent environs.

- Reviewed available history of ownership and land usage records and interviewed persons with knowledge of the subject property to obtain past usage information.

- Reviewed available aerial photographs and/or topographic maps to aid in assessing local geology and in assessing past and present land use at the subject property and vicinity.

- Conducted a reconnaissance of the subject property on September 28, 2022, to assess surficial and general environmental conditions at the subject property and adjacent environs for evidence of RECs associated with past or present *petroleum product* or *hazardous substance* handling or storage activities.

- Prepared this report summarizing the results of the assessment.

No ASTM non-scope items are included as part of this Phase I ESA.

1.3 Significant Assumptions

It is assumed that federal, state, and local records are generally complete and current. The preparer assumes that all individuals contacted and/or interviewed during the preparation of this Phase I ESA have responded in good faith. Nobis is entitled to rely on all information gathered during this scope of work.

1.4 Limitations and Exceptions

This Phase I ESA is intended to assess the subject property for significant environmental issues. It is not intended as a guidance document for potential future remedial action. In addition, this ESA is subject to the limitations included in Appendix A.

1.5 Special Terms and Conditions

No special terms or conditions apply to this project.

1.6 User Reliance

This Phase I ESA has been prepared exclusively for the use of Nobis' Client. With the exception of release to any third party by Nobis or the Client, reliance on this report is for informational purposes only. Nobis makes no warranties to person(s) or entity(ies) other than the Client to rely on the information provided in this report. Any person(s) or entity(ies) wishing to use this information shall do so with the written permission of Nobis and the contract for which it is intended. Prior approval from Nobis is required for disclosure of information obtained in this report.

Continued viability of this report is subject to ASTM E 1527-21 Sections 4.6 and 4.8. If this ESA will be used by a different user(s) (third party) than the user(s)for whom the ESA was originally prepared, the third party must also satisfy the user(s) responsibilities in Section 6 of ASTM E 1527-21.

1.7 User Obligations

As defined in ASTM E 1527-21, the user responsibilities are as follows:

- Check title records for environmental liens and activity and use restrictions.
- Disclose specialized knowledge and experience.
- Explain why the purchase price is below market value, if it is discounted.
- Answer interview questions in good faith.
- Provide information as outlined in Section 6 of ASTM E 1527-21 including completing the User Questionnaire attached in Appendix B.

For the purpose of this ESA, the *user* is defined as the City of Franklin, New Hampshire. A representative of the *user* provided the information required under Section 3.0, as well as responses to the User Questionnaire.

1.8 Data Gaps

Efforts were made by Nobis to obtain *user* provided information and review all reasonably ascertainable resources to determine historical uses of the subject property and surrounding properties to identify the possibility of RECs in connection with the subject property. Objectives are completed within the framework of research outlined above; however, data failure may be encountered. As defined by ASTM, data failure or data gaps occur when historical research is reasonably ascertained and reviewed, but the intended objectives have not been met. This ESA was limited by the following:

- The interior of the former mill building on the subject property could not be accessed during site reconnaissance on September 28, 2022 due to safety concerns.
- The owner and past owners of the subject property and adjoining property owners were not interviewed regarding the past usage of the target property.

The subject property has been secured and remained vacant since prior inspections and assessments were completed and remains unused. No substantial changes to interior use are anticipated. It is the opinion of the Environmental Professionals writing this report that the data gaps noted above has not significantly impacted the ability to identify RECs in association with the subject property.

2.0 SUBJECT PROPERTY DESCRIPTION

2.1 Location and Legal Description

The subject property is located at 93 Memorial Street in Franklin, Merrimack County, New Hampshire, and is identified by the City of Franklin on Tax Map 117 as Lot 142. According to the City of Franklin Assessor's records, the parcel comprises an area of approximately 1.2-acres and is currently owned by Ferrari Franklin Mills Realty LLC, of Stoneham, Massachusetts. Ownership of the subject property and a legal description is contained in a 2015 Deed recorded in Book 3467 Page 2235 at the Merrimack County Registry of Deeds. A Locus Plan is provided as Figure 1 and a Site Plan is provided as Figure 2. Photographs taken during the property reconnaissance on September 28, 2022 are provided on Figure 3.

2.2 Previous Environmental Investigations

1999 UST Closure and Removal - Lakes Region Environmental Contractors

In December 1998, a 10,000-gallon UST containing #2 fuel oil was closed and removed from the site. The UST formerly provided fuel oil to the mill building. The tank was reported to be in fair condition with no evidence of leakage. A composite soil sample was taken from the area around the tank. No compounds were detected above their applicable soil standards in the sample. The January 1999 report stated that no further work was required regarding the UST.

2014 Phase I ESA - Credere Associates LLC

Credere Associates LLC completed a Phase I ESA for the subject property in 2014. The report indicated the subject property was owned by the Ferrari Mill Trust. Historically, the subject property was used for manufacturing of hacksaw blades and as a state National Guard Armory. The report indicated the subject property has been unused and unoccupied since acquisition by the current owner with exception of a brief period of time where a portion of the armory building was leased to a cabinet making business.

The Phase I identified several RECs: Disposal of industrial waste as fill at the site, evidence of a UST behind the armory building, presumed asbestos-containing material (ACM), staining on a former transformer pad, threat of release from corroded drums in the buildings, release to surface soil from hopper east of Stanley mill, release or the threat or from possible subsurface supply lines in the boiler house, and likely presence of surface soil impacts throughout the site related to historic use. The Phase I also identified three (3) environmental findings: observed possible hazardous building materials throughout the site, upstream historical industrial operations, and a former UST removed from the east side of the Stanley Mill building.

The Phase I report recommended the removal of the drums, a Phase II investigation to confirm or dismiss the RECs identified, and a Hazardous Building Materials Survey (HBMS).

2015 Phase II ESA - Credere Associates LLC

Credere Associates LLC completed a Phase II ESA in 2015 to confirm or dismiss the presence of RECs identified in the 2014 Phase I ESA. The investigation included: a ground penetrating radar (GPR) survey, soil borings, soil sample collection, monitoring well installation and groundwater sample collection, surface soil sampling, test pit excavation, collecting sediment samples from the Winnipesaukee River, an asbestos and polychlorinated biphenyls (PCB)-containing materials survey and sample collection of suspect materials, collection of samples from stained concrete, a lead-based paint (LBP) screening of site buildings, and an inventory of universal, hazardous, and/or other wastes present in site buildings.

The assessment confirmed the presence of industrial waste as fill at the site, evidence of a UST outside the northwest corner of the former armory, asbestos-containing materials, and PCB-containing building materials.

The assessment reported several compounds in soil samples at the site. Tetrachloroethene (PCE) was reported in several soil samples collected during the assessment at concentrations above thye NHDES Soil Remediation Standard (SRS). Other volatile organic compounds (VOCs) detected below their applicable SRS were: Cis-1,2-dichloroethene, trichloroethene (TCE), 1,2,4-trimethylbenzene, tetrachloroethene (PCE), and xylenes. Several polycyclic aromatic hydrocarbons (PAHs) were detected in soil samples at the site above their applicable SRS. Compounds detected above their SRS included: benzo(a)anthracene, benzo(b)fluoranthene, benzo(a)pyrene, dibenzo(a,h)anthracene, indeno(1,2,3-cd)pyrene, and naphthalene. Metals reported in soil samples at the site above their applicable SRS were antimony, arsenic, chromium, and lead.

The only compound reported above its SRS in sediment samples from the Winnipesaukee River was benzo(a)pyrene.

The assessment reported vinyl chloride, trichloroethene (TCE), and PCE above their AGQS in groundwater samples collected from the site, and TCE was detected above its GW-2 standard at one location. Arsenic was reported above its AGQS in one sample and was detected below its AGQS at other locations.

The assessment recommended: further assessment of contaminants in soil and groundwater onsite to better delineate the extent of contamination, the removal of the former UST, proper abatement of ACM, PCB and LBP containing building materials, proper decommissioning and disposal of fuel oil supply lines and disposal of drums offsite, further assessment of the risk of vapor intrusion onsite, and preparation of a remedial action plan (RAP) once contaminants onsite were adequately assessed.

2018 Targeted Brownfields Assessment and Remedial Action Plan- Nobis Group

Nobis completed a Phase II ESA/ Targeted Brownfields Assessment (TBA) in 2018 to further assess contamination onsite. Investigation activities included: soil gas sample point installation, sub-slab soil sampling, bedrock well installation, drive and wash soil borings and subsurface soil sampling, test pits and related soil sampling, shallow soil sampling, monitoring well installation and development, groundwater sampling, soil gas sampling, UST closure, and supplemental hazardous building materials sampling.

The UST was removed and disposed of in accordance with all local, state, and federal regulations. No evidence of release from the UST was observed. Two (2) composite soil samples were collected from the base of the UST excavation and analyzed for VOCs, PAHs, RCRA metals, and diesel range organics (DRO). Soil samples collected from the UST excavation did not report any SRS exceedances.

Information and observations obtained from test pit explorations as well as a subsurface soil boring program identified an area of industrial fill material consisting of metal particles, solid waste, and hacksaw blades from improper disposal of industrial wastes generated from the former mill operations. The extent of the industrial fill material spans the top of the riverbank in the rear of the former Stanley Mill and the armory building. The total inferred extent of industrial fill was calculated to cover a footprint of approximately 11,660 square feet with an estimated mass of 5,506 tons.

The investigation reported contamination in several matrices throughout the site. Analysis of soil samples indicated the presence of VOCs naphthalene and PCE, PAHs benzo[a]anthracene, benzo[a]pyrene, benzo[b]fluoranthene, benzo[k]fluoranthene, chrysene, dibenz[a,h]anthracene, fluorene, indeno[1,2,3-cd]pyrene, and arsenic, chromium, cadmium, and lead above their applicable SRS in one or more locations onsite.

Groundwater sampling results reported the presence of cis-1,2-dichloroethene, PCE, TCE, Benzo[a]anthracene, and benzo[b]fluoranthene above their applicable AGQS in one or more groundwater samples from the site. TCE was detected above GW-2 standards in two groundwater samples. 1,4-dioxane was reported in several groundwater samples onsite. At the time of the report, the levels were below the applicable AGQS of 3.0 µg/L, but since the AGQS dropped to 0.32 µg/L in September 2018, 1,4-dioxane levels are now in exceedance of the current AGQS in several locations onsite.

Soil gas sampling indicated the presence of PCE and TCE above soil gas screening levels at one location onsite.

Asbestos was reported in several materials sampled throughout the two buildings, and PCBs were detected above the laboratory detection limit in one bulk sample.

Nobis proposed three (3) remedial action alternatives as part of a Remedial Action Plan (RAP):

- Alternative 1 - an Activity and Use Restriction (AUR) with fencing and no site access.
- Alternative 2 - partial building demolition, riverbank encapsulation and stabilization, fence and AUR.

- Alternative 3 - partial building demolition and excavation of Industrial waste fill material area. Based on the future development goals for the site, partial excavation of PAH impacted areas with an AUR for any PAH-contaminated soils remaining in place.

Nobis recommended Alternative 3 as the preferred remedial alternative. This action would also include hazardous building materials abatement, restoration and stabilization of the riverbank, long-term groundwater monitoring, and an AUR.

Excerpts from the TBA Report are included in Appendix C.

2.3 Site and Vicinity General Characteristics

The subject property is currently developed with two (2) buildings- a former mill building and an armory. Both buildings are currently unoccupied. The topography of the subject property is generally flat and level. The general surrounding area slopes gradually to the west towards the Pemigewasset River. The subject property has an approximate elevation of ±300-feet above mean sea level.

Currently, unoccupied commercial properties are located to the east of the subject property along Memorial Street. Residential properties and a community center are located to the south of subject property along Memorial Street. A public park is located to the west of the subject property. The Merrimack River borders the subject property to the north. According to City of Franklin Zoning Map, the subject property and surrounding area are located within the Franklin Falls Historic District.

2.4 Current Use of the Site

The subject property is currently an unoccupied lot developed with a former mill building and an armory.

2.5 Descriptions of Structures, Roads, Other Improvements on Site

The property is developed with two buildings. The building on the east side of the property is a 10,312 sq ft footprint two (2) story brick and mortar mill building. The building on the west side of the property is a 10,038 sq ft footprint 1.5-story former armory. There is a driveway off Memorial Street which borders the east side of the property. Utility lines run along the east side of the property and across the river. Memorial Street borders the property to the south and a sidewalk runs along the edge of the property. A retaining wall is present along the northern edge of the property along the river. Several monitoring wells are located on the property.

2.6 Current Use of Adjoining Properties

Currently, unoccupied commercial properties are located to the east of the subject property along Memorial Street. Residential properties and a community center are located to the south of subject property along Memorial Street. A public park is located to the west of the subject property. The Merrimack River borders the subject property to the north.

2.7 Subject Property Physical Setting

The subject property is depicted on the U.S. Geological Survey (USGS), Franklin, NH - 2018 7.5-minute topographic quadrangle at an elevation of approximately ±300 feet referenced to the North American Vertical Datum of 1988.

Bedrock beneath the subject property is comprised of metapelite, turbidites, with thin quartz conglomerates of the Lower part of the Rangeley Formation. (J.B. Lyons, W.A. Bothner, R.H. Moench, and J.B. Thompson, Jr., 1997, Bedrock Geologic Map of New Hampshire: USGS, scale 1:250,000). Previous environmental investigations encountered weathered bedrock at depths between 26 and 46 feet below ground surface (bgs). Competent bedrock was encountered at approximately 70 ft bgs at one location.

According to the United States Department of Agriculture's Natural Resource Conservation Service (NRCS) Web Soil Survey (http://websoilsurvey.sc.egov.usda.gov/App/WebSoilSurvey.aspx), soil beneath the subject property consists primarily of urban land with slopes of 0 to 8 percent, with a small percentage of Champlain loamy fine sand, with slopes of 0 to 3 percent. Soil type at the subject property is depicted in the NRCS Soil Map included in Appendix C.

The subject property is located on the National Flood Insurance Program Flood Insurance Rate Map (FIRM) for the City of Franklin, Merrimack County, New Hampshire – Map Number 33013C0159E, effective April 19, 2010. The FIRM image was available in the Federal Emergency Management Agency (FEMA) online database and was reviewed as part of this assessment and is included in Appendix C. The map depicts the subject property in several zones. The northernmost portion of the property is depicted in Zone A, without Base Flood Elevation. This is considered a special flood hazard area. The image is not high enough resolution to discern, but it appears this zone extends only to the edge of the sloped portion on the northern part of the property. A significant portion of the property is depicted in Zone X, an area which has a 0.2% annual chance flood hazard or a 1% annual chance flood hazard with average depth of less than one foot or drainaige areas of less than one square mile. The Southernmost portion of the property is depicted in Zone X, area of minimal flood hazard.

3.0 USER PROVIDED INFORMATION

Mr. Seth Creighton, a representative of the City of Franklin responded to a User Questionnaire. The completed questionnaire is attached in Appendix B.

3.1 Environmental Liens

The *user* is not aware of any environmental liens for the subject property.

3.2 Activity and Use Restrictions

The *user* is not aware of activity and use limitations for the subject property.

3.3 Specialized Knowledge

The *user* does not possess any specialized knowledge of the subject property.

3.4 Valuation Reduction for Environmental Issues

The *user* believes that the purchase price reasonably reflects fair market value of the property.

3.5 Commonly Known or Reasonably Ascertainable Information

The *user* indicated that they are aware the subject property is undeveloped land.

3.6 Obviousness of Presence of Contamination

The *user* indicated that they are aware of contamination at the subject property that has been identified during prior assessments.

3.7 Reason for Performing Phase I

The *user* stated that their acquisition of the site is the reason for performing the Phase I ESA.

4.0 RECORDS REVIEW

4.1 Standard Environmental Record Sources

As part of this ESA, state and federal environmental records were reviewed in the form of an environmental database report provided by EDR. A copy of the database report is included as

Appendix D. Information was also obtained from other local municipal and state records. The following is a summary of significant findings from this review:

Federal and State Regulatory Agencies

EPA National Priority List (NPL)

The EPA's NPL is a list of confirmed or proposed Superfund facilities. The subject property was not identified as an NPL facility. No NPL facilities were identified within a ±1.0-mile radius of the subject property.

Delisted NPL

The Delisted NPL is a list of sites removed from the NPL when no further response is appropriate. The subject property was not identified as a delisted NPL facility. No delisted NPL facilities were identified within a ±1.0-mile radius of the subject property.

Superfund Enterprise Management System (SEMS), including Federal Facility Sites

SEMS (formerly CERCLIS) tracks sites and remedial activities in support of the EPA Superfund Program. This database contains data on potentially hazardous waste sites reported to EPA by states, municipalities, private companies, and private persons; site proposed for inclusion on the NPL, and sites being assessed for possible inclusion on the NPL. The subject property was not identified as a SEMS facility. No SEMS facilities were identified within a ±0.5-mile radius of the subject property.

Superfund Enterprise Management System Archive (SEMS-ARCHIVE)

The SEMS-ARCHIVE (formerly CERCLIS-NFRAP) database is a database of archived SEMS facilities at which, to the best of the EPA's knowledge, assessment has been completed and the EPA has determined that no further steps will be taken to list this site on the NPL. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site. The subject property was not identified in the SEMS-ARCHIVE database. No SEMS-ARCHIVE facilities were identified within a ±0.5-mile radius of the subject property.

Emergency Response Notification System (ERNS) Releases

The ERNS database is the EPA's database of emergency response actions. The subject property was not identified as an ERNS site.

Federal Resource Conservation and Recovery Act (RCRA) Handlers

The RCRA database is the EPA's database of registered hazardous waste generators and Treatment, Storage or Disposal Facilities (TSDF). The subject property was not identified as a TSDF, corrective

action (CORRACTS) facility, RCRA Large Quantity Generator (RCRA-LQG), RCRA Small Quantity Generator (RCRA-SQG), or RCRA Very Small Quantity Generator (RCRA-VSQG).

The database report did not contain listings for RCRA CORRACTS facilities within a ±1-mile radius, RCRA non-CORRACTS TSD facilities within a ±0.5-mile radius, and RCRA-LQG or RCRA-SQG within a ±0.25-mile radius of the subject property.

The database report did contain listings for two (2) RCRA-VSQG within a ±0.25-mile radius of the subject property. The RCRA-VSQG include Tradebe HHW at 43 W Bow St, and Xtra Mart at 449 Central Street. No violations were reported for any of the RCRA-VSQG facilities.

Federal Institutional Control / Engineering Control Sites

The Federal Institutional Control / Engineering Control (IC / EC) registry is the EPA's database of Superfund or RCRA sites that have either institutional or engineering controls in place as part of the remedial action to achieve or maintain protection of human health and the environment. The subject property was not identified as a Federal IC/EC. No Federal IC/EC sites were identified within a ±0.5-mile radius of the subject property.

State Institutional / Engineering Control Sites

The State IC/EC database consists of state-maintained databases which contain information on sites with Activity and Use Restrictions (AURs) where remedial action relies on the restriction of site activities and uses to achieve or maintain protection of human health and the environment. The subject property was not identified as a State IC/EC site. Three (3) State IC/EC sites were identified within a ±0.5-mile radius of the subject property. The sites include: Riverbend Mill at 100 Memorial Street, Franklin Fire Station at 59 W Bow St, and Castle Motors at 168 Central Street. Due to the downgradient topographic location of theses site relative to the subject property, none of these sites are expected to adversely impact the subject property.

State and Tribal Hazardous Waste Site Inventory (SHWS) Sites

The SHWS Sites database is a database of confirmed disposal sites, locations to be investigated, waived, deleted, and reserved sites. The subject property was not identified as a SHWS.

Seven (7) SHWS sites were identified within a ±1.0-mile radius of the subject property. According to the database report, four (4) of the 7 SHWS sites are greater than 0.25-miles from the subject property and four (4) of the 7 listed sites have closed regulatory status. One site with an open regulatory status, Franklin Non-Ferrous Foundry, is located 0.89 miles from the subject property, and another, Franklin Fire Station, is located at a lower elevation and across the Pemigewasset River, a hydrogeological divide. Based on proximity and nature of the releases, these sites are not

expected to adversely impact the subject property. Franklin Business Center, located at 20 Canal Street, is discussed further in section 4.2.

State and Tribal Spill Reports

The SPILLS database contains surface, groundwater, and hazardous materials spills as reported to NHDES. Additionally, SPILLS 90 records were obtained from FirstSearch, and includes spill and release records pertaining to chemical, oil and/or hazardous substances spills. The subject property was not identified as a SPILL site by the EDR report.

State and Tribal Landfill and/or Solid Waste Disposal Sites (SWF/LF)

State/Tribal SWF/LF type records contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet certain RCRA criteria for solid waste landfills or disposal sites. The subject property was not identified as a current or former SWF/LF. No State or Tribal SWF/LF sites were identified within a ±0.5-mile radius of the subject property.

State and Tribal Leaking Underground/Above-ground Storage Tank (LUST/LAST) List

The LUST/LAST list is a database of sites where leaking underground and above-ground storage tanks have been identified/reported and is maintained by the NHDES. The subject property was not identified as a LUST/LAST site.

The database report identified no LAST sites within ±0.50-mile of the subject property; however, eight (8) LUST sites were identified within ±0.50-mile radius of the subject property. All of the LUST sites have a closed regulatory status and therefore are not expected to adversely impact the subject property.

State and Tribal Underground Storage Tank (UST) and Aboveground Storage Tank (AST) List

The UST/AST list is a database of registered underground and aboveground storage tanks maintained by NHDES. The subject property was identified as a UST facility and is discussed further in section 4.2.

The database report lists thirteen (13) UST facilities and two (2) AST facilities within a ±0.25-mile radius of the subject property. The USTs located at Franklin Savings Bank (405, 287 Central Street), JJ Newbury #6146 (384 Central Street), Regal Auction Services (349 Central Street), and Franklin City Hall (316 Central Street) within a ±0.125-mile radius of the subject property have been closed. Franklin Business Center at 20 Canal Street has a reported AST and a UST and is discussed further in section 4.2.

Federal Brownfields Sites

The Federal Brownfields Sites database assists EPA in collecting, tracking, and updating information, as well as reporting on the major activities and accomplishments of the various Brownfield Grant Programs. The subject property was identified as a Federal Brownfields site and is discussed further in section 4.2.

Four (4) Federal Brownfields sites were identified within a ±0.5-mile radius of the subject property. Polyclad Laminates (45 Tannery Street) and Ciao Pasta (194 Central Street) are located more than 0.25 miles from the subject property and across a hydrogeological divide and therefore are not expected to adversely impact the subject property. Franklin Business Center (20 Canal Street) and R&D Paving (81 Memorial Street) are adjacent to the subject property and are discussed further in section 4.2.

State and Tribal Brownfields Sites

The NHDES maintains a database of Brownfields sites that are registered with the agency. The database may not include the federal Brownfields sites. The subject property was identified as a brownfields site and is discussed further in section 4.2.

Six (6) State or Tribal Brownfield sites were identified within a ±0.5-mile radius of the subject property. Polyclad Laminates (45 Tannery Street), Franklin Elks Lodge (192 Central Street), Former Ciao Pasta (194 Central Street), and Former JP Stevens Mill (38 E Bow Street) are located across the Winnipesaukee River, a hydrogeological divide, and are not expected to adversely impact the subject property. Franklin Business Center and R&D Paving are adjacent to the subject property and are discussed further in section 4.2.

Orphan Summary Sites

According to EDR, unmapped facilities are those that do not contain sufficient address or location information to evaluate the facility listing locations relative to the subject property. The database report contained a listing for five (5) unmapped facilities. Further research indicated that one (1) facility was outside the one-mile radius. Two (2) facilities, Franklin Municipal Landfill and Franklin River Road Landfill, reference the same site, which is greater than 0.5 miles and downgradient from the subject property. One facility, GHI Associates, Inc. references the J.P. Stevens Textile Mill Building, which is located at 38 E Bow Street. The site is across the Winnipesaukee River and has a closed regulatory status. One facility, Stanley Mill, is the subject property and is discussed further in section 4.2.

The EDR identified unlisted LUST documentation at the orphan site Stanley Mill. Recent environmental investigations at the subject property have not identified any petroleum-related contamination or concerns with a former LUST onsite.

4.2 Vapor Encroachment Screening

As specified in the ASTM E1527-21 standard, Nobis completed a VES for the subject property. The screening was prepared in general compliance with ASTM E2600-15, *Standard Guide for Vapor Encroachment Screening on Property Involved in Real Estate Transactions*. The objective of the VES was to determine if a vapor encroachment condition (VEC) exists or does not exist relative to the subject property. A VEC is defined as:

> "*the presence or likely presence of chemical(s) of concern (COC) vapors in the vadose zone of the subject property caused by the release of vapors from contaminated soil and/or groundwater either on or near the subject property.*"

A VEC is a potential exposure pathway, specifically to building occupants, whereby volatile organic contamination present in soil and groundwater may partition into the vapor phase and migrate into soil gas and indoor air of a building, if present.

On Site: Environmental investigations in 2015 and 2018 reported the presence of volatile chlorinated compounds PCE and TCE at levels exceeding regulatory standards at one or more locations onsite. Based on this information, a VEC due to an on-site source is present.

Off-Site: To conduct the VES of the nearby area, Nobis conducted a detailed review and analysis of the EDR report with particular focus on the follow two types of sites:

1. Off-site properties that are impacted by non-petroleum spills or releases (i.e., chlorinated volatile organic compounds (CVOCs) and/or semi-volatile-organic compounds (SVOCs) and are located within approximately **1,750 feet** of the subject property, and,

2. Off-site properties that are impacted by petroleum spills or releases and are located within approximately **525 feet** of the subject property.

Our review of the site-specific environmental database indicates that four (4) non-petroleum impacted sites (Franklin Business Center, R&D Paving, Franklin Elks Lodge, and Ciao Pasta) and two (2) petroleum-impacted sites (Riverbend Mill and Franklin Business Center) are located within the above-described radii of the subject property. However, all six (6) impacted sites can

be ruled out due to their regulatory status (i.e., regulatory closure has been issued) and/or topographical position from the subject property (i.e., down-gradient or cross-gradient). Based on this information, it is Nobis's opinion that a VEC at the subject property due to an off-site source does not appear to exist.

4.3 Additional Environmental Sources

Based on the database listings provided by EDR, Nobis also completed an online database search using the NHDES's OneStop (https://www4.des.state.nh.us/DESOnestop/BasicSearch.aspx) for select listed facilities. Information pertaining to the select listed facilities identified above are summarized below.

Stanley Mill, NHDES Site No. 198606087, Facility ID: 0113000

The subject property, referred to as Stanley Mill, Ferrari Mill, and 93 Memorial Street, had a registered UST from 1982 to 1999. The UST report is detailed in Section 2.2.

Stanley Mill, NHDES Site No. 198606087, Project No. 0033501

A Phase I environmental site assessment was completed on the subject property in 2014, which identified several RECs associated with the subject property. A subsequent Phase II investigation in 2015 confirmed the presence of several environmental contaminants. An additional environmental investigation in 2017 further delineated the extent of contamination onsite. Remedial action plans have been proposed and the site is considered an ongoing project. Refer to Section 2.2 for detailed summary of site investigations.

R&D Paving, NHDES Site No. 201409001

Due to the proximity of the site to the subject property, environmental files were reviewed for this site. The site is located on the east side of the subject property, slightly upgradient. A Phase I ESA was performed in 2014, which identified several RECs associated with the site. A Phase II ESA was completed in 2015.

The Phase II ESA identified PAHs above their SRS in surface soil at the site, and TCE in groundwater below its AGQS at the site. The report stated that based on available data, PAH and TCE contamination onsite cannot be attributed to a specific onsite source.

Correspondence from DES in 2015 stated that additional site investigations were not required at that time. Additionally, environmental investigations at the subject property indicate that there is an onsite source of PAHs and that TCE is not present in the site's eastern boundary wells above the AGQS. Based on the available investigation data and results, the site is not expected to adversely affect the subject property.

Catch Neighborhood Housing, EPA ID NHD510222227

Due to the proximity of the site to the subject property, environmental records were reviewed. The site is currently federally owned as is listed as a non-generator. It was listed as a conditionally exempt small quantity generator in June 2017 and was listed as a non-generator in August 2017. No violations were reported. Due to this, the site is not expected to adversely impact the subject property.

Riverbend Mill/Catch Neighborhood Housing, NHDES Site No. 200406004

Due to the proximity of the site to the subject property, environmental records were reviewed. The site is a Federal Institutional Controls Site and is currently managed under a groundwater monitoring program. The most recent groundwater monitoring report indicates that VOCs are detected onsite only at levels below their applicable AGQS. Records indicate groundwater at the site flows south toward the Winnipesaukee River. The Institutional Control exists as an AUR related to soil contamination onsite. Based on this information, the site is not expected to adversely affect the subject property.

Franklin Business Center, EPA ID NHD510114648

Due to the proximity of the site to the subject property, environmental records were reviewed. The property was classified as a generator in 2002. Waste was classified as non-hazardous waste oil. No violations were reported and the location was declassified as a generator in 2003. Based on this information, the site is not expected to adversely affect the subject property.

Franklin Business Center, NHDES Site No. 199608021, Project No. 0028082

Due to the proximity of the site to the subject property, environmental records were reviewed. A former 20,000-gallon fuel oil UST was present onsite. Credere performed a Phase I ESA in 2012 which identified the UST as a REC. The UST was closed in 2012, and soil samples taken in the area of the UST indicated the presence of naphthalene and PAHs above the applicable SRS, but PAHs were attributed to a small fire that occurred during removal. Additional investigations indicated that VOCs and PAHs associated with the UST were below applicable standards.

In November 2019, NHDES issued a letter stating the fuel oil project cleanup was complete but that the site was an ongoing hazardous waste site. The site is discussed further below.

Franklin Business Center, NHDES Site No. 199608021, Project No. 0038894

Due to the presence of SVOCs encountered in shallow soils during a site investigation associated with the former UST onsite, further site investigation and remediation of the contaminated soils was required. A 2015 investigation confirmed the presence of chlorinated SVOCs in shallow soil in a courtyard area onsite. A remedial action was implemented in June 2022 which included soil

excavation and removal from a courtyard area and disposal of the contaminated soils offsite. An August 2022 report stated that there are no further recommendations for assessment or remediation. Regulator response is pending' however, based on this information, the site is not expected to adversely affect the subject property.

Franklin Business Center, NHDES Site No. 199608021, Project No. 0012644

In February 2003, a spill of approximately 50 gallons of No. 2 fuel oil occurred in the boiler room. The spill was immediately cleaned up and DES closed the file in 2003. Based on this information, the site is not expected to adversely affect the subject property.

Franklin Business Center, NHDES Site No. 199608021, AFS No. 3301300057

An air stationary source permit was issued in 1997 for the burning of No. 2 fuel oil onsite. A Letter of deficiency was issued and then resolved in 2005. An Administrative Order was issued and later resolved in 2006. The permit ceased in 2007. Based on this information, the site is not expected to negatively impact the subject property.

City Side Cleaners, EPA ID No. NHD018912329

Due to the proximity of the site to the subject property, environmental records were reviewed. The property appears to have operated as a drycleaner from 1983 to 2005. There are no records of spills at the site. Based on the lack of reported spills on the site and lack of CVOC detections in eastern boundary wells on the subject property, the site has not adversely impacted the subject property.

31 Memorial Street, EDR Historical Cleaner

The EDR report identified 31 Memorial Street, located adjacent to the subject property as a historical drycleaner. The report contained records that indicated the laundry and drycleaning business operated from at least 1961 to 1993. No records of spills or releases were found. Based on the lack of reported spills on the site and lack of CVOC detections in eastern boundary wells on the subject property, the site has not adversely impacted the subject property.

City of Franklin Municipal Records

On September 28, 2022, Nobis reviewed records for the subject property at the City of Franklin Offices. Historical documentation from the local records review is provided in Appendix E and summarized below.

Tax Assessor Department: Nobis reviewed property cards and deeds dating back to 1986. Property cards indicate that the property was owned by G.W. Griffin as early as 1895. The property was sold to the current owners, Ferrari Trust, in 1986.

Code Administration/Building Department: A 2018 complaint and a 2020 notice from the fire department regarding the hazard of heavy objects (trees, metal), falling from the roof of the former mill building were found. A 2022 letter indicating that the mill building is planned for demolition was also found.

Planning Department: A segment of the building department in the city of Franklin.

Fire Department: This department had no record of usage of any USTs or ASTs or responses to fire.

Health Department: The city of Franklin does not have a health department.

4.4 Historical Use Information on the Site

Historical topographic maps, Sanborn® Fire Insurance Maps, aerial photographs, and City-Directories obtained from EDR are provided in Appendix D. Review of the historical information included in the database report indicates the following:

Topographic Maps

Readily available historic USGS topographic maps dated 1927, 1956, 1987, 2000, 2012, 2015, and 2018 were provided by EDR, and were reviewed to ascertain area conditions.

The 1927 map appears to depict 2 structures on the subject property. The Winnipesaukee River is depicted along the north of the subject property and the Merrimack River lies to the west. There is a road running along the south side of the subject property which ends at the subject property. There is significant development in franklin around subject property, labelled as Franklin Falls.

The 1956 map is similar to the 1927 map but appears to depict more development on the adjoining properties to the east and south of the subject property. Buildings are now depicted along the Winnipesaukee River north of the subject property. The vacant area west of the subject property is now labelled as a park. The road south of the subject property now extends into the park and ends in a loop. Development in the area of Franklin Falls appears to have expanded.

The 1987 map is similar to the 1956 map but the buildings on the subject property and on the properties to the east and south are clearly depicted as large commercial/industrial buildings. The buildings to the north of the subject property across the river are larger than on the 1956 map. A small building is depicted on the park west of the subject property. A small bridge crosses the river on the northeast corner of the property. Development has expanded further in Franklin.

The 2000 map reflects the details depicted on the 1987 map.

The 2012 map no longer depicts buildings but depicts white in areas of urban development. The subject property and surrounding areas are shaded white.

The 2015 map reflects the details depicted on the 2012 map except the road on the south border of the subject property now ends at the subject property. The map depicts roads in the vicinity similar to current conditions.

The 2018 map reflects the details depicted on the 2015 map.

Sanborn Fire Insurance Maps

During the late 19th Century, companies such as the Sanborn® Company began preparing maps of central business districts for use by fire insurance companies. These maps were updated and expanded geographically periodically through the 20th Century. Fire insurance maps often indicate construction materials, specific property use, and the location of other features such as gasoline storage tanks.

Based upon inquiries to EDR, a licensed Sanborn provider, Sanborn® Map coverage dated 1884, 1892, 1897, 1902, 1911, 1923, 1929, 1948, and 1964 were available for the subject property. Reviewed Sanborn Maps are summarized below:

The subject property is not depicted in the 1884 map. Directly east of the subject property are several rectangles labelled as cord wood. A hotel and several retail locations are depicted to the southeast of the subject property.

The subject property is not depicted on the 1892 map. There are a few unlabeled boxes to the southeast of the subject property and the buildings in the 1884 map to the southeast appear similar to the 1884 map. Two lines, likely depicting the Winnipesaukee River are visible to the northeast of the property but end before the property.

The subject property is not depicted on the 1897 map. The Winnipesaukee River is depicted north of the subject property and Franklin Box Co, a box manufacturer, is depicted on the north side of the river across from the subject property. Additional unlabeled buildings are depicted on the north side of the river. Several small buildings are depicted to the southeast of the subject property. One building is labeled ‘private’ another ‘storeho’ and the largest is labeled as Whol. Gro. Buildings further southeast appear similar to the 1892 map, though more buildings are depicted.

The 1902 map reflects the 1897 map except Memorial Street, Canal Street, and Central Street are now depicted to the southeast of the subject property. E. Bow St is depicted and labelled to the north. The subject property is unmapped.

The 1911 map depicts a building on the southeast portion of the subject property, labeled as G.W. Griffin & Co. Manufacture Hack Saws. A small building is depicted north of the main building with a question mark. A large commercial building is now depicted south of the subject property and is labeled as ACME Knitting Machine & Needle Co. Another building on the southeast of the ACME building is labeled as Ideal Wrapper Co. and Light & Power Co. The area west of the subject property is labelled as Odell Park, and a Ground Shed and a dressing room are depicted in the park. To the east of the subject property, there are many small buildings. There is a large building east of the subject property labelled as storage. Another building just south of the storage building is labeled as Wheel Writing Painting. Directly east is a large building labeled as Shepard Bro's Wholesale Grocers. A footbridge across the Winnipesaukee River is depicted just east of the subject property. Franklin Falls Paper Box Co. is depicted across the river from the subject property.

The 1923 map shows G.W. Griffin Co. As two large buildings on the subject property, with a small building labeled 'oil ho' to the north, and another small building just to the east. Another large building is now depicted on the western portion of the subject property and is labeled as Armory. The buildings to the east are now labeled as 'storage' or 'garage' with the main building labelled Shepard Grocery Co. Odell Park is labelled, with just one building in the southern portion of the property labeled grandstand. The building across the river north of the subject property is now The Nevins Needle Co. needle factory.

The 1929 map shows G.W. Griffin Co. as one large building with 3 main sections. The front section closest to Memorial Street is labeled as a machine shop. The second section is divided into a machine shop and storage. The third section is labeled 'tempering'. There is a small outbuilding to the east of the main building. The armory is depicted as in the 1923 map. Adjoining properties are shown as in the 1923 map.

The 1948 map depicts G.W. Griffin Co. as in the 1929 map. The former armory building is now labeled as storage, French Mills Inc. with G.W. Griffin Co-Owners. There is new building south of the property, west of ACME knitting machine & needle Co. labeled as New Hampshire National Guard Armory Drill Shed. The building on the southeast corner of ACME is now labeled as Public Service Co. of NH Power Plant. Only one small unlabeled building is depicted in Odell Park. The building across the river from the subject property is now labeled as storage.

The 1964 map depicts the G.W. Griffin Co. as in the 1948 map, including the small building. The former armory is now depicted as approximately twice as wide (east-west) as in the 1948 map and is labeled Mica Depot. Across Memorial Street ACME is now Shepard Grocery Co. The former Shepard Grocery Co. building is now vacant, a small annex building is labeled 'priv auto'. The small building in Odell Park is identified as a W.C. (restroom).

Aerial Photographs

Readily available historical aerial photographs supplied by EDR were reviewed for the subject property to obtain pertinent subject property information concerning the history of development on and in the vicinity of the subject property. Evaluation of these aerial photographs may be limited by the quality and scale of the image. Aerial photographs from 1951, 1956, 1960, 1974, 1986, 1993, 1998, 2006, 2009, 2012, and 2016 were reviewed and are summarized below.

The 1951 image shows the property developed with 3 buildings. The two large buildings appear to be the Hacksaw Manufacturing building and the armory. The third building is smaller and is most likely related to the hacksaw manufacturing facility. There is possibly a fourth, small building on the northeast portion of the subject property but the image is too grainy to discern. The footbridge crossing the Winnipesaukee River next to the northeast corner of the property appears to also be a dam across the river. Surrounding areas are developed similarly to their depictions in the topographic and Sanborn maps.

The 1956 image is similar to the 1951 image, but what appeared as two manufacturing buildings appears now as one large building as the hacksaw manufacturing facility. The armory appears to have a large addition added. There is clearly a small building in the northeast portion of the property. The road driveway along the east side of the property is wider.

The 1960 image is too pixelated to discern details on the subject property.

The 1974 image is low quality but the same buildings appear on the subject property as in the 1956 image.

The 1986 image depicts the former hacksaw manufacturing building (mill building) and the armory on the subject property. Trees are now growing along the river on the north edge of the property, so the third building is not seen. The footbridge and dam across the river are difficult to discern, the dam may have been removed. The property east of the subject property is now occupied by one very large building and several smaller buildings

The 1993 image is very low quality but appears to show the subject property similar to the 1986 image.

The 1998 image shows only two buildings on the subject property, and the dam across the river is not discernable. More extensive dam workings are seen upriver from the property.

The 2006 and 2009 images reflect the details depicted on the 1998 image, though now in color. The 2009 image depicts a small island in the Winnipesaukee north of the subject property, and trees are now growing throughout the subject property.

The 2012 and 2016 images reflect the details depicted on the 2009 image. The images appear to show the property similar to current conditions.

Local Street Directories

The city directories used in this study were made available through EDR and were reviewed at approximate 5-year intervals for historic subject property usage. City directories for the years 1961, 1966, 1992, 1995, 2000, 2005, 2010, and 2014 were reviewed during this assessment.

The city directories were reviewed for both 93 Memorial Street and adjoining properties at 100 Memorial Street, and 124 Memorial Street.

- The 1961 directory lists Public Service Co. of NH Light and Power and Shepard Grocery at 54 Memorial Street, GW Griffin Co. hack saw blade manufacturers at 93 Memorial Street, State Armory at 94 Memorial Street, and US Government Materials Purchase Depot and Johnson Mica Processing Plant at 95 Memorial Street.

- The 1965 directory lists Public Service Co of NH at 54 Memorial Street, Shepard Grocery at 92 Memorial Street, GW Griffin Co at 93 Memorial Street, Henry J Proulx at 94 Memorial Street, and Odell Park at 95 Memorial Street.

- The 1992 directory lists a resident at 99 Memorial Street, Charles Non-ferrous Castings, Creative Gymnastics, Foodee's Inc, and Norplex at 100 Memorial Street.

- The 1995 directory lists Pretco Ltd at 93 Memorial Street, a resident at 99 Memorial Street, and Charles Non-ferrous Castings, Foodee's Inc, Franklin Nautilus Inc., Norplex, Franklin Nautilus Inc, Sandogardy Transport, TJs Brokerage and two residents at 100 Memorial Street.

- The 2000 directory lists two residents at 99 Memorial Street, Charles Non-Ferrous Castings, Franklin Nautilus Inc, Gandor Development, Norplex Oak, and residents at 100 Memorial Street, and Franklin City Parks & Recreation Department at 124 Memorial Street.

- The 2005 directory lists a resident at 99 Memorial Street, Enabling Sport Foundation, Honeywell International, Off Drop Auctions, Thomas Allen Coffee Co, and several residents at 100 Memorial Street. A resident is listed at 102 Memorial Street and the community center is listed at 124 Memorial Street.

- The 2010 directory lists at resident at 99 Memorial Street and the community center at 124 Memorial Street.

- The 2014 directory lists a resident at 99 Memorial Street and Franklin Business and Industrial Development at 124 Memorial Street.

Date of Development

Based on the information compiled for the assessment, it appears that the subject property was first developed as a hacksaw manufacturing facility in the late 1800's or early 1900s and was used for industrial purposes until circa 1980.

4.5 Historical Use Information on Adjoining Properties

Properties to east and south of the subject property were historically used for industrial and commercial purposes including manufacturing and electric power. The property to the west was historically used as a park/ recreational area. Properties to the north across the Winnipesaukee River were historically mixed residential and industrial use.

5.0 SITE RECONNAISSANCE

5.1 Methodology and Limiting Conditions

Nobis conducted a reconnaissance of the subject property on September 28, 2022, to observe general site conditions. Portions of the property were obscured by dense vegetation. A small area on the east side was covered by building materials. Nobis was not able to access the interior of the former mill building due to safety concerns as the building has been condemned by local officials and deemed unsuitable for access. Site features for the subject property are shown on Figure 2. Site photographs are provided on Figure 3.

5.2 General Site Setting

The subject property is in a mixed former industrial and current residential area. The subject property is generally flat and level until it slopes steeply down to the Winnipesaukee River on the northern edge of the property. The surrounding area generally slopes west toward the Winnipesaukee and Pemigewasset rivers. The subject property has an approximate elevation of ±300-feet above mean sea level.

Formerly Industrial/commercial properties currently undergoing construction are located to the east. A residential property and town offices are located to the south. Odell Park is located to the west. The Winnipesaukee River borders the property to the north.

5.3 Exterior Observations

Refer to Section 2.5 for a general description of site development and features.

The former hacksaw manufacturing building on the east side of the property is in poor condition. Nobis observed trees growing on the roof of the building and windows and doors boarded up to prevent access. The property is generally overgrown with shrubs and trees. On the east side of the mill building, Nobis observed several corrugated plastic pipes that appeared to be new stored in the open area. The city representative confirmed the pipes are associated with the construction on the adjacent property and are temporary. Nobis also observed two industrial fixtures, one assumed to be a hopper, on the east side of the building. An additional industrial fixture was observed in the central portion of the property.

Nobis observed glass and other building debris throughout the property, especially in the northern portion of the property close to the river. Evidence of urban fill, including hacksaw blades, was observed on the ground surface. A retaining wall approximately four (4) to six (6) feet in height was observed on the northern edge of the property at the base of the slope. Sloughing was observed on the slope. Nobis did not walk down to the river due to dense vegetation and a possibly unstable slope, but observations from the top of the slope did not indicate that urban fill extended past the retaining wall. Several monitoring wells were observed in the northern portion of the property. The western portion of the property around the former armory is also heavily vegetated. Nobis observed rubbish related to trespasser use, some building debris such as glass and wood, and some evidence of urban fill.

Power lines run along the eastern portion of the property and across the river.

5.4 Interior Observations

Due to safety concerns, Nobis was unable to access the interior of the mill building on this site visit. Almost all windows were boarded over, limiting the possibility of interior observations or access. One basement window on the northeast corner of the building was open. Nobis observed an empty concrete basement with pipes running along the ceiling.

Nobis was able to observe the interior of the former armory building. The building consists of several rooms on the western side, and a large open space on the eastern side of the building. The building walls appeared to generally be constructed of brick or cinder block, and there was concrete floor throughout the building. The interior is in poor condition, with internal walls and ceilings in a general state of disrepair. Nobis observed insulation and other building materials such as glass and brick on the floor throughout the building. There was a large pile of glass in the Northwest corner of the building, the city representative did not know if the glass was associated with the building windows, many of which were missing glass and covered by a steel grate.

Graffiti and rubbish associated with trespasser use was observed throughout the building. Nobis observed floor staining throughout the building, and the floor was wet in several areas, likely from water entering through the roof or windows.

A large lift and a compressor were observed in the main portion of the building. Nobis observed several electrical panels in various states of disrepair in one room. The building is not currently serviced by utilities. Nobis observed three drums, each in a different area of the building. The drums were unlabeled and in fair to poor condition. Nobis did not observe significant leaks associated with any of the drums, but debris surrounding the drums obscured most of the floor from view.

6.0 INTERVIEWS

6.1 Interview with Current Property Owner

Nobis did not interview the current property owner for this Phase I ESA.

6.2 Interviews with Occupants

The subject property has no occupants.

6.3 Interviews with Local Government Officials

Refer to Section 4.2 for additional information collected from representatives of the City of Franklin.

6.4 Interviews with Others

Nobis did not interview others.

7.0 FINDINGS

The Findings of the ASTM E 1527-21 Phase I ESA identify the known or suspected *RECs, Controlled RECs, Historical RECs,* and/or *de minimis* conditions at the subject property. The Opinion (Section 8.0) will discuss the impact to the subject property (*i.e.*, *REC*, *Controlled REC, Historical REC*, or *de minimis* conditions) and present the logic and reasoning for making that determination. Based on the information collected during a Phase I ESA of the Map 117 Lot 142 property in Franklin, New Hampshire, Nobis presents the findings detailed below.

The subject property encompasses a 1.2-acre lot developed with a former mill building which operated as a hacksaw manufacturing facility from the early 1900s to circa 1980, and a former armory which has been historically used for storage. The property was transferred to the current owners, Ferrari Franklin Falls Realty, LLC in 1986. Prior reports indicate the subject property has been unused and unoccupied since acquisition by the current owner with exception of a brief period of time where a portion of the armory building was leased to a cabinet making business. Significant site observations included three (3) drums in poor condition in the armory building and evidence of urban fill throughout the northern portion of the site.

Currently unoccupied commercial properties are located to the east of the subject property along Memorial Street. Residential properties and a community center are located to the south of subject property along Memorial Street. A public park is located to the west of the subject property. The Merrimack River borders the subject property to the north. According to City of Franklin Zoning Map, the subject property and surrounding area are located within the Franklin Falls Historic District.

Historical data including topographic maps, aerial photographs, Sanborn maps, and municipal records suggest that the property was developed as a hacksaw manufacturing facility in the late 1800s or early 1900s and operated as such until circa 1980. The former armory was constructed circa 1920 and operated as a storage facility until the 1980s. Historical maps show that the surrounding area was developed by the late 1800s and primarily used for industrial purposes, including metals manufacturing and hydroelectric power.

The EDR report indicated several records were found to be associated with the subject property. The subject property has undergone several environmental investigations, and there is record of

PAHs, CVOCs, naphthalene, 1,4-dioxane, and metals contamination exceeding action levels as well as hazardous building materials onsite. Remedial actions have been proposed for the property and are pending.

One hundred and three (103) environmental records (NH ALLSITES, NH Aqueous Foam, AST, Brownfields, Drycleaners, ECHO, EDR Hist. Cleaner, EDR MGP, FINDS, ICEC, LUST, Manifest (RI, NY), PFAS, RCRA-nongen, VSQG, SHWS, US Brownfields, UST) were identified with twenty-four (24) properties within a 1/8-mile radius of the subject property. Because of their distance, hydraulic location (cross-gradient) and/or closed regulatory status, none of the records/sites are expected to adversely impact the subject property.

8.0 OPINION

The Opinion of the ASTM E 1527-21 Phase I ESA defines the environmental professional's determination of the impact to the subject property (i.e., REC, HREC, CREC, DMC or VEC) of the conditions identified in the Findings (Section 7.0) and presents the logic and reasoning for making that determination. Based upon our review of the municipal and historical information available for the subject property and adjoining properties, as well as the observations made during this Phase I ESA, Nobis' opinions regarding the Findings of this Phase I ESA are detailed below.

Recognized Environmental Conditions

REC #1: Presence of improperly disposed solid waste.

Improperly disposed of solid waste was observed in a large area in the northern portion of the subject property. Observed waste includes hacksaw blades and manufacturing waste. As these materials are improperly disposed and remain in place, the presence of improperly disposed industrial wastes constitutes a REC in association with the subject property.

REC #2: Soil contamination exceeding action levels.

Prior assessments identified the presence of several PAHs, naphthalene, PCE, TCE, and several heavy metals at concentrations exceeding their applicable SRS in surface and shallow soils onsite, primarily in the areas of improperly managed industrial waste. The presence of contaminants in soil exceeding regulatory standards constitutes a REC in association with the subject property.

REC #3: Groundwater contamination exceeding action levels.

Prior assessments identified several PAHs, PCE, TCE, cis-1,2-dichlorothene, vinyl chloride, 1,4-dioxane and arsenic in groundwater at concentrations exceeding their

applicable AGQS. The presence these contaminants in groundwater at concentrations exceeding regulatory standards constitutes a REC in association with the subject property.

REC #4: Presence of TCE and PCE soil gas above action levels.

Soil gas sampling during the 2018 investigation indicated the presence of PCE and TCE vapors at concentrations exceeding their respective screening levels at one or more locations onsite. The presence of potential vapor intrusion into building at the subject property constitutes a REC in association with the subject property.

REC #5: Presence of drums containing unknown substance.

Three (3) drums containing unknown substances were observed in the armory on the September 28, 2022 site walk. Another drum was observed during previous investigations in the former mill building. As these drums contain unknown substances, are in fair to poor condition and pose a threat of release, they constitute a REC in association with the subject property.

Historical Recognized Environmental Conditions

No *Historical RECs* were associated with the subject property.

HREC #1: Former UST adjacent to the armory building.

Evidence of an unregistered UST was documented during prior assessments at the subject property. Subsequent assessment and closure of the UST indicated no evidence of release of petroleum and no soil contaminants exceeding regulatory standards. The former UST at the armory is considered an HREC.

Controlled Recognized Environmental Conditions

No *Controlled RECs* are associated with the subject property.

Vapor Encroachment Condition

Due to the presence of TCE and PCE on the subject property above GW-2 standards and/or indoor air screening levels, a *VEC* has been identified in association with the subject property.

De Minimis Conditions

No DMCs were identified to be associated with the subject property.

9.0 CONCLUSIONS

In accordance with ASTM Practice E 1527-21 requirements, the Environmental Professionals that prepared this Phase I ESA provide the following Statement of Conclusion:

We have performed a Phase I Environmental Site Assessment in conformance with the scope and limitations of ASTM Practice E 1527-21 of the parcels identified by the City of Franklin on Tax Map 117 Lot 142. Any exceptions to, or deletions from, this practice are described in Sections 1.4 and 10.0 of this report.

This assessment revealed evidence of five (5) *RECs, one (1) HREC* and a *VEC* in connection with the subject property. Conditions are described in section 8.0.

10.0 DEVIATIONS

No substantive deviations from ASTM E 1527-21 were encountered during performance of this Phase I ESA. Limitations of this Phase I ESA are detailed in Section 1.4.

11.0 ADDITIONAL SERVICES

Additional Services are assessments, recommendations, or other details beyond the scope of ASTM Practice E 1527-21. No additional services were conducted as part of this assessment.

12.0 REFERENCES

ASTM E1527-21, Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process, dated 2015. www.astm.org

EDR, Historical Topo Map Report with QuadMatch, September 21, 2022.

EDR, Aerial Photo Decade Package, September 23, 2022.

EDR, City Directory Image Report, September 21, 2022.

EDR, Radius Map with GeoCheck, September 21, 2022.

EDR, Certified Sanborn Map Report, September 22, 2022.

Google earth website, www.googlearth.com. September 2022.

NHDES Online Database, https://www4.des.state.nh.us/DESOnestop/BasicSearch.aspx, September 2022

City of Franklin, NH, Tax Assessor Office, September 28, 2022.

City of Franklin, NH Building Department, September 28, 2022.

City of Franklin, NH, Fire Department, September 28, 2022.

City of Franklin, NH, Planning Department, September 28, 2022.

Merrimack County Registry of Deeds, Franklin, NH. Online Inquiry.

13.0 QUALIFICATIONS OF ENVIRONMENTAL PROFESSIONALS

In accordance with ASTM Practice E 1527-21 12.13, Nobis provides the following statements of qualification:

We declare that, to the best of our professional knowledge and belief, we meet the definition of *environmental professionals* as defined in §312.10 of 40 CFR 312. We have the specific qualifications based on education, training, and experience to assess a *property* of the nature, history, and setting of the subject property. We have developed and performed all the appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312.

The qualifications of the *environmental professionals* who prepared, or supervised the preparation of, this report, and who are signatories of this report, are provided below.

Clarence "Tim" Andrews, P.G.
Director of State & Municipal Services, Senior Project Manager

- State of New Hampshire Professional Geologist.

- Over 24 years of experience conducting various investigations to identify the extent of airborne, soil, and groundwater organic and inorganic contamination at residential, commercial, and industrial sites. Researched historical federal, state, local, and commercial records to collect background information for numerous environmental projects.

- Performed or overseen numerous Phase I ESAs and other environmental projects involving research, investigation, and data assessment of historical and current site conditions on current or former residential, commercial, and industrial properties. Investigations have included identification, assessment, and delineation of petroleum and hazardous substances released to the environment or with the potential for release to the environment.

- Project responsibilities have included interaction with clients and regulators; coordination and oversight of subcontractors; data collection, interpretation and presentation; and report preparation. Acts as technical lead or project manager on numerous water quality assessment projects and long-term monitoring projects.

FIGURES

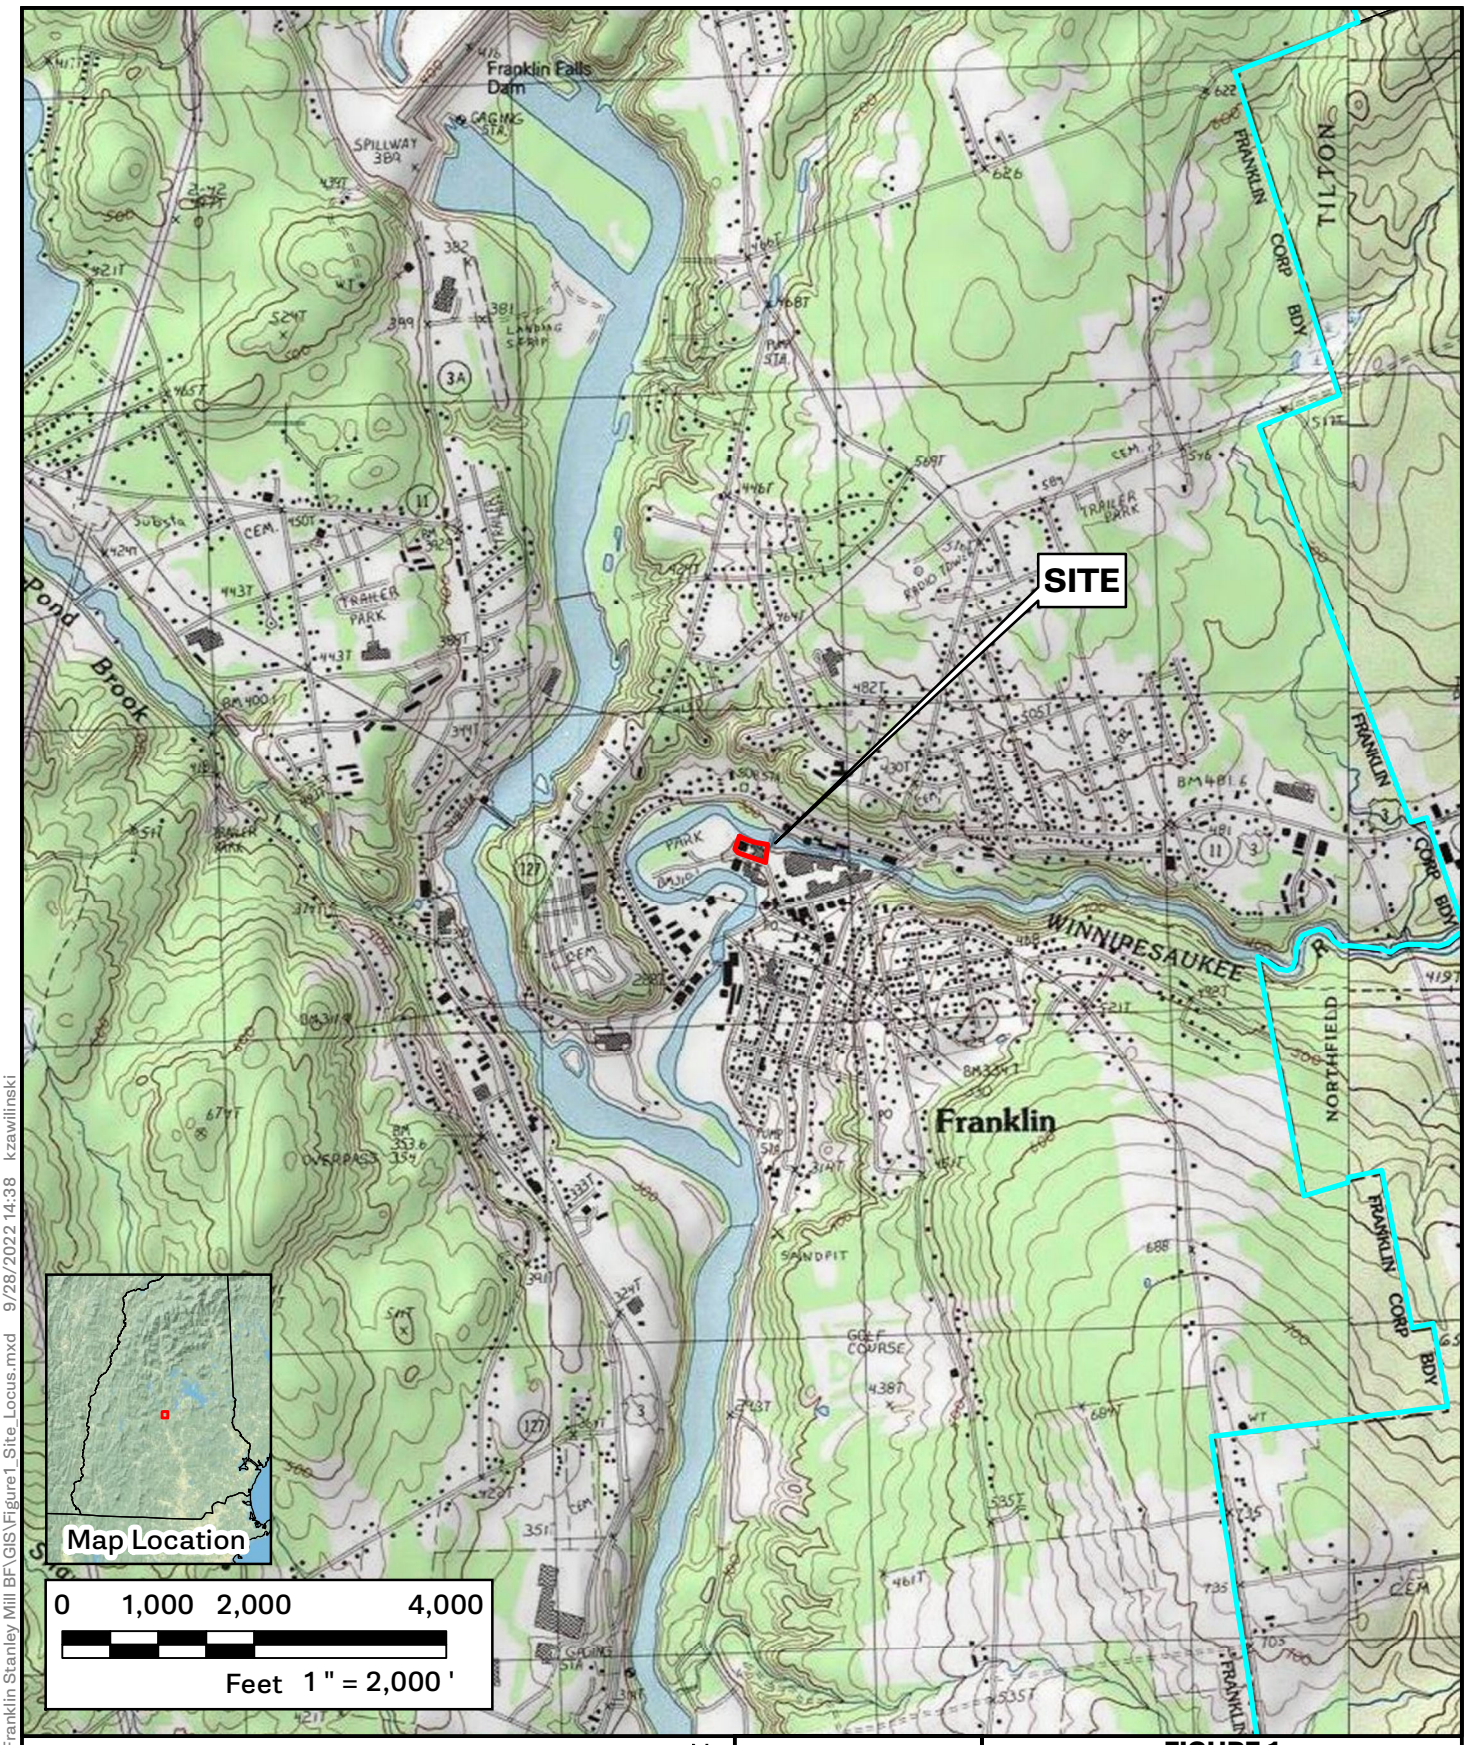

USGS Topographic Map
Franklin, NH
2000

nobis
Nobis Group® - 18 Chenell Drive
Concord, NH 03301 - (603) 224-4182
www.nobis-group.com

FIGURE 1
SITE LOCUS
FORMER STANLEY MILL
93 MEMORIAL STREET
FRANKLIN NH

PREPARED BY: KZ	CHECKED BY: TA
PROJECT NO. 100400.000	DATE: OCT 2022

J:\100400.000-City of Franklin Stanley Mill BF\GIS\Figure1_Site_Locus.mxd 9/28/2022 14:38 kzawilinski

Former Foundation
Former UST
Winnipesaukee River
55
Corroded Drum
55
55
Former Armory
D
Assumed Rusted Tar Drum
55
Former Transformer Area
Former Garage Foundation
Former 10,000-Gallon No. 2 Fuel Oil UST Area
Former Stanley Mill
Concentrated Floor Cleaner Drum
55
Memorial Street
River Bend Mill

Notes:

1. Site sketch was developed from several sources including, City of Franklin Tax Map N8, Figures created by Credere Associates, LLC, observations made by Nobis and from the aerial photography provided by ESRI.

2. Locations of site features depicted hereon are approximate and given for illustrative purposes only.

3. Observations and features within the Former Stanley Mill are based on prior assessment and report findings. Coinditions within the Mill Building were not confirmed during this assessment.

Legend

- Drum
- Floor Drain
- Natural Gas Hookup
- Outfall
- Unknown Pipe
- UST Vent Fill Line
- Pipe
- Retaining Wall
- Property Boundary
- Site Boundary
- Limit of Fill (Metal Shavings and Saw Blades)
- Foundation
- Transformer Area
- UST Area
- Limit of PAH Impacted Area

N

0 20 40 80
Feet

1 inch = 33 feet

nobis
Nobis Group® - 18 Chenell Drive
Concord, NH 03301 - (603) 224-4182
www.nobis-group.com

FIGURE 2

SITE AREA PLAN
FORMER STANLEY MILL
93-119 MEMORIAL STREET
FRANKLIN, NEW HAMPSHIRE

PREPARED BY: TF	CHECKED BY: TA
PROJECT NO. 100400.000	DATE: OCT 2022

F:\80000 Task Orders\80108 Brownfields Multi-Site\GIS\Ferrari Mill\Figures\Figure2_Stanley_Mill_2022.mxd 10/19/2022 15:59 tfurtado

FIGURE 3
SITE PHOTOGRAPHS
FORMER STANLEY MILL
93 MEMORIAL STREET, FRANKLIN, NEW HAMPSHIRE

Photo 1: View of the south side of the mill building from Memorial Street

Photo 2: View of the west side of the mill building from Memorial Street

Photo 3: View of the south side of the armory building from Memorial Street

Photo 4: View of the west side of the armory building from Odell Park

Photo 5: View of the north side of the armory building.

Photo 6: View of heavy vegetation on north edge of the property behind the armory.

Photo 7: View of the east side of the armory and heavy vegetation in the center of the property.

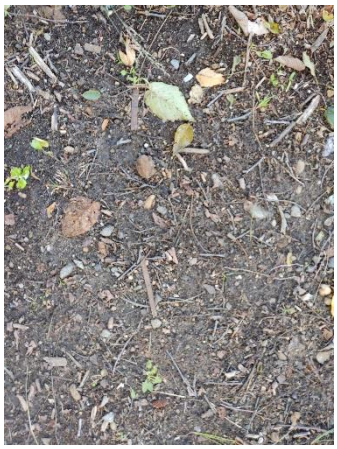

Photo 8: View of hacksaw blades in surface soil in the northern portion of the property.

Photo 9: View of urban fill and trespasser related rubbish on sloped northern edge of property.

Photo 10: View of basement of mill building through missing window.

Photo 11: View of industrial fixture in northern portion of the property.

Photo 12: View of east side of mill building with corrugated pipes

Photo 13: View of east side of mill building with hopper

Photo 14: Building debris and trespasser rubbish in armory

Photo 15: Glass in northwest corner of armory

Photo 16: Electrical room with building debris in armory

Photo 17: Main room of armory with industrial fixture

Photo 18: Compressor and floor staining in main room of armory

Photo 19: Northeast corner of Armory with portion of the roof caved in

Photo 20: Drum No. 1 in armory

Photo 21: Drum No. 2 in armory

Photo 22: Drum No. 3 in armory

APPENDICES

APPENDIX A

LIMITATIONS

1) These environmental services were performed in accordance with generally accepted practices of other consultants undertaking similar assessments at the same time and in the same geographical area. The results of this assessment are based on our professional judgment and are not scientific certainties. Specifically, Nobis Group®. does not and cannot represent that the site contains no hazardous wastes, oil, or other latent conditions beyond those observed during this assessment. No other warranty, express or implied, is made.

2) The observations and conclusions presented in this report were made solely on the basis of conditions described in the report and not on scientific tasks or procedures beyond the scope of described services or the budgetary and time constraints imposed by the client. The work described in this report was performed in accordance with the terms and conditions of our contract. No other warranty, express or implied, is made.

3) Observations were made of the site as indicated in this report. Where access to portions of the site was unavailable or limited, Nobis Group®. renders no opinion as to the presence of hazardous wastes or the presence of indirect evidence of hazardous wastes in that portion of the site.

4) No property boundary, site feature, or topographic surveys of the site were performed by Nobis Group® unless specifically indicated in the text of the report.

5) No sampling or testing was performed for the presence of dioxins, furans, pesticides, herbicides, radon, lead paint, urea-formaldehyde, asbestos, or polychlorinated biphenyls (PCBs) at the site unless specifically indicated in the text of the report.

6) Except as noted within the text of the report, no quantitative laboratory testing was performed as part of this assessment. Where such analyses have been conducted by an outside laboratory, Nobis Group® has relied upon the data provided and has not conducted an independent evaluation of the reliability of these data.

7) Chemical analyses have been performed for specific parameters during this site assessment, as described in the text of the report. Additional chemical constituents not searched for during the current study may be present in soil and/or groundwater at the site.

8) This report has been prepared for the exclusive use by the City of Franklin solely for use in an environmental evaluation of the site. This report shall not, in whole or in part, be conveyed to any other party, other than those authorized by the City of Franklin without prior written consent of Nobis Group®.

APPENDIX B

ASTM E 1527-21 PHASE I ENVIRONMENTAL SITE ASSESSMENT

USER QUESTIONNAIRE

Section 1 - General

The information requested in this section is intended to assist the environmental professional but is not necessarily required to qualify for one of the Landowner Liability Protections (See Section 2).

(1.) Why is the Phase I Environmental Site Assessment required?
The City of Franklin, NH will acquire the property in order to facilitate the implementation of a comprehensive economic redevelopment plan for its downtown. This is an important and strategically located commercial space that is critical to overall revitalization of the core downtown area.

(2.) What is the type of property and type of property transaction (sale, purchase, exchange, etc.)?
The City will purchase the subject property,

(3.) What is the complete and correct address of the property?
The property is referred to as Ferrari Mill Site, and the address is 93-119 Memorial Street, Tax Map-Lot # 117-142, Franklin, New Hampshire, 03235.

(4.) What is the scope of services desired for the Phase I?
As described in the contract / work scope Yes_X__ No___
If No, please explain.

Are any considerations beyond the requirements of Practice E 1527 to be addressed?
Yes___ No_X__
If Yes, please explain.

(5.) Please identify all parties who will rely on the Phase I report.
a) City of Franklin, NH
b) Ferrari Franklin Mills Realty

(6.) Please identify the site contact and how the site contact can be reached.
Seth Creighton, Planning & Zoning Director, City of Franklin: screighton@franklinnh.org
City of Franklin, 316 Central St, Franklin, NH 03235, 603-934-2341 (Phone)

(7.) Are there any special terms and conditions that must be agreed upon by the environmental professional?
No

(8.) Do you have any knowledge or experience with the property that may be pertinent to the environmental professional (prior environmental reports, documents, correspondence, etc. concerning the environmental condition of the property). Attach additional sheets if required.

All of the available property files and data have been provided to the environmental professional for review or copying. Additionally, any environmental reports, documents, etc. accessible on the State DES Website or have been made available.

(9) Does the user intend to retain a title company or title professional to review reasonable ascertainable title and judicial records for environmental liens or activity and use limitations (AULs)?

Yes___ No___

If Yes, will the results of the review be provided to the environmental professional?

Yes___ No___

Section 2 - Landowner Liability Protections

In order to qualify for one of the Landowner Liability Protections (LLPs)[1] offered by the Small Business Liability Relief and Brownfields Revitalization Act of 2001 (the "Brownfields Amendments"), the user must provide the following information (if available) to the environmental professional. Failure to provide this information could result in a determination that "all appropriate inquiry" is not complete.

(1.) Environmental cleanup liens that are filed or recorded against the site (40 CFR 312.25).

Are you aware of any environmental cleanup liens against the property that are filed or recorded under federal, tribal, state or local law?

No.

---

1 Landowner Liability Protections, or LLPs, is the term used to describe the three types of potential defenses to Superfund liability in EPA's Interim Guidance Regarding Criteria Landowners Must Meet in Order to Qualify for Bona Fide Prospective Purchaser, Contiguous Property Owner, or Innocent Landowner Limitations on CERCLA Liability ("Common Elements" Guide) issued on March 6, 2003.

(2.) Activity and land use limitations that are in place on the site or that have been filed or recorded in a registry (40 CFR 312.26).

Are you aware of any AULs , such as engineering controls, land use restrictions or institutional controls that are in place at the site and/or have been filed or recorded in a registry under federal, tribal, state or local law?
No.

(3.) Specialized knowledge or experience of the person seeking to qualify for the LLP (40 CFR 312.28).

As the user of this ESA do you have any specialized knowledge or experience related to the property or nearby properties? For example, are you involved in the same line of business as the current or former occupants of the property or an adjoining property so that you would have specialized knowledge of the chemicals and processes used by this type of business? If "yes", please explain.
Yes, but only to the extent that the City has worked previously via investigating the subject parcel to determine containments and locations. As such the City is aware of the environmental investigations and testing that has occurred on the identified parcel.

(4.) Relationship of the purchase price to the fair market value of the property if it were not contaminated (40 CFR 312.29).

Does the purchase price being paid for this property reasonably reflect the fair market value of the property? If you conclude that there is a difference, have you considered whether the lower purchase price is because contamination is known or believed to be present at the property?
The purchase price is entirely based on the known contamination onsite.

(5.) Commonly known or reasonably ascertainable information about the property (40 CFR 312.30).

Are you aware of commonly known or reasonably ascertainable information about the property that would help the environmental professional to identify conditions indicative of releases or threatened releases? For example, as user,

(a.) Do you know the past uses of the property?
Yes. The subject property contains two structures; the former Stanley Mill and the former Armory. The mill was used from approximately 1897 to 1979 for the manufacture of hacksaw blades. From 1979 to 1986, Stanley Tool Company produced tool components. They sold the property in 1986 to the Ferrari family, and the site has sat basically abandoned since then.

(b.) Do you know of specific chemicals that are present or once were present at the property?
Yes / Some, limited to the extent that specific chemicals have been discovered during the earlier environmental investigations and testing. The contamination, which occurred between circa 1900 to 1979, includes buried solid, and dumped liquid, industrial waste. Contaminates of concern include chlorinated VOCs [Tetrachloroethene, Trichloroethene, Naphthalene] PAHs, and metals [arsenic and lead].

(c.) Do you know of spills or other chemical releases that have taken place at the property?
Yes / Some, limited to the extent that specific chemicals have been discovered during the earlier environmental investigations and testing.

(d.) Do you know of any environmental cleanups that have taken place at the property?
Yes, to the extent that the earlier environmental investigations and testing work has triggered the removal of older UST's and/or other sub-surface piping, drywells, etc

(6.) The degree of obviousness of the presence of likely presence of contamination at the property, and the ability to detect the contamination by appropriate investigation (40 CFR 312.31).

As the user of this ESA, based on your knowledge and experience related to the property are there any obvious indicators that point to the presence or likely presence of contamination at the property?
Yes, because the earlier environmental investigations and testing work identified contaminated areas and contaminants; however, the contamination has not been remediated.

User Signature

I have answered the above questions in good faith and based on my knowledge of the property.

Printed Name Seth Creighton

Title Planning + Zoning Director, City of Franklin, NH

Signature

Date 10/11/2022

APPENDIX C

Map Scale: 1:780 if printed on A landscape (11" x 8.5") sheet.

N

Meters
0 10 20 40 60

Feet
0 35 70 140 210

Map projection: Web Mercator Corner coordinates: WGS84 Edge tics: UTM Zone 19N WGS84

MAP LEGEND

Area of Interest (AOI)

- Area of Interest (AOI)

Soils

- Soil Map Unit Polygons
- Soil Map Unit Lines
- Soil Map Unit Points

Special Point Features

- Blowout
- Borrow Pit
- Clay Spot
- Closed Depression
- Gravel Pit
- Gravelly Spot
- Landfill
- Lava Flow
- Marsh or swamp
- Mine or Quarry
- Miscellaneous Water
- Perennial Water
- Rock Outcrop
- Saline Spot
- Sandy Spot
- Severely Eroded Spot
- Sinkhole
- Slide or Slip
- Sodic Spot
- Spoil Area
- Stony Spot
- Very Stony Spot
- Wet Spot
- Other
- Special Line Features

Water Features

- Streams and Canals

Transportation

- Rails
- Interstate Highways
- US Routes
- Major Roads
- Local Roads

Background

- Aerial Photography

MAP INFORMATION

The soil surveys that comprise your AOI were mapped at 1:24,000.

Warning: Soil Map may not be valid at this scale.

Enlargement of maps beyond the scale of mapping can cause misunderstanding of the detail of mapping and accuracy of soil line placement. The maps do not show the small areas of contrasting soils that could have been shown at a more detailed scale.

Please rely on the bar scale on each map sheet for map measurements.

Source of Map: Natural Resources Conservation Service
Web Soil Survey URL:
Coordinate System: Web Mercator (EPSG:3857)

Maps from the Web Soil Survey are based on the Web Mercator projection, which preserves direction and shape but distorts distance and area. A projection that preserves area, such as the Albers equal-area conic projection, should be used if more accurate calculations of distance or area are required.

This product is generated from the USDA-NRCS certified data as of the version date(s) listed below.

Soil Survey Area: Merrimack and Belknap Counties, New Hampshire
Survey Area Data: Version 27, Aug 31, 2021

Soil map units are labeled (as space allows) for map scales 1:50,000 or larger.

Date(s) aerial images were photographed: May 31, 2019—Aug 29, 2019

The orthophoto or other base map on which the soil lines were compiled and digitized probably differs from the background imagery displayed on these maps. As a result, some minor shifting of map unit boundaries may be evident.

Map Unit Legend

Map Unit Symbol	Map Unit Name	Acres in AOI	Percent of AOI
35A	Champlain loamy fine sand, 0 to 3 percent slopes	0.1	4.2%
699B	Urban land, 0 to 8 percent slopes	1.5	95.8%
Totals for Area of Interest		**1.5**	**100.0%**

DES Waste Management Division
29 Hazen Drive PO Box 95
Concord, New Hampshire 03302-0095

TARGETED BROWNFIELDS ASSESSMENT AND REMEDIAL ACTION PLAN FERRARI MILL SITE

93-119 Memorial Street
Franklin, New Hampshire

NHDES Site No. 198606087
NHDES Project No. 33501

Prepared For:
United States Environmental Protection Agency
Region 1 – Brownfields Program
5 Post Office Square, Suite 100 (OSRR07-2)
(617) 918-1022
Mr. Alan Peterson

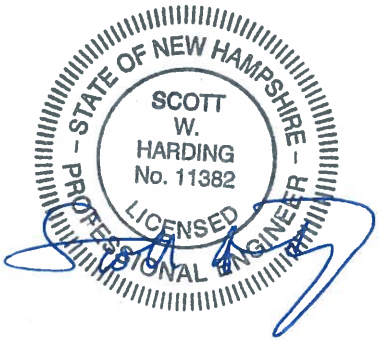

Prepared By:
Nobis Engineering, Inc.
18 Chenell Drive
Concord, New Hampshire 03301
(603) 224-4182
Clarence "Tim" Andrews, P.G. / Scott Harding, P.E.
TAndrews@nobiseng.com

February 14, 2018
File No. 80108.08

Nobis
Engineering a Sustainable Future

EPA Region 1 RAC 2 Contract No. EP-S1-06-03

February 14, 2018
Nobis Project No. 80108

Via Electronic Submittal

U.S. Environmental Protection Agency
Attention: Mr. Alan Peterson, Task Order Project Officer
5 Post Office Square, Suite 100 (OSRR07-2)
Boston, Massachusetts 02109-3912

Subject: Transmittal of Targeted Brownfields Assessment and Remedial Action Plan
Ferrari Mill, Franklin, New Hampshire
NHDES Site No. 198606087, Project No. 33501
Targeted Brownfields Assessment
EPA Task Order No. 0108-SI-BZ-0100

Dear Mr. Peterson:

Enclosed is the Targeted Brownfields Assessment and Remedial Action Plan for the above referenced Task Order.

Should you have any questions or comments, please contact me at (603) 724-6226, or tandrews@nobiseng.com.

Sincerely,

NOBIS ENGINEERING, INC.

Clarence "Tim" Andrews, P.G.
Senior Project Manager

Scott W. Harding, P.E.
Senior Engineer

Enclosure

c: File 80108/NH

Nobis Engineering, Inc.
18 Chenell Drive
Concord, NH 03301
T (603) 224-4182

Targeted Brownfields Assessment and Remedial Action Plan

Ferrari Mill Site
Franklin, New Hampshire

NHDES Site No. 198606087, Project No. 33501
Targeted Brownfields Site Assessment
EPA Task Order No. 0108-SI-BZ-0100

REMEDIAL ACTION CONTRACT No. EP-S1-06-03

FOR

US Environmental Protection Agency Region 1

BY

Nobis Engineering, Inc.

Nobis Project No. 80108

February 2018

U.S. Environmental Protection Agency
Region 1
5 Post Office Square, Suite 100
Boston, Massachusetts 02109-3919

Nobis Engineering, Inc.
Lowell, Massachusetts
Concord, New Hampshire

Phone (800) 394-4182
www.nobisengineering.com

Targeted Brownfields Assessment and Remedial Action Plan

Ferrari Mill Site
Franklin, New Hampshire
NHDES Site No. 198606087, Project No. 33501
Targeted Brownfields Site Assessment
EPA Task Order No. 0108-SI-BZ-0100

REMEDIAL ACTION CONTRACT
No. EP-S1-06-03

For

US Environmental Protection Agency
Region 1

By

Nobis Engineering, Inc.

Nobis Project No. 80108

February 2018

Clarence “Tim” Andrews, P.G.
Senior Project Manager

TABLE OF CONTENTS
TARGETED BROWNFIELDS ASSESSMENT AND REMEDIAL ACTION PLAN
FERRARI MILL
FRANKLIN, NEW HAMPSHIRE
NHDES SITE NO. 198606087

SECTION		PAGE
ES	**EXECUTIVE SUMMARY**	**1**
1.0	**INTRODUCTION**	**1**
2.0	**KEY TEAM MEMBERS**	**3**
3.0	**SITE BACKGROUND**	**3**
3.1	Site History	4
3.2	Contaminants of Concern	4
3.3	Previous Site Investigations	4
3.4	Site Geology and Hydrogeology Summary	6
4.0	**SUMMARY OF TBA INVESTIGATION ACTIVITIES**	**7**
4.1	Soil Gas Sample Point Installation	7
4.2	Sub-Slab Soil Sampling	7
4.3	Bedrock Well Installation	8
4.4	Drive and Wash Soil Borings and Subsurface Soil Sampling	8
4.5	Test Pits and Soil Sampling	10
4.6	Shallow Soil Sampling	10
4.7	Monitoring Well Installation and Development	11
4.8	Groundwater Sampling	12
4.9	Soil Gas Sampling	13
4.10	UST Closure	14
4.11	Supplemental Hazardous Building Materials Sampling	14
4.12	Investigation Derived Waste	16
5.0	**SUMMARY OF SAMPLING RESULTS**	**16**
5.1	Soil Sampling Results	17
5.2	Groundwater Sampling Results	19
5.3	Soil Gas Sampling Results	20
5.4	Building Material Results	21
5.5	Data Validation and Usability Evaluation	22
6.0	**CONTAMINANT DISTRIBUTION**	**22**
6.1	Soil Contamination	23
6.2	Groundwater Contamination	25
6.3	Soil Gas Contamination	27
7.0	**REMEDIAL RECOMMENDATIONS AND COST ESTIMATE**	**28**
7.1	Industrial Waste Fill Material	28
7.2	Asbestos-Containing Materials	32
7.3	Remedial Cost Estimate and Cost Effectiveness Analysis for Industrial Waste Fill Material Area	32

TABLE OF CONTENTS (cont.)
TARGETED BROWNFIELDS ASSESSMENT AND REMEDIAL ACTION PLAN
FERRARI MILL
FRANKLIN, NEW HAMPSHIRE
NHDES SITE NO. 198606087

SECTION **PAGE**

7.4 EPA Green Remediation 34
7.5 Impacted Groundwater 35
7.6 Impacted Soil Gas 36

8.0 CONCLUSIONS AND RECOMMENDATIONS 36
8.1 TBA Investigation Conclusions 36
8.2 Recommendations 41

9.0 REFERENCES 44

TABLES

NUMBER

1 Summary of Soil Analytical Results – VOCs
2 Summary of Soil Analytical Results – PAHs
3 Summary of Soil Analytical Results – Metals
4 Summary of Soil Analytical Results – DRO
5 Summary of Groundwater Elevations
6 Summary of Groundwater Analytical Results - VOCs
7 Summary of Groundwater Analytical Results - PAHs
8 Summary of Groundwater Analytical Results - Metals
9 Summary of Soil Gas Analytical Results – VOCs
10 Summary of Asbestos Analytical Results
11 Summary of PCB Analytical Results
12 Alternative #1 Cost Estimate - Institutional Controls
13 Alternative #2 Cost Estimate - Industrial Waste Fill Materials Encapsulation and Stabilization Cost
14 Alternative #3 Cost Estimate - Industrial Waste Fill Materials Excavation Cost
15 Cost Estimate - Shallow PAH Soil Excavation Cost
16 Cost Estimate – Asbestos Abatement
17 Cost Estimate Long-Term Groundwater Monitoring Cost

TABLE OF CONTENTS (cont.)
TARGETED BROWNFIELDS ASSESSMENT AND REMEDIAL ACTION PLAN
FERRARI MILL
FRANKLIN, NEW HAMPSHIRE
NHDES SITE NO. 198606087

FIGURES

NUMBER

1 Locus Plan
2 Site Area Plan
3 Investigation Sample Location Summary
4 Soil Investigation VOC Results
5 Soil Investigation PAH Results
6 Soil Investigation Metals Results
7 Groundwater Investigation
8 Sub-Slab Soil Gas Investigation
9 UST Closure
10 Building Materials Sample Location Plan
11 Remedial Action Plan

APPENDICES

A Test Pit, Soil Boring, Soil Gas Well and Monitoring Well Construction Logs
B Low-Flow Groundwater Sampling Field Data Sheets
C Well Elevation Survey
D Laboratory Analytical Reports
E Data Validation Memoranda

ES EXECUTIVE SUMMARY

Nobis Engineering, Inc. (Nobis) has completed a Targeted Brownfields Assessment (TBA) and Remedial Action Plan (RAP) for the Ferrari Mill Site (the Site), located at 93-119 Memorial Street, Franklin, New Hampshire. The Site is identified by the New Hampshire Department of Environmental Services (NHDES) as the former Stanley Mill with NHDES Site No. 198606087, Project No. 33501. The objectives of the TBA were to address data gaps and further define the types and general extent of contamination present in soil, soil gas, groundwater, and building materials as a result of historical site operations and/or releases, as well as to assess for releases from a previously unidentified underground storage tank (UST). Nobis performed investigations at the Site which included the collection of shallow and subsurface soil samples, groundwater samples, soil gas samples, and building materials samples.

Soil analytical results presented in this TBA Report were compared to the New Hampshire Department of Environmental Services (NHDES) Soil Remediation Standards (SRS). The SRS are intended to provide a cleanup standard for assessment of contamination at the Site. The volatile organic compound (VOC) tetrachloroethene (PCE) was detected in several soil samples collected at the site at concentrations exceeding the applicable SRS. PCE exceedances were detected in the industrial/hacksaw fill along the back of the property by the river bank. The VOC naphthalene was detected in a soil sample collected between the former mill and former armory at a concentration exceeding the applicable SRS. Several polycyclic aromatic hydrocarbons (PAHs) were detected at concentrations exceeding their respective SRS across the Site. High concentrations of PAHs were detected in the industrial fill in the area between the armory and the mill building. The metals arsenic and lead were detected in several soil samples collected from across the Site at concentrations exceeding their respective SRS. Additionally, the metals cadmium and chromium were detected in a single soil sample each at concentrations exceeding their respective SRS. All metals concentrations exceeding SRS were detected in locations containing industrial fill. Based on soil sample analytical results, PAH contamination at the Site is generally present at the ground surface to 4 feet below ground surface (bgs). Metal contamination at the Site is generally present at the ground surface to 4 feet bgs and up to 12 feet bgs within the area of industrial waste fill materials. Industrial waste fill materials on the property range in thickness from less than 1 foot to 12 feet, within an areal extent of approximately 11,700 square feet.

Groundwater analytical results in this TBA Report are compared to the NHDES Ambient Groundwater Quality Standards (AGQS). The use of AGQS is intended to provide a cleanup standard for assessment of contamination at the Site. The VOCs PCE, trichloroethene (TCE), cis-1,2-dichloroethene, and the PAHs benzo[a]anthracene and benzo[b]fluoranthene were detected at concentrations exceeding their respective AGQS. Groundwater VOC exceedances were detected in locations where industrial fill was observed and not in upgradient locations relative to the Site.

Soil gas analytical results in this TBA Report are compared to the New Hampshire Residential Soil Gas Screening Levels. Concentrations of PCE and TCE were detected at concentrations exceeding their respective Soil Gas Screening Levels. The soil gas exceedances were from a sample location adjacent to a floor drain in the northern portion of the mill building. This soil gas location was also the only location that had a chloroform detection.

Nobis completed assessment of the previously unidentified UST by test pit evaluation and removal of the tank to evaluate for releases, and ultimate closure of the UST and related product piping. The UST was observed to be approximately 1,000-gallons in capacity and utilized for storage of heating oil. Evaluation of the UST indicated the tank was in fair condition with no evidence of releases. Soil samples collected from the UST excavation did not report any SRS exceedances. The tank was closed in accordance with NHDES guidelines.

Nobis evaluated three alternatives to address contamination identified at the site. The first included fencing off areas of the Site that have residual soil contamination and recording an Activity and Use Restriction (AUR) for contaminated areas and installing asbestos warning signage on the former mill building and securing the building from entry. This alternative is presented as a “do nothing option”.

The second alternative includes the partial demolition of site buildings. Installation of a geotextile liner over contaminated soil areas identified at the site (Industrial waste fill area and PAH impacted area), followed by capping of the areas with clean fill material to a minimum thickness of 2 feet. 1-foot angular riprap would be installed over the riverbank slope to armor the riverbank and protect the river bank from potential erosion. This alternative would also include and AUR.

The third alternative would also include the partial demolition of site buildings. As well as excavation and removal of industrial waste fill material and impacted soil from the river bank.

Excavation and removal of PAH impacted soil from the identified PAH areas with limited on-site management of PAH impacted soils. Followed by installation of a geotextile liner and backfilling of all excavated areas with suitable clean fill material to the original grade. One-foot angular riprap would be installed over the riverbank slope to armor the riverbank and protect the river bank from potential erosion. This alternative would also include an AUR.

Based on information gathered during this TBA, pending future site development considerations, and the evaluated remedial alternatives, the following remedial processes are recommended; The PCE and metal-impacted soil (industrial waste fill area) should be excavated to mitigate a potential direct contact risk to humans. PAH-impacted soil should also be excavated and disposed of off-site with limited potential for possible reuse on-site as deep backfill. PCE and metal-impacted soil (industrial waste fill area) should be excavated to mitigate potential vapor intrusion into Site buildings and to address a likely continuing source area to groundwater contamination. Groundwater exceedances detected in locations where industrial fill was observed will need to be monitored under a groundwater management permit, issued by NHDES. Asbestos-containing building materials should be abated at the former armory and former Stanley Mill buildings.

If construction of new buildings is planned during future site redevelopment, an evaluation of soil, groundwater, and soil gas conditions in the proposed building footprint may be warranted depending on the nature of use and type of construction. Site conditions may warrant additional remedial actions or installation of a soil gas mitigation system (passive or active) to eliminate potential VOC impacts to indoor air.

1.0 INTRODUCTION

This Targeted Brownfields Assessment (TBA) Report and Remedial Action Plan (RAP) was prepared by Nobis Engineering, Inc. (Nobis) for the United States Environmental Protection Agency (EPA) under contract No. EP-S1-06-03, Task Order No. 0108-SI-BZ-0100. This TBA Report documents the investigation activities and summarizes the data collected by Nobis at the Ferrari Mill (Site) located at 93-119 Memorial Street in Franklin, New Hampshire. The Site is identified by the New Hampshire Department of Environmental Services (NHDES) as the former Stanley Mill with NHDES Site No. 198606087, Project No. 33501. A Site Locus Plan is included as Figure 1. A Site Area Plan depicting pertinent site features is included as Figure 2.

The objectives of the TBA were to address data gaps from previous investigations and to further define the types and general extent of contamination present in soil, soil gas, and groundwater as a result of historical site operations and/or releases, as well as to evaluate hazardous building materials that would require abatement to support redevelopment. Nobis performed investigations at the Site which included the collection of shallow and subsurface soil samples, groundwater samples, soil gas samples, and building materials samples. Soil and groundwater sampling data collected during the TBA were compared to criteria established by the New Hampshire Department of Environmental Services (NHDES) in the New Hampshire Code of Administrative Rules Chapter Env-Or 600, Contaminated Site Management (Env-Or 600), to evaluate potential risks associated with contaminated environmental media (NHDES, 2016). Soil gas sampling data collected during the TBA were compared to the NH Residential Soil Gas Screening Levels. Building materials were analyzed for asbestos and polychlorinated biphenyl (PCB) content. This information will be used to support the development of potential alternatives for clean-up with order-of-magnitude cost estimates that will help support decision-making concerning future redevelopment of the Site.

This TBA Report was prepared in accordance with the EPA-approved Field Task Work Plan and Quality Assurance Project Plan Addendum (FTWP/QAPPA) for the Site, prepared by Nobis, submitted to EPA on March 20, 2017 and used to complete the Site activities (Nobis, 2017). The TBA activities included the following:

- A sub-slab investigation of the former armory and mill buildings, included installation of soil gas wells and limited soil sampling.

- Collection of soil gas samples.
- Oversight of test pits with collection of soil samples.
- Advancement of soil borings and collection of soil samples.
- Installation of overburden groundwater monitoring wells.
- Installation of a bedrock monitoring well.
- Collection of groundwater samples from existing and newly-installed monitoring wells.
- Underground storage tank (UST) release assessment and closure oversight with collection of confirmation samples.
- A supplemental Hazardous Building Materials (HBM) Survey with collection of building material samples.
- Data evaluation.
- Development of this report.
- Development of a Remedial Action Plan (RAP) to address hazardous building materials present at the Site and remediation of contaminated soil and groundwater identified at the Site. The RAP is needed to assess the feasibility and cost/benefit of remedial options including partial demolition of Site buildings, soil source removal, and establishment of an Activity and Use Restriction (AUR).

The results of this TBA investigation were used to develop remedial recommendations and associated cost estimates.

2.0 KEY TEAM MEMBERS

Alan Peterson is the EPA Task Order Project Officer (TOPO). Tim Andrews managed Nobis and subcontractor tasks and Gail DeRuzzo monitored project quality. Gail DeRuzzo also coordinated with the analytical laboratory and managed data review activities. Joshua Stewart was responsible for the implementation of all field activities as the Field Operations Leader (FOL). Absolute Resource Associates, Inc. (ARA) of Portsmouth, New Hampshire performed the soil, groundwater, and investigation-derived waste (IDW) disposal characterization analyses, Con-Test Analytical Laboratory (Con-Test) of East Longmeadow, Massachusetts performed the soil gas analyses, and EMSL Analytical, Inc. (EMSL) of Woburn, Massachusetts performed the building materials analyses. Monitoring wells were installed by New England Boring Contractors (NEBC) of Londonderry, New Hampshire. Soil gas monitoring points were installed by Eastern Analytical, Inc. (EAI) of Concord, New Hampshire. Test pitting and UST closure was performed by Accuworx, Inc. (Accuworx) of Barre, Vermont.

3.0 SITE BACKGROUND

This section provides a physical description of the Site, historical site usage, discusses potential contaminants of concern identified during historical assessments, and summarizes previous environmental investigations completed at the Site.

The approximate 1.2-acre Site located at 93-119 Memorial Street near downtown Franklin, New Hampshire is identified as Lot 142 on City Tax Map 117. The Site is adjacent to the Winnipesaukee River and is part of the Franklin Falls Historic District. Two vacant structures currently exist on the Site; a former armory on the west side of the property and the former Stanley Mill on the east side.

The plan for Site redevelopment is currently undefined. The City of Franklin (City) is working with stakeholders to find sustainable commercial redevelopment options that support the downtown master plan.

A Site Locus Plan is included as Figure 1. A Site Area Plan is included as Figure 2.

3.1 Site History

G.W. Griffin Company operated a hacksaw manufacturing mill from approximately 1897 to 1979. The armory was constructed in 1911 and was used by the New Hampshire National Guard until 1935 when the G.W. Griffin company purchased the armory. In 1979 the Stanley Works purchased the property and operated on the Site until 1986. The property was then passed to the Franklin Falls Trust and in 1995 was transferred to the Ferrari Realty Trust. Previous investigations have identified the presence of hacksaw blade waste/industrial waste in fill material used to level and extend the property to the north, toward the Winnipesaukee River.

3.2 Contaminants of Concern

Contaminants of concern (COCs) include volatile organic compounds (VOCs), polycyclic aromatic hydrocarbons (PAHs), arsenic, and lead in soil, VOCs and PAHs in groundwater, and VOCs in soil gas. Maximum concentrations of contaminants detected in soil, groundwater, and soil gas samples collected from the Site exceeded applicable NHDES criteria.

Specific contaminants of concern in soil include the VOCs tetrachloroethene (PCE) and naphthalene, the PAHs benzo[a]anthracene, benzo[a]pyrene, benzo[b]fluoranthene, benzo[k]fluoranthene, chrysene, dibenzo[a,h]anthracene, fluorene, and indeno[1,2,3-cd]pyrene, and the metals arsenic, chromium, and lead. The VOC PCE, its degradation compounds trichloroethene (TCE), cis-1,2-dichloroethene and vinyl chloride, and PAHs benzo[a]anthracene and benzo[b]fluoranthene are present in groundwater beneath the Site. The VOCs 1,2,4-trimethylbenzene, 1,4-dichlorobenzene, chloroform, ethylbenzene, PCE, and additional VOCs are present in soil gas at the Site. Asbestos and PCB-containing building materials and lead based paint are present in construction materials utilized in both the former armory and mill buildings.

3.3 Previous Site Investigations

A Phase I Environmental Site Assessment (ESA) was completed by Credere Associates, LLC (Credere) in August, 2014 (Credere, 2014), followed by a Phase II ESA completed by Credere in June, 2015 (Credere, 2015). These and other reports are available on the NHDES OneStop website. A summary of the findings from prior site investigations are as follows:

- Groundwater beneath the Site generally flows west/northwest toward the Winnipesaukee River (immediately adjacent to the Site) and is present at depths of approximately 10 to 17 feet below ground surface (bgs).

- A UST is present behind the former armory, located on the northwest corner of the Site.

- Industrial waste was used as fill material along the northern portion of the Site.

- The fill material varies in thickness from 3.5 to 8.5 feet and contains rusty metal coils, sheet metals, hacksaw blades, and other metal debris.

- The approximate extent of the fill encompasses the majority of the northern portion of the Site, including the riverbank.

- The fill may extend under portions of both the former mill and armory.

- Soil samples from the fill contain PCE, PAHs, and metals at concentrations exceeding NHDES Soil Remediation Standards (SRS).

- Analytical data collected from groundwater samples indicate that groundwater at the Site has been impacted by PCE, TCE, vinyl chloride, and arsenic at concentrations exceeding applicable Ambient Groundwater Quality Standards (AQGS).

- Groundwater was likely impacted from the industrial fill and/or historical discharges to floor drains within the former mill.

- PAHs were detected at concentrations exceeding applicable SRS in one of the sediment samples collected from the Winnipesaukee River.

- PCBs were not detected in the area of the former transformer pad.

- Surface soil throughout portions of the Site is impacted by PAHs at concentrations exceeding NHDES SRS.

- Asbestos-containing materials (ACM) and lead based paint were identified in the former mill.

- Florescent light fixtures, unlabeled drums and low level-PCB containing building materials were present throughout both the former mill and armory.

3.4 Site Geology and Hydrogeology Summary

Based on the investigations performed at the Site by Credere and Nobis, Nobis has prepared a summary of the conceptual site model for the Site. Nobis understands the following about the Site geology and hydrogeology:

- The overburden consists of fill material of varying composition and thickness. Below the fill are alluvial deposits. Weathered bedrock was encountered between 26 (NB-4) and 46 (NB-1) feet bgs. Competent bedrock was encountered at approximately 70 feet bgs at BR-1.

- The fill on-site contains hacksaw blades, metal debris, metal shavings, ash, and brick fragments. The thickness of the fill ranges from 3 to 12 feet bgs.

- Fine sands and silty sand was observed below the fill to approximately 30 feet bgs, transitioning to glacial till to approximately 40 feet bgs with weathered bedrock below.

- According to the Bedrock Geologic Map of New Hampshire, bedrock in the vicinity of the subject site is classified as metapelite, turbidites, with thin quartz conglomerates of the Lower part of the Rangeley Formation.

- Groundwater was observed to range from approximately 7.7 (NB-4S) to 15.4 (NB-1D) feet bgs and flowed in a generally northwest/west direction to the Winnipesaukee River. The variation in measured depth to groundwater is partially due to drop in ground surface elevation at the NB-4 well couplet.

- Four overburden well couplets are present at the site, all four indicate a downward vertical gradient of groundwater. The Winnipesaukee River is likely a discharge point for the groundwater on-site and may be acting as a groundwater contamination barrier.

4.0 SUMMARY OF TBA INVESTIGATION ACTIVITIES

A summary of the TBA investigation activities performed by Nobis is presented in the sections that follow.

4.1 Soil Gas Sample Point Installation

Nobis oversaw the installation of four permanent soil gas sampling points (AR-1 through AR-4) beneath the slab of the armory building and 5 permanent soil gas sampling points (SM-1 through SM-5) beneath the slab of the former Stanley Mill to varying depths from 3.5 feet bgs (SM-5), 4.0 feet bgs (AR-3), 4.5 feet bgs (AR-1), 5.0 feet bgs (AR-4), 5.5 feet bgs (AR-2), to 6.0 feet bgs (SM-1 through SM-4) by EAI using a hammer drill with a combination of 2-foot samplers and an auger bit on April 12 and 13, 2017. Soil gas sampling points were constructed of 6-inch AMS, Inc. vapor implants attached to ¼-inch low density polyethylene (LDPE) tubing, backfilled with filter sand with a bentonite seal at approximately 6 inches bgs. Each soil gas sampling point was finished with a flush-mounted road box set in concrete. Soil gas sampling point locations are shown on Figure 2. Construction details are included in Appendix A.

4.2 Sub-Slab Soil Sampling

Nobis performed sub-slab soil sampling concurrently with soil gas sample point installation activities at five of the nine sub-slab locations (AR-1, AR-2, SM-1, SM-2, and SM-3) to determine the presence of fill materials below the slab and evaluate potential impacts to the soil below the slab of the buildings in areas where industrial fill was likely used. Nobis visually classified soils in the field using the Modified Burmister Classification System and used a MiniRAE 3000 photoionization detector (PID) to field screen soil samples from each sub-slab boring location. PID screening results were all less than 1.0 part per million by volume (ppmv). Hacksaw blades and metal fragments were observed in the sample from 5 feet bgs at sub-slab location AR-2. No obvious indications of industrial fill material were observed in the soil recovered from the other sub-slab borings. Nobis reviewed boring logs prepared by Credere dated October 2014 in which industrial fill material was observed to a depth of 7.5 feet below ground surface (bgs) in boring CA-MW-4 and to a depth of 3.5 feet bgs in boring CA-MW-5. Both CA-MW-4 and -5 are located outside the Stanley Mill building along the northern most side of the building. Based on observations of industrial fill in borings CA-MW-4 and -5 and with the knowledge that the northern

portion of the Mill has been observed to be settling, possibly due to being constructed on top of fill material, it is inferred that some industrial fill material may be present below the building footprint, but the presence of fill below the building has not been confirmed.

A total of five sub-slab soil samples were collected. All five sub-slab soil samples were submitted for laboratory analysis of VOCs by SW-846 Method 8260C, PAHs by SW-846 Method 8270D, and Resource Conservation and Recovery Act (RCRA) metals by SW-846 Method 6020A/7471B. A summary of soil analytical data collected from the sub-slab soil borings advanced during the TBA is presented in Tables 1 through 3 and the complete laboratory analytical reports are included in Appendix D.

4.3 Bedrock Well Installation

Nobis oversaw the construction of a single bedrock well (BR-1) performed by NEBC beginning on April 19, 2017 and completed April 25, 2017. The borehole was advanced with a track-mounted Mobile Drill B-57 using drive and wash drilling methods using a 6-inch roller bit. No soil samples were collected during the advancement of the borehole, drill action and wash cuttings were observed. Presumed weathered bedrock was encountered at approximately 40 feet bgs, competent bedrock was encountered at approximately 69 feet bgs. 4-inch permanent casing was set at 69.5 feet bgs, the borehole and casing were grouted from 69.5 feet bgs to 1.5 feet bgs. The borehole was terminated at 95 feet bgs creating a 25-foot open borehole bedrock interval from 70 to 95 feet bgs. Boring logs are included in Appendix A.

4.4 Drive and Wash Soil Borings and Subsurface Soil Sampling

Nobis oversaw the advancement of soil borings by drive and wash methods performed by NEBC on April 21, 2017 through May 1, 2017. NEBC advanced six soil borings at the Site to collect soil data with which to evaluate the presence and nature of contamination in soils. Soil borings were advanced in locations intended to provide coverage across the Site and to enable field observations of subsurface conditions. Borings were completed as follows:

- One of the borings (NB-1) was advanced in the center portion of the Site to the west of and between the northern and southern portions of the former mill (shallow and deep overburden well couplet).

- Two of the borings (NB-2 and NB-3) were advanced on the northern portion of the Site, between the former mill and the armory (shallow and deep overburden well couplets).

- One of the borings (NB-4) was advanced on the northwestern portion of the Site, behind the former armory (shallow and deep overburden well couplet).

- Two of the borings (NB-5 and NB-6) were advanced to the north of the Site behind the former mill (deep overburden only).

Soil boring locations are shown on Figure 3. Boring logs are included in Appendix A.

Soil borings were advanced by a track-mounted Mobile Drill B-57 using drive and wash drill methods. Soil samples were collected continuously from ground surface to at least 10 feet bgs and at a minimum of every 5 feet after. Soil samples were collected using a standard 2-inch diameter by 24-inch long split spoon. After each spoon was driven into the sub-surface the spoons were opened to allow for soil classification and collection of soil samples for lab analyses. Split-spoons were decontaminated prior to reassembly. Termination depths of the borings were: 26 feet bgs (NB-4), 28 feet bgs (NB-5), 36 feet bgs (NB-2, NB-3, NB-6), and 46 feet bgs (NB-1).

Nobis visually classified soils in the field using the Modified Burmister Classification System and used a MiniRAE 3000 PID to field screen soil samples extracted during each sample interval. Fill material observed in borings ranged from no fill observed in borings NB-1, NB-3, and NB-4 to 6.5 to 12 feet bgs in borings (NB-2, NB-5, and NB-6). Fill material consisted of hacksaw blades, metal fragments and shavings, ash, brick fragments, and other fill debris. Generally, soils beneath the fill material were observed to be fine sands and silty sands, with glacial till encountered beneath the fine sands and silty sands and directly above weathered bedrock. PID screening results generally ranged from less than 1.0 ppmv to no more than 15.0 ppmv. However, there were several outliers recorded at NB-2 of 30.2 ppmv (2-4 feet bgs), 63.7 ppmv (34-36 feet bgs), and 217 ppmv (29-31 feet bgs). No staining or odors indicative of contaminant presence was noted in any of the soils inspected.

Three soil samples were collected for laboratory analysis from each soil boring to evaluate the potential vertical distribution of contaminants. Generally, one sample was collected at or near ground surface, one was collected just above the groundwater interface, and one was collected

at depth. Soil samples were submitted for laboratory analysis of VOCs by SW-846 Method 8260C, PAHs by SW-846 Method 8270D, and RCRA metals by SW-846 Method 6020A/7471B. Samples were selected for laboratory analysis based on PID field screening results, visual or olfactory evidence of contamination, and proximity to the groundwater interface. A summary of soil analytical data collected from soil borings advanced during the TBA is presented in Tables 1 through 3 and the complete laboratory analytical reports are included in Appendix D.

4.5 Test Pits and Soil Sampling

Nobis performed oversight of six test pit explorations (NB-TP-1 through NB-TP-6) completed by Accuworx on May 17, 2017. Test pits were completed to enable field observations of subsurface conditions, to further define the presence and nature of contamination previously identified at the site, and the extent of industrial waste fill materials. Test pits were completed at locations intended to fill in data gaps from previous investigations. Test pit locations are shown on Figure 3. Test pit logs are included in Appendix A.

Test pits were completed using a Volvo EC60E mini excavator with a 14-foot reach. Test pits were completed to varying depths ranging from 4 feet bgs (NB-TP-4), 4.5 feet bgs (NB-TP-5), 5 feet bgs (NB-TP-6), to 6 feet bgs (NB-TP-1 through NB-TP-3). Fill material thickness observed in the test pits ranged from no fill observed in NB-TP-3, to 0-2 feet bgs observed in NB-TP-2, and NB-TP-4 through NB-TP-6, to 0-3 feet bgs observed in NB-TP-1. Fill material consisted of metal fragments, ash, brick fragments, glass, and other fill debris.

One soil sample was collected for laboratory analysis from each test pit. Soil samples were submitted for laboratory analysis of VOCs by SW-846 Method 8260C, PAHs by SW-846 Method 8270D, and RCRA metals by SW-846 Method 6020A/7471B. Additionally, the soil samples collected from NB-TP-1 and NB-TP-4 were analyzed for hexavalent chromium by SW-846 Method 3060A/7196A. A summary of soil analytical data collected from soil borings advanced during the TBA is presented in Tables 1 through 3 and the complete laboratory analytical reports are included in Appendix D.

4.6 Shallow Soil Sampling

Nobis performed shallow soil sampling on June 7, 2017. Shallow soil boings targeted soil from 0.5 feet to 1.5 feet bgs to evaluate potential impacts to shallow soil and soil management concerns

for future redevelopment. Soil samples were collected using a 2-inch diameter stainless steel hand-auger. The hand-auger was decontaminated between boring locations using a liquid Alconox solution and a potable water rinse. Shallow soil sample locations are shown on Figure 3.

A total of ten shallow soil samples were collected, one per sample location. All shallow soil samples were analyzed for PAHs, with four (NB-SS-1, NB-SS-2, NB-SS-3, and NB-SS-4) of the samples also analyzed for VOCs, RCRA metals, and hexavalent chromium. A summary of soil analytical data collected from shallow soil borings completed during the TBA is presented in Tables 1 through 3 and the complete laboratory analytical reports are included in Appendix D.

4.7 Monitoring Well Installation and Development

Soil borings NB-1 through NB-4 were completed as 2-inch monitoring well shallow/deep couplets. Soil borings NB-5 and NB-6 were completed as 2-inch monitoring wells. The well screen intervals for the shallow/deep couplets were as follows: NB-1 (shallow 10-20’ bgs, deep 34-39’ bgs), NB-2 (shallow 8-18’ bgs, deep 29-34’ bgs), NB-3 (shallow 11-18; bgs, deep 25-28’ bgs), and NB-4 (shallow 4-12’ bgs, deep 20-25’ bgs). Monitoring wells were constructed with polyvinyl chloride (PVC) materials consisting of 0.010-inch slotted screen and solid riser to bring the well to the ground surface. The annular space around the well screen was filled with filter sand pack, which was generally extended 2 feet above the top of the screen. Generally, a minimum 2-foot thick bentonite seal was installed above the sand pack and the remainder of the borehole annulus was backfilled using filter sand, except during installation of well couplets where an additional bentonite seal was installed above the filter sand pack of the second well. All monitoring wells were finished at the ground surface with a flush-mount road box protective cover. Monitoring well locations are shown on Figure 3. Refer to Appendix A for monitoring well construction details.

Following installation, the monitoring wells were developed by NEBC by surging and over-pumping them using a submersible pump. Observations were recorded during the well development process. Initial development water was laden with silt; however, water clarity improved with continued well development. All wells were developed until at least five well volumes of water were removed from the well or the well was purged dry. Development purge water was containerized into 55-gallon drums.

A well head elevation survey was completed by Nobis on June 7, 2017. The survey included the new monitoring wells installed by Nobis and six existing monitoring wells previously installed by others. The survey was referenced to a temporary benchmark with an elevation of 100 feet, set at the top of a fire hydrant located on Memorial Street to the south of the former Stanley mill and west/northwest of monitoring well CA-MW-1. Survey data and reference elevation calculations are included in Appendix C.

4.8 Groundwater Sampling

Nobis collected groundwater samples from the 11 newly installed wells and the six existing wells on May 31, 2017 and June 1, 2017. A synoptic round of groundwater elevation measurements of all Site monitoring wells was completed prior to sampling and is included in Table 5. Groundwater beneath the Site generally flows to the north/northwest, toward the Winnipesaukee River. Fluctuations in groundwater levels and transport directions will occur due to variations in precipitation, surface runoff, temperature, seasonal fluctuations, and other factors not assessed in this report. Local groundwater flow anomalies may also exist due to the influence of buildings, paved areas, underground utilities, and localized topography. Calculated groundwater elevation contours are shown on Figure 7.

Nobis used a peristaltic pump and dedicated polyethylene tubing with the inlet located approximately at the mid-point of the well screen to collect groundwater samples from each monitoring well. Groundwater samples were collected using the USEPA Region I Low Flow/Low Stress method. Groundwater levels were gauged using a Solinst® Model 101 electronic water interface probe (0.01-foot accuracy). Depth to groundwater measured at the Site ranged from 7.7 ft bgs (NB-4S) to 15.4 ft bgs (NB-1D). Non-aqueous phase liquid (NAPL) was not encountered in any of the sampled wells. A total of 17 groundwater samples, plus a field duplicate were submitted for laboratory analysis of VOCs, PAHs, and RCRA metals. The samples collected for PAHs and metals analysis were filtered in the field at the time of sample collection.

Purging rates varied between 85 to 135 milliliters per minute (ml/min). Purge water was monitored for stabilization of field indicator parameters (i.e., pH, temperature, specific conductance, dissolved oxygen, and oxidation/reduction potential [ORP]) using an In-Situ SmarTroll (SmarTroll) multi-parameter sonde with a 90ml flow-through cell. Turbidity was monitored using a HACH 2100Q turbidity meter. Both the SmarTrolls and turbidity meters were calibrated in accordance

with manufacturer specifications prior to the start of groundwater sampling activities. Field parameters were monitored at 5-minute intervals until the following stabilization criteria were met for 3 consecutive readings:

- Temperature; ± 3 percent;
- Specific conductance; ±3 percent;
- pH; ±0.1;
- ORP; ±10 millivolts;
- Dissolved oxygen; ±10 percent or measured less than 0.5 mg/L; and
- Turbidity; measured less than 5 NTUs or ±10 percent.

The data were recorded on low flow sample data sheets, which are included in Appendix B. When purging was completed, the discharge line from the pump was disconnected from the SmarTroll flow cell and samples were collected directly from the peristaltic pump discharge tube into pre-preserved containers provided by ARA. Following collection, samples were subsequently placed on ice in a cooler, logged on a chain-of-custody form, and transported to the laboratory by courier. A summary of groundwater analytical data collected from monitoring wells is presented in Tables 6 through 8. Results of groundwater sample laboratory analyses are presented on Figure 7 and the complete laboratory analytical reports are included in Appendix D. Data validation reports are included in Appendix E.

4.9 Soil Gas Sampling

Nobis collected soil gas samples from the newly installed soil gas sampling points (SG-AR1 through SG-AR4 and SG-SM1 through SG-SM5) on April 26, 2017. Prior to sampling each soil gas point approximately three 1-liter volumes of soil gas were collected in a Tedlar® bag to complete the initial purge of the sample point using a peristaltic pump. Potential short-circuiting (i.e., ambient air being drawn into the probe and mixing with the soil gas indicating poor representation of in-situ soil gas) was assessed by measuring oxygen (O_2) and carbon dioxide (CO_2) from the purged soil gas in the Tedlar® bag and compared to ambient O_2 and CO_2 levels. Total VOCs were also measured using a PID to screen the soil gas purged from the sample probe and into the Tedlar® bag. Upon verification of the absence of short-circuiting, a soil gas sample was collected.

Soil gas samples were collected using 6-liter SUMMA® canisters equipped with pressure gauges and 200 ml/min regulators. Each sample had a run time of approximately 30 minutes, except at SG-AR2 where a duplicate sample was collected simultaneously and the total run time was approximately 1 hour. Initial and final pressures of each canister were recorded. Soil gas samples were submitted to Con-Test for laboratory analysis of VOCs by Method TO-15. A summary of soil gas analytical data is presented in Table 9. Results of soil gas sample laboratory analyses are presented on Figure 8 and the laboratory analytical reports are included in Appendix D.

4.10 UST Closure

Nobis oversaw the release assessment by closure of a 1,000-gallon fuel oil UST performed by Accuworx on May 18, 2017. The UST was located along the north side of the former armory building to the northwest corner of the building, and measured 11 feet long with a 4-foot diameter. Approximately 4 inches of product was present in the UST and was removed using a vac-truck. The UST was cleaned prior to removal from the ground. The UST and product were transported and disposed of in accordance with all local, state, and federal regulations. The excavation measured 18 feet long by 8 feet wide and was 6 feet deep; soil encountered was tan fine sands. Soil from the excavation was screened using a PID; readings from the soil were all less than 1 ppmv. No pitting or holes were observed on the UST and no evidence of a release was observed. The UST closure was performed in general accordance with Chapter Env-Or 400 of the New Hampshire Code of Administrative Rules (NHDES, 2013). Field notes and photos of the UST closure are included in Appendix C.

A total of two composite soil samples were collected from the base of the UST excavation and were analyzed for VOCs, PAHs, RCRA metals, and diesel range organics (DRO) by Method 8015. A summary of soil analytical data collected from the UST excavation completed during the TBA is presented in Tables 1 through 4. Results of UST closure sample laboratory analyses are presented on Figure 9 and the complete laboratory analytical reports are included in Appendix D.

4.11 Supplemental Hazardous Building Materials Sampling

A limited hazardous building materials survey was conducted within the Site buildings to supplement a previous survey completed by Credere. The hazardous building material survey included the identification, quantification, and location of ACM and PCB-containing building materials. Detailed below are the hazardous materials identified within the Ferrari Mill and former armory.

The Ferrari Mill (Former Stanley Mill) building is a two-story structure with basement, it contains multiple rooms and open-concept office areas located on the first floor. The second floor of the building had four large open rooms. The former armory is a single-story structure with multiple rooms, and one large storage room. The construction of both buildings are brick and masonry with a combination of rubber membrane and asphalt shingle roofs on the buildings.

Figure 10 depicts the approximate bulk sample locations for asbestos and PCB analysis. The laboratory reports for the asbestos and PCB bulk samples are included as Appendix D.

Asbestos-Containing Materials

Mr. Karl Karlsson, an Asbestos Hazard Emergency Response Act (AHERA)-certified Asbestos Inspector, collected a total of 20 bulk samples from both buildings, on April 14, 2017. The bulk samples were transmitted under a chain-of-custody to EMSL Analytical, Inc. in Woburn, Massachusetts, a NHDES and U.S. Environmental Protection Agency (EPA) accredited laboratory. The laboratory analyzed the samples by polarized light microscopy (PLM) in accordance with the EPA “Method for Determination of Asbestos in Bulk Material”; EPA/600/R-93/116 (July 1993). Five samples of non-friable organically bound (NOB) materials were identified for additional analysis by transmission electron microscopy (TEM), if the PLM analysis did not already identify the sample as ACM.

Homogeneous building material bulk samples were analyzed with the “hit-stop” procedure. Utilizing the “hit-stop” procedure, if asbestos is detected in a sample collected from a homogeneous area, the remaining samples collected from that same homogeneous area are not required to be analyzed. Through the “hit-stop” procedure, a total of 21 bulk samples were analyzed by PLM. A summary of the asbestos analytical results is included in Table 10. A copy of the laboratory analytical data is included in Appendix D.

PCB-Containing Materials

Nobis examined the structures for building materials that could potentially contain PCBs on April 14, 2017. The Former Stanley Mill was reportedly constructed in the 1890’s and the former armory was constructed in 1910’s; however, based on observations made during the inspection, the structures have since gone through multiple renovations since their original construction. The

rationale for PCB characterization of suspect building materials was to determine the presence and/or concentrations of PCBs in building materials prior to renovation or demolition of the site structures. The sampling program consisted of collecting up to ten samples of suspect building material for analysis of PCBs by EPA Method 3540C/8082, using the Soxhlet extraction method. Based on observations made during the building inspections and grouping the structures together based similar construction materials and age, a total of only five building material samples were collected for off-site laboratory analysis.

The samples were analyzed by EMSL Analytical, Inc. (EMSL) of Cinnaminson, New Jersey. EMSL required a minimum of 10 grams per sampled material, to achieve the reporting limit of 0.1 milligrams per kilogram (mg/kg) equivalent to parts per million (ppm). The reporting limit was elevated for the analysis of the collected building materials due to matrix interference. A summary of the PCB analytical results is included in Table 11. A copy of the laboratory analytical data is included in Appendix D.

4.12 Investigation Derived Waste

IDW including soil cuttings, well development and sampling purge water, and debris (equipment and materials contaminated during fieldwork) were managed in accordance with the FTWP/QAPPA (Nobis 2017). Soil cuttings were containerized into a solids drum. Well development and sampling purge water was containerized into a liquids drum. One composite IDW soil sample and one composite liquid sample was collected and submitted to ARA for laboratory analysis of disposal characteristics. The soil, water, and any debris generated was containerized and disposed of as general waste in accordance with Federal, state, and local laws. IDW was transported off-Site by National Response Corporation (NRC) for proper disposal.

5.0 SUMMARY OF SAMPLING RESULTS

Soil, groundwater, soil gas, and building material laboratory analytical results of samples collected by Nobis for this TBA investigation are summarized in the following sections. Analytical results are compared to the applicable New Hampshire or Federal criteria to make a preliminary evaluation of potential risks associated with contamination and to determine the need for remedial actions or use limitations to facilitate reuse or redevelopment.

Soil analytical results were compared to the NHDES SRS published as Table 600-2 in Env-Or 600.

Groundwater analytical results were compared to the NHDES AGQS published as Table 600-1 in Env-Or 600 most recently updated October 22, 2016 and to NHDES Vapor Intrusion Screening Levels, groundwater to indoor air GW-2 (GW-2) values.

Soil gas analytical results were compared to the NH Residential Soil Gas Screening Levels.

Building materials were analyzed for asbestos and PCB content. Building material PCB analytical results were compared to Federal cleanup levels established in 40 CFR § 761.61 high occupancy use, bulk waste scenario (PCB Cleanup Standard).

Copies of laboratory analytical reports are included as Appendix D.

5.1 Soil Sampling Results

Soil analytical results are summarized on Tables 1 through 4. Soil analytical results are compared to the NHDES SRS. A summary of soil analytical results is provided below.

VOCs

A summary of VOC soil sample results is presented on Table 1. Several VOCs were detected at concentrations that exceed their respective SRS. A summary of the VOC exceedances is provided in the table below. All other VOCs, when detected, were below their respective SRS. Sample locations where VOCs were detected above their respective SRS are shown on Figure 4.

Contaminant/SRS (mg/Kg)	Sample Location/Concentration (mg/Kg)
Naphthalene / 5	NB-TP-1 / 26
Tetrachloroethene / 2	NB-2S/D / 5.4 NB-TP-6 / 4.1 SG-SM1 / 2.8

PAHs

A summary of PAH soil sample results is presented on Table 2. Several PAHs were detected at concentrations that exceed their respective SRS. A summary of the PAH exceedances is provided in the table below. All other PAHs, when detected, were below their respective SRS. Sample locations where PAHs were detected above their respective SRS are shown on Figure 5.

Contaminant/SRS (mg/Kg)	Sample Location/Concentration (mg/Kg)
Benzo[a]anthracene / 1	SG-SM2 / 19; SG-SM3 / 49; NB-2 S-1 0.5-2' / 1.1; NB-3 S-1 0.3-2' / 1.7; NB-6 S-1 0.3-2' / 6.1J; NB-5 0.3-2' / 1.3; NB-TP-1 3' / 340; NB-TP-3 1' / 9.8; NB-TP-6 4' / 2.5; NB-SS-1 / 7.1J; NB-SS-2 / 5.7J(20J); NB-SS-7 / 8.1
Benzo[a]pyrene / 0.7	SG-SM2 / 14; SG-SM3 / 41; NB-2 S-1 0.5-2' / 1.1; NB-3 S-1 0.3-2' / 1.4; NB-6 S-1 0.3-2' / 4.9J; NB-5 0.3-2' / 1.2; NB-TP-1 3' / 210; NB-TP-3 1' / 7.1; NB-TP-6 4' / 2.4; NB-SS-1 / 5.3J; NB-SS-2 / 3.9J(14J); NB-SS-4 / 0.64; NB-SS-7 / 5.4
Benzo[b]fluoranthene / 1	SG-SM2 / 15; SG-SM3 / 37; NB-2 S-1 0.5-2' / 1.3; NB-3 S-1 0.3-2' / 1.2; NB-6 S-1 0.3-2' / 5.0J; NB-5 0.3-2' / 1.3; NB-TP-1 3' / 180; NB-TP-3 1' / 5.8; NB-TP-6 4' / 2.5; NB-SS-1 / 5.9J; NB-SS-2 / 4.1J(12J); NB-SS-7 / 4.8
Benzo[k]fluoranthene / 12	SG-SM3 / 36; NB-TP-1 3' / 220
Chrysene / 120	NB-TP-1 3' / 270
Dibenz[a,h]anthracene / 0.7	SG-SM2 / 2.7; SG-SM3 / 5.1; NB-TP-1 3' / 42; NB-TP-3 1' / 1.3; NB-SS-1 / 1.5J; NB-SS-2 / 1.1J(3.4J); NB-SS-7 / 1.2
Fluorene / 77	NB-TP-1 3' / 140
Indeno[1,2,3-cd]pyrene / 1	SG-SM2 / 6.6; SG-SM3 / 14; NB-6 S-1 0.3-2' / 1.3J; NB-TP-1 3' / 99; NB-TP-3 1' / 3.9; NB-SS-1 / 3.0J; NB-SS-2 / 1.8J(6.9J); NB-SS-7 / 3.0
Naphthalene / 5	SG-SM3 / 5.1; NB-TP-1 3' / 64

Note: J = Concentration is estimated, (20) = field duplicate value.

Metals

A summary of metals soil sample results are presented on Table 3. Several metals were detected at concentrations that exceed their respective SRS. A summary of the metal exceedances is provided in the table below. All other metals, when detected, were below their respective SRS. Sample locations where PAHs were detected above their respective SRS are shown on Figure 6.

Contaminant/SRS (mg/Kg)	Sample Location/Concentration (mg/Kg)
Arsenic / 11	SG-AR2 / 50; NB-2 S-1 0.5-2' / 13 NB-3 S-1 0.3-2' / 19; NB-6 S-1 0.3-2' / 31(33) NB-SS-2 / 17(16)
Cadmium / 33	NB-2S/D / 140
Lead / 400	SG-SM3 / 650; NB-2 S-1 0.5-2' / 730 NB-5 0.3-2' / 480; NB-TP-6 4' / 440

5.2 Groundwater Sampling Results

A summary of groundwater sample results is presented on Tables 6 through 8. Groundwater analytical results are compared to the NHDES AGQS. The use of AGQS is intended to provide cleanup standards for the Site. A summary of groundwater exceedances is provided in the table below. All other analytes, when detected, were below their respective AGQS. VOC results exceeding GW-2 are marked in the table where applicable. Sample locations where analytes were detected above their respective AGQS are shown on Figure 7.

Contaminant/NHDES AGQS (GW-2)	Location/Concentration (µg/L)
Cis-1,2-Dichloroethene / 70	NB-4D / 82
Tetrachloroethene / 5 (240)	CA-MW-5 / 120 CA-MW-6 / 30 NB-2S / 21 NB-4S / 10 NB-4D / 42
Trichloroethene / 5 (20)	CA-MW-5 / 12 CA-MW-6 / 6 NB-2D / 23* NB-4D / 140* BR-1 / 6
Benzo[a]anthracene / 0.1	NB-4D / 0.2
Benzo[b]fluoranthene / 0.1	NB-4D / 0.2

Note: * = Concentration exceeds GW-2

5.3 Soil Gas Sampling Results

A summary of soil gas sampling results is presented on Table 9. Concentrations of PCE and TCE were detected above the NH Residential Soil Gas Screening Levels. All other VOCs, when detected, were below their respective NH Residential Soil Gas Screening Levels. A summary of exceedances is provided in the table below.

Contaminant/ NH Soil Gas Standard (µg/m^3)	Location/Concentration (µg/m^3)
Tetrachloroethene / 400	SM-1 / 2,100*;
Trichloroethene / 20	SM-1 / 74*

Note: * = Concentration exceeds Soil Gas Screening Levels

5.4 Building Material Results

Building materials bulk sample analytical results are summarized on Tables 10 and 11. A summary of building materials bulk sample analytical results is provided below.

Asbestos

Results of the laboratory analyses indicated the presence of asbestos (greater than or equal to 1 percent) in nine of the 21 bulk samples analyzed by PLM. Asbestos was not detected above 1 percent in any of the five NOB bulk samples analyzed by TEM. The building materials identified as ACM included window glazing, 12x12 brown floor tile and mastic, and tan speckled sheet flooring at the former armory, and boiler gasket, glue daubs, multi-colored sheet flooring, textured Tan/Brown sheet, and black caulking at the former Stanley Mill. These materials were readily accessible at the two buildings. Additional information pertaining to ACM identified at the buildings is included in Table 10.

PCBs

Results of the laboratory analyses indicated the following:

PCB-1 (White Paint Chips, Former Stanley Mill):

- No aroclors were present above the laboratory detection limit of 0.93 ppm.

PCB-2 (Green Wall Board, Former Stanley Mill):

- No aroclors were present above the laboratory detection limit of 0.98 ppm.

PCB-3 (Tan Wall Board, Former Stanley Mill):

- No aroclors were present above the laboratory detection limit of 0.95 ppm.

PCB-4 (Black Caulk, Former Stanley Mill):

- No aroclors were present above the laboratory detection limit of 0.93 ppm.

PCB-5 (White and Blue Painted Cinder Blocks, Former Armory):

- PCB Aroclor 1254 was present in the bulk sample, at a concentration of 1.5 ppm. This material exceeded the 1 ppm criterion for High Occupancy Use but did not exceed the 10 ppm criterion for High Occupancy Use With Encapsulation and Deed Recordation. These materials would be classified as Excluded PCB Product and would not trigger TSCA notification requirements as the detected total PCB concentration is <50 ppm.

Cleanup criteria based on high and low occupancy standards are established in 40 CFR §761.61. Cleanup levels for bulk PCB remediation waste is defined under 40 CFR §761.61 (a)(4)(i) and for porous material under 40 CFR §761.61 (a)(4)(iii).

5.5 Data Validation and Usability Evaluation

Nobis performed a Tier 1 Modified data validation in accordance with the EPA New England Environmental Data Review Supplement for Regional Data Review Elements and Superfund Specific Guidance/Procedures (EPA, 2013); USEPA Contract Laboratory Program National Functional Guidelines for Inorganic Superfund Data Review (EPA, 2014a); USEPA Contract Laboratory Program National Functional Guidelines for Superfund Organic Methods Data Review (EPA, 2014b), and the FTWP/QAPPA (Nobis, 2017). Data validation was performed on soil, soil gas, groundwater, and quality assurance/quality control (QA/QC) samples collected during the TBA. Tier 1 data validation only evaluates completeness of the data. Results of field and laboratory QA/QC samples were also evaluated and limited qualification of the data was performed. Limitations and qualification of the data were noted and explained in the data validation reports, which are provided in Appendix E. Based on the data validation performed, Nobis determined that the data are usable to support the objectives of the TBA.

6.0 CONTAMINANT DISTRIBUTION

This section provides a discussion of contaminant distribution based on the environmental data collected during the TBA and previous site investigations to support remedial recommendations to address contaminants of concern that would facilitate reuse and redevelopment of the Site.

6.1 Soil Contamination

VOCs

TBA soil sampling results and historic results indicate naphthalene and PCE are the only two VOCs that have been detected at concentrations exceeding their respective SRS. Detections of naphthalene exceeding the SRS of 5 mg/kg are limited to the samples collected at NB-TP-1 at 3 feet bgs and CA-TP-A3. Naphthalene concentrations at NB-TP-1 are most likely due to the presence of ash fill materials, the sample at NB-TP-1 was collected from a layer of ash fill material, this ash material was also observed at NB-TP-2 but was not sampled at this location. Naphthalene detection at CA-TP-A3 is most likely due to the presence of fill material at this location. Naphthalene was also present in the sample collected from location SG-SM3 performed as part of this TBA at a concentration exceeding the SRS.

Detections of PCE exceeding the applicable SRS were present across the area delineated as industrial fill, but were all within the extents of the industrial waste fill material. Detections of PCE exceeding the SRS include historic data collected from locations CA-TP-1(0-6 feet bgs), CA-TP-2(0-3.5 feet bgs), CA---SB-4/CA-MW-4, and CA-SB-5/CA-MW-5 and from locations NB-2(0.5-2 feet bgs), NB-TP-6(4 feet bgs), and SG-SM1(0.5-2 feet bgs) performed as part of this TBA. PCE was also present in the samples collected from locations NB-1(0.3-2 feet bgs), NB-3(0.3-2 feet bgs), NB-6(0.3-2 and 12-13 feet bgs), NB-SS-2(1 foot bgs), SG-AR2(0.5-2 feet bgs), SG-SM2(0.5-2 feet bgs), and SG-SM3(0.5-2 feet bgs) performed as part of this TBA and historic data collected from CA-SB-6/CA-MW-6(0.5-10 feet bgs), CA-SS-8(0-2 feet bgs) and CA-SS-10(0-2 feet bgs) at concentrations below the SRS. PCE concentrations in soil are generally limited to the extents of the industrial waste fill along the north end of the property. The source of PCE in this area is likely due to historic uses on-site, specifically from the production of hacksaw blades and from the use of industrial waste materials as fill.

PAHs

In general, PAHs are present across the Site at concentrations exceeding applicable SRS. Shallow soil (0-2 ft) detections of PAHs exceeding SRS are present within the extents of the industrial waste fill material and within a limited area between the former armory and former Stanley Mill buildings near loading docks and former parking or staging areas. PAHs at concentrations exceeding SRS were present in the shallow soil within the area between the

buildings in the samples collected from locations NB-3, NB-SS-7, and NB-TP-3 performed as part of this TBA and historic data collected from CA-SS-1 and CA-SS-2. Urban fill material, black soil and ash material, was present within 0-2 feet bgs in this area and is likely the source of the PAH contamination at these locations. PAHs were detected in exceedance of SRS in the samples collected from the shallow soil within the industrial fill area at locations (NB-2, NB-5, NB-6, NB-SS-1, NB-SS-2, NB-SS-4, SG-SM2, and SG-SM3) performed as part of this TBA and historic data collected from CA-SB-4/CA-MW-4, CA-TP-1, CA-TP-2, and CA-TP-A3. The source of PAHs in this area is likely from the industrial waste material used as fill in this area. PAH impacted shallow soil will need to be managed during any redevelopment activities.

PAHs present at concentrations exceeding applicable SRS in the sub-surface (2+ feet bgs) are limited to the extents of the industrial waste fill material, a limited area between the buildings (NP-TP-1), and a location of general urban fill (such as glass, brick, metal, etc.) located on the northeast portion of the site (NB-TP-6). PAHs were detected in the sample collected from NB-TP-1 at 3 feet bgs at concentrations exceeding applicable SRS. PAH concentrations at this location are most likely due to the presence of ash fill materials as the sample at NB-TP-1 was collected from a layer of ash fill material. This ash material was also observed at NB-TP-2 but was not sampled at this location, it is assumed the ash material at this location also contains PAHs at concentrations exceeding applicable SRS. PAHs were detected in a sample collected from NB-TP-6 at 4 feet bgs at concentrations exceeding applicable SRS. A black urban fill material consisting of metal fragments, ash, brick fragments, glass, and other fill debris including assumed graphite anodes was present at this location. This urban/industrial fill material is the likely source of the PAH contamination. This soil may need to be managed during any redevelopment activities. Based on the available data, PAH soil contamination at the Site generally appears to be limited to the urban and industrial waste fill materials located above the native soils.

Metals

The presence of metals at concentrations exceeding applicable SRS is limited to the extent of the industrial waste fill material and the area of urban fill materials on the northeast portion of the site. Arsenic was present at concentrations exceeding the applicable SRS in the samples collected from five locations (NB-2, NB-3, NB-6, NB-SS-2, and SG-AR2) performed as part of this TBA and historic data collected from CA-SB-4/CA-MW-4, CA-SB-5/CA-MW-5, CA-SB-6/CA-MW-6, CA-SS-5, CA-SS-9, CA-SS-10, CA-TP-1, CA-TP-3, and CA-TP-A3. Arsenic is present across the site,

and is likely from a combination of natural sources and minimal anthropogenic sources, except within the extents of the industrial waste fill material. The majority of arsenic concentrations within the extents of the industrial waste fill material are most likely from anthropogenic sources.

Lead was present at concentrations exceeding the SRS in the samples collected from four locations (NB-2, NB-5, NB-TP-6, and SG-SM3) performed as part of this TBA and historic data collected from CA-SS-5 and CA-TP-1. Lead is present across the site; however, the concentrations of lead exceeding the SRS were all within the extents of the industrial waste fill material. Lead in this area is most likely from anthropogenic sources.

Chromium detections exceeding the SRS were limited to historic data collected from CA-SS-10 (0-2ft bgs). This sample location is within the industrial waste fill area just below the west end of a retaining wall near the river edge. The chromium detected in this sample is most likely from anthropogenic sources related to the industrial waste fill material. Hexavalent chromium, where analyzed, did not exceed the SRS.

Cadmium detections exceeding the SRS were limited to the sample collected from NB-2 at 29 to 31 feet bgs. The source of cadmium in this sample is unknown. Cadmium was detected in only seven other samples collected at the site during the current TBA and previous site investigation activities, all at concentrations less than 2 mg/kg, far below the SRS of 33 mg/kg.

6.2 Groundwater Contamination

VOCs

Concentrations of VOCs in groundwater samples collected during TBA sampling which exceeded applicable AGQS include PCE and the PCE degradation compounds TCE and cis-1,2-dichloroethene. PCE was present in the groundwater samples collected from five locations (CA-MW-5, CA-MW-6, NB-2S, NB-4S, and NB-4D), TCE at five locations (CA-MW-5, CA-MW-6, NB-2D, NB-4D, and BR-1), and cis-1,2-dichloroethene at NB-4D.

The presence of PCE at concentrations exceeding AGQS at these locations is likely due to leaching from the industrial waste fill material as PCE was likely a component of cutting oils and cleaning agents used during production of hacksaw blades at the site. Additionally, a drain was identified in the northwest basement of the former Stanley Mill building and investigation results

suggest the drain is either a potential point source for PCE contamination or provides a preferential pathway for migration of PCE contamination. The highest concentrations of PCE have been present in the groundwater sampled from CA-MW-5 which was installed in close proximity to the drain pipe. The sub-slab soil sample collected at SG-SM1, located directly adjacent to the identified floor drain contained concentrations of PCE exceeding the SRS.

PCE is a dense non-aqueous phase liquid (DNAPL), with greater density than water and tends to "sink" if unconfined in groundwater. As discussed in Section 3.4, groundwater at the Site flows in a general northwest/west direction with a downward vertical gradient in the overburden aquifer. Spatial distribution of PCE and its degradation compounds is consistent with the current site geologic and hydrogeologic model. Concentrations of PCE degradation compounds increase downgradient in the horizontal and vertical directions.

Results reported from the sample collected at NB-4D and the site hydrogeologic model indicate deep overburden groundwater with concentrations of PCE, TCE, and cis-1,2-dichloroethene exceeding AGQS likely exists downgradient of this location, potentially extending off-site to the adjacent property to the west. The extent of downgradient impacts to overburden groundwater to the west of NB-4D is unknown and represents a data gap that may require future evaluation. TCE was present at concentrations exceeding AGQS in the sample collected from BR-1. BR-1 is an open bedrock borehole with an open interval from 70 feet bgs to 95 feet bgs. The presence of TCE exceeding AGQS at BR-1 is consistent with the current site hydrogeologic model and indicates the bedrock aquifer downgradient from this location is likely impacted by site contaminants. Groundwater impacted by PCE and its degradation compounds is confined to the industrial waste fill area and the areas downgradient discussed above. The extent of downgradient impacts is not known. Removal of the source area (industrial waste fill material) would likely address the source of the PCE, TCE, and cis-1,2-dichloroethene-impacted groundwater at the Site.

PAHs

PAHs were detected at concentrations exceeding AGQS in the groundwater sample collected from NB-4D and included benzo[a]anthracene and benzo[b]fluoranthene. The sample was field filtered prior to collection. The presence of these PAHs at concentrations above AGQS at this location may be attributable to leaching from the industrial waste fill material and ash fill materials

present at the Site. PAHs will bind to organic compounds in the soil, but at elevated concentrations these compounds could leach to the fine sand layer below the fill materials and could be transported down both horizontal and vertical gradients to the deep overburden aquifer in the vicinity of NB-4D. PAH impacts to groundwater at the Site appear to be limited to MW-4D; however, PAH impacts may exist downgradient of this location.

It is also possible that during sample collection cross contamination may have occurred, either by introduction of stray dust particles or some other means, resulting in a false detection. Regardless of validity of the PAH concentrations reported, these concentrations are relatively low in comparison to the standard and additional sampling should be performed to confirm the presence of these exceedances.

Metals

Metals were not present at concentrations exceeding AGQS in any of the samples collected during this TBA investigation. Arsenic was detected in a single sample (NB-5) and barium was detected in all the samples except for the sample collected from CA-MW-3. In 2014, arsenic was detected at a concentration exceeding the AGQS in well CA-MW-2, arsenic was not detected above laboratory detection limits at this location in 2017. All samples were field filtered prior to collection except for the sample collected from the bedrock well BR-1. Results indicate a dissolved metals plume leaching from the industrial waste fill material is not present at the Site and the metals present in the fill do not currently represent a significant risk to groundwater quality at the Site.

6.3 Soil Gas Contamination

VOCs were detected in shallow sub-slab soil gas samples collected at the Site at concentrations exceeding NH Residential Soil Gas Screening Levels. PCE was present in the soil gas sample collected from SG-SM1 at a concentration exceeding NH Residential Soil Gas Screening Level of 400 µg/m^3. TCE was also present in the soil gas sample collected from SG-SM1 at a concentration exceeding the NH Residential Soil Gas Screening Level of 20 µg/m^3. PCE and TCE present in the soil gas at this location is likely due to the presence of PCE and TCE in the soil and groundwater in the vicinity.

Chloroform was present in the soil gas sample collected from SG-SM1 at a concentration below the NH Residential Soil Gas Screening Level. Chloroform can be naturally occurring and the chloroform present in soil gas at the site is likely a combination of natural and anthropogenic sources.

1,2,4-Trimethylbenzene, 1,4-dichlorobenzene, and ethylbenzene were present in all the soil gas samples collected at the site at concentrations below their respective NH Residential Soil Gas Screening Levels. The concentrations reported for each of these analytes was generally uniform across the site. Soil and groundwater sampling at the Site did not indicate the widespread presence of petroleum impacts across the site.

7.0 REMEDIAL RECOMMENDATIONS AND COST ESTIMATE

Nobis identified, evaluated, and selected potential Remedial Action Alternatives (RAAs) to meet the requirements listed in New Hampshire Code of Administrative Rules Chapter Env-Or 600. Four areas are targeted for remedial action. The first area is the industrial waste fill material, several soil samples from the industrial waste fill material exceeded SRS for VOCs, PAHs, and metals. This area was also identified as the likely source of VOC impacts to groundwater at the site. The second area is an area of PAH soil contamination exceeding SRS, located between the former armory and former Stanley Mill buildings. The third area is the groundwater beneath the north and northwestern portion of the site impacted by PCE and its degradation compounds TCE and cis-1,2-dichloroethene at concentrations exceeding AGQS. One sample from location NB-4D reported concentrations of PAHs exceeding AGQS. The fourth area is the identified asbestos containing materials located at the former armory and former Stanley Mill buildings. The ACM was identified as a brownfields cleanup need and is included in this section for completeness of cost estimates.

7.1 Industrial Waste Fill Material

Industrial waste material in the form of hacksaw blades, metal fragments, metal shavings, and other fill material can be observed along the north end of the property down to the edge of the Winnipesaukee River. The industrial waste fill currently functions as the river bank along the property. This waste material contains VOCs, PAHs, and metals at concentrations that exceed NHDES SRS. Additionally, the waste is considered a solid waste potentially subject to NHDES Env-Sw 100-2000. During TBA investigation activities, Nobis observed evidence of bank erosion and the presence of hacksaw blades in the shallows of the river. Previous site investigation sediment sampling results indicated PAHs are present at concentrations exceeding applicable

standards. A possible source of the PAH contamination is the industrial waste fill material along the riverbank; however, given the industrial history of the vicinity, there are other possible sources including upstream sites, stormwater runoff, and atmospheric deposition of ash from nearby sources. Nobis evaluated multiple alternatives to address the industrial waste fill material, as summarized below.

Remedial Alternative #1: AUR with Fence

Alternative #1 evaluated the costs of implementing institutional controls including an AUR, and installation of chain-link fence to deny access to the industrial waste fill materials. Alternative #1 also includes the installation of chain-link fence to restrict access to the area of shallow soil PAH contamination, asbestos warning signage for the former armory and Stanley Mill buildings, and securing both buildings. This alternative also includes periodic inspections of the site, including long-term groundwater monitoring, inspecting fence and buildings for signs of entry, and inspecting the condition of the riverbank. This alternative is included to present a low capital cost "do nothing" remedial alternative. This alternative does not meet future use goals for the site.

The total cost over a 30-year span to implement this alternative is $337,362. Cost details are presented on Table 12. Long-term groundwater monitoring cost details included in this alternative are presented on Table 17.

Remedial Alternative #2: Partial Building Demolition, Riverbank Encapsulation and Stabilization, Fence, AUR

Alternative #2 evaluated implementing riverbank encapsulation and stabilization. This alternative would include an encapsulation and stabilization of the riverbank, AUR, installation of chain-link fence to deny access to the encapsulated industrial waste fill material and the area of shallow soil PAH contamination, asbestos abatement of the former armory and former Stanley Mill, partial demolition of the former armory and former Stanley Mill, and long-term groundwater monitoring. Encapsulation and stabilization of the riverbank would be completed by partial demolition of the former armory and former Stanley Mill after asbestos abatement to access industrial waste fill material beneath portions of both buildings. The extents of the industrial waste fill material and the area of shallow PAH-impacted soil would be covered with a geotextile liner and capped with a minimum of 2 feet of clean soil; 1-foot angular riprap would be installed over a portion of the clean soil cap to armor the riverbank and protect against potential erosion. Nobis estimates an

area of approximately 15,260 square feet would need to be capped and approximately 4,500 square feet would need 1-foot angular riprap installed.

This alternative leaves soil on site with PAH concentrations exceeding RCMP S-3 standards and would require approval from NHDES on a site-specific basis. PAHs detected in the groundwater at MW-4D indicate it is possible PAHs are leaching from the industrial waste fill material. The alternative also does not address the likely source of groundwater VOC impacts and would require long-term groundwater monitoring. This alternative may not meet future use goals for the site, depending on the selected reuse. The total cost over a 30-year span to implement this alternative is $999,789. Inspection, monitoring, and reporting costs are included in this estimate. Permitting for compliance with the Shoreland Water Quality Protection Act (SWQPA) has also been considered. Cost details are presented on Table 13. Long-term groundwater monitoring cost details included in this alternative are presented on Table 17.

Remedial Alternative #3: Partial Building Demolition and Excavation of Industrial Waste Fill Material Area

Alternative #3 evaluated excavating the industrial waste fill material area, and the shallow PAH-impacted soil area. This alternative would include excavation of the industrial waste fill material area, excavation of the PAH-impacted soil areas with off-site disposal and limited on-site management, AUR, asbestos abatement of the former armory and former Stanley Mill, partial demolition of the former armory and former Stanley Mill, restoration and stabilization of the riverbank, and long-term groundwater monitoring. A partial demolition of the former armory and former Stanley Mill after asbestos abatement would occur to access industrial waste fill material beneath portions of both buildings. The extents of the industrial waste fill material would be excavated to the layer of native tan fine sand (generally between 4 and 12 feet bgs). The areas of PAH-impacted soil exceeding RCMP S-3 standards would be excavated down to 1.5 or 3 feet bgs and disposed of off-site, the remaining PAH impacted soil will be managed on-site (backfilled within the industrial waste fill excavation), the excavations will be backfilled with suitable clean fill, and 1-foot angular riprap would be installed to armor the riverbank. Nobis estimates an area of approximately 4,500 square feet would need 1-foot angular riprap installed. The industrial waste fill material area comprises approximately 11,050 square feet and an estimated 3,478 cubic yards (5,218 tons) of soil and solid waste proposed for excavation and disposal (based on assumption of average fill thickness of 8.5 feet across the area). The impacted soil will be disposed of at

approved licensed landfill(s). Due to the excavation proximity to the river and the potential for limited excavation in the river (0 to 2 feet bgs) a 275-linear-foot sheet pile wall may need to be installed during excavation activities to protect the excavation from river flow.

Based on the results of the soil samples collected as part of this TBA and previous investigations, shallow PAH-contaminant impacts outside the extents of the industrial waste fill material appear to be localized to the area between the former armory and Stanley Mill buildings. Results from this TBA and previous investigations indicate PAH impacted soil in this area is present between 0 and 3 feet bgs. The impacted area is assumed to be 3,785 square feet.

Based on the nature of PAHs, limited area of impact, shallow depth of the affected soil, and the objective of achieving reuse of the area, soil excavation has been selected as the presumptive remedial measure. PAH results, specifically naphthalene and benzo[a]pyrene, exceed Method 1 Soil Standards Selection S-3 classification of the Risk Characterization and Management Policy (RCMP) (NHDES, 2013) of 5 mg/kg for both compounds. An approximately 720-square-foot area from the ground surface down to 3 feet bgs will be excavated and an additional approximately 1,055-square-foot area from the ground surface down to 1.5 feet bgs will be excavated. The soil from these two excavations would need to be disposed of off-site due to RMCP S-3 exceedances. Another approximately 2,015-square-foot area of PAH impacted soil from the ground surface down to 1.5 feet bgs will be excavated which currently exceeds RMCP S-1 but not S-3 standards. As these soils are shallow and regarded as readily accessible, they will also be disposed of off-site in accordance with NHDES policy. The excavation areas are defined by PAH results collected during this TBA and previous investigations, an outline of the areas to be excavated is shown on Figure 11.

The impacted soil identified for off-site disposal will be disposed of at approved licensed landfill(s. Nobis has assumed 251 cubic yards (376 tons) of PAH-impacted soils require disposal as non-regulated waste.

Abatement of hazardous building materials (as described in Section 7.2) is estimated to be $210,750. The costs associated with the partial building demolition are $205,000. Costs associated with the engineering design and construction of the sheet pile wall are approximately $155,500, and costs associated with industrial fill soil excavation, transport and disposal and riverbank restoration are approximately $734,504 and assumes excavated material would be

categorized as non-hazardous waste for disposal purposes. Permitting for compliance with the SWQPA has also been considered. Nobis has calculated a cost assuming disposal of identified soil exceeding S-3 standards at an approved landfill facility and management of remaining PAH impacted soil on-site. Total costs associated with PAH soil excavation and management are estimated to be $56,634. Because soil with PAHs will potentially remain on site, an AUR will be required at the site as described in Part Env-Or 608. The expected preparation and legal fees are approximately $5,000 with $3,500 assumed for survey of the restricted area. Long-term groundwater monitoring will still be required with an assumption of a 10-year period for groundwater quality to naturally attenuate. A 20% contingency is applied to the capital costs to cover unanticipated conditions.

The present value costs for this option are estimated to be $1,992,391. Cost details are presented on Table 14 as well as supporting information presented on Tables 15 through 17. This alternative meets the future use goals for the site.

7.2 Asbestos-Containing Materials

Asbestos-containing materials were identified during this TBA and previous site investigations at the former armory and Stanley Mill buildings. Abatement of the identified materials has been selected as the presumptive remedy, to support the future use and redevelopment goals for the site. The costs associated with addressing known asbestos-containing materials during planned renovation or demolition activities at both the former armory and the former Stanley Mill is estimated to be $273,975. The price is estimated conservatively high due to the elevated efforts to remove ACM windows. Given the uncertainty related to the extent of future renovation or demolition activities to site buildings, costs for recycling of ballasts and disposal of lead-based paint materials is not currently known; however, the demolition contractor would develop a cost estimate for these items as part of their work scope. Cost details are presented on Table 16.

7.3 Remedial Cost Estimate and Cost Effectiveness Analysis for Industrial Waste Fill Material Area

Currently no remedial actions are taking place at the site and it is Nobis's understanding that no remedial actions have taken place at the site to date. An AUR, fencing, and signage would at least identify potential risks to site visitors; however, it is unlikely this alternative would be

sustainable for long-term protection of human health and the environment and it renders the Site useless for redevelopment and reuse. For these reasons, this alternative is not recommended.

Encapsulation and stabilization of the riverbank is practical, but not effective at addressing contamination in soil, groundwater, and soil gas at the site. It also may not allow the site to achieve its future use goals. Based on the statements presented above and in Section 7.1, this alternative is not recommended and if implemented should only be used as a temporary alternative.

Source removal can be a very effective remedial action, will likely address a potential source area of groundwater and soil gas contamination, and will allow for the site to meet future use goals, while being the most protective of human health and the environment.

Estimated costs for the three remedial alternatives are summarized in the table below:

Remedial Alternative	Estimated Cost
Alternative #1: AUR, Fencing, Signage	$337,000
Alternative #2: Encapsulation and Stabilization	$1,000,000
Alternative #3: Excavation and Off-Site Disposal	$1,970,000

The three remedial alternatives for addressing the industrial waste fill material area and PAH contaminated soils were ranked in terms of feasibility, effectiveness, risk reduction, treatment time, and cost. Each criterion was scored with 1 being the lowest rank and 4 being the highest.

Remedial Alternative	Feasibility	Effectiveness	Risk Reduction	Treatment Time	Cost	Weighted Score
Weighting	0.2	0.2	0.2	0.2	0.2	
1. Alternative #1: AUR, Fencing, Signage	4	1	1	1	3	2.0
2. Alternative #2: Encapsulation and Stabilization	3	2	2	1	3	2.2
3. Alternative #3: Excavation and Off-Site Disposal	2	4	3	4	2	3.0

Based on these evaluations, the presumptive remedies for asbestos abatement and excavation of PAH-impacted soil, and remedial Alternative 3 for excavation and off-site disposal for the industrial waste fill material area are recommended to achieve the Site remediation goals. The estimated total cost of Alternative #3 remedial actions is $1,908,000.

7.4 EPA Green Remediation

The selected remedy aligns with several of the goals included in the EPA Region 1 Green Remediation Policy (EPA, 2012) including:

- Minimize total energy use and maximize use of renewable energy;
- Minimize air emissions and greenhouse gas generation;
- Minimize water use and impacts to water resources;
- Reduce, reuse, and recycle materials and wastes; and
- Protect and minimize adverse impacts to land and ecosystems.

Energy use, air emissions and greenhouse gas generation can be reduced with the use of biofuel blends in the construction equipment on site and by minimizing the amount of time equipment idles on-site.

Metal waste (saw blades, etc.) within the industrial waste fill materials could possibly be salvaged and recycled.

Impacts to water resources are minimized by removing PCE-contaminated soil, the likely source of PCE and PCE degradation compound contamination in Site groundwater.

Adverse impacts to land and ecosystems are minimized by performing the remedy, as the contamination identified on-site is present in shallow soil and poses a greater risk if left in place. Additionally, the waste materials currently pose a risk to the Winnipesaukee River and associated ecosystem, particularly if a catastrophic erosion event disturbs or dislodges the industrial fill materials into the water body.

The selected remedy will allow for redevelopment of the site, with the potential for green and sustainable development initiatives.

7.5 Impacted Groundwater

The industrial waste fill material in the form of hacksaw blades, metal fragments, metal shavings, and other fill material and the additional point source discharge to the waste fill material has been identified as the most likely source of VOC impacts to the groundwater at the site. The presumptive remedy for the impacted groundwater is the removal of the source material (industrial waste fill material) and long-term monitoring of groundwater with a goal of being protective to potential receptors. Several remedial technologies were considered (in-situ chemical oxidation, in-situ bioremediation, soil vapor extraction, and groundwater pump and treat) however, none of the technologies addressed the source area that exists entirely in the vadose zone. The considered technologies could be applied after the source area is removed if long-term monitoring data indicates a “polishing step” to groundwater remediation is warranted. A NHDES Groundwater Management Permit (GMP) would likely be required. The GMP would establish a Groundwater Management Zone, locations to be sampled, and sampling frequency. The cost to establish a GMP for the site is estimated to be $3,000 and annual monitoring and reporting costs are estimated to be $17,000. This cost estimate carried costs for the installation or replacement of approximately six monitoring wells. Cost details are presented on Table 17.

7.6 Impacted Soil Gas

The industrial waste fill material in the form of hacksaw blades, metal fragments, metal shavings, and other fill material and the additional point source discharge to the waste fill material has been identified as the most likely source of VOC impacts to soil gas identified at the site. The presumptive remedy for the impacted soil gas is the removal of the source material (industrial waste fill material).

It is noted that mitigation of soil gas and vapor intrusion issues associated with reuse of existing Site buildings or construction of new buildings at the Site is not included in these remedial evaluations as the plans for Site reuse are not known in enough detail to accurately estimate costs or methods of implementation; however, some method of addressing indoor air quality will have to be considered in conjunction with future redevelopment planning as a precaution.

If construction of new buildings is planned during future site redevelopment, an evaluation of soil, groundwater, and soil gas conditions in the proposed building footprint may be warranted depending on the nature of use and type of construction. Site conditions may warrant additional remedial actions or installation of a soil gas mitigation system (passive or active) to eliminate potential VOC impacts to indoor air with a goal of being protective to potential receptors.

8.0 CONCLUSIONS AND RECOMMENDATIONS

The following sections present the TBA investigation conclusions, a summary of data gaps, and recommendations.

8.1 TBA Investigation Conclusions

Soil

TBA soil sampling results and historic results indicate naphthalene and PCE are the only two VOCs that have been detected at concentrations exceeding their respective SRS. Detections of naphthalene above the SRS of 5 mg/kg are limited to the samples collected at NB-TP-1 at 3 feet bgs and CA-TP-A3. Naphthalene concentrations at NB-TP-1 are most likely due to the presence of ash fill materials, the sample at NB-TP-1 was collected from a layer of ash fill material, this ash material was also observed at NB-TP-2 but was not sampled at this location. Naphthalene

concentrations at CA-TP-A3 are most likely due to the presence of fill material at this location. Naphthalene was also present in the sample collected from location SG-SM3 performed as part of this TBA at a concentration below the SRS.

Detections of PCE above the SRS were present across the site, but were all within the extents of the industrial waste fill material. Detections of PCE exceeding the SRS include historic data collected from locations CA-TP-1(0-6 feet bgs), CA-TP-2(0-3.5 feet bgs), CA-SB-4/CA-MW-4, and CA-SB-5/CA-MW-5 and from locations NB-2(0.5-2 feet bgs), NB-TP-6(4 feet bgs), and SG-SM1(0.5-2 feet bgs) performed as part of this TBA. PCE was also present in several samples collected from locations performed as part of this TBA and several historic data records at concentrations below the SRS. PCE concentrations in soil are generally limited to the extents of the industrial waste fill along the north end of the property. The source of PCE in this area is likely due to historic uses on-site, specifically from the production of hacksaw blades and from the use of industrial waste materials as fill.

In general, PAHs are present across the Site at concentrations exceeding applicable SRS. Shallow soil (0-2 ft) detections of PAHs exceeding SRS are present within the extents of the industrial waste fill material and within a limited area between the former armory and former Stanley Mill buildings. PAHs at concentrations above SRS were present in the shallow soil within the area between the buildings in the samples collected from locations NB-3, NB-SS-7, and NB-TP-3 performed as part of this TBA and historic data collected from CA-SS-1 and CA-SS-2. Urban fill material, black soil and ash material, was present within 0-2 feet bgs in this area and is likely the source of the PAH contamination at these locations. PAHs were detected in exceedance of SRS in the samples collected from the shallow soil within the industrial fill area at locations (NB-2, NB-5, NB-6, NB-SS-1, NB-SS-2, NB-SS-4, SG-SM2, and SG-SM3) performed as part of this TBA and historic data collected from CA-SB-4/CA-MW-4, CA-TP-1, CA-TP-2, and CA-TP-A3. The source of PAHs in this area is likely from the industrial waste material used as fill in this area. PAH-impacted shallow soil will need to be managed during any redevelopment activities.

PAHs present at concentrations exceeding applicable SRS in the sub-surface (2+ feet bgs) are limited to the extents of the industrial waste fill material, a limited area between the buildings (NP-TP-1), and a location of general urban fill located on the northeast portion of the site (NB-TP-6). PAHs were detected in a sample collected from NB-TP-1 at 3 feet bgs at concentrations exceeding applicable SRS. PAH concentrations at this location are most likely due to the presence of ash fill

materials. The sample at NB-TP-1 was collected from a layer of ash fill material; this ash material was also observed at NB-TP-2 but was not sampled at this location. It is assumed the ash material at this location also contains PAHs at concentrations exceeding applicable SRS. PAHs were detected in a sample collected from NB-TP-6 at 4 feet bgs at concentrations exceeding applicable SRS. A black urban fill material consisting of metal fragments, ash, brick fragments, glass, and other fill debris including assumed graphite anodes was present at this location and is the likely source of the PAH contamination. This soil may need to be managed during any redevelopment activities. Based on the available data, PAH soil contamination at the Site generally appears to be limited to the urban and industrial waste fill materials located above the native soils. The extent of PAH impacted soil in exceedance of SRS to the east of NB-TP-6 is unknown and future investigation may be required to evaluate this data gap.

The presence of metals at concentrations exceeding applicable SRS is limited to the extent of the industrial waste fill material and the area of urban fill materials on the northeast portion of the site. Arsenic was present at concentrations exceeding the SRS in the samples collected from five locations (NB-2, NB-3, NB-6, NB-SS-2, and SG-AR2) performed as part of this TBA and historic data collected from CA-SB-4/CA-MW-4, CA-SB-5/CA-MW-5, CA-SB-6/CA-MW-6, CA-SS-5, CA-SS-9, CA-SS-10, CA-TP-1, CA-TP-3, and CA-TP-3A. Arsenic concentrations exceeding SRS at the site are likely from anthropogenic sources with a minimal amount from natural sources.

Lead was present at concentrations greater than the SRS in the samples collected from four locations (NB-2, NB-5, NB-TP-6, and SG-SM3) performed as part of this TBA and historic data collected from CA-SS-5 and CA-TP-1. Lead is present across the site, however the concentrations of lead exceeding the SRS were all within the extents of the industrial waste fill material. Lead in this area is most likely from anthropogenic sources.

Chromium detections exceeding the SRS were limited to historic data collected from CA-SS-10 (0-2 ft bgs). This sample location is within the industrial waste fill area just below the west end of a retaining wall near the river edge. The chromium detected in this sample is most likely from anthropogenic sources related to the industrial waste fill material. Hexavalent chromium, where analyzed, did not exceed the SRS.

Cadmium detections exceeding the SRS were limited to the sample collected from NB-2 at 29 to 31 feet bgs. The source of cadmium in this sample is unknown. Cadmium was detected in only

seven other samples collected at the site during the current TBA and previous site investigation activities all at concentrations less than 2 mg/kg, far below the SRS of 33 mg/kg.

Groundwater

Concentrations of VOCs in groundwater samples collected during TBA sampling which exceeded applicable AGQS include PCE and the PCE degradation compounds TCE and cis-1,2-dichloroethene. PCE was present in the groundwater samples collected from five locations (CA-MW-5, CA-MW-6, NB-2S, NB-4S, and NB-4D), TCE at five locations (CA-MW-5, CA-MW-6, NB-2D, NB-4D, and BR-1), and cis-1,2-dichloroethene at NB-4D.

The presence of PCE at concentrations above AGQS at these locations is likely due to leaching from the industrial waste fill material as PCE was likely used as a cutting oil and for cleaning metal during production of hacksaw blades at the Site. Additionally, a drain was identified in the northwest basement of the former Stanley Mill building and investigation results suggest the drain is likely a point source for PCE contamination. The highest concentrations of PCE have been present in the groundwater sampled from CA-MW-5 which was installed in close proximity to the drain pipe. The sub-slab soil sample collected at SG-SM1, located directly adjacent to the identified floor drain, contained concentrations of PCE exceeding the SRS.

PCE is a DNAPL and is more dense than water. As discussed in section 3.4, groundwater at the Site flows in a general northwest/west direction with a downward vertical gradient in the overburden aquifer. Spatial distribution of PCE and its degradation compounds is consistent with the current site geologic and hydrogeologic model. Concentrations of PCE degradation compounds increase downgradient in the horizontal and vertical directions.

Results reported from the sample collected at NB-4D and the site hydrogeologic model indicate deep overburden groundwater with concentrations of PCE, TCE, and cis-1,2-dichloroethene exceeding AGQS likely exists downgradient of this location, potentially extending off-site to the adjacent property to the west. The extent of downgradient impacts to overburden groundwater to the west of NB-4D is unknown and represents a data gap that may require future evaluation. TCE was present at concentrations exceeding AGQS in the sample collected from BR-1. BR-1 is an open bedrock borehole with an open interval from 70 feet bgs to 95 feet bgs. The presence of TCE exceeding AGQS at BR-1 is consistent with the current site hydrogeologic model and

indicates the bedrock aquifer downgradient from this location is likely impacted by site contaminants. Identified groundwater impacted by PCE and its degradation compounds is limited to the industrial waste fill area and the areas downgradient discussed above. The extent of downgradient impacts is not known. Removal of the source area (industrial waste fill material) would likely address the majority of the PCE, TCE, and cis-1,2-dichloroethene-impacted groundwater at the site.

PAHs were detected at concentrations exceeding AGQS in the groundwater sample collected from NB-4D and included benzo[a]anthracene and benzo[b]fluoranthene. The sample was field filtered prior to collection. The presence of these PAHs at concentrations above AGQS at this location is likely due to leaching from the industrial waste fill material and ash fill materials present at the site. PAHs will bind to organic compounds in the soil, but at elevated concentrations these compounds could leach to the fine sand layer below the fill materials and could be transported down both horizontal and vertical gradients to the deep overburden aquifer in the vicinity of NB-4D. PAH impacts to groundwater at the site appear to be limited to MW-4D; however, PAH impacts may exist downgradient of this location.

Metals were not present at concentrations exceeding AGQS in any of the samples collected during this TBA investigation. All samples were field filtered prior to collection except for the sample collected from the bedrock well BR-1. Results indicate a dissolved metals plume leaching from the industrial waste fill material is not present at the Site and the metals present in the fill do not represent a significant risk to groundwater quality at the Site.

Soil Gas

VOCs were detected in shallow soil gas samples collected at the Site at concentrations exceeding NH Residential Soil Gas Screening Levels. PCE and TCE concentrations in the sample collected from SG-SM1 exceeded the NH Soil Gas Screening Levels of 400 µg/m^3 and 20 µg/m^3, respectively. The presence of these compounds in the soil gas at is likely due to the presence of PCE and TCE in the groundwater in the vicinity.

Hazardous Building Materials

TBA results and historic results indicate asbestos-containing building materials (ACBM) are present within both the former armory and former Stanley Mill building. ACBM in the former armory

is limited to Transite siding (observed, not sampled), window glazing, 12x12 brown floor tile and mastic, and tan speckled sheet flooring. ACBM in the former Stanley Mill building includes thermal system insulation (pipe wraps and mudded elbows), felt paper (roofing), hard window caulking, boiler gasket, glue daubs, multi-colored sheet flooring, textured Tan/Brown sheet flooring, and black caulking.

TBA results and historic results indicate PCB-containing building materials are present within both the former armory and former Stanley Mill building. PCB-containing materials at the former armory are limited to white and blue paint over cinderblocks present in the bulk sample, at a concentration of 1.5 ppm. PCB-containing materials at the former Stanley Mill include the concrete transformer pad (less than 1 mg/kg), pale green over green paint over brick (less than 1 mg/kg), and light blue over dark blue paint over brick at a concentration of 1.3 ppm.

8.2 Recommendations

Recommendations for remediation, and future site development considerations are provided in the sections below.

Groundwater Monitoring and Reporting

Given the presence of groundwater contamination in exceedance of AGQS, a GMP for the Site should be issued and groundwater monitoring and reporting schedules will be established in the GMP.

Concurrent with Site remediation and redevelopment activities, future groundwater monitoring needs should be evaluated and possible GMP monitoring locations should be reduced as appropriate to the nature and extent of dissolved groundwater contamination identified at the Site.

Remedial Actions

Asbestos-Containing Building Material Remediation

Nobis recommends asbestos abatement of the identified asbestos-containing building materials identified in the former armory and former Stanley Mill as the presumptive remedy to meet future use goals at the site.

PAH Soil Contamination Remediation

Nobis recommends excavation of shallow PAH-impacted soil outside the extents of the industrial waste fill material localized to the area between the former armory and Stanley Mill buildings as the presumptive remedy to address PAH soil contamination exceeding SRS and RCMP S-3. Nobis recommends excavation and disposal of approximately 251 cubic yards (376 tons) of PAH-impacted soils from within an area of approximately 720 square feet from 0 to approximately 3 feet bgs and an area of approximately 3,070 square feet from 0 to approximately 1.5 feet bgs. Coordination with an appropriate approved disposal facility will be required prior to soil excavation implementation to determine facility acceptance needs.

Industrial Waste Fill Material Area Remediation

To address the industrial waste fill material, Nobis recommends selection and implementation of Alternative 3 - excavation and off-site disposal. Based on the evaluation of alternatives, this alternative scored the highest weighted score of 3.0 out of a possible 4.0. This alternative consists of excavation and disposal of approximately 5,506 tons of contaminated soil and solid waste from within an area of approximately 11,660 square feet. Backfill material would consist of suitable clean fill and 1-foot riprap material along the riverbank to stabilize the excavated area from erosion and to protect the restored riverbank from weather events. Nobis recommends long-term groundwater monitoring to monitor the performance of the selected alternative.

Future Site Development Considerations

Due to the current groundwater quality at the Site and the results of sub-slab soil gas sampling, construction of new buildings planned for future Site redevelopment may warrant installation of a soil gas mitigation system (passive or active) to eliminate potential VOC impacts to indoor air. Plans for new buildings should consider groundwater quality within the vicinity of proposed construction.

Nobis assumes that some PAH-contaminated soils will remain at the site and implementation of an AUR will be required. The AUR for the site should define soil management requirements and limitation for high-risk uses (i.e. situations where children are expected to be present with high intensity/high frequency). Future redevelopment considerations should take into account the presence of residual contamination. Given the widespread presence of low-level PAHs in soil

throughout the Site, redevelopment planning should consider the incorporation of clean cover material and a separation barrier to prevent future exposure to contaminants.

Proposed redevelopment should consider the location and nature of remedial elements of the industrial waste fill material area. Redevelopment scenarios should incorporate design requirements such as stormwater controls and other infrastructure such that the performance of the remedial measure selected is not adversely impacted.

9.0 REFERENCES

Credere Associates, LLC. 2014. Phase I Environment Site Assessment, Ferrari Realty Trust Property, 93-119 Memorial Street, Franklin, NH. August.

Credere Associates, LLC. 2015. Phase II Environment Site Assessment, Ferrari Realty Trust Property, 93-119 Memorial Street, Franklin, NH. June.

NHDES. 2013a. Chapter Env-Or 400 of the New Hampshire Code of Administrative Rules: Underground Storage Tank Facilities, September.

NHDES. 2013b. Risk Characterization and Management Policy, February.

NHDES. 2016. Chapter Env-Or 600 of the New Hampshire Code of Administrative Rules: Contaminated Site Management, October.

Nobis, 2017. Field Task Work Plan and Quality Assurance Project Plan, Addendum Targeted Brownfields Assessment, Ferrari Mill Site, March.

United States Environmental Protection Agency (EPA), 2016. “EPA New England Environmental Data Review Supplement for Regional Data Review Elements and Superfund Specific Guidance/Procedures”, April.

United States Environmental Protection Agency (EPA), 2014a. “USEPA National Functional Guidelines for Superfund Organic Methods Data Review”, August.

United States Environmental Protection Agency (EPA), 2014b. “USEPA National Functional Guidelines for Inorganic Superfund Data Review”, August.

United States Environmental Protection Agency (EPA), 2016. “Targeted Brownfields Assessment Statement of SOW, Task Order 108-SIBZ-0100, Brownfield Multi Site, July”.

United States Environmental Protection Agency (EPA), 2012. “Clean and Greener Policy for Contaminated Sites EPA Region 1 Office of Site Remediation and Restoration, February”.

TABLES

Table 1
Summary of Soil Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		NH Soil Remediation Standards (SRS)	Trip Blank	SG-AR2	SG-AR1	SG-SM1	SG-SM2	SG-SM3	Trip Blank	NB-1 0.3-2' S-1	NB-1 14-15' S-8	NB-1 39-39.5' S-13	NB-2 S-1 0.5-2'	NB-2 S-7 12-13'	NB-2 S-11 29-31'
LAB ID:			39842-001	39842-002	39842-003	39842-004	39842-005	39842-006	40029-001	40029-002	40029-003	40029-004	40029-005	40029-006	40029-007
Matrix:			soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil
Sample Depth (feet bgs):			NA	2	2	2	2	2	NA	0.3 - 2	14 - 15	39 - 39.5	0.5 - 2	12 - 13	29 - 31
Date Sampled:	Units		4/12/2017	4/12/2017	4/12/2017	4/13/2017	4/13/2017	4/13/2017	4/21/2017	4/21/2017	4/21/2017	4/21/2017	4/25/2017	4/25/2017	4/25/2017
Volatile Organic Compounds (VOCs)															
1,1,1,2-Tetrachloroethane	mg/kg	0.8	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
1,1,1-Trichloroethane	mg/kg	78	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
1,1,2,2-Tetrachloroethane	mg/kg	4	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
1,1,2-Trichloroethane	mg/kg	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,1-Dichloroethane	mg/kg	3	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
1,1-Dichloroethene	mg/kg	14	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
1,1-Dichloropropene	mg/kg	NE	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
1,2,3-Trichlorobenzene	mg/kg	NE	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
1,2,3-Trichloropropane	mg/kg	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
1,2,4-Trichlorobenzene	mg/kg	19	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,2,4-Trimethylbenzene	mg/kg	130	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,2-Dibromo-3-chloropropane	mg/kg	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,2-Dibromoethane(EDB)	mg/kg	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,2-Dichlorobenzene	mg/kg	88	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,2-Dichloroethane	mg/kg	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
1,2-Dichloropropane	mg/kg	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
1,3,5-Trichlorobenzene	mg/kg	NE	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,3,5-Trimethylbenzene	mg/kg	96	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,3-Dichlorobenzene	mg/kg	150	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,3-Dichloropropane	mg/kg	NE	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,4-Dichlorobenzene	mg/kg	7	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,4-Dioxane	mg/kg	5	<2	<2	<2	<2	<3	<3	<2	<3	<2	<2	<3	< 2 J	< 2
2,2-Dichloropropane	mg/kg	NE	< 0.1 R	< 0.1 R	< 0.1 R	< 0.1 R	< 0.1 R	< 0.1 R	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
2-Butanone(MEK)	mg/kg	51	< 0.3	< 0.2	< 0.3	< 0.3	< 0.3	< 0.3	< 0.3	< 0.4	< 0.3	< 0.3	< 0.4	< 0.3 J	< 0.3
2-Chlorotoluene	mg/kg	15	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
2-Hexanone	mg/kg	NE	< 0.5	< 0.4	< 0.4	< 0.5	< 0.5	< 0.5	< 0.5	< 0.6	< 0.5	< 0.5	< 0.6	< 0.5 J	< 0.5
4-Chlorotoluene	mg/kg	680	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
4-Isopropyltoluene	mg/kg	NE	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
4-Methyl-2-pentanone(MIBK)	mg/kg	29	< 0.4	< 0.4	< 0.4	< 0.4	< 0.5	< 0.5	< 0.4	< 0.6	< 0.4	< 0.4	< 0.5	< 0.4 J	< 0.4
Acetone	mg/kg	75	< 2	< 2	< 2	< 2	< 3	< 3	< 2	< 3	< 2	< 2	< 3	< 2	< 2

Table 1
Summary of Soil Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		NH Soil Remediation Standards (SRS)	Trip Blank	SG-AR2	SG-AR1	SG-SM1	SG-SM2	SG-SM3	Trip Blank	NB-1 0.3-2' S-1	NB-1 14-15' S-8	NB-1 39-39.5' S-13	NB-2 S-1 0.5-2'	NB-2 S-7 12-13'	NB-2 S-11 29-31'
LAB ID:			39842-001	39842-002	39842-003	39842-004	39842-005	39842-006	40029-001	40029-002	40029-003	40029-004	40029-005	40029-006	40029-007
Matrix:			soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil
Sample Depth (feet bgs):			NA	2	2	2	2	2	NA	0.3 - 2	14 - 15	39 - 39.5	0.5 - 2	12 - 13	29 - 31
Date Sampled:	Units		4/12/2017	4/12/2017	4/12/2017	4/13/2017	4/13/2017	4/13/2017	4/21/2017	4/21/2017	4/21/2017	4/21/2017	4/25/2017	4/25/2017	4/25/2017
Benzene	mg/kg	0.3	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
Bromobenzene	mg/kg	NE	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Bromochloromethane	mg/kg	NE	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Bromodichloromethane	mg/kg	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
Bromoform	mg/kg	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
Bromomethane	mg/kg	0.3	< 0.2	< 0.2	< 0.2	< 0.2	< 0.3	< 0.3	< 0.2	< 0.3	< 0.2	< 0.2	< 0.3	< 0.2	< 0.2
Carbon disulfide	mg/kg	460	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
Carbon tetrachloride	mg/kg	12	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
Chlorobenzene	mg/kg	6	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Chloroethane	mg/kg	NE	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Chloroform	mg/kg	3	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
Chloromethane	mg/kg	3	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
cis-1,2-Dichloroethene	mg/kg	2	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
cis-1,3-Dichloropropene	mg/kg	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
Dibromochloromethane	mg/kg	1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
Dibromomethane	mg/kg	NE	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
Dichlorodifluoromethane	mg/kg	1000	< 0.1 R	< 0.1 R	< 0.1 R	< 0.1 R	< 0.1 R	< 0.1 R	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
Diethyl Ether	mg/kg	3900	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Ethyl t-butyl ether (ETBE)	mg/kg	0.7	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
Ethylbenzene	mg/kg	120	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Hexachlorobutadiene	mg/kg	17	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Isopropylbenzene	mg/kg	330	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Isopropyl ether (DIPE)	mg/kg	10	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
m,p-Xylene	mg/kg	500	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Methyl-t-butyl ether(MTBE)	mg/kg	0.2	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Methylene chloride	mg/kg	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
Naphthalene	mg/kg	5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	**0.6**	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
n-Butylbenzene	mg/kg	110	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
n-Propylbenzene	mg/kg	85	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
o-Xylene	mg/kg	500	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1

Table 1
Summary of Soil Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		**NH Soil Remediation Standards (SRS)**	**Trip Blank**	**SG-AR2**	**SG-AR1**	**SG-SM1**	**SG-SM2**	**SG-SM3**	**Trip Blank**	**NB-1 0.3-2' S-1**	**NB-1 14-15' S-8**	**NB-1 39-39.5' S-13**	**NB-2 S-1 0.5-2'**	**NB-2 S-7 12-13'**	**NB-2 S-11 29-31'**
LAB ID:			**39842-001**	**39842-002**	**39842-003**	**39842-004**	**39842-005**	**39842-006**	**40029-001**	**40029-002**	**40029-003**	**40029-004**	**40029-005**	**40029-006**	**40029-007**
Matrix:			**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**
Sample Depth (feet bgs):			**NA**	**2**	**2**	**2**	**2**	**2**	**NA**	**0.3 - 2**	**14 - 15**	**39 - 39.5**	**0.5 - 2**	**12 - 13**	**29 - 31**
Date Sampled:	**Units**		**4/12/2017**	**4/12/2017**	**4/12/2017**	**4/13/2017**	**4/13/2017**	**4/13/2017**	**4/21/2017**	**4/21/2017**	**4/21/2017**	**4/21/2017**	**4/25/2017**	**4/25/2017**	**4/25/2017**
sec-Butylbenzene	mg/kg	130	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Styrene	mg/kg	17	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
tert-amyl-methyl ether (TAME)	mg/kg	3	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
t-Butanol (TBA)	mg/kg	2	< 2	< 2	< 2	< 2	< 3	< 2	< 2	< 3	< 2	< 2	< 3	< 2 J	< 2
tert-Butylbenzene	mg/kg	100	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
Tetrachloroethene	mg/kg	2	< 0.1	**0.2**	< 0.1	**2.8**	**0.2**	**0.2**	< 0.1	**0.6**	< 0.1	< 0.1	**5.4**	< 0.1	< 0.1
Tetrahydrofuran(THF)	mg/kg	NE	< 0.5	< 0.4	< 0.4	< 0.5	< 0.5	< 0.5	< 0.5	< 0.6	< 0.5	< 0.5	< 0.6	< 0.5 J	< 0.5
Toluene	mg/kg	100	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	**0.1**	< 0.1 J	< 0.1
trans-1,2-Dichloroethene	mg/kg	9	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
trans-1,3-Dichloropropene	mg/kg	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
Trichloroethene	mg/kg	0.8	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
Trichlorofluoromethane	mg/kg	1000	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1
Vinyl chloride	mg/kg	1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1 J	< 0.1

Notes:
< - not detected at the reporting limit
J - estimated value
NT - not tested
Italic Underlined = Reporting Limit exceeds action limit.
BOLD=detection
BOLD SHADED=detection exceeds action limit.

Table 1
Summary of Soil Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		NH Soil Remediation Standards (SRS)	NB-3 S-1 0.3-2'	NB-3 S-8 14-15'	NB-3 S-10 24-26'	Trip Blank	NB-6 S-1 0.3-2'	FD-1 (NB-6 S-1 0.3-2')	NB-6 S-7 12-13'	NB-6 S-12 34-36'	Trip Blank	NB-4 S-1 0.3-2'	NB-4 S-3 5-6'	NB-4 S-8 24-26'
LAB ID:			40029-008	40029-009	40029-010	40096-001	40096-002	40096-003	40096-004	40096-005	40097-001	40097-002	40097-003	40097-004
Matrix:			soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil
Sample Depth (feet bgs):			0.3 - 2	14 - 15	24 - 26	NA	0.3 - 2	0.3 - 2	12 - 13	34 - 36	NA	0.3 - 2	5 - 6	24 - 26
Date Sampled:	Units		4/26/2017	4/26/2017	4/26/2017	5/1/2017	5/1/2017	5/1/2017	5/1/2017	5/1/2017	4/27/2017	4/27/2017	4/27/2017	4/27/2017
Volatile Organic Compounds (VOCs)														
1,1,1,2-Tetrachloroethane	mg/kg	0.8	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,1,1-Trichloroethane	mg/kg	78	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,1,2,2-Tetrachloroethane	mg/kg	4	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,1,2-Trichloroethane	mg/kg	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,1-Dichloroethane	mg/kg	3	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,1-Dichloroethene	mg/kg	14	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,1-Dichloropropene	mg/kg	NE	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,2,3-Trichlorobenzene	mg/kg	NE	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,2,3-Trichloropropane	mg/kg	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,2,4-Trichlorobenzene	mg/kg	19	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,2,4-Trimethylbenzene	mg/kg	130	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,2-Dibromo-3-chloropropane	mg/kg	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,2-Dibromoethane(EDB)	mg/kg	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,2-Dichlorobenzene	mg/kg	88	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,2-Dichloroethane	mg/kg	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,2-Dichloropropane	mg/kg	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,3,5-Trichlorobenzene	mg/kg	NE	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,3,5-Trimethylbenzene	mg/kg	96	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,3-Dichlorobenzene	mg/kg	150	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,3-Dichloropropane	mg/kg	NE	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,4-Dichlorobenzene	mg/kg	7	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
1,4-Dioxane	mg/kg	5	< 3	< 3	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
2,2-Dichloropropane	mg/kg	NE	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
2-Butanone(MEK)	mg/kg	51	< 0.4	< 0.3	< 0.3	< 0.3	< 0.3	< 0.2	< 0.3	< 0.2	< 0.3	< 0.3	< 0.3	< 0.2
2-Chlorotoluene	mg/kg	15	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
2-Hexanone	mg/kg	NE	< 0.7	< 0.5	< 0.4	< 0.5	< 0.4	< 0.4	< 0.5	< 0.4	< 0.5	< 0.5	< 0.5	< 0.4
4-Chlorotoluene	mg/kg	680	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
4-Isopropyltoluene	mg/kg	NE	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
4-Methyl-2-pentanone(MIBK)	mg/kg	29	< 0.6	< 0.5	< 0.4	< 0.4	< 0.4	< 0.3	< 0.4	< 0.3	< 0.4	< 0.4	< 0.4	< 0.4
Acetone	mg/kg	75	< 3	< 3	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2

Table 1
Summary of Soil Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		NH Soil Remediation Standards (SRS)	NB-3 S-1 0.3-2'	NB-3 S-8 14-15'	NB-3 S-10 24-26'	Trip Blank	NB-6 S-1 0.3-2'	FD-1 (NB-6 S-1 0.3-2')	NB-6 S-7 12-13'	NB-6 S-12 34-36'	Trip Blank	NB-4 S-1 0.3-2'	NB-4 S-3 5-6'	NB-4 S-8 24-26'
LAB ID:			40029-008	40029-009	40029-010	40096-001	40096-002	40096-003	40096-004	40096-005	40097-001	40097-002	40097-003	40097-004
Matrix:			soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil
Sample Depth (feet bgs):			0.3 - 2	14 - 15	24 - 26	NA	0.3 - 2	0.3 - 2	12 - 13	34 - 36	NA	0.3 - 2	5 - 6	24 - 26
Date Sampled:	Units		4/26/2017	4/26/2017	4/26/2017	5/1/2017	5/1/2017	5/1/2017	5/1/2017	5/1/2017	4/27/2017	4/27/2017	4/27/2017	4/27/2017
Benzene	mg/kg	0.3	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Bromobenzene	mg/kg	NE	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Bromochloromethane	mg/kg	NE	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Bromodichloromethane	mg/kg	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Bromoform	mg/kg	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Bromomethane	mg/kg	0.3	< 0.3	< 0.3	< 0.2	< 0.2	< 0.2	< 0.2	< 0.2	< 0.2	< 0.2	< 0.2	< 0.2	< 0.2
Carbon disulfide	mg/kg	460	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Carbon tetrachloride	mg/kg	12	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Chlorobenzene	mg/kg	6	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Chloroethane	mg/kg	NE	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Chloroform	mg/kg	3	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Chloromethane	mg/kg	3	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
cis-1,2-Dichloroethene	mg/kg	2	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
cis-1,3-Dichloropropene	mg/kg	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Dibromochloromethane	mg/kg	1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Dibromomethane	mg/kg	NE	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Dichlorodifluoromethane	mg/kg	1000	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Diethyl Ether	mg/kg	3900	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Ethyl t-butyl ether (ETBE)	mg/kg	0.7	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Ethylbenzene	mg/kg	120	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Hexachlorobutadiene	mg/kg	17	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Isopropylbenzene	mg/kg	330	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Isopropyl ether (DIPE)	mg/kg	10	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
m,p-Xylene	mg/kg	500	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Methyl-t-butyl ether(MTBE)	mg/kg	0.2	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Methylene chloride	mg/kg	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Naphthalene	mg/kg	5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
n-Butylbenzene	mg/kg	110	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
n-Propylbenzene	mg/kg	85	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
o-Xylene	mg/kg	500	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1

Table 1
Summary of Soil Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		NH Soil Remediation Standards (SRS)	NB-3 S-1 0.3-2'	NB-3 S-8 14-15'	NB-3 S-10 24-26'	Trip Blank	NB-6 S-1 0.3-2'	FD-1 (NB-6 S-1 0.3-2')	NB-6 S-7 12-13'	NB-6 S-12 34-36'	Trip Blank	NB-4 S-1 0.3-2'	NB-4 S-3 5-6'	NB-4 S-8 24-26'
LAB ID:			40029-008	40029-009	40029-010	40096-001	40096-002	40096-003	40096-004	40096-005	40097-001	40097-002	40097-003	40097-004
Matrix:			soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil
Sample Depth (feet bgs):			0.3 - 2	14 - 15	24 - 26	NA	0.3 - 2	0.3 - 2	12 - 13	34 - 36	NA	0.3 - 2	5 - 6	24 - 26
Date Sampled:	**Units**		4/26/2017	4/26/2017	4/26/2017	5/1/2017	5/1/2017	5/1/2017	5/1/2017	5/1/2017	4/27/2017	4/27/2017	4/27/2017	4/27/2017
sec-Butylbenzene	mg/kg	130	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Styrene	mg/kg	17	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
tert-amyl-methyl ether (TAME)	mg/kg	3	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
t-Butanol (TBA)	mg/kg	2	< 3	< 3	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
tert-Butylbenzene	mg/kg	100	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Tetrachloroethene	mg/kg	2	0.3	< 0.1	< 0.1	< 0.1	**1.5**	**1.6**	**0.4**	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Tetrahydrofuran(THF)	mg/kg	NE	< 0.7	< 0.5	< 0.4	< 0.5	< 0.4	< 0.4	< 0.5	< 0.4	< 0.5	< 0.5	< 0.5	< 0.4
Toluene	mg/kg	100	1.4	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
trans-1,2-Dichloroethene	mg/kg	9	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
trans-1,3-Dichloropropene	mg/kg	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Trichloroethene	mg/kg	0.8	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Trichlorofluoromethane	mg/kg	1000	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Vinyl chloride	mg/kg	1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1

Notes:
< - not detected at the reporting limit
J - estimated value
NT - not tested
Italic Underlined = Reporting Limit exceeds action limit.
BOLD=detection
BOLD SHADED=detection exceeds action limit.

Sample ID:		NH Soil Remediation Standards (SRS)	NB-5 0.3-2'	NB-5 8-10'	NB-5 24-26	Trip Blank	NB-TP-1 3'	NB-TP-2 5'	NB-TP-3 1'	NB-TP-4 1.5'	NB-TP-5 4'	NB-TP-6 4'	UST Bottom	UST Sides/Ends	Trip Blank	NB-SS-1	NB-SS-2
LAB ID:			40097-005	40097-006	40097-007	40327-001	40327-002	40327-003	40327-004	40327-005	40327-006	40327-007	40327-008	40327-009	40595-001	40595-002	40595-003
Matrix:			soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil
Sample Depth (feet bgs):			0.3 - 2	8 - 10	24 - 26	NA	3	5	1	1.5	4	4	NA	NA	NA	1	1.5
Date Sampled:	Units		4/28/2017	4/28/2017	4/28/2017	5/17/2017	5/17/2017	5/17/2017	5/17/2017	5/17/2017	5/17/2017	5/17/2017	5/18/2017	5/18/2017	6/7/2017	6/7/2017	6/7/2017
Volatile Organic Compounds (VOCs)																	
1,1,1,2-Tetrachloroethane	mg/kg	0.8	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
1,1,1-Trichloroethane	mg/kg	78	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
1,1,2,2-Tetrachloroethane	mg/kg	4	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
1,1,2-Trichloroethane	mg/kg	0.1	*< 0.2*	< 0.1	< 0.1	< 0.1	*< 0.5*	< 0.1	< 0.1	< 0.1	< 0.1	*< 0.2*	*< 0.2*	< 0.1	< 0.1	< 0.2	< 0.1
1,1-Dichloroethane	mg/kg	3	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
1,1-Dichloroethene	mg/kg	14	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
1,1-Dichloropropene	mg/kg	NE	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
1,2,3-Trichlorobenzene	mg/kg	NE	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
1,2,3-Trichloropropane	mg/kg	0.1	*< 0.2*	< 0.1	< 0.1	< 0.1	*< 0.5*	< 0.1	< 0.1	< 0.1	< 0.1	*< 0.2*	*< 0.2*	< 0.1	< 0.1	< 0.2	< 0.1
1,2,4-Trichlorobenzene	mg/kg	19	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
1,2,4-Trimethylbenzene	mg/kg	130	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
1,2-Dibromo-3-chloropropane	mg/kg	0.1	*< 0.2*	< 0.1	< 0.1	< 0.1	*< 0.5*	< 0.1	< 0.1	< 0.1	< 0.1	*< 0.2*	*< 0.2*	< 0.1	< 0.1	< 0.2	< 0.1
1,2-Dibromoethane(EDB)	mg/kg	0.1	*< 0.2*	< 0.1	< 0.1	< 0.1	*< 0.5*	< 0.1	< 0.1	< 0.1	< 0.1	*< 0.2*	*< 0.2*	< 0.1	< 0.1	< 0.2	< 0.1
1,2-Dichlorobenzene	mg/kg	88	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
1,2-Dichloroethane	mg/kg	0.1	*< 0.2*	< 0.1	< 0.1	< 0.1	*< 0.5*	< 0.1	< 0.1	< 0.1	< 0.1	*< 0.2*	*< 0.2*	< 0.1	< 0.1	< 0.2	< 0.1
1,2-Dichloropropane	mg/kg	0.1	*< 0.2*	< 0.1	< 0.1	< 0.1	*< 0.5*	< 0.1	< 0.1	< 0.1	< 0.1	*< 0.2*	*< 0.2*	< 0.1	< 0.1	< 0.2	< 0.1
1,3,5-Trichlorobenzene	mg/kg	NE	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
1,3,5-Trimethylbenzene	mg/kg	96	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
1,3-Dichlorobenzene	mg/kg	150	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
1,3-Dichloropropane	mg/kg	NE	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
1,4-Dichlorobenzene	mg/kg	7	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
1,4-Dioxane	mg/kg	5	< 4	< 2	< 3	< 2	< 13	< 3	< 3	< 3	< 3	< 5	< 4	< 3	< 2	< 4	< 4
2,2-Dichloropropane	mg/kg	NE	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
2-Butanone(MEK)	mg/kg	51	< 0.5	< 0.3	< 0.3	< 0.3	< 1.6	< 0.3	< 0.3	< 0.4	< 0.4	< 0.6	< 0.5	< 0.3	< 0.3	< 0.5	< 0.4
2-Chlorotoluene	mg/kg	15	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
2-Hexanone	mg/kg	NE	< 0.8	< 0.5	< 0.5	< 0.5	< 2.6	< 0.5	< 0.6	< 0.6	< 0.6	< 1.0	< 0.8	< 0.5	< 0.5	< 0.8	< 0.7
4-Chlorotoluene	mg/kg	680	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
4-Isopropyltoluene	mg/kg	NE	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
4-Methyl-2-pentanone(MIBK)	mg/kg	29	< 0.7	< 0.4	< 0.5	< 0.4	< 2.4	< 0.5	< 0.5	< 0.6	< 0.6	< 0.9	< 0.7	< 0.5	< 0.4	< 0.7	< 0.6
Acetone	mg/kg	75	< 4	< 2	< 3	< 2	< 13	< 3	< 3	< 3	< 3	< 5	< 4	< 3	< 2	< 4	< 4

Table 1
Summary of Soil Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		NH Soil Remediation Standards (SRS)	NB-5 0.3-2'	NB-5 8-10'	NB-5 24-26	Trip Blank	NB-TP-1 3'	NB-TP-2 5'	NB-TP-3 1'	NB-TP-4 1.5'	NB-TP-5 4'	NB-TP-6 4'	UST Bottom	UST Sides/Ends	Trip Blank	NB-SS-1	NB-SS-2
LAB ID:			40097-005	40097-006	40097-007	40327-001	40327-002	40327-003	40327-004	40327-005	40327-006	40327-007	40327-008	40327-009	40595-001	40595-002	40595-003
Matrix:			soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil
Sample Depth (feet bgs):			0.3 - 2	8 - 10	24 - 26	NA	3	5	1	1.5	4	4	NA	NA	NA	1	1.5
Date Sampled:	Units		4/28/2017	4/28/2017	4/28/2017	5/17/2017	5/17/2017	5/17/2017	5/17/2017	5/17/2017	5/17/2017	5/17/2017	5/18/2017	5/18/2017	6/7/2017	6/7/2017	6/7/2017
Benzene	mg/kg	0.3	< 0.2	< 0.1	< 0.1	< 0.1	*< 0.5*	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
Bromobenzene	mg/kg	NE	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
Bromochloromethane	mg/kg	NE	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
Bromodichloromethane	mg/kg	0.1	*< 0.2*	< 0.1	< 0.1	< 0.1	*< 0.5*	< 0.1	< 0.1	< 0.1	< 0.1	*< 0.2*	*< 0.2*	< 0.1	< 0.1	< 0.2	< 0.1
Bromoform	mg/kg	0.1	*< 0.2*	< 0.1	< 0.1	< 0.1	*< 0.5*	< 0.1	< 0.1	< 0.1	< 0.1	*< 0.2*	*< 0.2*	< 0.1	< 0.1	< 0.2	< 0.1
Bromomethane	mg/kg	0.3	< 0.4	< 0.2	< 0.3	< 0.2	*< 1.3*	< 0.3	< 0.3	< 0.3	< 0.3	< 0.5	< 0.4	< 0.3	< 0.2 R	< 0.4 R	< 0.4 R
Carbon disulfide	mg/kg	460	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
Carbon tetrachloride	mg/kg	12	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
Chlorobenzene	mg/kg	6	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
Chloroethane	mg/kg	NE	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
Chloroform	mg/kg	3	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
Chloromethane	mg/kg	3	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1 R	< 0.2 R	< 0.1 R
cis-1,2-Dichloroethene	mg/kg	2	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
cis-1,3-Dichloropropene	mg/kg	0.1	*< 0.2*	< 0.1	< 0.1	< 0.1	*< 0.5*	< 0.1	< 0.1	< 0.1	< 0.1	*< 0.2*	*< 0.2*	< 0.1	< 0.1	< 0.2	< 0.1
Dibromochloromethane	mg/kg	1	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
Dibromomethane	mg/kg	NE	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
Dichlorodifluoromethane	mg/kg	1000	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
Diethyl Ether	mg/kg	3900	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
Ethyl t-butyl ether (ETBE)	mg/kg	0.7	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
Ethylbenzene	mg/kg	120	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
Hexachlorobutadiene	mg/kg	17	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
Isopropylbenzene	mg/kg	330	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
Isopropyl ether (DIPE)	mg/kg	10	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
m,p-Xylene	mg/kg	500	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
Methyl-t-butyl ether(MTBE)	mg/kg	0.2	< 0.2	< 0.1	< 0.1	< 0.1	*< 0.5*	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
Methylene chloride	mg/kg	0.1	*< 0.2*	< 0.1	< 0.1	< 0.1	*< 0.5*	< 0.1	< 0.1	< 0.1	< 0.1	*< 0.2*	*< 0.2*	< 0.1	< 0.1	< 0.2	< 0.1
Naphthalene	mg/kg	5	< 0.2	< 0.1	< 0.1	< 0.1	**26**	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
n-Butylbenzene	mg/kg	110	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
n-Propylbenzene	mg/kg	85	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
o-Xylene	mg/kg	500	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1

Table 1
Summary of Soil Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		**NH Soil Remediation Standards (SRS)**	**NB-5 0.3-2'**	**NB-5 8-10'**	**NB-5 24-26**	**Trip Blank**	**NB-TP-1 3'**	**NB-TP-2 5'**	**NB-TP-3 1'**	**NB-TP-4 1.5'**	**NB-TP-5 4'**	**NB-TP-6 4'**	**UST Bottom**	**UST Sides/Ends**	**Trip Blank**	**NB-SS-1**	**NB-SS-2**
LAB ID:			**40097-005**	**40097-006**	**40097-007**	**40327-001**	**40327-002**	**40327-003**	**40327-004**	**40327-005**	**40327-006**	**40327-007**	**40327-008**	**40327-009**	**40595-001**	**40595-002**	**40595-003**
Matrix:			**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**
Sample Depth (feet bgs):			**0.3 - 2**	**8 - 10**	**24 - 26**	**NA**	**3**	**5**	**1**	**1.5**	**4**	**4**	**NA**	**NA**	**NA**	**1**	**1.5**
Date Sampled:	**Units**		**4/28/2017**	**4/28/2017**	**4/28/2017**	**5/17/2017**	**5/17/2017**	**5/17/2017**	**5/17/2017**	**5/17/2017**	**5/17/2017**	**5/17/2017**	**5/18/2017**	**5/18/2017**	**6/7/2017**	**6/7/2017**	**6/7/2017**
sec-Butylbenzene	mg/kg	130	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
Styrene	mg/kg	17	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
tert-amyl-methyl ether (TAME)	mg/kg	3	< 0.2	< 0.1	< 0.1	< 0.1	*< 0.5*	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
t-Butanol (TBA)	mg/kg	2	< 4	< 2	< 3	< 2	*< 13*	< 3	< 3	< 3	< 3	< 5	< 4	< 3	< 2	< 4	< 4
tert-Butylbenzene	mg/kg	100	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
Tetrachloroethene	mg/kg	2	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	**4.1**	< 0.2	< 0.1	< 0.1	< 0.2	**0.5**
Tetrahydrofuran(THF)	mg/kg	NE	< 0.8	< 0.5	< 0.5	< 0.5	< 2.6	< 0.5	< 0.6	< 0.6	< 0.6	< 1.0	< 0.8	< 0.5	< 0.5	< 0.8	< 0.7
Toluene	mg/kg	100	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
trans-1,2-Dichloroethene	mg/kg	9	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
trans-1,3-Dichloropropene	mg/kg	0.1	*< 0.2*	< 0.1	< 0.1	< 0.1	*< 0.5*	< 0.1	< 0.1	< 0.1	< 0.1	*< 0.2*	*< 0.2*	< 0.1	< 0.1	< 0.2	< 0.1
Trichloroethene	mg/kg	0.8	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
Trichlorofluoromethane	mg/kg	1000	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1
Vinyl chloride	mg/kg	1	< 0.2	< 0.1	< 0.1	< 0.1	< 0.5	< 0.1	< 0.1	< 0.1	< 0.1	< 0.2	< 0.2	< 0.1	< 0.1	< 0.2	< 0.1

Notes:
< - not detected at the reporting limit
J - estimated value
NT - not tested
Italic Underlined = Reporting Limit exceeds action limit.
BOLD=detection
BOLD SHADED=detection exceeds action limit.

Sample ID:		NH Soil Remediation Standards (SRS)	NB-SS-3	NB-SS-4	NB-SS-5	NB-SS-6	NB-SS-7	NB-SS-8	NB-SS-9	NB-SS-10	NB-SS-FD (NB-SS-2)	CA-SB-1	CA-SB-2	CA-SB-2	CA-SB-3	CA-SB-4	CA-SB-4	CA-SB-4
LAB ID:			**40595-004**	**40595-005**	**40595-006**	**40595-007**	**40595-008**	**40595-009**	**40595-010**	**40595-011**	**40595-014**							
Matrix:			**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**
Sample Depth (feet bgs):			**1.5**	**NA**	**1-1.5**	**1.5**	**1**	**1.3**	**1.2**	**1.3**	**1.5**	**0-2**	**0-2**	**15-17**	**16-18**	**0-7**	**0-7**	**7-9**
Date Sampled:	**Units**		**6/7/2017**	**6/7/2017**	**6/7/2017**	**6/7/2017**	**6/7/2017**	**6/7/2017**	**6/7/2017**	**6/7/2017**	**6/7/2017**	**10/27/2014**	**10/30/2014**	**10/30/2014**	**10/30/2014**	**10/30/2014**	**DUP-1**	**10/30/2014**
Volatile Organic Compounds (VOCs)																		
1,1,1,2-Tetrachloroethane	mg/kg	0.8	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
1,1,1-Trichloroethane	mg/kg	78	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
1,1,2,2-Tetrachloroethane	mg/kg	4	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
1,1,2-Trichloroethane	mg/kg	0.1	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
1,1-Dichloroethane	mg/kg	3	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
1,1-Dichloroethene	mg/kg	14	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
1,1-Dichloropropene	mg/kg	NE	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
1,2,3-Trichlorobenzene	mg/kg	NE	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
1,2,3-Trichloropropane	mg/kg	0.1	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
1,2,4-Trichlorobenzene	mg/kg	19	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
1,2,4-Trimethylbenzene	mg/kg	130	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	**0.4**	**0.2**	ND
1,2-Dibromo-3-chloropropane	mg/kg	0.1	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
1,2-Dibromoethane(EDB)	mg/kg	0.1	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
1,2-Dichlorobenzene	mg/kg	88	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
1,2-Dichloroethane	mg/kg	0.1	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
1,2-Dichloropropane	mg/kg	0.1	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
1,3,5-Trichlorobenzene	mg/kg	NE	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
1,3,5-Trimethylbenzene	mg/kg	96	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
1,3-Dichlorobenzene	mg/kg	150	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
1,3-Dichloropropane	mg/kg	NE	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
1,4-Dichlorobenzene	mg/kg	7	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
1,4-Dioxane	mg/kg	5	< 2	< 5	NT	NT	NT	NT	NT	NT	< 3	ND	ND	ND	ND	ND	ND	ND
2,2-Dichloropropane	mg/kg	NE	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
2-Butanone(MEK)	mg/kg	51	< 0.3	< 0.6	NT	NT	NT	NT	NT	NT	< 0.4	ND	ND	ND	ND	ND	ND	ND
2-Chlorotoluene	mg/kg	15	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
2-Hexanone	mg/kg	NE	< 0.5	< 0.9	NT	NT	NT	NT	NT	NT	< 0.7	ND	ND	ND	ND	ND	ND	ND
4-Chlorotoluene	mg/kg	680	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
4-Isopropyltoluene	mg/kg	NE	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
4-Methyl-2-pentanone(MIBK)	mg/kg	29	< 0.4	< 0.8	NT	NT	NT	NT	NT	NT	< 0.6	ND	ND	ND	ND	ND	ND	ND
Acetone	mg/kg	75	< 2	< 5	NT	NT	NT	NT	NT	NT	< 3	ND	ND	ND	ND	ND	ND	ND

Table 1
Summary of Soil Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		NH Soil Remediation Standards (SRS)	NB-SS-3	NB-SS-4	NB-SS-5	NB-SS-6	NB-SS-7	NB-SS-8	NB-SS-9	NB-SS-10	NB-SS-FD (NB-SS-2)	CA-SB-1	CA-SB-2	CA-SB-2	CA-SB-3	CA-SB-4	CA-SB-4	CA-SB-4
LAB ID:			40595-004	40595-005	40595-006	40595-007	40595-008	40595-009	40595-010	40595-011	40595-014							
Matrix:			soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil
Sample Depth (feet bgs):			1.5	NA	1-1.5	1.5	1	1.3	1.2	1.3	1.5	0-2	0-2	15-17	16-18	0-7	0-7	7-9
Date Sampled:	Units		6/7/2017	6/7/2017	6/7/2017	6/7/2017	6/7/2017	6/7/2017	6/7/2017	6/7/2017	6/7/2017	10/27/2014	10/30/2014	10/30/2014	10/30/2014	10/30/2014	DUP-1	10/30/2014
Benzene	mg/kg	0.3	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Bromobenzene	mg/kg	NE	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Bromochloromethane	mg/kg	NE	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Bromodichloromethane	mg/kg	0.1	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Bromoform	mg/kg	0.1	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Bromomethane	mg/kg	0.3	< 0.2 R	< 0.5 R	NT	NT	NT	NT	NT	NT	< 0.3 R	ND	ND	ND	ND	ND	ND	ND
Carbon disulfide	mg/kg	460	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Carbon tetrachloride	mg/kg	12	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Chlorobenzene	mg/kg	6	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Chloroethane	mg/kg	NE	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Chloroform	mg/kg	3	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Chloromethane	mg/kg	3	< 0.1 R	< 0.2 R	NT	NT	NT	NT	NT	NT	< 0.1 R	ND	ND	ND	ND	ND	ND	ND
cis-1,2-Dichloroethene	mg/kg	2	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
cis-1,3-Dichloropropene	mg/kg	0.1	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Dibromochloromethane	mg/kg	1	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Dibromomethane	mg/kg	NE	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Dichlorodifluoromethane	mg/kg	1000	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Diethyl Ether	mg/kg	3900	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Ethyl t-butyl ether (ETBE)	mg/kg	0.7	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Ethylbenzene	mg/kg	120	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Hexachlorobutadiene	mg/kg	17	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Isopropylbenzene	mg/kg	330	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Isopropyl ether (DIPE)	mg/kg	10	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
m,p-Xylene	mg/kg	500	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	**0.4**	**0.3**	ND
Methyl-t-butyl ether(MTBE)	mg/kg	0.2	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Methylene chloride	mg/kg	0.1	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Naphthalene	mg/kg	5	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
n-Butylbenzene	mg/kg	110	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
n-Propylbenzene	mg/kg	85	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
o-Xylene	mg/kg	500	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND

Table 1
Summary of Soil Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		**NH Soil Remediation Standards (SRS)**	**NB-SS-3**	**NB-SS-4**	**NB-SS-5**	**NB-SS-6**	**NB-SS-7**	**NB-SS-8**	**NB-SS-9**	**NB-SS-10**	**NB-SS-FD (NB-SS-2)**	**CA-SB-1**	**CA-SB-2**	**CA-SB-2**	**CA-SB-3**	**CA-SB-4**	**CA-SB-4**	**CA-SB-4**
LAB ID:			**40595-004**	**40595-005**	**40595-006**	**40595-007**	**40595-008**	**40595-009**	**40595-010**	**40595-011**	**40595-014**							
Matrix:			**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**
Sample Depth (feet bgs):			**1.5**	**NA**	**1-1.5**	**1.5**	**1**	**1.3**	**1.2**	**1.3**	**1.5**	**0-2**	**0-2**	**15-17**	**16-18**	**0-7**	**0-7**	**7-9**
Date Sampled:	**Units**		**6/7/2017**	**6/7/2017**	**6/7/2017**	**6/7/2017**	**6/7/2017**	**6/7/2017**	**6/7/2017**	**6/7/2017**	**6/7/2017**	**10/27/2014**	**10/30/2014**	**10/30/2014**	**10/30/2014**	**10/30/2014**	**DUP-1**	**10/30/2014**
sec-Butylbenzene	mg/kg	130	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Styrene	mg/kg	17	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
tert-amyl-methyl ether (TAME)	mg/kg	3	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
t-Butanol (TBA)	mg/kg	2	< 2	< 5	NT	NT	NT	NT	NT	NT	< 3	ND	ND	ND	ND	ND	ND	ND
tert-Butylbenzene	mg/kg	100	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Tetrachloroethene	mg/kg	2	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	**0.4**	ND	ND	ND	ND	**13**	**5.9**	**0.1**
Tetrahydrofuran(THF)	mg/kg	NE	< 0.5	< 0.9	NT	NT	NT	NT	NT	NT	< 0.7	ND	ND	ND	ND	ND	ND	ND
Toluene	mg/kg	100	< 0.1	**0.4**	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
trans-1,2-Dichloroethene	mg/kg	9	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
trans-1,3-Dichloropropene	mg/kg	0.1	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Trichloroethene	mg/kg	0.8	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Trichlorofluoromethane	mg/kg	1000	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND
Vinyl chloride	mg/kg	1	< 0.1	< 0.2	NT	NT	NT	NT	NT	NT	< 0.1	ND	ND	ND	ND	ND	ND	ND

Notes:
< - not detected at the reporting limit
J - estimated value
NT - not tested
Italic Underlined = Reporting Limit exceeds action limit.
BOLD=detection
BOLD SHADED=detection exceeds action limit.

Table 1
Summary of Soil Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		NH Soil Remediation Standards (SRS)	CA-SB-4	CA-SB-5	CA-SB-5	CA-SB-5	CA-SB-6	CA-SB-6	CA-TP-A3	CA-TP-1	CA-TP-2	CA-TP-2	CA-TP-2	CA-TP-3	CA-TP-4	CA-SS-1	CA-SS-2	CA-SS-2
LAB ID:																		
Matrix:			soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil
Sample Depth (feet bgs):			14-16	0-4	4-6	20-22	0.5-10	10.5-12.5	0-4	0-6	0-3.5	0-3.5	3.5-5.5	3.5-8	1-4	0-2	0-2	0-2
Date Sampled:	Units		10/30/2014	10/30/2014	10/30/2014	10/30/2014	10/30/2014	10/30/2014	11/12/2014	11/12/2014	11/12/2014	DUP-2	11/12/2014	11/12/2014	12/18/2014	10/27/2014	10/27/2014	12/18/2014
Volatile Organic Compounds (VOCs)																		
1,1,1,2-Tetrachloroethane	mg/kg	0.8	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
1,1,1-Trichloroethane	mg/kg	78	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
1,1,2,2-Tetrachloroethane	mg/kg	4	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
1,1,2-Trichloroethane	mg/kg	0.1	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
1,1-Dichloroethane	mg/kg	3	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
1,1-Dichloroethene	mg/kg	14	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
1,1-Dichloropropene	mg/kg	NE	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
1,2,3-Trichlorobenzene	mg/kg	NE	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
1,2,3-Trichloropropane	mg/kg	0.1	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
1,2,4-Trichlorobenzene	mg/kg	19	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
1,2,4-Trimethylbenzene	mg/kg	130	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
1,2-Dibromo-3-chloropropane	mg/kg	0.1	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
1,2-Dibromoethane(EDB)	mg/kg	0.1	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
1,2-Dichlorobenzene	mg/kg	88	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
1,2-Dichloroethane	mg/kg	0.1	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
1,2-Dichloropropane	mg/kg	0.1	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
1,3,5-Trichlorobenzene	mg/kg	NE	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
1,3,5-Trimethylbenzene	mg/kg	96	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
1,3-Dichlorobenzene	mg/kg	150	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
1,3-Dichloropropane	mg/kg	NE	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
1,4-Dichlorobenzene	mg/kg	7	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
1,4-Dioxane	mg/kg	5	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
2,2-Dichloropropane	mg/kg	NE	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
2-Butanone(MEK)	mg/kg	51	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
2-Chlorotoluene	mg/kg	15	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
2-Hexanone	mg/kg	NE	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
4-Chlorotoluene	mg/kg	680	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
4-Isopropyltoluene	mg/kg	NE	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
4-Methyl-2-pentanone(MIBK)	mg/kg	29	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Acetone	mg/kg	75	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS

Table 1
Summary of Soil Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		NH Soil Remediation Standards (SRS)	CA-SB-4	CA-SB-5	CA-SB-5	CA-SB-5	CA-SB-6	CA-SB-6	CA-TP-A3	CA-TP-1	CA-TP-2	CA-TP-2	CA-TP-2	CA-TP-3	CA-TP-4	CA-SS-1	CA-SS-2	CA-SS-2
LAB ID:																		
Matrix:			soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil
Sample Depth (feet bgs):			14-16	0-4	4-6	20-22	0.5-10	10.5-12.5	0-4	0-6	0-3.5	0-3.5	3.5-5.5	3.5-8	1-4	0-2	0-2	0-2
Date Sampled:	Units		10/30/2014	10/30/2014	10/30/2014	10/30/2014	10/30/2014	10/30/2014	11/12/2014	11/12/2014	11/12/2014	DUP-2	11/12/2014	11/12/2014	12/18/2014	10/27/2014	10/27/2014	12/18/2014
Benzene	mg/kg	0.3	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Bromobenzene	mg/kg	NE	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Bromochloromethane	mg/kg	NE	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Bromodichloromethane	mg/kg	0.1	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Bromoform	mg/kg	0.1	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Bromomethane	mg/kg	0.3	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Carbon disulfide	mg/kg	460	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Carbon tetrachloride	mg/kg	12	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Chlorobenzene	mg/kg	6	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Chloroethane	mg/kg	NE	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Chloroform	mg/kg	3	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Chloromethane	mg/kg	3	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
cis-1,2-Dichloroethene	mg/kg	2	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
cis-1,3-Dichloropropene	mg/kg	0.1	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Dibromochloromethane	mg/kg	1	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Dibromomethane	mg/kg	NE	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Dichlorodifluoromethane	mg/kg	1000	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Diethyl Ether	mg/kg	3900	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Ethyl t-butyl ether (ETBE)	mg/kg	0.7	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Ethylbenzene	mg/kg	120	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Hexachlorobutadiene	mg/kg	17	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Isopropylbenzene	mg/kg	330	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Isopropyl ether (DIPE)	mg/kg	10	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
m,p-Xylene	mg/kg	500	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Methyl-t-butyl ether(MTBE)	mg/kg	0.2	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Methylene chloride	mg/kg	0.1	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Naphthalene	mg/kg	5	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
n-Butylbenzene	mg/kg	110	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
n-Propylbenzene	mg/kg	85	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
o-Xylene	mg/kg	500	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS

Table 1
Summary of Soil Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		NH Soil Remediation Standards (SRS)	CA-SB-4	CA-SB-5	CA-SB-5	CA-SB-5	CA-SB-6	CA-SB-6	CA-TP-A3	CA-TP-1	CA-TP-2	CA-TP-2	CA-TP-2	CA-TP-3	CA-TP-4	CA-SS-1	CA-SS-2	CA-SS-2
LAB ID:																		
Matrix:			soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil
Sample Depth (feet bgs):			14-16	0-4	4-6	20-22	0.5-10	10.5-12.5	0-4	0-6	0-3.5	0-3.5	3.5-5.5	3.5-8	1-4	0-2	0-2	0-2
Date Sampled:	Units		10/30/2014	10/30/2014	10/30/2014	10/30/2014	10/30/2014	10/30/2014	11/12/2014	11/12/2014	11/12/2014	DUP-2	11/12/2014	11/12/2014	12/18/2014	10/27/2014	10/27/2014	12/18/2014
sec-Butylbenzene	mg/kg	130	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Styrene	mg/kg	17	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
tert-amyl-methyl ether (TAME)	mg/kg	3	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
t-Butanol (TBA)	mg/kg	2	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
tert-Butylbenzene	mg/kg	100	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Tetrachloroethene	mg/kg	2	ND	**6.0**	**6.5**	ND	**0.2**	ND	ND	**2.8**	**5.4**	**3.5**	**0.2**	ND	NS	NS	NS	NS
Tetrahydrofuran(THF)	mg/kg	NE	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Toluene	mg/kg	100	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
trans-1,2-Dichloroethene	mg/kg	9	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
trans-1,3-Dichloropropene	mg/kg	0.1	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Trichloroethene	mg/kg	0.8	ND	**0.1**	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Trichlorofluoromethane	mg/kg	1000	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS
Vinyl chloride	mg/kg	1	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS	NS	NS	NS

Notes:
< - not detected at the reporting limit
J - estimated value
NT - not tested
Italic Underlined = Reporting Limit exceeds action limit.
BOLD=detection
BOLD SHADED=detection exceeds action limit.

Sample ID:		NH Soil Remediation Standards (SRS)	CA-SS-3	CA-SS-4	CA-SS-5	CA-SS-5	CA-SS-6	CA-SS-7	CA-SS-7	CA-SS-8	CA-SS-9	CA-SS-10	CA-SS-10	CA-SS-11
LAB ID:														
Matrix:			soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil
Sample Depth (feet bgs):			0-2	0-2	0-2	0-2	0-2	0-2	0-2	0-2	0-2	0-2	0-2	0-2
Date Sampled:	Units		10/30/2014	10/27/2014	10/27/2014	12/18/2014	10/27/2014	10/27/2014	12/18/2014	12/18/2014	12/18/2014	12/18/2014	DUP-3	12/18/2014
Volatile Organic Compounds (VOCs)														
1,1,1,2-Tetrachloroethane	mg/kg	0.8	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
1,1,1-Trichloroethane	mg/kg	78	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
1,1,2,2-Tetrachloroethane	mg/kg	4	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
1,1,2-Trichloroethane	mg/kg	0.1	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
1,1-Dichloroethane	mg/kg	3	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
1,1-Dichloroethene	mg/kg	14	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
1,1-Dichloropropene	mg/kg	NE	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
1,2,3-Trichlorobenzene	mg/kg	NE	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
1,2,3-Trichloropropane	mg/kg	0.1	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
1,2,4-Trichlorobenzene	mg/kg	19	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
1,2,4-Trimethylbenzene	mg/kg	130	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
1,2-Dibromo-3-chloropropane	mg/kg	0.1	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
1,2-Dibromoethane(EDB)	mg/kg	0.1	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
1,2-Dichlorobenzene	mg/kg	88	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
1,2-Dichloroethane	mg/kg	0.1	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
1,2-Dichloropropane	mg/kg	0.1	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
1,3,5-Trichlorobenzene	mg/kg	NE	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
1,3,5-Trimethylbenzene	mg/kg	96	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
1,3-Dichlorobenzene	mg/kg	150	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
1,3-Dichloropropane	mg/kg	NE	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
1,4-Dichlorobenzene	mg/kg	7	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
1,4-Dioxane	mg/kg	5	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
2,2-Dichloropropane	mg/kg	NE	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
2-Butanone(MEK)	mg/kg	51	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
2-Chlorotoluene	mg/kg	15	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
2-Hexanone	mg/kg	NE	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
4-Chlorotoluene	mg/kg	680	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
4-Isopropyltoluene	mg/kg	NE	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
4-Methyl-2-pentanone(MIBK)	mg/kg	29	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Acetone	mg/kg	75	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND

Table 1
Summary of Soil Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		**NH Soil Remediation Standards (SRS)**	**CA-SS-3**	**CA-SS-4**	**CA-SS-5**	**CA-SS-5**	**CA-SS-6**	**CA-SS-7**	**CA-SS-7**	**CA-SS-8**	**CA-SS-9**	**CA-SS-10**	**CA-SS-10**	**CA-SS-11**
LAB ID:														
Matrix:			**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**
Sample Depth (feet bgs):			**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**
Date Sampled:	**Units**		**10/30/2014**	**10/27/2014**	**10/27/2014**	**12/18/2014**	**10/27/2014**	**10/27/2014**	**12/18/2014**	**12/18/2014**	**12/18/2014**	**12/18/2014**	**DUP-3**	**12/18/2014**
Benzene	mg/kg	0.3	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Bromobenzene	mg/kg	NE	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Bromochloromethane	mg/kg	NE	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Bromodichloromethane	mg/kg	0.1	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Bromoform	mg/kg	0.1	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Bromomethane	mg/kg	0.3	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Carbon disulfide	mg/kg	460	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Carbon tetrachloride	mg/kg	12	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Chlorobenzene	mg/kg	6	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Chloroethane	mg/kg	NE	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Chloroform	mg/kg	3	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Chloromethane	mg/kg	3	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
cis-1,2-Dichloroethene	mg/kg	2	NS	NS	NS	NS	NS	NS	NS	**0.5**	ND	ND	ND	ND
cis-1,3-Dichloropropene	mg/kg	0.1	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Dibromochloromethane	mg/kg	1	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Dibromomethane	mg/kg	NE	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Dichlorodifluoromethane	mg/kg	1000	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Diethyl Ether	mg/kg	3900	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Ethyl t-butyl ether (ETBE)	mg/kg	0.7	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Ethylbenzene	mg/kg	120	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Hexachlorobutadiene	mg/kg	17	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Isopropylbenzene	mg/kg	330	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Isopropyl ether (DIPE)	mg/kg	10	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
m,p-Xylene	mg/kg	500	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Methyl-t-butyl ether(MTBE)	mg/kg	0.2	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Methylene chloride	mg/kg	0.1	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Naphthalene	mg/kg	5	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
n-Butylbenzene	mg/kg	110	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
n-Propylbenzene	mg/kg	85	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
o-Xylene	mg/kg	500	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND

Table 1
Summary of Soil Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		**NH Soil Remediation Standards (SRS)**	**CA-SS-3**	**CA-SS-4**	**CA-SS-5**	**CA-SS-5**	**CA-SS-6**	**CA-SS-7**	**CA-SS-7**	**CA-SS-8**	**CA-SS-9**	**CA-SS-10**	**CA-SS-10**	**CA-SS-11**
LAB ID:														
Matrix:			**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**
Sample Depth (feet bgs):			**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**
Date Sampled:	**Units**		**10/30/2014**	**10/27/2014**	**10/27/2014**	**12/18/2014**	**10/27/2014**	**10/27/2014**	**12/18/2014**	**12/18/2014**	**12/18/2014**	**12/18/2014**	**DUP-3**	**12/18/2014**
sec-Butylbenzene	mg/kg	130	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Styrene	mg/kg	17	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
tert-amyl-methyl ether (TAME)	mg/kg	3	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
t-Butanol (TBA)	mg/kg	2	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
tert-Butylbenzene	mg/kg	100	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Tetrachloroethene	mg/kg	2	NS	NS	NS	NS	NS	NS	NS	**1.6**	ND	**0.9**	**1.1**	ND
Tetrahydrofuran(THF)	mg/kg	NE	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Toluene	mg/kg	100	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
trans-1,2-Dichloroethene	mg/kg	9	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
trans-1,3-Dichloropropene	mg/kg	0.1	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Trichloroethene	mg/kg	0.8	NS	NS	NS	NS	NS	NS	NS	**0.6**	ND	ND	ND	ND
Trichlorofluoromethane	mg/kg	1000	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND
Vinyl chloride	mg/kg	1	NS	NS	NS	NS	NS	NS	NS	ND	ND	ND	ND	ND

Notes:
< - not detected at the reporting limit
J - estimated value
NT - not tested
Italic Underlined = Reporting Limit exceeds action limit.
BOLD=detection
BOLD SHADED=detection exceeds action limit.

Table 2
Summary of Soil Analytical Results - PAHs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		**NH Soil Remediation Standards (SRS)**	**SG-AR2**	**SG-AR1**	**SG-SM1**	**SG-SM2**	**SG-SM3**	**NB-1 0.3-2' S-1**	**NB-1 14-15' S-8**	**NB-1 39-39.5' S-13**	**NB-2 S-1 0.5-2'**	**NB-2 S-7 12-13'**	**NB-2 S-11 29-31'**	**NB-3 S-1 0.3-2'**
LAB ID:			**39842-002**	**39842-003**	**39842-004**	**39842-005**	**39842-006**	**40029-002**	**40029-003**	**40029-004**	**40029-005**	**40029-006**	**40029-007**	**40029-008**
Matrix:			**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**
Sample Depth (feet bgs):			**2**	**2**	**2**	**2**	**2**	**0.3 - 2**	**14 - 15**	**39 - 39.5**	**0.5 - 2**	**12 - 13**	**29 - 31**	**0.3 - 2**
Date Sampled:	**Units**		**4/12/2017**	**4/12/2017**	**4/13/2017**	**4/13/2017**	**4/13/2017**	**4/21/2017**	**4/21/2017**	**4/21/2017**	**4/25/2017**	**4/25/2017**	**4/25/2017**	**4/26/2017**
Polycyclic Aromatic Hydrocarbons (PAHs)														
2-Methylnaphthalene	mg/kg	96	<0.50	<0.51	<0.51	**0.82**	**3.1**	< 0.58	< 0.60	< 0.58	< 0.60	< 0.62	< 0.61	< 0.68
Acenaphthene	mg/kg	340	<0.50	<0.51	<0.51	**1.7**	**10**	< 0.58	< 0.60	< 0.58	< 0.60	< 0.62	< 0.61	< 0.68
Acenaphthylene	mg/kg	490	<0.50	<0.51	<0.51	**3.7**	**4.6**	< 0.58	< 0.60	< 0.58	< 0.60	< 0.62	< 0.61	< 0.68
Anthracene	mg/kg	1000	<0.50	<0.51	<0.51	**6.8**	**22**	< 0.58	< 0.60	< 0.58	< 0.60	< 0.62	< 0.61	< 0.68
Benzo[a]anthracene	mg/kg	1	<0.50	<0.51	<0.51	**19**	**49**	< 0.58	< 0.60	< 0.58	**1.1**	< 0.62	< 0.61	**1.7**
Benzo[a]pyrene	mg/kg	0.7	<0.50	<0.51	<0.51	**14**	**41**	< 0.58	< 0.60	< 0.58	**1.1**	< 0.62	< 0.61	**1.4**
Benzo[b]fluoranthene	mg/kg	1	<0.50	<0.51	<0.51	**15**	**37**	< 0.58	< 0.60	< 0.58	**1.3**	< 0.62	< 0.61	**1.2**
Benzo[g,h,i]perylene	mg/kg	NE	<0.50	<0.51	<0.51	**6.6**	**13**	< 0.58	< 0.60	< 0.58	**0.68**	< 0.62	< 0.61	**0.73**
Benzo[k]fluoranthene	mg/kg	12	<0.50	<0.51	<0.51	**9.6**	**36**	< 0.58	< 0.60	< 0.58	**0.82**	< 0.62	< 0.61	**1.1**
Chrysene	mg/kg	120	<0.50	<0.51	<0.51	**15**	**43**	< 0.58	< 0.60	< 0.58	**1.2**	< 0.62	< 0.61	**1.4**
Dibenz[a,h]anthracene	mg/kg	0.7	<0.50	<0.51	<0.51	**2.7**	**5.1**	< 0.58	< 0.60	< 0.58	< 0.60	< 0.62	< 0.61	< 0.68
Fluoranthene	mg/kg	960	<0.50	<0.51	<0.51	**40**	**110**	< 0.58	< 0.60	< 0.58	**2.0**	< 0.62	< 0.61	**3.1**
Fluorene	mg/kg	77	<0.50	<0.51	<0.51	**3.6**	**9.3**	< 0.58	< 0.60	< 0.58	< 0.60	< 0.62	< 0.61	< 0.68
Indeno[1,2,3-cd]pyrene	mg/kg	1	<0.50	<0.51	<0.51	**6.6**	**14**	< 0.58	< 0.60	< 0.58	**0.72**	< 0.62	< 0.61	< 0.68
Naphthalene	mg/kg	5	<0.50	<0.51	<0.51	<0.54	**5.1**	< 0.58	< 0.60	< 0.58	< 0.60	< 0.62	< 0.61	< 0.68
Phenanthrene	mg/kg	NE	<0.50	<0.51	<0.51	**36**	**100**	< 0.58	< 0.60	< 0.58	**1.2**	< 0.62	< 0.61	**2.5**
Pyrene	mg/kg	720	<0.50	<0.51	<0.51	**30**	**95**	< 0.58	< 0.60	< 0.58	**2.0**	< 0.62	< 0.61	**2.9**

Notes:
< - not detected at the reporting limit
J - estimated value
Italic Underlined = Reporting Limit exceeds action limit.
BOLD=detection
BOLD SHADED=detection exceeds action limit.

Table 2
Summary of Soil Analytical Results - PAHs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		NH Soil Remediation Standards (SRS)	NB-3 S-8 14-15'	NB-3 S-10 24-26'	NB-6 S-1 0.3-2'	FD-1 (NB-6 S-1 0.3-2')	NB-6 S-7 12-13'	NB-6 S-12 34-36'	NB-4 S-1 0.3-2'	NB-4 S-3 5-6'	NB-4 S-8 24-26'	NB-5 0.3-2'	NB-5 8-10'
LAB ID:			**40029-009**	**40029-010**	**40096-002**	**40096-003**	**40096-004**	**40096-005**	**40097-002**	**40097-003**	**40097-004**	**40097-005**	**40097-006**
Matrix:			**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**
Sample Depth (feet bgs):			**14 - 15**	**24 - 26**	**0.3 - 2**	**0.3 - 2**	**12 - 13**	**34 - 36**	**0.3 - 2**	**5 - 6**	**24 - 26**	**0.3 - 2**	**8 - 10**
Date Sampled:	**Units**		**4/26/2017**	**4/26/2017**	**5/1/2017**	**5/1/2017**	**5/1/2017**	**5/1/2017**	**4/27/2017**	**4/27/2017**	**4/27/2017**	**4/28/2017**	**4/28/2017**
Polycyclic Aromatic Hydrocarbons (PAHs)													
2-Methylnaphthalene	mg/kg	96	< 0.66	< 0.61	< 0.56	< 0.49	< 0.60	< 0.57	< 0.53	< 0.61	< 0.58	< 0.64	< 0.59
Acenaphthene	mg/kg	340	< 0.66	< 0.61	**1.9 J**	< 0.49 J	< 0.60	< 0.57	< 0.53	< 0.61	< 0.58	< 0.64	< 0.59
Acenaphthylene	mg/kg	490	< 0.66	< 0.61	< 0.56	< 0.49	< 0.60	< 0.57	< 0.53	< 0.61	< 0.58	< 0.64	< 0.59
Anthracene	mg/kg	1000	< 0.66	< 0.61	**1.9 J**	< 0.49 J	< 0.60	< 0.57	< 0.53	< 0.61	< 0.58	< 0.64	< 0.59
Benzo[a]anthracene	mg/kg	1	< 0.66	< 0.61	**6.1 J**	**0.58 J**	< 0.60	< 0.57	< 0.53	< 0.61	< 0.58	**1.3**	< 0.59
Benzo[a]pyrene	mg/kg	0.7	< 0.66	< 0.61	**4.9 J**	**0.49 J**	< 0.60	< 0.57	< 0.53	< 0.61	< 0.58	**1.2**	< 0.59
Benzo[b]fluoranthene	mg/kg	1	< 0.66	< 0.61	**5.0 J**	**0.53 J**	< 0.60	< 0.57	< 0.53	< 0.61	< 0.58	**1.3**	< 0.59
Benzo[g,h,i]perylene	mg/kg	NE	< 0.66	< 0.61	**0.96**	< 0.49	< 0.60	< 0.57	< 0.53	< 0.61	< 0.58	**0.66**	< 0.59
Benzo[k]fluoranthene	mg/kg	12	< 0.66	< 0.61	**5.1 J**	< 0.49 J	< 0.60	< 0.57	< 0.53	< 0.61	< 0.58	**0.99**	< 0.59
Chrysene	mg/kg	120	< 0.66	< 0.61	**7.0 J**	**1.5 J**	< 0.60	< 0.57	< 0.53	< 0.61	< 0.58	**1.4**	< 0.59
Dibenz[a,h]anthracene	mg/kg	0.7	< 0.66	< 0.61	< 0.56	< 0.49	< 0.60	< 0.57	< 0.53	< 0.61	< 0.58	< 0.64	< 0.59
Fluoranthene	mg/kg	960	< 0.66	< 0.61	**14 J**	**1.3 J**	< 0.60	< 0.57	< 0.53	< 0.61	< 0.58	**2.7**	< 0.59
Fluorene	mg/kg	77	< 0.66	< 0.61	**1.4 J**	< 0.49 J	< 0.60	< 0.57	< 0.53	< 0.61	< 0.58	< 0.64	< 0.59
Indeno[1,2,3-cd]pyrene	mg/kg	1	< 0.66	< 0.61	**1.3 J**	< 0.49 J	< 0.60	< 0.57	< 0.53	< 0.61	< 0.58	**0.67**	< 0.59
Naphthalene	mg/kg	5	< 0.66	< 0.61	**1.0 J**	< 0.49 J	< 0.60	< 0.57	< 0.53	< 0.61	< 0.58	< 0.64	< 0.59
Phenanthrene	mg/kg	NE	< 0.66	< 0.61	**14 J**	**1.2 J**	< 0.60	< 0.57	< 0.53	< 0.61	< 0.58	**3.0**	< 0.59
Pyrene	mg/kg	720	< 0.66	< 0.61	**13 J**	**1.4 J**	< 0.60	< 0.57	< 0.53	< 0.61	< 0.58	**2.7**	< 0.59

Notes:
< - not detected at the reporting limit
J - estimated value
Italic Underlined = Reporting Limit exceeds action limit.
BOLD=detection
BOLD SHADED=detection exceeds action limit.

Table 2
Summary of Soil Analytical Results - PAHs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		NH Soil Remediation Standards (SRS)	NB-5 24-26	NB-TP-1 3'	NB-TP-2 5'	NB-TP-3 1'	NB-TP-4 1.5'	NB-TP-5 4'	NB-TP-6 4'	UST Bottom	UST Sides/Ends	NB-SS-1	NB-SS-2	NB-SS-3	NB-SS-4	NB-SS-5	NB-SS-6
LAB ID:			40097-007	40327-002	40327-003	40327-004	40327-005	40327-006	40327-007	40327-008	40327-009	40595-002	40595-003	40595-004	40595-005	40595-006	40595-007
Matrix:			soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil
Sample Depth (feet bgs):			24 - 26	3	5	1	1.5	4	4	NA	NA	1	1.5	1.5	NA	1-1.5	1.5
Date Sampled:	**Units**		4/28/2017	5/17/2017	5/17/2017	5/17/2017	5/17/2017	5/17/2017	5/17/2017	5/18/2017	5/18/2017	6/7/2017	6/7/2017	6/7/2017	6/7/2017	6/7/2017	6/7/2017
Polycyclic Aromatic Hydrocarbons (PAHs)																	
2-Methylnaphthalene	mg/kg	96	< 0.60	**49**	< 0.57	< 0.57	< 13	< 0.54	< 0.66	< 0.53	< 0.52	< 0.66	< 0.70	< 0.58	< 0.64	< 0.59	< 0.56
Acenaphthene	mg/kg	340	< 0.60	**150**	< 0.57	**1.2**	< 13	< 0.54	< 0.66	< 0.53	< 0.52	**1.6**	**1.2 J**	< 0.58	< 0.64	< 0.59	< 0.56
Acenaphthylene	mg/kg	490	< 0.60	< 11	< 0.57	< 0.57	< 13	< 0.54	< 0.66	< 0.53	< 0.52	< 0.66	< 0.70	< 0.58	< 0.64	< 0.59	< 0.56
Anthracene	mg/kg	1000	< 0.60	**290**	< 0.57	**3.9**	< 13	< 0.54	< 0.66	< 0.53	< 0.52	**4.3 J**	**3.3 J**	< 0.58	< 0.64	< 0.59	< 0.56
Benzo[a]anthracene	mg/kg	1	< 0.60	**340**	< 0.57	**9.8**	*< 13*	< 0.54	**2.5**	< 0.53	< 0.52	**7.1 J**	**5.7 J**	< 0.58	**0.68**	< 0.59	**0.60**
Benzo[a]pyrene	mg/kg	0.7	< 0.60	**210**	< 0.57	**7.1**	*< 13*	< 0.54	**2.4**	< 0.53	< 0.52	**5.3 J**	**3.9 J**	< 0.58	**0.64**	< 0.59	< 0.56
Benzo[b]fluoranthene	mg/kg	1	< 0.60	**180**	< 0.57	**5.8**	*< 13*	< 0.54	**2.5**	< 0.53	< 0.52	**5.9 J**	**4.1 J**	< 0.58	< 0.64	< 0.59	< 0.56
Benzo[g,h,i]perylene	mg/kg	NE	< 0.60	**90**	< 0.57	**4.3**	< 13	< 0.54	< 0.66	< 0.53	< 0.52	**3.9 J**	**2.0 J**	< 0.58	< 0.64	< 0.59	< 0.56
Benzo[k]fluoranthene	mg/kg	12	< 0.60	**220**	< 0.57	**7.4**	*< 13*	< 0.54	**2.2**	< 0.53	< 0.52	**3.7 J**	**3.2 J**	< 0.58	**0.73**	< 0.59	< 0.56
Chrysene	mg/kg	120	< 0.60	**270**	< 0.57	**8.3**	< 13	< 0.54	**2.6**	< 0.53	< 0.52	**6.6 J**	**4.4 J**	< 0.58	**0.66**	< 0.59	**0.60**
Dibenz[a,h]anthracene	mg/kg	0.7	< 0.60	**42**	< 0.57	**1.3**	*< 13*	< 0.54	< 0.66	< 0.53	< 0.52	**1.5 J**	**1.1 J**	< 0.58	< 0.64	< 0.59	< 0.56
Fluoranthene	mg/kg	960	< 0.60	**660**	< 0.57	**14**	< 13	< 0.54	**3.2**	< 0.53	< 0.52	**17 J**	**10 J**	< 0.58	**1.8**	< 0.59	**1.5**
Fluorene	mg/kg	77	< 0.60	**140**	< 0.57	**1.2**	< 13	< 0.54	< 0.66	< 0.53	< 0.52	**1.6**	**1.3 J**	< 0.58	< 0.64	< 0.59	< 0.56
Indeno[1,2,3-cd]pyrene	mg/kg	1	< 0.60	**99**	< 0.57	**3.9**	*< 13*	< 0.54	**0.80**	< 0.53	< 0.52	**3.0 J**	**1.8 J**	< 0.58	< 0.64	< 0.59	< 0.56
Naphthalene	mg/kg	5	< 0.60	**64**	< 0.57	< 0.57	*< 13*	< 0.54	< 0.66	< 0.53	< 0.52	< 0.66	**1.2**	< 0.58	< 0.64	< 0.59	< 0.56
Phenanthrene	mg/kg	NE	< 0.60	**1100**	< 0.57	**14**	< 13	< 0.54	**1.5**	< 0.53	< 0.52	**18 J**	**12 J**	< 0.58	**1.2**	< 0.59	**1.1**
Pyrene	mg/kg	720	< 0.60	**480**	< 0.57	**12**	< 13	< 0.54	**3.1**	< 0.53	< 0.52	**13 J**	**8.5 J**	< 0.58	**1.0**	< 0.59	**1.0**

Notes:
< - not detected at the reporting limit
J - estimated value
Italic Underlined = Reporting Limit exceeds action limit.
BOLD=detection
BOLD SHADED=detection exceeds action limit.

Sample ID:		NH Soil Remediation Standards (SRS)	NB-SS-7	NB-SS-8	NB-SS-9	NB-SS-10	NB-SS-FD (NB-SS-2)	CA-SB-1	CA-SB-2	CA-SB-2	CA-SB-3	CA-SB-4	CA-SB-4	CA-SB-4	CA-SB-4	CA-SB-5	CA-SB-5
LAB ID:			40595-008	40595-009	40595-010	40595-011	40595-014										
Matrix:			soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil
Sample Depth (feet bgs):			1	1.3	1.2	1.3	1.5	0-2	0-2	15-17	16-18	0-7	0-7	7-9	14-16	0-4	4-6
Date Sampled:	**Units**		6/7/2017	6/7/2017	6/7/2017	6/7/2017	6/7/2017	10/27/2014	10/30/2014	10/30/2014	10/30/2014	10/30/2014	DUP-1	10/30/2014	10/30/2014	10/30/2014	10/30/2014
Polycyclic Aromatic Hydrocarbons (PAHs)																	
2-Methylnaphthalene	mg/kg	96	< 0.57	< 0.60	< 0.52	< 0.54	**0.69**	ND	ND	ND	ND	ND	**0.66**	ND	ND	ND	NS
Acenaphthene	mg/kg	340	**0.98**	< 0.60	< 0.52	< 0.54	**2.1 J**	ND	ND	ND	ND	**0.71**	**1.9**	ND	ND	ND	NS
Acenaphthylene	mg/kg	490	< 0.57	< 0.60	< 0.52	< 0.54	< 0.62	ND	ND	ND	ND	ND	ND	ND	ND	ND	NS
Anthracene	mg/kg	1000	**3.5**	< 0.60	< 0.52	< 0.54	**7.9 J**	ND	ND	ND	ND	**1.0**	**2.2**	ND	ND	ND	NS
Benzo[a]anthracene	mg/kg	1	**8.1**	< 0.60	< 0.52	< 0.54	**20 J**	**0.64**	**0.06**	ND	ND	**2.7**	**7.2**	ND	ND	ND	NS
Benzo[a]pyrene	mg/kg	0.7	**5.4**	< 0.60	< 0.52	< 0.54	**14 J**	**0.67**	**0.06**	ND	ND	**2.2**	**6.2**	ND	ND	ND	NS
Benzo[b]fluoranthene	mg/kg	1	**4.8**	< 0.60	< 0.52	< 0.54	**12 J**	**0.75**	**0.06**	ND	ND	**2.8**	**7.8**	**0.06**	ND	ND	NS
Benzo[g,h,i]perylene	mg/kg	NE	**3.4**	< 0.60	< 0.52	< 0.54	**7.2 J**	**0.31**	ND	ND	ND	**0.77**	**1.4**	**0.06**	ND	ND	NS
Benzo[k]fluoranthene	mg/kg	12	**4.4**	< 0.60	< 0.52	< 0.54	**13 J**	**0.57**	**0.08**	ND	ND	**1.9**	**7**	ND	ND	ND	NS
Chrysene	mg/kg	120	**7.1**	< 0.60	< 0.52	< 0.54	**16 J**	**0.88**	**0.10**	ND	ND	**2.9**	**7.2**	ND	ND	**2.9**	NS
Dibenz[a,h]anthracene	mg/kg	0.7	**1.2**	< 0.60	< 0.52	< 0.54	**3.4 J**	ND	ND	ND	ND	ND	**0.75**	ND	ND	ND	NS
Fluoranthene	mg/kg	960	**13**	< 0.60	< 0.52	< 0.54	**35 J**	**1.1**	**0.12**	ND	ND	**6.5**	**16**	ND	ND	**1.2**	NS
Fluorene	mg/kg	77	**0.97**	< 0.60	< 0.52	< 0.54	**2.4 J**	ND	ND	ND	ND	**0.64**	**1.6**	ND	ND	ND	NS
Indeno[1,2,3-cd]pyrene	mg/kg	1	**3.0**	< 0.60	< 0.52	< 0.54	**6.9 J**	**0.34**	ND	ND	ND	**0.82**	**1.5**	ND	ND	ND	NS
Naphthalene	mg/kg	5	**0.57**	< 0.60	< 0.52	< 0.54	**1.2**	ND	ND	ND	ND	**0.79**	**2.2**	ND	ND	ND	NS
Phenanthrene	mg/kg	NE	**13**	< 0.60	< 0.52	< 0.54	**30 J**	**0.46**	**0.07**	ND	ND	**5.9**	**15**	ND	ND	ND	NS
Pyrene	mg/kg	720	**11**	< 0.60	< 0.52	< 0.54	**25 J**	**1**	**0.11**	ND	ND	**4.8**	**14**	**0.06**	ND	**1.9**	NS

Notes:
< - not detected at the reporting limit
J - estimated value
Italic Underlined = Reporting Limit exceeds action limit.
BOLD=detection
BOLD SHADED=detection exceeds action limit.

Table 2
Summary of Soil Analytical Results - PAHs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		NH Soil Remediation Standards (SRS)	CA-SB-5	CA-SB-6	CA-SB-6	CA-TP-A3	CA-TP-1	CA-TP-2	CA-TP-2	CA-TP-2	CA-TP-3	CA-TP-4	CA-SS-1	CA-SS-2	CA-SS-2	CA-SS-3	CA-SS-4	CA-SS-5
LAB ID:																		
Matrix:			soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil
Sample Depth (feet bgs):			20-22	0.5-10	10.5-12.5	0-4	0-6	0-3.5	0-3.5	3.5-5.5	3.5-8	1-4	0-2	0-2	0-2	0-2	0-2	0-2
Date Sampled:	**Units**		10/30/2014	10/30/2014	10/30/2014	11/12/2014	11/12/2014	11/12/2014	DUP-2	11/12/2014	11/12/2014	12/18/2014	10/27/2014	10/27/2014	12/18/2014	10/30/2014	10/27/2014	10/27/2014
Polycyclic Aromatic Hydrocarbons (PAHs)																		
2-Methylnaphthalene	mg/kg	96	ND	ND	ND	**6.3**	ND	ND	ND	ND	ND	NS	ND	ND	NS	ND	ND	ND
Acenaphthene	mg/kg	340	ND	ND	ND	ND	ND	ND	**0.36**	ND	ND	NS	ND	**0.42**	NS	ND	ND	ND
Acenaphthylene	mg/kg	490	ND	ND	ND	**0.9**	ND	ND	**0.07**	ND	ND	NS	ND	ND	NS	ND	ND	ND
Anthracene	mg/kg	1000	ND	ND	ND	ND	ND	**0.89**	**1**	ND	ND	NS	ND	**0.6**	NS	ND	ND	ND
Benzo[a]anthracene	mg/kg	1	ND	ND	ND	**0.6**	**1.6**	**2.1**	**2.6**	ND	ND	NS	**1.1**	**2.5**	NS	**0.44**	ND	ND
Benzo[a]pyrene	mg/kg	0.7	ND	ND	ND	ND	ND	**1.7**	**2.4**	ND	ND	NS	**1.1**	**2.3**	NS	**0.38**	ND	**0.58**
Benzo[b]fluoranthene	mg/kg	1	ND	ND	ND	ND	**1.2**	**1.4**	**2.3**	ND	ND	NS	**1.1**	**2.3**	NS	**0.31**	ND	**0.48**
Benzo[g,h,i]perylene	mg/kg	NE	ND	ND	ND	ND	ND	**0.98**	**0.63**	ND	ND	NS	**0.36**	**0.79**	NS	ND	ND	ND
Benzo[k]fluoranthene	mg/kg	12	ND	ND	ND	ND	ND	**1.8**	**2.8**	ND	ND	NS	**1.1**	**2.4**	NS	**0.41**	ND	ND
Chrysene	mg/kg	120	ND	ND	ND	**3.0**	**2.9**	**2.2**	**2.5**	ND	ND	NS	**1.3**	**2.7**	NS	**0.5**	ND	**1.7**
Dibenz[a,h]anthracene	mg/kg	0.7	ND	ND	ND	ND	ND	**0.4**	**0.3**	ND	ND	NS	ND	**0.39**	NS	ND	ND	ND
Fluoranthene	mg/kg	960	ND	ND	ND	**1.0**	**3.2**	**4.5**	**7.5**	ND	ND	NS	**1.9**	**5.7**	NS	**0.81**	ND	ND
Fluorene	mg/kg	77	ND	ND	ND	**1.5**	ND	ND	**0.38**	ND	ND	NS	ND	**0.28**	NS	ND	ND	ND
Indeno[1,2,3-cd]pyrene	mg/kg	1	ND	ND	ND	ND	ND	**0.89**	**0.66**	ND	ND	NS	**0.38**	**0.85**	NS	ND	ND	ND
Naphthalene	mg/kg	5	ND	ND	ND	**10**	ND	ND	**0.08**	ND	ND	NS	ND	ND	NS	ND	ND	ND
Phenanthrene	mg/kg	NE	ND	ND	ND	**3.3**	**2.7**	**4.2**	**6.1**	ND	ND	NS	1.1	**4.0**	NS	**0.62**	ND	**0.62**
Pyrene	mg/kg	720	ND	ND	ND	**1.8**	**4.1**	**4.3**	**6.5**	ND	ND	NS	**1.9**	**4.8**	NS	**0.77**	ND	ND

Notes:
< - not detected at the reporting limit
J - estimated value
Italic Underlined = Reporting Limit exceeds action limit.
BOLD=detection
BOLD SHADED=detection exceeds action limit.

Table 2
Summary of Soil Analytical Results - PAHs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		**NH Soil Remediation Standards (SRS)**	**CA-SS-5**	**CA-SS-6**	**CA-SS-7**	**CA-SS-7**	**CA-SS-8**	**CA-SS-9**	**CA-SS-10**	**CA-SS-10**	**CA-SS-11**
LAB ID:											
Matrix:			**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**
Sample Depth (feet bgs):			**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**
Date Sampled:	**Units**		**12/18/2014**	**10/27/2014**	**10/27/2014**	**12/18/2014**	**12/18/2014**	**12/18/2014**	**12/18/2014**	**DUP-3**	**12/18/2014**
Polycyclic Aromatic Hydrocarbons (PAHs)											
2-Methylnaphthalene	mg/kg	96	NS	NS	ND	NS	ND	ND	ND	ND	ND
Acenaphthene	mg/kg	340	NS	NS	ND	NS	ND	ND	ND	ND	ND
Acenaphthylene	mg/kg	490	NS	NS	ND	NS	ND	ND	ND	ND	ND
Anthracene	mg/kg	1000	NS	NS	ND	NS	ND	ND	ND	ND	ND
Benzo[a]anthracene	mg/kg	1	NS	NS	ND	NS	ND	ND	ND	ND	ND
Benzo[a]pyrene	mg/kg	0.7	NS	NS	ND	NS	ND	ND	ND	ND	ND
Benzo[b]fluoranthene	mg/kg	1	NS	NS	**0.08**	NS	ND	ND	ND	ND	ND
Benzo[g,h,i]perylene	mg/kg	NE	NS	NS	ND	NS	ND	ND	ND	ND	ND
Benzo[k]fluoranthene	mg/kg	12	NS	NS	**0.08**	NS	ND	ND	ND	ND	ND
Chrysene	mg/kg	120	NS	NS	**0.07**	NS	ND	**0.7**	ND	ND	ND
Dibenz[a,h]anthracene	mg/kg	0.7	NS	NS	ND	NS	ND	ND	ND	ND	ND
Fluoranthene	mg/kg	960	NS	NS	**0.08**	NS	**1.1**	**1.1**	**4.9**	ND	**1.2**
Fluorene	mg/kg	77	NS	NS	ND	NS	ND	ND	ND	ND	ND
Indeno[1,2,3-cd]pyrene	mg/kg	1	NS	NS	ND	NS	ND	ND	ND	ND	ND
Naphthalene	mg/kg	5	NS	NS	ND	NS	ND	ND	ND	ND	ND
Phenanthrene	mg/kg	NE	NS	NS	ND	NS	**0.8**	**0.7**	**5.2**	ND	**1.1**
Pyrene	mg/kg	720	NS	NS	**0.08**	NS	**1.1**	**0.9**	**3.8**	ND	**1.2**

Notes:
< - not detected at the reporting limit
J - estimated value
Italic Underlined = Reporting Limit exceeds action limit.
BOLD=detection
BOLD SHADED=detection exceeds action limit.

Table 3
Summary of Soil Analytical Results - Metals
Ferrari Mill
Franklin, New Hampshire

Sample ID:		**NH Soil Remediation Standards (SRS)**	**SG-AR2**	**SG-AR1**	**SG-SM1**	**SG-SM2**	**SG-SM3**	**NB-1 0.3-2' S-1**	**NB-1 14-15' S-8**	**NB-1 39-39.5' S-13**	**NB-2 S-1 0.5-2'**	**NB-2 S-7 12-13'**	**NB-2 S-11 29-31'**	**NB-3 S-1 0.3-2'**
LAB ID:			**39842-002**	**39842-003**	**39842-004**	**39842-005**	**39842-006**	**40029-002**	**40029-003**	**40029-004**	**40029-005**	**40029-006**	**40029-007**	**40029-008**
Matrix:			**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**
Sample Depth (feet bgs):			**2**	**2**	**2**	**2**	**2**	**0.3 - 2**	**14 - 15**	**39 - 39.5**	**0.5 - 2**	**12 - 13**	**29 - 31**	**0.3 - 2**
Date Sampled:	**Units**		**4/12/2017**	**4/12/2017**	**4/13/2017**	**4/13/2017**	**4/13/2017**	**4/21/2017**	**4/21/2017**	**4/21/2017**	**4/25/2017**	**4/25/2017**	**4/25/2017**	**4/26/2017**
Metals														
Arsenic	mg/kg	11	**50**	**8.3**	**2.8**	**3.4**	7.9	**3.8**	< 3.0	< 3.0	**13**	< 3.0	< 2.8	**19**
Barium	mg/kg	1000	**20**	**26**	**30**	**30**	49	**54**	**21**	**23**	**72**	**36**	**2.6**	**180**
Cadmium	mg/kg	33	<0.5	<0.5	<0.5	<0.5	<0.5	< 0.6	< 0.6	< 0.6	**0.8**	< 0.6	**140**	**0.8**
Chromium (Total)	mg/kg	1000	**280**	**10**	**11**	**8**	18	**15**	< 6	**7**	**160**	**10**	< 0.6	**33**
Lead	mg/kg	400	**17**	**13**	**12**	**16**	**650**	**12**	< 3.0	< 3.0	**730**	**4.4**	**27**	**230**
Mercury	mg/kg	7	<0.16	<0.14	<0.16	<0.16	0.4	< 0.18 J	< 0.17 J	< 0.18 J	< 0.17 J	< 0.17 J	< 0.19 J	< 0.19 J
Selenium	mg/kg	180	<5	<5	<5	<5	<5	< 6	< 6	< 6	< 6	< 6	**9.4**	< 7
Silver	mg/kg	89	<2.5	<2.4	<2.4	<2.5	<2.6	< 2.8	< 3.0	< 3.0	< 2.9	< 3.0	< 6	< 3.5
Hexavalent Chromium	mg/kg	130	NT	NT	NT	NT	NT	NT	NT	NT	NT	NT	NT	NT

Notes:
< - not detected at the reporting limit
J - estimated value
NT - not tested

Italic Underlined = Reporting Limit exceeds action limit.

BOLD=detection
BOLD SHADED=detection exceeds action limit.

Table 3
Summary of Soil Analytical Results - Metals
Ferrari Mill
Franklin, New Hampshire

Sample ID:		**NH Soil Remediation Standards (SRS)**	**NB-3 S-8 14-15'**	**NB-3 S-10 24-26'**	**NB-6 S-1 0.3-2'**	**FD-1 (NB-6 S-1 0.3-2')**	**NB-6 S-7 12-13'**	**NB-6 S-12 34-36'**	**NB-4 S-1 0.3-2'**	**NB-4 S-3 5-6'**	**NB-4 S-8 24-26'**	**NB-5 0.3-2'**	**NB-5 8-10'**
LAB ID:			**40029-009**	**40029-010**	**40096-002**	**40096-003**	**40096-004**	**40096-005**	**40097-002**	**40097-003**	**40097-004**	**40097-005**	**40097-006**
Matrix:			**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**
Sample Depth (feet bgs):			**14 - 15**	**24 - 26**	**0.3 - 2**	**0.3 - 2**	**12 - 13**	**34 - 36**	**0.3 - 2**	**5 - 6**	**24 - 26**	**0.3 - 2**	**8 - 10**
Date Sampled:	**Units**		**4/26/2017**	**4/26/2017**	**5/1/2017**	**5/1/2017**	**5/1/2017**	**5/1/2017**	**4/27/2017**	**4/27/2017**	**4/27/2017**	**4/28/2017**	**4/28/2017**
Metals													
Arsenic	mg/kg	11	< 3.1	< 3.0	**31**	**33**	< 2.9	< 2.7	**4.5**	< 3.1	< 2.7	**5.8**	**4.1**
Barium	mg/kg	1000	**49**	**46**	**38**	**31**	**28**	**60**	**69**	**16**	**15**	**77**	**38**
Cadmium	mg/kg	33	< 0.6	< 0.6	< 0.5	< 0.5	< 0.6	< 0.5	**1.8**	< 0.6	< 0.5	< 0.6	< 0.6
Chromium (Total)	mg/kg	1000	**12**	**14**	**76**	**81**	**9**	**16**	**25**	< 6	< 5	**16**	**15**
Lead	mg/kg	400	**4.4**	**4.0**	**50**	**53**	**3.9**	< 2.7	**29**	< 3.1	< 2.7	**480**	**7.7**
Mercury	mg/kg	7	< 0.21 J	< 0.17 J	< 0.17	< 0.15	< 0.18	< 0.17	< 0.16	< 0.17	< 0.17	< 0.19	< 0.18
Selenium	mg/kg	180	< 6	< 6	< 5	< 5	< 6	< 5	< 5	< 6	< 5	< 6	< 6
Silver	mg/kg	89	< 3.1	< 3.0	< 2.7	< 2.5	< 2.9	< 2.7	< 2.7	< 3.1	< 2.7	< 3.2	< 2.8
Hexavalent Chromium	mg/kg	130	NT	NT	NT	NT	NT	NT	NT	NT	NT	NT	NT

Notes:
< - not detected at the reporting limit
J - estimated value
NT - not tested

Italic Underlined = Reporting Limit exceeds action limit.

BOLD=detection
BOLD SHADED=detection exceeds action limit.

Table 3
Summary of Soil Analytical Results - Metals
Ferrari Mill
Franklin, New Hampshire

Sample ID:		NH Soil Remediation Standards (SRS)	NB-5 24-26	NB-TP-1 3'	NB-TP-2 5'	NB-TP-3 1'	NB-TP-4 1.5'	NB-TP-5 4'	NB-TP-6 4'	UST Bottom	UST Sides/Ends	NB-SS-1	NB-SS-2	NB-SS-3	NB-SS-4	NB-SS-5
LAB ID:			40097-007	40327-002	40327-003	40327-004	40327-005	40327-006	40327-007	40327-008	40327-009	40595-002	40595-003	40595-004	40595-005	40595-006
Matrix:			soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil
Sample Depth (feet bgs):			24 - 26	3	5	1	1.5	4	4	NA	NA	1	1.5	1.5	NA	1-1.5
Date Sampled:	**Units**		4/28/2017	5/17/2017	5/17/2017	5/17/2017	5/17/2017	5/17/2017	5/17/2017	5/18/2017	5/18/2017	6/7/2017	6/7/2017	6/7/2017	6/7/2017	6/7/2017
Metals																
Arsenic	mg/kg	11	< 3.0	**7.4**	**4.7**	**7.9**	**11**	< 2.8	**8.3**	**3.5**	**3.6**	**7.8**	**17**	**7.1**	**4.2**	NT
Barium	mg/kg	1000	**51**	**26**	**26**	**54**	**54**	**34**	**140**	**22**	**23**	**55 J+**	**110 J+**	**58 J+**	**110 J+**	NT
Cadmium	mg/kg	33	< 0.6	< 0.5	< 0.6	< 0.6	< 0.6	< 0.6	< 0.7	< 0.5	< 0.5	< 0.6	< 0.7	< 0.6	< 0.7	NT
Chromium (Total)	mg/kg	1000	**13**	**14**	**10**	**17**	**24**	**10**	**130**	**7**	**7**	**160**	**49**	**26**	**30**	NT
Lead	mg/kg	400	**4.6**	**85**	**3.5**	**180**	**150**	**4.2**	**440**	**13**	**14**	**77**	**300**	**360**	**48**	NT
Mercury	mg/kg	7	< 0.20	< 0.16	< 0.17	**0.24**	**0.28**	< 0.17	**0.90**	< 0.17	< 0.16	< 0.19	**0.28**	< 0.18	< 0.18	NT
Selenium	mg/kg	180	< 6	< 5	< 6	< 6	< 6	< 6	< 7	< 5	< 5	< 6	< 7	< 6	< 7	NT
Silver	mg/kg	89	< 3.0	< 2.7	< 2.8	< 2.8	< 3.2	< 2.8	< 3.3	< 2.6	< 2.6	< 3.2	< 3.5	< 3.0	< 3.4	NT
Hexavalent Chromium	mg/kg	130	NT	**0.69**	NT	NT	**2.2**	NT	NT	NT	NT	**0.62**	< 0.58	**1.3**	< 5.6	NT

Notes:
< - not detected at the reporting limit
J - estimated value
NT - not tested

Italic Underlined = Reporting Limit exceeds action limit.

BOLD=detection
BOLD SHADED=detection exceeds action limit.

Table 3
Summary of Soil Analytical Results - Metals
Ferrari Mill
Franklin, New Hampshire

Sample ID:		**NH Soil Remediation Standards (SRS)**	**NB-SS-6**	**NB-SS-7**	**NB-SS-8**	**NB-SS-9**	**NB-SS-10**	**NB-SS-FD**	**CA-SB-1**	**CA-SB-2**	**CA-SB-2**	**CA-SB-3**	**CA-SB-4**	**CA-SB-4**	**CA-SB-4**	**CA-SB-4**	**CA-SB-5**
LAB ID:			**40595-007**	**40595-008**	**40595-009**	**40595-010**	**40595-011**	**40595-014**									
Matrix:			**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**
Sample Depth (feet bgs):			**1.5**	**1**	**1.3**	**1.2**	**1.3**	**1.5**	**0-2**	**0-2**	**15-17**	**16-18**	**0-7**	**0-7**	**7-9**	**14-16**	**0-4**
Date Sampled:	**Units**		**6/7/2017**	**6/7/2017**	**6/7/2017**	**6/7/2017**	**6/7/2017**	**6/7/2017**	**10/27/2014**	**10/30/2014**	**10/30/2014**	**10/30/2014**	**10/30/2014**	**DUP-1**	**10/30/2014**	**10/30/2014**	**10/30/2014**
Metals																	
Arsenic	mg/kg	11	NT	NT	NT	NT	NT	**16**	ND	**7**	**2**	**1.7**	**14**	**16**	**4.1**	NS	**47**
Barium	mg/kg	1000	NT	NT	NT	NT	NT	**100 J+**	**51**	**53**	**34**	**31**	**63**	**110**	NS	NS	**29**
Cadmium	mg/kg	33	NT	NT	NT	NT	NT	< 0.7	ND	ND	ND	ND	ND	ND	NS	NS	ND
Chromium (Total)	mg/kg	1000	NT	NT	NT	NT	NT	**47**	**12**	**11**	**13**	**9**	**65**	**83**	NS	NS	**150**
Lead	mg/kg	400	NT	NT	NT	NT	NT	**290**	**130**	**31**	**3.5**	**2.9**	**250**	**160**	NS	NS	**43**
Mercury	mg/kg	7	NT	NT	NT	NT	NT	< 0.20	NS	NS	NS	NS	NS	NS	NS	NS	NS
Selenium	mg/kg	180	NT	NT	NT	NT	NT	< 7	ND	ND	ND	ND	**4**	**4**	NS	NS	ND
Silver	mg/kg	89	NT	NT	NT	NT	NT	< 3.4	ND	ND	ND	ND	**0.77**	ND	NS	NS	ND
Hexavalent Chromium	mg/kg	130	NT	NT	NT	NT	NT	< 0.54	NS	NS	NS	NS	NS	NS	NS	NS	NS

Notes:
< - not detected at the reporting limit
J - estimated value
NT - not tested

Italic Underlined = Reporting Limit exceeds action limit.

BOLD=detection
BOLD SHADED=detection exceeds action limit.

Sample ID:		NH Soil Remediation Standards (SRS)	CA-SB-5	CA-SB-5	CA-SB-6	CA-SB-6	CA-TP-A3	CA-TP-1	CA-TP-2	CA-TP-2	CA-TP-2	CA-TP-3	CA-TP-4	CA-SS-1	CA-SS-2	CA-SS-2	CA-SS-3	CA-SS-4
LAB ID:																		
Matrix:			soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil	soil
Sample Depth (feet bgs):			4-6	20-22	0.5-10	10.5-12.5	0-4	0-6	0-3.5	0-3.5	3.5-5.5	3.5-8	1-4	0-2	0-2	0-2	0-2	0-2
Date Sampled:	**Units**		10/30/2014	10/30/2014	10/30/2014	10/30/2014	11/12/2014	11/12/2014	11/12/2014	DUP-2	11/12/2014	11/12/2014	12/18/2014	10/27/2014	10/27/2014	12/18/2014	10/30/2014	10/27/2014
Metals																		
Arsenic	mg/kg	11	**10**	NS	**48**	**0.9**	**92**	**19**	**11**	**10**	NS	**24**	NS	**6.2**	**5.8**	NS	**6.3**	**8.1**
Barium	mg/kg	1000	NS	NS	**41**	NS	NS	NS	NS	NS	NS	NS	NS	**45**	**43**	NS	**33**	**35**
Cadmium	mg/kg	33	NS	NS	ND	NS	NS	ND	**0.4**	**0.2**	NS	**0.5**	NS	ND	**0.4**	NS	ND	ND
Chromium (Total)	mg/kg	1000	**29**	NS	**210**	**10**	**460**	**110**	**38**	**41**	NS	**35**	NS	**27**	**150**	NS	**16**	**46**
Lead	mg/kg	400	NS	NS	**98**	NS	**380**	**870**	**90**	**74**	NS	**95**	NS	**80**	**97**	NS	**36**	**46**
Mercury	mg/kg	7	NS	NS	NS	NS	NS	ND	ND	ND	NS	ND	NS	NS	NS	NS	NS	NS
Selenium	mg/kg	180	NS	NS	ND	NS	NS	ND	ND	ND	NS	ND	NS	ND	ND	NS	ND	ND
Silver	mg/kg	89	NS	NS	ND	NS	NS	ND	ND	ND	NS	ND	NS	ND	ND	NS	ND	ND
Hexavalent Chromium	mg/kg	130	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	**5.7**	NS	NS	ND	NS	NS

Notes:
< - not detected at the reporting limit
J - estimated value
NT - not tested

Italic Underlined = Reporting Limit exceeds action limit.

BOLD=detection
BOLD SHADED=detection exceeds action limit.

Table 3
Summary of Soil Analytical Results - Metals
Ferrari Mill
Franklin, New Hampshire

Sample ID:		**NH Soil Remediation Standards (SRS)**	**CA-SS-5**	**CA-SS-5**	**CA-SS-6**	**CA-SS-7**	**CA-SS-7**	**CA-SS-8**	**CA-SS-9**	**CA-SS-10**	**CA-SS-10**	**CA-SS-11**
LAB ID:												
Matrix:			**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**	**soil**
Sample Depth (feet bgs):			**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**	**0-2**
Date Sampled:	**Units**		**10/27/2014**	**12/18/2014**	**10/27/2014**	**10/27/2014**	**12/18/2014**	**12/18/2014**	**12/18/2014**	**12/18/2014**	**DUP-3**	**12/18/2014**
Metals												
Arsenic	mg/kg	11	**37**	NS	NS	**6.3**	NS	**4.2**	**35**	**55**	**24**	**5**
Barium	mg/kg	1000	**60**	NS	NS	**190**	NS	NS	NS	NS	NS	NS
Cadmium	mg/kg	33	**0.7**	NS	NS	ND	NS	NS	NS	NS	NS	NS
Chromium (Total)	mg/kg	1000	**530**	NS	NS	**450**	NS	**30**	**200**	**1300**	**610**	**53**
Lead	mg/kg	400	**650**	NS	NS	**150**	NS	**74**	**140**	**220**	**270**	**34**
Mercury	mg/kg	7	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
Selenium	mg/kg	180	**11**	NS	NS	**5**	NS	NS	NS	NS	NS	NS
Silver	mg/kg	89	ND	NS	NS	ND	NS	NS	NS	NS	NS	NS
Hexavalent Chromium	mg/kg	130	NS	ND	NS	NS	**4.4**	NS	NS	NS	NS	NS

Notes:
< - not detected at the reporting limit
J - estimated value
NT - not tested

Italic Underlined = Reporting Limit exceeds action limit.

BOLD=detection
BOLD SHADED=detection exceeds action limit.

Table 4
Summary of Soil Analytical Results - DRO
Ferrari Mill
Franklin, New Hampshire

Sample ID:	**Units**	**NH Soil Remediation Standards (SRS)**	**UST Bottom**	**UST Sides/Ends**
LAB ID:			**40327-008**	**40327-009**
Matrix:			**soil**	**soil**
Sample Depth (feet bgs):			**NA**	**NA**
Date Sampled:			**5/18/2017**	**5/18/2017**
Diesel Range Organics (DRO)				
DRO	mg/kg	10000	< 110	< 100

Note:
< - not detected at the reporting limit

Table 5
Summary of Groundwater Elevations
Ferrari Mill
Franklin, New Hampshire

Well ID	Date	Aquifer	Reference Elevation	Measured Depth to Water	Groundwater Elevation
CA-MW-1	6/1/2017	Shallow	95.05	10.42	84.63
CA-MW-2	5/31/2017	Shallow	96.09	13.24	82.85
CA-MW-3	5/31/2017	Shallow	96.30	14.64	81.66
CA-MW-4	5/31/2017	Shallow	94.58	13.32	81.26
CA-MW-5	5/31/2017	Shallow	94.00	12.75	81.25
CA-MW-6	5/31/2017	Shallow	92.70	12.25	80.45
NB-1S	5/31/2017	Shallow	96.38	14.74	81.64
NB-1D	5/31/2017	Deep	96.46	15.44	81.02
NB-2S	5/31/2017	Shallow	94.21	13.25	80.96
NB-2D	5/31/2017	Deep	94.33	13.65	80.68
NB-3S	5/31/2017	Shallow	95.25	14.04	81.21
NB-3D	5/31/2017	Deep	95.45	14.78	80.67
NB-4S	5/31/2017	Shallow	88.08	7.7	80.38
NB-4D	5/31/2017	Deep	88.32	8.43	79.89
NB-5	5/31/2017	Deep	93.44	11.38	82.06
NB-6	5/31/2017	Deep	94.04	13.25	80.79
BR-1	5/31/2017	Bedrock	94.27	13.93	80.34

Notes:

1. Well elevations are referenced to the top of the PVC well casing. All measurements are recorded in feet . "--" indicates no groundwater or product was present during measurement.

2. Elevations are referenced to a temporary benchmark with an arbitrary elevation of 100.00 feet set at top of a fire hydrant on Memorial St. (see site plan).

3. Groundwater elevation measurements were obtained by Nobis Engineering, Inc. on the dates indicated, using a Solinst electronic water level indicator or Solinst electronic interface probe.

4. Monitoring wells NB-1 through NB-6 and BR-1 were installed by New England Boring Contractors (NEBC) under the observation of Nobis Engineering, Inc. (Nobis) on April 19, 2017 through May 1, 2017. Monitoring wells CA-MW-1 through CA-MW-6 were installed previously by Others.

Table 6
Summary of Groundwater Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:	Units	NH Ambient GW Quality Standards (AGQS)	Trip Blank	CA-MW-3	NB-3S	NB-1S	NB-3D	CA-MW-5	FD-1 (CA-MW-5)	NB-4S	NB-1D	NB-4D
LAB ID:			40499-001	40499-002	40499-003	40499-004	40499-005	40499-006	40499-007	40499-008	40499-009	40499-010
Matrix:			aqueous	aqueous	aqueous	aqueous	aqueous	aqueous	aqueous	aqueous	aqueous	aqueous
Date Sampled:			5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017
Volatile Organic Compounds (VOCs)												
1,1,1,2-Tetrachloroethane	µg/L	70	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,1,1-Trichloroethane	µg/L	200	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,1,2,2-Tetrachloroethane	µg/L	2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,1,2-Trichloroethane	µg/L	5	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,1-Dichloroethane	µg/L	81	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,1-Dichloroethene	µg/L	7	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1
1,1-Dichloropropene	µg/L	NE	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,2,3-Trichlorobenzene	µg/L	NE	< 2	< 2	< 2	< 2	< 2 J	< 2	< 2	< 2	< 2	< 2
1,2,3-Trichloropropane	µg/L	0.5	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,2,4-Trichlorobenzene	µg/L	70	< 2	< 2	< 2	< 2	< 2 J	< 2	< 2	< 2	< 2	< 2
1,2,4-Trimethylbenzene	µg/L	330	< 2	< 2	< 2	< 2	< 2	< 2	< 2	**7**	< 2	< 2
1,2-Dibromo-3-chloropropane	µg/L	0.2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,2-Dibromoethane(EDB)	µg/L	0.05	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,2-Dichlorobenzene	µg/L	600	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,2-Dichloroethane	µg/L	5	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,2-Dichloropropane	µg/L	5	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,3,5-Trichlorobenzene	µg/L	40	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,3,5-Trimethylbenzene	µg/L	330	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,3-Dichlorobenzene	µg/L	600	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,3-Dichloropropane	µg/L	NE	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,4-Dichlorobenzene	µg/L	75	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,4-Dioxane*	µg/L	3	< 0.25	< 0.25	< 0.25	< 0.25	< 0.25	< 0.25	< 0.25	< 0.25	< 0.25	< 0.25
2,2-Dichloropropane	µg/L	NE	< 2	< 2	< 2	< 2	< 2 J	< 2	< 2	< 2	< 2	< 2
2-Butanone(MEK)	µg/L	4000	< 10	< 10	< 10	< 10	< 10	< 10	< 10	< 10	< 10	< 10

Table 6
Summary of Groundwater Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:	Units	NH Ambient GW Quality Standards (AGQS)	Trip Blank	CA-MW-3	NB-3S	NB-1S	NB-3D	CA-MW-5	FD-1 (CA-MW-5)	NB-4S	NB-1D	NB-4D
LAB ID:			40499-001	40499-002	40499-003	40499-004	40499-005	40499-006	40499-007	40499-008	40499-009	40499-010
Matrix:			aqueous	aqueous	aqueous	aqueous	aqueous	aqueous	aqueous	aqueous	aqueous	aqueous
Date Sampled:			5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017
Volatile Organic Compounds (VOCs)												
2-Chlorotoluene	µg/L	100	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
2-Hexanone	µg/L	NE	< 10	< 10	< 10	< 10	< 10	< 10	< 10	< 10	< 10	< 10
4-Chlorotoluene	µg/L	NE	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
4-Isopropyltoluene	µg/L	260	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
4-Methyl-2-pentanone(MIBK)	µg/L	2000	< 10	< 10	< 10	< 10	< 10	< 10	< 10	< 10	< 10	< 10
Acetone	µg/L	6000	< 50	< 50	< 50	< 50	< 50	< 50	< 50	< 50	< 50	< 50
Benzene	µg/L	5	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Bromobenzene	µg/L	60	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Bromochloromethane	µg/L	NE	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Bromodichloromethane	µg/L	0.6	< 0.6	< 0.6	< 0.6	< 0.6	< 0.6	< 0.6	< 0.6	< 0.6	< 0.6	< 0.6
Bromoform	µg/L	4	< 2	< 2 R	< 2 R	< 2	< 2	< 2 R	< 2	< 2	< 2	< 2
Bromomethane	µg/L	10	< 2	< 2	< 2	< 2	< 2 J	< 2	< 2	< 2	< 2	< 2
Carbon disulfide	µg/L	70	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Carbon tetrachloride	µg/L	5	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Chlorobenzene	µg/L	100	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Chloroethane	µg/L	NE	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Chloroform	µg/L	70	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Chloromethane	µg/L	30	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
cis-1,2-Dichloroethene	µg/L	70	< 2	< 2	< 2	< 2	< 2	**16**	**16**	< 2	**2**	**82**
cis-1,3-Dichloropropene	µg/L	0.5	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Dibromochloromethane	µg/L	60	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Dibromomethane	µg/L	NE	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Dichlorodifluoromethane	µg/L	1000	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Diethyl Ether	µg/L	1400	< 5	< 5	< 5	< 5	< 5	< 5	< 5	< 5	< 5	< 5

Table 6
Summary of Groundwater Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:	**Units**	**NH Ambient GW Quality Standards (AGQS)**	**Trip Blank**	**CA-MW-3**	**NB-3S**	**NB-1S**	**NB-3D**	**CA-MW-5**	**FD-1 (CA-MW-5)**	**NB-4S**	**NB-1D**	**NB-4D**
LAB ID:			**40499-001**	**40499-002**	**40499-003**	**40499-004**	**40499-005**	**40499-006**	**40499-007**	**40499-008**	**40499-009**	**40499-010**
Matrix:			**aqueous**	**aqueous**	**aqueous**	**aqueous**	**aqueous**	**aqueous**	**aqueous**	**aqueous**	**aqueous**	**aqueous**
Date Sampled:			**5/31/2017**	**5/31/2017**	**5/31/2017**	**5/31/2017**	**5/31/2017**	**5/31/2017**	**5/31/2017**	**5/31/2017**	**5/31/2017**	**5/31/2017**
Volatile Organic Compounds (VOCs)												
Ethyl t-butyl ether (ETBE)	µg/L	40	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Ethylbenzene	µg/L	700	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Hexachlorobutadiene	µg/L	0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Isopropylbenzene	µg/L	800	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Isopropyl ether (DIPE)	µg/L	120	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
m,p-Xylene	µg/L	10000	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Methyl-t-butyl ether(MTBE)	µg/L	13	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Methylene chloride	µg/L	5	< 5	< 5	< 5	< 5	< 5	< 5	< 5	< 5	< 5	< 5
Naphthalene	µg/L	20	< 5	< 5	< 5	< 5	< 5 J	< 5	< 5	< 5	< 5	< 5
n-Butylbenzene	µg/L	260	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
n-Propylbenzene	µg/L	260	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
o-Xylene	µg/L	10000	< 2	< 2	< 2	< 2	< 2	< 2	< 2	**2**	< 2	< 2
sec-Butylbenzene	µg/L	260	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Styrene	µg/L	100	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
tert-amyl-methyl ether (TAME)	µg/L	140	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
t-Butanol (TBA)	µg/L	40	< 30	< 30	< 30	< 30	< 30	< 30	< 30	< 30	< 30	< 30
tert-Butylbenzene	µg/L	260	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Tetrachloroethene	µg/L	5	< 2	< 2	< 2	**2**	< 2	**120**	**120**	**10**	**3**	**42**
Tetrahydrofuran(THF)	µg/L	600	< 10	< 10	< 10	< 10	< 10	< 10	< 10	< 10	< 10	< 10
Toluene	µg/L	1000	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
trans-1,2-Dichloroethene	µg/L	100	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	2
trans-1,3-Dichloropropene	µg/L	0.5	*< 2*	*< 2*	*< 2*	*< 2*	*< 2*	*< 2*	*< 2*	*< 2*	*< 2*	*< 2*
Trichloroethene	µg/L	5	< 2	< 2	< 2	< 2	< 2	**12**	**12**	< 2	**5**	**140**
Trichlorofluoromethane	µg/L	2000	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Vinyl chloride	µg/L	2	< 2	< 2	< 2	< 2	< 2 J	< 2	< 2	< 2	< 2	< 2

Notes:
< - not detected at the reporting limit
J - estimated value; R - rejected
* reported by SIM method
Italic Underlined = Reporting Limit exceeds action limit.
BOLD=detection
BOLD SHADED=detection exceeds action limit.

Table 6
Summary of Groundwater Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:	Units	NH Ambient GW Quality Standards (AGQS)	NB-6	NB-2S	CA-MW-6	NB-2D	CA-MW-4	BR-1	NB-5	CA-MW-1	CA-MW-2
LAB ID:			40499-011	40499-012	40499-013	40499-014	40499-015	40499-016	40499-017	40499-018	40499-019
Matrix:			aqueous	aqueous	aqueous	aqueous	aqueous	aqueous	aqueous	aqueous	aqueous
Date Sampled:			5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017	6/1/2017	6/1/2017	6/1/2017
Volatile Organic Compounds (VOCs)											
1,1,1,2-Tetrachloroethane	µg/L	70	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,1,1-Trichloroethane	µg/L	200	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,1,2,2-Tetrachloroethane	µg/L	2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,1,2-Trichloroethane	µg/L	5	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,1-Dichloroethane	µg/L	81	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,1-Dichloroethene	µg/L	7	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1
1,1-Dichloropropene	µg/L	NE	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,2,3-Trichlorobenzene	µg/L	NE	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,2,3-Trichloropropane	µg/L	0.5	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,2,4-Trichlorobenzene	µg/L	70	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,2,4-Trimethylbenzene	µg/L	330	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,2-Dibromo-3-chloropropane	µg/L	0.2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,2-Dibromoethane(EDB)	µg/L	0.05	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,2-Dichlorobenzene	µg/L	600	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,2-Dichloroethane	µg/L	5	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,2-Dichloropropane	µg/L	5	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,3,5-Trichlorobenzene	µg/L	40	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,3,5-Trimethylbenzene	µg/L	330	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,3-Dichlorobenzene	µg/L	600	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,3-Dichloropropane	µg/L	NE	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,4-Dichlorobenzene	µg/L	75	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
1,4-Dioxane*	µg/L	3	**0.30**	**0.30**	< 0.25	< 0.25	**0.69**	**0.63**	< 0.25	**0.71**	**0.40**
2,2-Dichloropropane	µg/L	NE	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
2-Butanone(MEK)	µg/L	4000	< 10	< 10	< 10	< 10	< 10	< 10	< 10	< 10	< 10

Table 6
Summary of Groundwater Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:	Units	NH Ambient GW Quality Standards (AGQS)	NB-6	NB-2S	CA-MW-6	NB-2D	CA-MW-4	BR-1	NB-5	CA-MW-1	CA-MW-2
LAB ID:			40499-011	40499-012	40499-013	40499-014	40499-015	40499-016	40499-017	40499-018	40499-019
Matrix:			aqueous	aqueous	aqueous	aqueous	aqueous	aqueous	aqueous	aqueous	aqueous
Date Sampled:			5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017	6/1/2017	6/1/2017	6/1/2017
Volatile Organic Compounds (VOCs)											
2-Chlorotoluene	µg/L	100	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
2-Hexanone	µg/L	NE	< 10	< 10	< 10	< 10	< 10	< 10	< 10	< 10	< 10
4-Chlorotoluene	µg/L	NE	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
4-Isopropyltoluene	µg/L	260	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
4-Methyl-2-pentanone(MIBK)	µg/L	2000	< 10	< 10	< 10	< 10	< 10	< 10	< 10	< 10	< 10
Acetone	µg/L	6000	< 50	< 50	< 50	< 50	< 50	< 50	< 50	< 50	< 50
Benzene	µg/L	5	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Bromobenzene	µg/L	60	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Bromochloromethane	µg/L	NE	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Bromodichloromethane	µg/L	0.6	< 0.6	< 0.6	< 0.6	< 0.6	< 0.6	< 0.6	< 0.6	< 0.6	< 0.6
Bromoform	µg/L	4	< 2	< 2	< 2 R	< 2	< 2 R	< 2	< 2	< 2 R	< 2 R
Bromomethane	µg/L	10	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Carbon disulfide	µg/L	70	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Carbon tetrachloride	µg/L	5	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Chlorobenzene	µg/L	100	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Chloroethane	µg/L	NE	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Chloroform	µg/L	70	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Chloromethane	µg/L	30	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
cis-1,2-Dichloroethene	µg/L	70	**2**	< 2	**9**	**7**	< 2	**8**	< 2	< 2	< 2
cis-1,3-Dichloropropene	µg/L	0.5	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Dibromochloromethane	µg/L	60	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Dibromomethane	µg/L	NE	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Dichlorodifluoromethane	µg/L	1000	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Diethyl Ether	µg/L	1400	< 5	< 5	< 5	< 5	< 5	< 5	< 5	< 5	< 5

Sample ID:	Units	NH Ambient GW Quality Standards (AGQS)	NB-6	NB-2S	CA-MW-6	NB-2D	CA-MW-4	BR-1	NB-5	CA-MW-1	CA-MW-2
LAB ID:			40499-011	40499-012	40499-013	40499-014	40499-015	40499-016	40499-017	40499-018	40499-019
Matrix:			aqueous	aqueous	aqueous	aqueous	aqueous	aqueous	aqueous	aqueous	aqueous
Date Sampled:			5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017	6/1/2017	6/1/2017	6/1/2017
Volatile Organic Compounds (VOCs)											
Ethyl t-butyl ether (ETBE)	µg/L	40	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Ethylbenzene	µg/L	700	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Hexachlorobutadiene	µg/L	0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Isopropylbenzene	µg/L	800	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Isopropyl ether (DIPE)	µg/L	120	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
m,p-Xylene	µg/L	10000	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Methyl-t-butyl ether(MTBE)	µg/L	13	**12**	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Methylene chloride	µg/L	5	< 5	< 5	< 5	< 5	< 5	< 5	< 5	< 5	< 5
Naphthalene	µg/L	20	< 5	< 5	< 5	< 5	< 5	< 5	< 5	< 5	< 5
n-Butylbenzene	µg/L	260	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
n-Propylbenzene	µg/L	260	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
o-Xylene	µg/L	10000	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
sec-Butylbenzene	µg/L	260	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Styrene	µg/L	100	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
tert-amyl-methyl ether (TAME)	µg/L	140	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
t-Butanol (TBA)	µg/L	40	< 30	< 30	< 30	< 30	< 30	< 30	< 30	< 30	< 30
tert-Butylbenzene	µg/L	260	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Tetrachloroethene	µg/L	5	< 2	**21**	**30**	**3**	< 2	< 2	< 2	< 2	< 2
Tetrahydrofuran(THF)	µg/L	600	< 10	< 10	< 10	< 10	< 10	< 10	< 10	< 10	< 10
Toluene	µg/L	1000	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
trans-1,2-Dichloroethene	µg/L	100	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
trans-1,3-Dichloropropene	µg/L	0.5	*< 2*	*< 2*	*< 2*	*< 2*	*< 2*	*< 2*	*< 2*	*< 2*	*< 2*
Trichloroethene	µg/L	5	**5**	< 2	**6**	**23**	< 2	**6**	**2**	< 2	< 2
Trichlorofluoromethane	µg/L	2000	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2
Vinyl chloride	µg/L	2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2	< 2

Notes:
< - not detected at the reporting limit
J - estimated value; R - rejected
* reported by SIM method
Italic Underlined = Reporting Limit exceeds action limit.
BOLD=detection
BOLD SHADED=detection exceeds action limit.

Table 7
Summary of Groundwater Analytical Results - PAHs
Ferrari Mill
Franklin, New Hampshire

Sample ID:	Units	NH Ambient GW Quality Standards (AGQS)	CA-MW-3	NB-3S	NB-1S	NB-3D	CA-MW-5	FD-1 (CA-MW-5)	NB-4S	NB-1D	NB-4D
LAB ID:			40499-002	40499-003	40499-004	40499-005	40499-006	40499-007	40499-008	40499-009	40499-010
Matrix:			aqueous	aqueous	aqueous	aqueous	aqueous	aqueous	aqueous	aqueous	aqueous
Date Sampled:			5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017	5/31/2017
Polycyclic Aromatic Hydrocarbons (PAHs)											
2-Methylnaphthalene	µg/L	280	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Acenaphthene	µg/L	420	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Acenaphthylene	µg/L	420	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Anthracene	µg/L	2100	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Benzo[a]anthracene	µg/L	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	**0.2**
Benzo[a]pyrene	µg/L	0.2	< 0.2	< 0.2	< 0.2	< 0.2	< 0.2	< 0.2	< 0.2	< 0.2	< 0.2
Benzo[b]fluoranthene	µg/L	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	**0.2**
Benzo[g,h,i]perylene	µg/L	210	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Benzo[k]fluoranthene	µg/L	0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Chrysene	µg/L	5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Dibenz[a,h]anthracene	µg/L	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Fluoranthene	µg/L	280	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Fluorene	µg/L	280	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Indeno[1,2,3-cd]pyrene	µg/L	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Naphthalene	µg/L	20	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Phenanthrene	µg/L	210	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Pyrene	µg/L	210	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5

Notes:
< - not detected at the reporting limit
J - estimated value
Italic Underlined = Reporting Limit exceeds action limit.
BOLD=detection
BOLD SHADED=detection exceeds action limit.

Table 7
Summary of Groundwater Analytical Results - PAHs
Ferrari Mill
Franklin, New Hampshire

Sample ID:	Units	NH Ambient GW Quality Standards (AGQS)	NB-6	NB-2S	CA-MW-6	NB-2D	CA-MW-4	BR-1	NB-5	CA-MW-1	CA-MW-2
LAB ID:			**40499-011**	**40499-012**	**40499-013**	**40499-014**	**40499-015**	**40499-016**	**40499-017**	**40499-018**	**40499-019**
Matrix:			**aqueous**	**aqueous**	**aqueous**	**aqueous**	**aqueous**	**aqueous**	**aqueous**	**aqueous**	**aqueous**
Date Sampled:			**5/31/2017**	**5/31/2017**	**5/31/2017**	**5/31/2017**	**5/31/2017**	**5/31/2017**	**6/1/2017**	**6/1/2017**	**6/1/2017**
Polycyclic Aromatic Hydrocarbons (PAHs)											
2-Methylnaphthalene	µg/L	280	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Acenaphthene	µg/L	420	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Acenaphthylene	µg/L	420	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Anthracene	µg/L	2100	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Benzo[a]anthracene	µg/L	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Benzo[a]pyrene	µg/L	0.2	< 0.2	< 0.2	< 0.2	< 0.2	< 0.2	< 0.2	< 0.2	< 0.2	< 0.2
Benzo[b]fluoranthene	µg/L	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Benzo[g,h,i]perylene	µg/L	210	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Benzo[k]fluoranthene	µg/L	0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Chrysene	µg/L	5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Dibenz[a,h]anthracene	µg/L	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Fluoranthene	µg/L	280	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Fluorene	µg/L	280	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Indeno[1,2,3-cd]pyrene	µg/L	0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1
Naphthalene	µg/L	20	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Phenanthrene	µg/L	210	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5
Pyrene	µg/L	210	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5

Notes:
< - not detected at the reporting limit
J - estimated value
Italic Underlined = Reporting Limit exceeds action limit.
BOLD=detection
BOLD SHADED=detection exceeds action limit.

Table 8
Summary of Groundwater Analytical Results - Metals
Ferrari Mill
Franklin, New Hampshire

Sample ID:		**NH Ambient GW Quality Standards (AGQS)**	**CA-MW-3**	**NB-3S**	**NB-1S**	**NB-3D**	**CA-MW-5**	**FD-1 (CA-MW-5)**	**NB-4S**	**NB-1D**	**NB-4D**
LAB ID:			**40499-002**	**40499-003**	**40499-004**	**40499-005**	**40499-006**	**40499-007**	**40499-008**	**40499-009**	**40499-010**
Matrix:			**aqueous**	**aqueous**	**aqueous**	**aqueous**	**aqueous**	**aqueous**	**aqueous**	**aqueous**	**aqueous**
Date Sampled:	**Units**		**5/31/2017**	**5/31/2017**	**5/31/2017**	**5/31/2017**	**5/31/2017**	**5/31/2017**	**5/31/2017**	**5/31/2017**	**5/31/2017**
Metals											
Arsenic	mg/L	0.01	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005
Barium	mg/L	2	< 0.01	**0.22**	**0.01**	**0.01**	**0.03**	**0.03**	**0.06**	**0.03**	**0.06**
Cadmium	mg/L	0.005	< 0.001	< 0.001	< 0.001	< 0.001	< 0.001	< 0.001	< 0.001	< 0.001	< 0.001
Chromium (Total)	mg/L	0.1	< 0.01	< 0.01	< 0.01	< 0.01	< 0.01	< 0.01	< 0.01	< 0.01	< 0.01
Lead	mg/L	0.015	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005
Mercury	mg/L	0.002	< 0.0002	< 0.0002	< 0.0002	< 0.0002	< 0.0002	< 0.0002	< 0.0002	< 0.0002	< 0.0002
Selenium	mg/L	0.05	< 0.01	< 0.01	< 0.01	< 0.01	< 0.01	< 0.01	< 0.01	< 0.01	< 0.01
Silver	mg/L	0.1	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005

Notes:
< - not detected at the reporting limit
J - estimated value

Italic Underlined = Reporting Limit exceeds action limit.

BOLD=detection
BOLD SHADED=detection exceeds action limit.

Table 8
Summary of Groundwater Analytical Results - Metals
Ferrari Mill
Franklin, New Hampshire

Sample ID:		**NH Ambient GW Quality Standards (AGQS)**	**NB-6**	**NB-2S**	**CA-MW-6**	**NB-2D**	**CA-MW-4**	**BR-1**	**NB-5**	**CA-MW-1**	**CA-MW-2**
LAB ID:			**40499-011**	**40499-012**	**40499-013**	**40499-014**	**40499-015**	**40499-016**	**40499-017**	**40499-018**	**40499-019**
Matrix:			**aqueous**	**aqueous**	**aqueous**	**aqueous**	**aqueous**	**aqueous**	**aqueous**	**aqueous**	**aqueous**
Date Sampled:	**Units**		**5/31/2017**	**5/31/2017**	**5/31/2017**	**5/31/2017**	**5/31/2017**	**5/31/2017**	**6/1/2017**	**6/1/2017**	**6/1/2017**
Metals											
Arsenic	mg/L	0.01	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005	**0.005**	< 0.005	< 0.005
Barium	mg/L	2	**0.06**	**0.05**	**0.05**	**0.04**	**0.04**	**0.41**	**0.04**	**0.06**	**0.06**
Cadmium	mg/L	0.005	< 0.001	< 0.001	< 0.001	< 0.001	< 0.001	< 0.001	< 0.001	< 0.001	< 0.001
Chromium (Total)	mg/L	0.1	< 0.01	< 0.01	< 0.01	< 0.01	< 0.01	**0.09**	< 0.01	< 0.01	< 0.01
Lead	mg/L	0.015	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005
Mercury	mg/L	0.002	< 0.0002	< 0.0002	< 0.0002	< 0.0002	< 0.0002	< 0.0002	< 0.0002	< 0.0002	< 0.0002
Selenium	mg/L	0.05	< 0.01	< 0.01	< 0.01	< 0.01	< 0.01	< 0.01	< 0.01	< 0.01	< 0.01
Silver	mg/L	0.1	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005	< 0.005

Notes:
< - not detected at the reporting limit
J - estimated value

Italic Underlined = Reporting Limit exceeds action limit.

BOLD=detection
BOLD SHADED=detection exceeds action limit.

Table 9
Summary of Soil Gas Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		**NH Residential Soil Gas Screening Levels**	**AR-1**	**AR-2**	**AR-3**	**AR-4**	**Duplicate (AR-2)**	**SM-1**	**SM-2**	**SM-3**	**SM-4**	**SM-5**
LAB ID:			**17D1327-01**	**17D1327-02**	**17D1327-04**	**17D1327-05**	**17D1327-03**	**17D1327-06**	**17D1327-07**	**17D1327-08**	**17D1327-09**	**17D1327-10**
Matrix:			**soil gas**	**soil gas**	**soil gas**	**soil gas**	**soil gas**	**soil gas**	**soil gas**	**soil gas**	**soil gas**	**soil gas**
Date Sampled:	**Units**		**4/26/2017**	**4/26/2017**	**4/26/2017**	**4/26/2017**	**4/26/2017**	**4/26/2017**	**4/26/2017**	**4/26/2017**	**4/26/2017**	**4/26/2017**
Volatile Organic Compounds (VOCs)												
1,1,1-TRICHLOROETHANE	µg/m³	50000	< 0.55	< 0.55	< 0.55	< 0.55	< 0.55	< 0.55	< 0.55	< 0.55	< 0.55	< 0.55
1,1,2,2-TETRACHLOROETHANE	µg/m³	4	*< 0.69*	*< 0.69*	*< 0.69*	*< 0.69*	*< 0.69*	*< 0.69*	*< 0.69*	*< 0.69*	*< 0.69*	*< 0.69*
1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE	µg/m³	NE	< 3.1	< 3.1	< 3.1	< 3.1	< 3.1	< 3.1	< 3.1	< 3.1	< 3.1	< 3.1
1,1,2-TRICHLOROETHANE	µg/m³	2	*< 0.55*	*< 0.55*	*< 0.55*	*< 0.55*	*< 0.55*	*< 0.55*	*< 0.55*	*< 0.55*	*< 0.55*	*< 0.55*
1,1-DICHLOROETHANE	µg/m³	80	< 0.4	< 0.4	< 0.4	< 0.4	< 0.4	< 0.4	< 0.4	< 0.4	< 0.4	< 0.4
1,1-DICHLOROETHYLENE	µg/m³	2000	< 0.4	< 0.4	< 0.4	< 0.4	< 0.4	< 0.4	< 0.4	< 0.4	< 0.4	< 0.4
1,2,4-TRICHLOROBENZENE	µg/m³	20	*< 0.74*	*< 0.74*	*< 0.74*	*< 0.74*	*< 0.74*	*< 0.74*	*< 0.74*	*< 0.74*	*< 0.74*	*< 0.74*
1,2,4-TRIMETHYLBENZENE	µg/m³	170	**4.7**	**4.4**	**5.1**	**4.8**	**4.6**	**4.4**	**4.6**	**4.3**	**4.7**	**4.1**
1,2-DIBROMOETHANE (EDB)	µg/m³	2	*< 0.77*	*< 0.77*	*< 0.77*	*< 0.77*	*< 0.77*	*< 0.77*	*< 0.77*	*< 0.77*	*< 0.77*	*< 0.77*
1,2-DICHLORO-1,1,2,2-TETRAFLUOROETHANE	µg/m³	NE	< 0.7	< 0.7	< 0.7	< 0.7	< 0.7	< 0.7	< 0.7	< 0.7	< 0.7	< 0.7
1,2-DICHLOROBENZENE	µg/m³	2000	< 0.6	< 0.6	< 0.6	< 0.6	< 0.6	< 0.6	< 0.6	< 0.6	< 0.6	< 0.6
1,2-DICHLOROETHANE	µg/m³	10	*< 0.4*	*< 0.4*	*< 0.4*	*< 0.4*	*< 0.4*	*< 0.4*	*< 0.4*	*< 0.4*	*< 0.4*	*< 0.4*
1,2-DICHLOROPROPANE	µg/m³	10	*< 0.46*	*< 0.46*	*< 0.46*	*< 0.46*	*< 0.46*	*< 0.46*	*< 0.46*	*< 0.46*	*< 0.46*	*< 0.46*
1,3,5-TRIMETHYLBENZENE	µg/m³	NE	**0.65**	**0.62**	**0.63**	**0.69**	**0.55**	**0.53**	**0.63**	**0.62**	**0.59**	**0.57**
1,3-BUTADIENE	µg/m³	NE	< 0.22	< 0.22	< 0.22	< 0.22	< 0.22	< 0.22	< 0.22	< 0.22	< 0.22	< 0.22
1,3-DICHLOROBENZENE	µg/m³	NE	**7.1**	**7.6**	**7.4**	**7.2**	**7.6**	**7.3**	**9**	**9**	**8.4**	**7.6**
1,4-DICHLOROBENZENE	µg/m³	10	**1.9**	**1.8**	**1.9**	**1.6**	**1.8**	**1.3**	**1.6**	**1.6**	**1.6**	**1.6**
1,4-DIOXANE	µg/m³	NE	< 3.6	< 3.6	< 3.6	< 3.6	< 3.6	< 3.6	< 3.6	< 3.6	< 3.6	< 3.6
2-BUTANONE (MEK)	µg/m³	50000	< 12	< 12	< 12	< 12	< 12	< 12	< 12	< 12	< 12	< 12
2-HEXANONE	µg/m³	NE	< 0.41	< 0.41	< 0.41	< 0.41	< 0.41	< 0.41	< 0.41	**0.47**	< 0.41	< 0.41
4-ETHYLTOLUENE	µg/m³	NE	**0.9**	**0.78**	**0.87**	**0.96**	**0.81**	**0.68**	**0.81**	**0.95**	**0.79**	**0.78**
4-METHYL-2-PENTANONE (MIBK)	µg/m³	30000	< 0.41	< 0.41	< 0.41	< 0.41	< 0.41	< 0.41	< 0.41	< 0.41	< 0.41	< 0.41
ACETONE	µg/m³	NE	< 9.5	**12**	< 9.5	< 9.5	**10**	< 9.5	< 9.5	< 9.5	< 9.5	**9.5**

Table 9
Summary of Soil Gas Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		**NH Residential Soil Gas Screening Levels**	**AR-1**	**AR-2**	**AR-3**	**AR-4**	**Duplicate (AR-2)**	**SM-1**	**SM-2**	**SM-3**	**SM-4**	**SM-5**
LAB ID:			**17D1327-01**	**17D1327-02**	**17D1327-04**	**17D1327-05**	**17D1327-03**	**17D1327-06**	**17D1327-07**	**17D1327-08**	**17D1327-09**	**17D1327-10**
Matrix:			**soil gas**	**soil gas**	**soil gas**	**soil gas**	**soil gas**	**soil gas**	**soil gas**	**soil gas**	**soil gas**	**soil gas**
Date Sampled:	**Units**		**4/26/2017**	**4/26/2017**	**4/26/2017**	**4/26/2017**	**4/26/2017**	**4/26/2017**	**4/26/2017**	**4/26/2017**	**4/26/2017**	**4/26/2017**
Volatile Organic Compounds (VOCs)												
BENZENE	µg/m³	170	**0.58**	**0.64**	**0.33**	**0.52**	**0.64**	**0.93**	**0.75**	**0.42**	**0.68**	**0.44**
BENZYL CHLORIDE	µg/m³	NE	< 0.52	< 0.52	< 0.52	< 0.52	< 0.52	< 0.52	< 0.52	< 0.52	< 0.52	< 0.52
BROMODICHLOROMETHANE	µg/m³	NE	< 0.67	< 0.67	< 0.67	< 0.67	< 0.67	< 0.67	< 0.67	< 0.67	< 0.67	< 0.67
BROMOFORM	µg/m³	50	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1	< 1
BROMOMETHANE	µg/m³	NE	< 0.39	< 0.39	< 0.39	< 0.39	< 0.39	< 0.39	< 0.39	< 0.39	< 0.39	< 0.39
CARBON DISULFIDE	µg/m³	NE	< 3.1	< 3.1	< 3.1	< 3.1	< 3.1	< 3.1	< 3.1	< 3.1	< 3.1	< 3.1
CARBON TETRACHLORIDE	µg/m³	20	*< 0.63*	*< 0.63*	*< 0.63*	*< 0.63*	*< 0.63*	*< 0.63*	*< 0.63*	*< 0.63*	*< 0.63*	*< 0.63*
CHLOROBENZENE	µg/m³	500	< 0.46	< 0.46	< 0.46	< 0.46	< 0.46	< 0.46	< 0.46	< 0.46	< 0.46	< 0.46
CHLORODIBROMOMETHANE	µg/m³	NE	< 0.85	< 0.85	< 0.85	< 0.85	< 0.85	< 0.85	< 0.85	< 0.85	< 0.85	< 0.85
CHLOROETHANE	µg/m³	NE	< 0.26	< 0.26	< 0.26	< 0.26	< 0.26	< 0.26	< 0.26	< 0.26	< 0.26	< 0.26
CHLOROFORM	µg/m³	10	*< 0.49*	*< 0.49*	*< 0.49*	*< 0.49*	*< 0.49*	**1**	*< 0.49*	*< 0.49*	*< 0.49*	*< 0.49*
CHLOROMETHANE	µg/m³	NE	< 0.41	< 0.41	< 0.41	< 0.41	< 0.41	< 0.41	< 0.41	< 0.41	< 0.41	< 0.41
CIS-1,2-DICHLOROETHYLENE	µg/m³	NE	< 0.4	< 0.4	< 0.4	< 0.4	< 0.4	**3.7**	< 0.4	< 0.4	< 0.4	< 0.4
CIS-1,3-DICHLOROPROPENE	µg/m³	NE	< 0.45	< 0.45	< 0.45	< 0.45	< 0.45	< 0.45	< 0.45	< 0.45	< 0.45	< 0.45
CYCLOHEXANE	µg/m³	NE	< 0.34	< 0.34	< 0.34	< 0.34	< 0.34	< 0.34	< 0.34	< 0.34	**1.1**	< 0.34
DICHLORODIFLUOROMETHANE	µg/m³	NE	**1 J**	**1.4 J**	**1.2 J**	**1.2 J**	**1.3 J**	**1 J**	**1.2 J**	**1 J**	**1.1 J**	**1.1 J**
ETHANOL	µg/m³	NE	**67**	**47**	**42**	**56**	**46**	**89**	**82**	**54**	**87**	**73**
ETHYL ACETATE	µg/m³	NE	**0.76**	**0.74**	< 0.36	**1.2**	**0.66**	**1.2**	**1**	**0.46**	**0.98**	**0.68**
ETHYLBENZENE	µg/m³	100	**3.4**	**2.3**	**2.4**	**3.2**	**2.5**	**3.6**	**3.6**	**2.9**	**3.5**	**2.8**
HEPTANE	µg/m³	NE	**1**	**1.2**	**0.54**	**0.97**	**1.5**	**1.4**	**1.4**	**0.78**	**1.2**	**0.74**
HEXACHLOROBUTADIENE	µg/m³	NE	< 1.1	< 1.1	< 1.1	< 1.1	< 1.1	< 1.1	< 1.1	< 1.1	< 1.1	< 1.1
HEXANE	µg/m³	NE	< 14	< 14	< 14	< 14	< 14	< 14	< 14	< 14	< 14	< 14
ISOPROPANOL	µg/m³	NE	**39**	**28**	**24**	**34**	**29**	**66**	**57**	**39**	**62**	**53**

Table 9
Summary of Soil Gas Analytical Results - VOCs
Ferrari Mill
Franklin, New Hampshire

Sample ID:		**NH Residential Soil Gas Screening Levels**	**AR-1**	**AR-2**	**AR-3**	**AR-4**	**Duplicate (AR-2)**	**SM-1**	**SM-2**	**SM-3**	**SM-4**	**SM-5**
LAB ID:			**17D1327-01**	**17D1327-02**	**17D1327-04**	**17D1327-05**	**17D1327-03**	**17D1327-06**	**17D1327-07**	**17D1327-08**	**17D1327-09**	**17D1327-10**
Matrix:			**soil gas**	**soil gas**	**soil gas**	**soil gas**	**soil gas**	**soil gas**	**soil gas**	**soil gas**	**soil gas**	**soil gas**
Date Sampled:	**Units**		**4/26/2017**	**4/26/2017**	**4/26/2017**	**4/26/2017**	**4/26/2017**	**4/26/2017**	**4/26/2017**	**4/26/2017**	**4/26/2017**	**4/26/2017**
Volatile Organic Compounds (VOCs)												
M/P-XYLENE	µg/m³	1000	**12**	**8.8**	**8.6**	**11**	**9**	**13**	**13**	**11**	**13**	**10**
METHYL TERT-BUTYL ETHER (MTBE)	µg/m³	170	< 0.36	< 0.36	< 0.36	< 0.36	< 0.36	< 0.36	< 0.36	< 0.36	< 0.36	< 0.36
METHYLENE CHLORIDE	µg/m³	6000	< 3.5	< 3.5	< 3.5	< 3.5	< 3.5	< 3.5	< 3.5	< 3.5	< 3.5	< 3.5
NAPHTHALENE	µg/m³	60	*< 0.52*	*< 0.52*	*< 0.52*	*< 0.52*	*< 0.52*	*< 0.52*	*< 0.52*	*< 0.52*	*< 0.52*	*< 0.52*
O-XYLENE	µg/m³	1000	**4**	**3**	**3**	**3.8**	**3.1**	**4.2**	**4.2**	**3.6**	**4.1**	**3.5**
PROPENE	µg/m³	NE	< 6.9	< 6.9	< 6.9	< 6.9	< 6.9	< 6.9	< 6.9	< 6.9	< 6.9	< 6.9
STYRENE	µg/m³	10000	**0.49**	< 0.43	< 0.43	**0.53**	< 0.43	**0.44**	**0.48**	< 0.43	**0.45**	< 0.43
TETRACHLOROETHYLENE	µg/m³	400	**2.2**	**89**	**45**	**0.84**	**90**	**2,100**	**110**	**62**	**25**	**2.3**
TETRAHYDROFURAN	µg/m³	NE	< 0.29	< 0.29	< 0.29	< 0.29	< 0.29	**0.29**	**0.29**	< 0.29	< 0.29	< 0.29
TOLUENE	µg/m³	50000	**13**	**7.7**	**6.6**	**11**	**8**	**18**	**17**	**10**	**16**	**9.5**
TRANS-1,2-DICHLOROETHYLENE	µg/m³	600	< 0.4	< 0.4	< 0.4	< 0.4	< 0.4	< 0.4	< 0.4	< 0.4	< 0.4	< 0.4
TRANS-1,3-DICHLOROPROPENE	µg/m³	NE	*< 0.45*	*< 0.45*	*< 0.45*	*< 0.45*	*< 0.45*	*< 0.45*	*< 0.45*	*< 0.45*	*< 0.45*	*< 0.45*
TRICHLOROETHYLENE	µg/m³	20	< 0.54	< 0.54	< 0.54	< 0.54	< 0.54	**74**	< 0.54	< 0.54	< 0.54	< 0.54
TRICHLOROFLUOROMETHANE	µg/m³	NE	< 2.2	< 2.2	**3.1**	**2.9**	< 2.2	< 2.2	< 2.2	< 2.2	< 2.2	< 2.2
VINYL ACETATE	µg/m³	NE	< 7	< 7	< 7	< 7	< 7	< 7	< 7	< 7	< 7	< 7
VINYL CHLORIDE	µg/m³	20	< 0.26	< 0.26	< 0.26	< 0.26	< 0.26	< 0.26	< 0.26	< 0.26	< 0.26	< 0.26

Notes:
< - not detected at the reporting limit
J - estimated value
* indicates total xylene result
Italic Underlined = Reporting Limit exceeds action limit.
BOLD=detection
BOLD SHADED=detection exceeds action limit.

Table 10
Summary of Asbestos Analytical Results
Ferrari Mill
Franklin, New Hampshire

Sample Number	Sample Location	Type of Material[1]	Asbestos % and Type[2]	Friable or Non-Friable[3]	Physical Condition[4]	Accessibility / Potential for Disturbances[5]	Estimated Quantity of ACM (SF/LF/CF)
A-1	**Back Room, off Main Room** **Tan Speckled Sheet Flooring**	**M**	**20% CH**	**NF**	**D**	**Moderate**	**400 SF**
A-2	Back Room, off Main Room Tan Speckled Sheet Flooring	M	Not Analyzed				
A-3 Floor Tile	**Bathroom of Main Room** **Brown 12x12 Floor Tile**	**M**	**3% CH**	**NF**	**D**	**Moderate**	**600 SF**
A-3 Mastic	**Bathroom of Main Room** **Brown 12x12 Floor Tile - Mastic**	**M**	**3% Ch**	**NF**	**D**	**Low**	**600 SF**
A-4 Floor Tile	Bathroom of Main Room Brown 12x12 Floor Tile	M	Not Analyzed				
A-4 Mastic	Bathroom of Main Room Brown 12x12 Floor Tile - Mastic	M	Not Analyzed				
A-5	Front Storage Room Black Asphalt Shingle Roll	M	NAD				
A-6	Front Storage Room Black Asphalt Shingle Roll	M	NAD				
A-7	Exterior Roof Black Asphalt Shingle	M	NAD				
A-8	Exterior - Roof Black Asphalt Shingle	M	NAD				
A-9	**Interior of Windows** **Window Glazing**	**M**	**3% CH**	**F**	**D**	**Moderate**	**14 Units**
A-10	Interior of Windows Window Glazing	M	Not Analyzed				

Table 10
Summary of Asbestos Analytical Results
Ferrari Mill
Franklin, New Hampshire

Sample Number	Sample Location	Type of Material[1]	Asbestos % and Type[2]	Friable or Non-Friable[3]	Physical Condition[4]	Accessibility / Potential for Disturbances[5]	Estimated Quantity of ACM (SF/LF/CF)
SM-1	**Basement - Near Boiler Gasket**	**M**	**60% CH**	**NF**	**D**	**Moderate**	**15 LF**
SM-2 Sheetrock	1st Floor - Yellow Room Sheetrock	M	NAD				
SM-2 Joint Compound	1st Floor - Yellow Room Joint Compound	M	NAD				
SM-3	**1st Floor- Bathroom across from Offices Multi-Colored Sheet Flooring**	**M**	**20% Ch**	**NF**	**D**	**Moderate**	**400 SF**
SM-4	**1st Floor - Bathroom in office area Textured Tan/Brown Sheet Flooring**	**M**	**15% Ch**	**NF**	**D**	**Moderate**	**400 SF**
SM-5 Desktop	1st Floor - Office Admin Area Black Desktop	M	NAD				
SM-5 Mastic	1st Floor - Office Admin Area Black Desktop Mastic	M	NAD				
SM-6 Base Cove	1st Floor - Bathroom White Base Cove	M	NAD				
SM-6 Mastic	1st Floor Bathroom Base Cove Mastic	M	NAD				
SM-7	1st Floor - Second Room on Right Green Peg Board	M	NAD				
SM-8	1st Floor Office Area Wallboard	M	NAD				
SM-9	**1st Floor - Bathroom Brown Glue Dab**	**M**	**2% CH**	**NF**	**D**	**Moderate**	**600 SF**
SM-10	**Exterior Black Caulk**	**M**	**5% CH**	**NF**	**D**	**Moderate**	**600 LF**
PASM-1	**Exterior of Armory Transite Siding**	**M**		**NF**	**D**	**Moderate**	**600 SF**

Sample Number	Sample Location	Type of Material[1]	Asbestos % and Type[2]	Friable or Non-Friable[3]	Physical Condition[4]	Accessibility / Potential for Disturbances[5]	Estimated Quantity of ACM (SF/LF/CF)
Asbestos-Containing Building Materials Summary from June 18, 2015							
CA-PACM-1	Stanley Mill/Basement Pipe Wrap	TSI	50% CH	F	SD	Moderate	200 LF
CA-PACM-2	Stanley Mill/Basement Mudded Elbows	TSI	40% CH	F	SD	Moderate	20
CA-PACM-3	Stanley Mill/1st Floor Pipe Wrap	TSI	25% CH	F	SD	Moderate	100 LF
CA-PACM-4	Stanley Mill/1st Floor Mudded Elbows	TSI	75% CH	F	SD	Moderate	5
CA-PACM-5	Stanley Mill Roof Felt Paper	M	50% CH	NF	D	Low	10,500 SF
CA-PACM-6	Stanley Mill Roof Felt Paper	M	50% CH	NF	D	Low	10,500 SF
CA-PACM-8	Stanley Mill/1st Floor Hard Window Caulking	M	5% CH	NF	D	Moderate	122 Units

Notes:

1) M=Miscellaneous, S=Surfacing or TSI=Thermal System Insulation. Note that totals do not include boiler TSI that has since been abated.

2) CH = Chrysotile; or NAD = No Asbestos Detected

3) F = Friable; or NF = Nonfriable

4) U = Undamaged, limited or no visible damage or deterioration; D = Damaged, surface is blistering, crumbling, water stained, gouged, marred or abraded up to 10% of area if damage is evenly distributed, orto 25% if damage is localized; or SD = Significantly Damaged, surface is crumbling, water stained, gouged, marred or abraded over at least 10% of area if damage is evenly distributed, or over at least 25% if damage is localized.

5) low = No Potential for Damage; medium = Potential for Damage; or high = Potential for Significant Damage

6) samples were analyzed using Polarized Light Microscopy (PLM). In cases where the samples were reanalyzed using point count methods (PC), or transmission electron microscopy (TEM), this is indicated.

Table 11
Summary of PCB Analytical Results
Ferrari Mill
Franklin, New Hampshire

										PCB Cleanup Standards	High Occupancy	Unconditional	1 mg/kg
												Encapsulated/ Capped	10 mg/kg
											Low Occupancy	Unconditional	25 mg/kg
												Encapsulated/ Capped	100 mg/kg
				Aroclor 1016	Aroclor 1221	Aroclor 1232	Aroclor 1242	Aroclor 1248	Aroclor 1254	Aroclor 1260	Aroclor 1262	Aroclor 1268	Total PCBs
				NS	NS	NS	NS	NS	NS	NS	NS	NS	
Sample	**Matrix**	**Location**	**Date**										
PCB-1	SOLID	Stanley Mill, Basement White Paint	4/14/2017	<0.93	<0.93	<0.93	<0.93	<0.93	<0.93	<0.93	<0.93	<0.93	
PCB-2	SOLID	Stanley Mill, Office, Wall Board, Green	4/14/2017	<0.98	<0.98	<0.98	<0.98	<0.98	<0.98	<0.98	<0.98	<0.98	
PCB-3	SOLID	Stanley Mill, Office, Wall Board, Tan	4/14/2017	<0.95	<0.95	<0.95	<0.95	<0.95	<0.95	<0.95	<0.95	<0.95	
PCB-4	SOLID	Stanley Mill, Exterior, Black Caulking	4/14/2017	<0.93	<0.93	<0.93	<0.93	<0.93	<0.93	<0.93	<0.93	<0.93	
PCB-5	SOLID	Armory, Main Room, White and Blue Paint	4/14/2017	<0.94	<0.94	<0.94	<0.94	<0.94	1.5	<0.94	<0.94	<0.94	1.5
PCB Building Materials Summary from June 18, 2015													
CA-CC-3DUP-CC	SOLID	Stanley Mill transformer pad, concrete	6/18/2015										0.2
CA-PCB-1	SOLID	Stanley Mill, western hallway, light blue over dark blue paint	6/18/2017										1.3
CA-PCB-3	SOLID	Stanley Mill, pale green over green paint	6/18/2015										0.7

Notes:

1. All concentrations reported in milligrams per kilogram (mg/kg) equivalent to parts per million (ppm) unless otherwise indicated.

2 "<" indicates that parameter was not present above the given analytical detection limit.

3. Samples collected by Nobis Engineering, Inc. on the dates indicated.

4. Laboratory analyses performed by Eastern Analytical, Inc. of Concord, NH.

5. PCB Cleanup levels are stated in 40 CFR § 761.61. Cleanup Levels listed are for bulk PCB remediation waste 40 CFR § 761.61 (a)(4)(i), and porous surfaces 40 CFR § 761.61 (a)(4)(iii).

6. High Occupancy Use: Defined under TSCA as any area where PCB remediation waste has been disposed of on-site, and where occupancy for any individual not wearing dermal and respiratory protection for a calendar year is: 840 hours or more (an average of 16.8 hours or more per week) for non-porous surfaces and 335 hours or more (an average of 6.7 hours or more per week) for bulk PCB remediation waste.

7. Low Occupancy Use: Defined under TSCA as any area where PCB remediation waste has been disposed of on-site and where occupancy for any individual not wearing dermal and respiratory protection for a calendar year is: less than 840 hours (an average of 16.8 hours per week) for non-porous surfaces and less than 335 hours (an average of 6.7 hours per week) for bulk PCB remediation waste.

Table 12
Alternative #1 Cost Estimate - Institutional Controls
Ferrari Mill
Franklin, New Hampshire

ALTERNATIVE #1: INSTITUTIONAL CONTROLS: ACTIVITY USE RESTRICTION
Site: Ferrari Mill Site
Location: Franklin, New Hampshire
Phase: RAP

Description: Fence off areas of the Site that have residual soil contamination with Activity and Use Restriction (AUR) recorded for contaminated areas. Install asbestos warning signage on former mill building and secure from entry.

Description	Qty.	Units	Unit Cost	Cost	Notes	
Capital Costs						
Institutional Controls						
AUR - legal fees	1	ls	$5,000	$5,000		
Site Survey	1	ls	$3,500	$3,500		
Fencing Installation						
Permanent chain-link fencing installation	225	lf	$25	$5,625		
					Fence Install. subtotal:	$5,625
Secure Buildings						
Prevent entry to buildings (Locks, Boards, etc.)	1	ls	$750	$750		
Asbestos Warning Signs	20	per sign	$6	$120		
					Secure Bldg, subtotal:	$870
Long-Term Groundwater Monitoring						
See attached Table 17				$30,600		
SUBTOTAL				**$45,595**		
Contingency	20	%		$9,119		
Engineering, Design, and Regulatory Support	5	%		$2,280		
Project Management	5	%		$2,280		
Total Capital Costs:				**$59,274**		

Cost type	Year	Total Cost	Total Cost per Year	Discount Factor (5%)	Present Value	Notes
Present Value Analysis						
Capital Cost	0	$59,274			$59,274	
Site Inspection and Limited Maintenance Cost	1-30		$1,000	15.3721	$15,372	
Long-Term Monitoring Sampling and Reporting	1-30		$17,000.00	15.3721	$261,326	
Groundwater Management Permit Renewal	Every 5		$500.00	2.782	$1,391	
Total Cost					**$337,362**	

Table 13
Alternative #2 Cost Estimate - Industrial Waste Fill Materials Encapsulation and Stabilization Cost
Ferrari Mill
Franklin, New Hampshire

ALTERNATIVE 2: SOIL CAP, RIVER BANK ARMOR, BUILDING ABATEMENT AND PARTIAL DEMOLITION

Site: Ferrari Mill Site
Location: Franklin, New Hampshire
Phase: RAP

Description: Partial demolition site buildings. Install a geotextile liner over contaminated soil areas identified at the site (Industrial waste fill area and PAH impacted area). Followed by capping of the areas with clean fill material to a minimum thickness of 2 feet. 1-foot angular riprap will be installed over riverbank slope to armor the riverbank. The IC AUR is included.

Description	Qty.	Units	Unit Cost	Cost	Notes	
Capital Costs						
Institutional Controls - AUR	1	ls	$8,500	$8,500	IC subtotal:	$8,500
Partial Building Demolition						
Professional oversight	10	day	$1,000	$10,000		
Former Armory Demolition	1	ls	$150,000	$150,000		
Former Stanley Mill Demolition	1	ls	$45,000	$45,000	Demolition subtotal:	$205,000
Soil Cap and Riverbank Stabilization						
SWQPA Permitting Costs	1	ls	$5,000	$5,000		
Professional oversight	7	day	$1,000	$7,000		
Cap and riprap installation	7	day	$4,000	$28,000		
Clean fill (Soil Cap)	1,696	ton	$25.00	$42,389		
Geotextile Liner (Soil Cap Area)	15,260	sq. ft	$0.25	$3,815		
1-foot Angular Riprap (Riverbank Area)	250	ton	$35.00	$8,750	Soil Cap and Stabilization subtotal:	$89,954
Asbestos Abatement						
See attached Table 16				$210,750		
Long-Term Groundwater Monitoring						
See attached Table 17				$30,600		
SUBTOTAL				**$549,804**		
Contingency	20	%		$109,961		
Engineering, Design, and Regulatory Support	5	%		$27,490		
Project Management	5	%		$27,490		
Total Capital Costs:				**$714,745**		

Cost type	Year	Total Cost	Total Cost per Year	Discount Factor (5%)	Present Value	Notes
Present Value Analysis						
Capital Cost	0	$714,745.06			$714,745	
Site Inspection and Limited Maintenance Cost	1-30		$1,000	15.3721	$15,372	
Long-Term Monitoring Sampling and Reporting	1-30		$17,000.00	15.3721	$261,326	
Groundwater Management Permit Renewal	Every 5		$3,000.00	2.782	$8,346	
Total Cost					**$999,789**	

Table 14
Alternative #3 Cost Estimate - Industrial Waste Fill Materials Excavation Cost
Ferrari Mill
Franklin, New Hampshire

ALTERNATIVE 3: INDUSTRIAL WASTE FILL REMOVAL, RIVER BANK RESTORATION, PAH SOIL EXCAVATION, ASBESTOS ABATEMENT, PARTIAL BUILDING DEMOLITION

Site: Ferrari Mil Site
Location: Franklin, New Hampshire
Phase: CAFI/CAP

Description: Excavate and remove industrial waste fill material and impacted soil from the river bank. Followed by installation of a geotextile liner and backfilling of all excavated areas with suitable clean fill material to original grade. 1-foot angular riprap will be installed over riverbank slope to armor the riverbank. The IC AUR is included.

Description	Qty.	Units	Unit Cost	Cost	Notes	
Capital Costs						
Institutional Controls	1	ls	$8,500	$8,500	IC subtotal:	$8,500
SWQPA Permitting	1	ls	$5,000	$5,000	SWQPA subtotal:	$5,000
Partial Building Demolition						
Professional oversight	10	day	$1,000	$10,000		
Former Armory Demolition (Partial)	1	ls	$150,000	$150,000		
Former Stanley Mill Demolition (Partial)	1	ls	$45,000	$45,000	Demolition subtotal:	$205,000
Installation of Sheet Pile Wall						
Engineering Design	1	ls	$10,000	$10,000		
Professional oversight	4	day	$1,000	$4,000		
Installation	275	linear ft	$500	$137,500		
Reporting	1	ls	$4,000	$4,000	Sheet Pile subtotal:	$155,500
Industrial Waste Fill Material Excavation						
Professional oversight/sampling	13	day	$1,200	$15,600		
Excavation and backfill	13	day	$4,000	$52,000		
Characterization sampling	10	sample	$528.00	$5,510		
Confirmation sampling	8	sample	$228.00	$1,824		
Transport/disposal	5,218	ton	$100.00	$521,806		
Geotextile Liner	11,050	sq. ft	$0.25	$2,763		
1-foot Angular Riprap (Riverbank Area)	250	ton	$35.00	$8,750		
Clean fill	5,050	ton	$25.00	$126,251	**Excavation subtotal:**	**$734,504**
Shallow PAH Contaminated Soil Excavation						
See attached Table 15				$56,634		
Asbestos Abatement						
See attached Table 16				$210,750		
Long-Term Groundwater Monitoring Well Replacement						
See attached Table 17				$30,600		
Capital Costs Subtotal				$1,406,488		
Contingency	20	%		$281,298		
SUBTOTAL				**$1,687,786**		
Engineering, Design, and Regulatory Support	5	%		$84,389		
Project Management	5	%		$84,389		
Total Capital Costs:				**$1,856,564**		

Cost type	Year	Total Cost	Total Cost per Year	Discount Factor (5%)	Present Value	Notes
Present Value Analysis						
Capital Cost	0	$1,856,564.17			$1,856,564	
Site Inspection and Limited Maintenance Cost	1-10		$500	7.7216	$3,861	
Long-Term Monitoring Sampling and Reporting	1-10		$17,000.00	7.7216	$131,267	
Groundwater Management Permit Renewal	5 and 10		$500.00	1.3974	$699	
Total Cost					**$1,992,391**	

Table 15
Cost Estimate - Shallow PAH Soil Excavation Cost
Ferrari Mill
Franklin, New Hampshire

PAH SOIL EXCAVATION
Site: Ferrari Mill Site
Location: Franklin, New Hampshire
Phase: RAP

Description: Excavate and remove PAH impacted soils from identified areas. Followed by installation of a geotextile liner and backfilling of all excavated areas with clean fill material to a minimum thickness of 1.5 feet.

Description	Qty.	Units	Unit Cost	Cost	Notes	
Capital Costs						
Institutional Controls - AUR	1	ls	$8,500	$8,500	IC subtotal:	$8,500
PAH Excavation						
Professional oversight/sampling (PAH Area)	2	day	$1,200	$2,400		
Excavation and backfill (PAH Area)	2	day	$2,500	$5,000		
Characterization sampling (PAH Area)	1	sample	$528.00	$397		
Confirmation sampling (PAH Area)	4	sample	$228.00	$912		
Transport/disposal (PAH Area)	376	ton	$100.00	$37,583		
Geotextile Liner (PAH Area)	3,785	sq. ft	$0.25	$946		
Clean fill (PAH Area)	376	ton	$25.00	$9,396	PAH Excavation subtotal:	$56,634
SUBTOTAL				**$65,134**		
Contingency	20	%		$11,327		
Engineering, Design, and Regulatory Support	5	%		$3,257		
Project Management	5	%		$3,257		
Total Capital Costs:				**$82,975**		

Cost type	Year	Total Cost	Total Cost per Year	Discount Factor (5%)	Present Value	Notes
Present Value Analysis						
Capital Cost	0	$82,974.59			$82,975	
Total Cost					**$82,975**	

Table 16
Cost Estimate - Asbestos Abatement
Ferrari Mill
Franklin, New Hampshire

HAZARDOUS BUILDING MATERIALS ASBESTOS ABATEMENT
Site: Ferrari Mill Site
Location: Franklin, New Hampshire
Phase: RAP

Description: Abatement of all identified asbestos containing building materials in the former armory and former Stanley Mill

Description	Qty.	Units	Unit Cost	Cost	Notes	
Capital Costs						
Asbestos Abatement						
Professional oversight/sampling	15	day	$1,000	$15,000		
Abatement of former armory and former mill	1	ls	$195,750	$195,750	Abatement subtotal:	$210,750
SUBTOTAL				**$210,750**		
Contingency	20	%		$42,150		
Engineering, Design, and Regulatory Support	5	%		$10,538		
Project Management	5	%		$10,538		
Total Capital Costs:				**$273,975**		

Cost type	Year	Total Cost	Total Cost per Year	Discount Factor (5%)	Present Value	Notes
Present Value Analysis						
Capital Cost	0	$273,975.00			$273,975	
Total Cost					**$273,975**	

Table 17
Cost Estimate Long-Term Groundwater Monitoring Cost
Ferrari Mill
Franklin, New Hampshire

GROUNDWATER LONG-TERM MONITORING
Site: Ferrari Mill Site
Location: Franklin, New Hampshire
Phase: RAP

Description: Install monitoring wells (assumes 8). Perform long-term monitoring of groundwater that includes collecting samples for VOC, 1,4-dioxane, and RCRA 8 metals analysis twice a year, with annual reporting.

Description	Qty.	Units	Unit Cost	Cost	Notes	
Capital Costs						
Monitoring Well Installation						
Mobilization - Drill rig equipment and crew	1	ls	$500	$500		
Site access/IDW handling/standby	4	hr	$250	$1,000		
Install monitoring wells	2	day	$1,600	$3,200		
Drums and IDW disposal	2	ea.	$250	$500		
Engineering Oversight	2	day	$1,200	$2,400		
Engineering Reporting	1	ls	$3,500	$3,500	Well installation subtotal:	$11,100
Groundwater Sampling and Reporting						
Groundwater Management Permit Application	1	ls	$3,000	$3,000		
Groundwater sampling with VOC/1,4-dioxane/metals analysis	2	event	$7,000	$14,000		
Groundwater sampling report	1	ls	$2,500	$2,500	Groundwater sampling and reporting subtotal:	$19,500
SUBTOTAL				**$30,600**		
Contingency	20	%		$6,120		
Engineering, Design, and Regulatory Support	5	%		$1,530		
Project Management	5	%		$1,530		
Total Capital Costs:				**$39,780**		

Cost type	Year	Total Cost	Total Cost per Year	Discount Factor (3%)	Present Value	Notes
Present Value Analysis						
Capital Cost	0	$39,780.00			$39,780	
Annual Maintenance	1-10		$500.00	7.4410	$3,721	
Long-Term Monitoring Sampling and Reporting	1-10		$17,000.00	7.4410	$126,497	
Groundwater Management Permit Renewal	5 Years		$500.00	4.3130	$2,157	
Total Cost					**$172,154**	

FIGURES

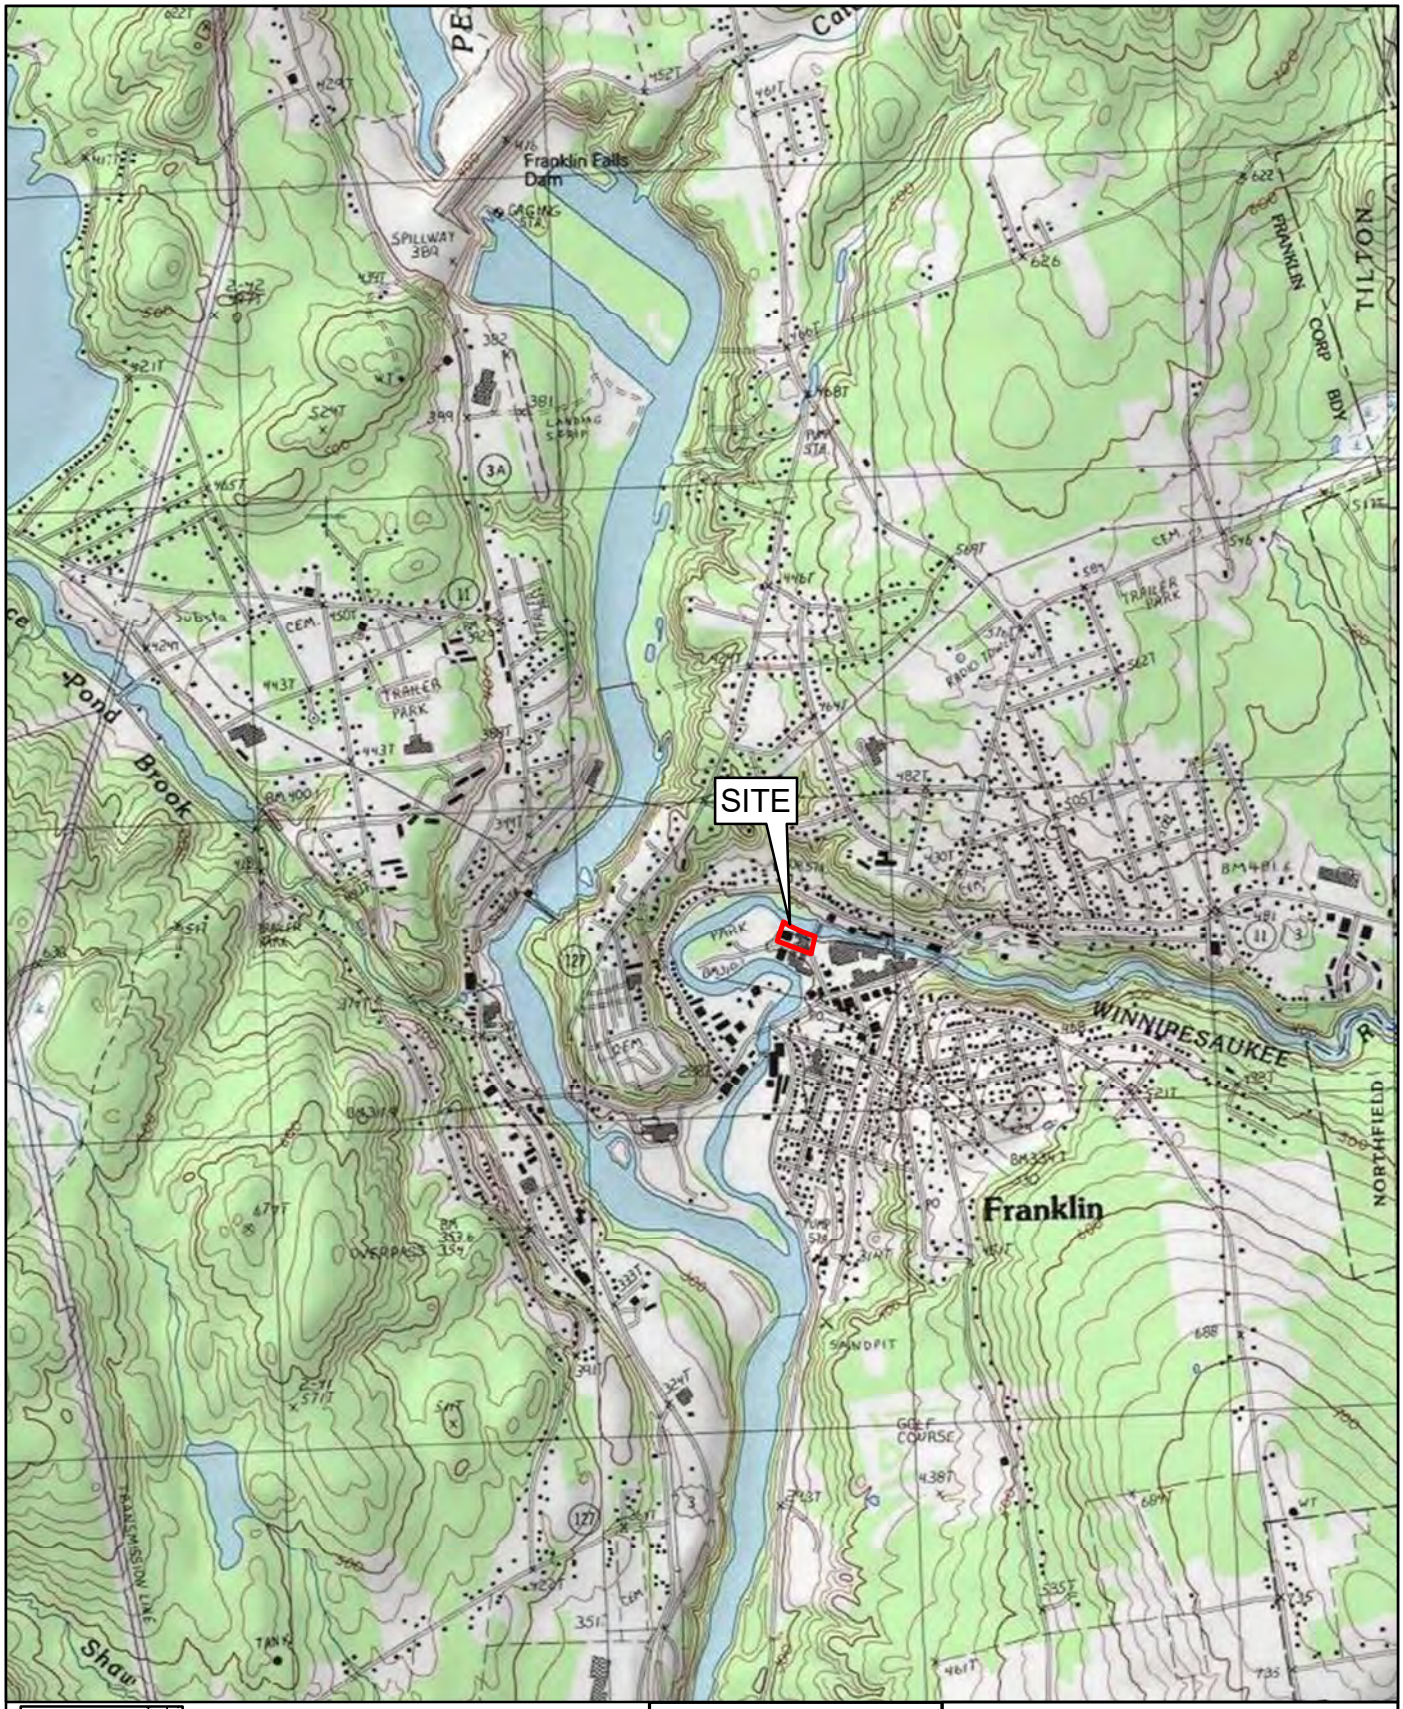

Map Location

USGS Topographic Map
Franklin, NH
Created 1987

0 500 1,000 2,000

Feet
1 inch = 2,000 feet

N

Nobis
Engineering a Sustainable Future
Nobis Engineering, Inc.
18 Chenell Drive
Concord, NH 03301
T(603) 224-4182
www.nobiseng.com
Client-Focused, Employee-Owned

FIGURE 1

LOCUS PLAN
FERRARI MILL
93-119 MEMORIAL STREET
FRANKLIN, NEW HAMPSHIRE

PREPARED BY: JRS	CHECKED BY: TA
PROJECT NO. 80108.08	DATE: FEBRUARY 2018

Path: R:\80000 Task Orders\80108 Brownfields Multi-Site\GIS\Ferrari Mill\Figures\Figure 1 Locus.mxd **Date Printed:** 8/29/2017

Notes:

1. Site sketch was developed from several sources including, City of Franklin Tax Map N8, Figures created by Credere Associates, LLC, observations made by Nobis and from the aerial photography provided by ESRI.

2. Locations of site features depicted hereon are approximate and given for illustrative purposes only.

Legend

- Drum
- Floor Drain
- Natural Gas Hookup
- Outfall
- Unknown Pipe
- UST Vent Fill Line
- Pipe
- Retaining Wall
- Property Boundary
- Site Boundary
- Limit of Fill (Metal Shavings and Saw Blades)
- Foundation
- Transformer Area
- UST Area

N

0 25 50 100

Feet

1 inch = 50 feet

Nobis
Engineering a Sustainable Future
Nobis Engineering, Inc.
18 Chenell Drive
Concord, NH 03301
(603) 224-4182
www.nobiseng.com
Client-Focused, Employee-Owned

FIGURE 2

SITE AREA PLAN
FERRARI MILL
93-119 MEMORIAL STREET
FRANKLIN, NEW HAMPSHIRE

PREPARED BY: JRS	CHECKED BY: TA
PROJECT NO. 80108.08	DATE: FEBRUARY 2018

R:\80000 Task Orders\80108 Brownfields Multi-Site\GIS\Ferrari Mill\Figures\Figure 2 Ferrari Mill Site Area Plan.mxd 11/28/2017 18:40 jharrington

Notes:

1. Site sketch was developed from several sources including, City of Franklin Tax Map N8, Figures created by Credere Associates, LLC, observations made by Nobis and from the aerial photography provided by ESRI.

2. Locations of site features depicted hereon are approximate and given for illustrative purposes only.

Legend

- Existing Overburden Monitoring Well
- New Overburden Monitoring Well Couplet
- New Deep Overburden Monitoring Well
- New Bedrock Monitoring Well
- Previous Soil Boring Location
- Nobis Industrial Waste Shallow Soil Boring
- Nobis Shallow Soil Boring
- Previous Test Pit Location
- Nobis Test Pit Location
- Nobis Sub-Slab Sample Location
- Previous Sediment Sample Location
- Floor Drain
- Outfall
- Pipe
- Retaining Wall
- Property Boundary
- Site Boundary
- Limit of Fill (Metal Shavings and Saw Blades)
- Foundation

N

0 15 30 60

Feet

1 inch = 30 feet

Nobis
Engineering a Sustainable Future
Nobis Engineering, Inc.
18 Chenell Drive
Concord, NH 03301
(603) 224-4182
www.nobiseng.com
Client-Focused, Employee-Owned

FIGURE 3

INVESTIGATION SAMPLE LOCATION SUMMARY
FERRARI MILL
93-119 MEMORIAL STREET
FRANKLIN, NEW HAMPSHIRE

PREPARED BY: JRS	CHECKED BY: TA
PROJECT NO. 80108.08	DATE: FEBRUARY 2018

R:\80000 Task Orders\80108 Brownfields Multi-Site\GIS\Ferrari Mill\Figures\Figure 3 Investigation Sample Location Summary.mxd 11/28/2017 09:13 jharrington

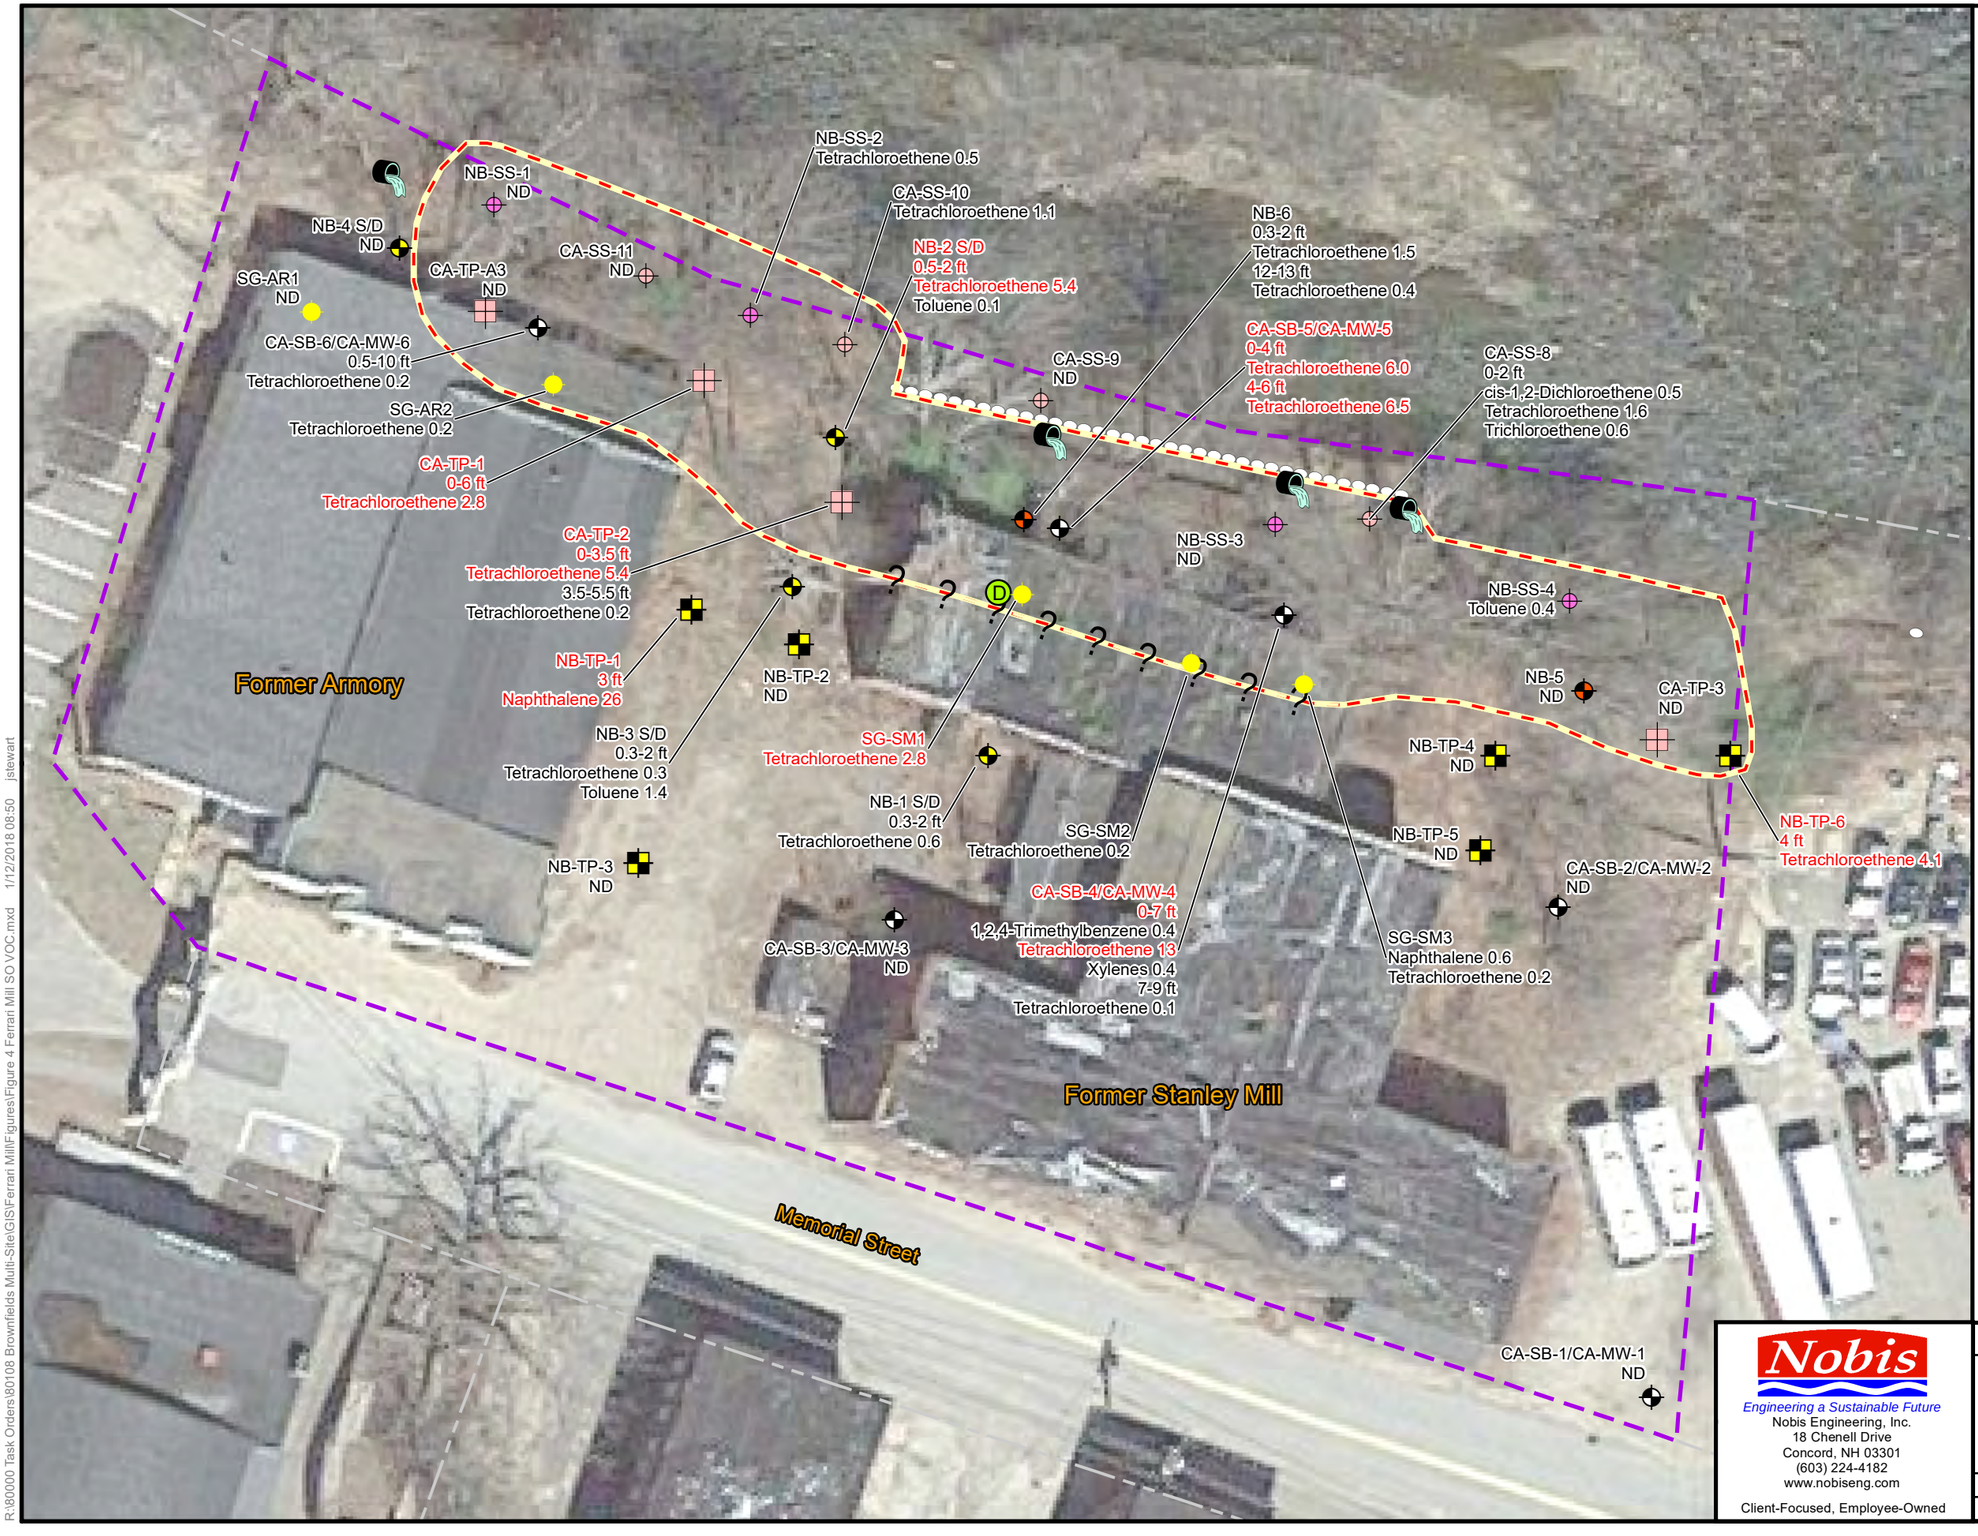

Notes:

1. Site sketch was developed from several sources including, City of Franklin Tax Map N8, Figures created by Credere Associates, LLC, observations made by Nobis and from the aerial photography provided by ESRI.

2. All results are reported in mg/kg, Results in RED exceed applicable SRS.

3. Locations of site features depicted hereon are approximate and given for illustrative purposes only.

Legend

- New Monitoring Well Couplet
- New Deep Overburden Well
- Existing Monitoring Well
- Industrial Waste Soil Boring
- Shallow Soil Boring Location
- Previous Soil Boring Location
- Proposed Test Pit Location
- Previous Test Pit Location
- Sub-Slab Sample Location
- Floor Drain
- Outfall
- Limit of Fill (Metal Shavings and Saw Blades)

N

0 15 30 60

Feet

1 inch = 30 feet

Nobis
Engineering a Sustainable Future
Nobis Engineering, Inc.
18 Chenell Drive
Concord, NH 03301
(603) 224-4182
www.nobiseng.com
Client-Focused, Employee-Owned

FIGURE 4

SOIL INVESTIGATION VOC RESULTS
FERRARI MILL
93-119 MEMORIAL STREET
FRANKLIN, NEW HAMPSHIRE

PREPARED BY: JRS	CHECKED BY: TA
PROJECT NO. 80108.08	DATE: FEBRUARY 2018

R:\80000 Task Orders\80108 Brownfields Multi-Site\GIS\Ferrari Mill\Figures\Figure 4 Ferrari Mill SO VOC.mxd 1/12/2018 08:50 jstewart

NB-SS-1
1 ft
Benzo[a]anthracene 7.1
Benzo[a]pyrene 5.3
Benzo[b]fluoranthene 5.9
Dibenz[a,h]anthracene 1.5
Indeno[1,2,3-cd]pyrene 3.0

NB-SS-2
1.5 ft
Benzo[a]anthracene 20
Benzo[a]pyrene 14
Benzo[b]fluoranthene 12
Dibenz[a,h]anthracene 3.4
Indeno[1,2,3-cd]pyrene 6.9

NB-2 S/D
0.5-2 ft
Benzo[a]anthracene 1.1
Benzo[a]pyrene 1.1
Benzo[b]fluoranthene 1.3
12-13 ft, ND
29-31 ft, ND

NB-6
0.3-2 ft
Benzo[a]anthracene 6.1
Benzo[a]pyrene 4.9
Benzo[b]fluoranthene 5.0
Indeno[1,2,3-cd]pyrene 1.3
12-13 ft, ND
34-36 ft, ND

CA-SB-4/CA-MW-4
0-7 ft
Benzo[a]anthracene 7.2
Benzo[a]pyrene 6.2
Benzo[b]fluoranthene 7.8
Dibenz[a,h]anthracene 0.75
Indeno[1,2,3-cd]pyrene 1.5
7-9 ft
14-16 ft, ND

NB-SS-4
1.5 ft
Benzo[a]pyrene 0.64

NB-5
0.3-2 ft
Benzo[a]anthracene 1.3
Benzo[a]pyrene 1.2
Benzo[b]fluoranthene 1.3
8-10 ft, ND
24-26 ft, ND

CA-TP-2
0-3.5 ft
Benzo[a]anthracene 2.1
Benzo[a]pyrene 1.7
Benzo[b]fluoranthene 1.4
3.5-5.5 ft, ND

NB-4 S/D
0.3-2 ft, ND
5-6 ft, ND
24-26 ft, ND

CA-SS-11
0-2 ft

SG-AR1
2 ft, ND

CA-SB-6/CA-MW-6
0.5-10 ft, ND
10.5-12.5 ft, ND

CA-TP-A3
0-4 ft
Naphthalene 10

CA-SS-4
0-2 ft, ND

SG-AR2
2 ft, ND

CA-SS-10
0-2 ft

CA-SS-9
0-2 ft

CA-SS-5
0-2 ft

CA-TP-1
0-6 ft
Benzo[a]anthracene 1.6
Benzo[b]fluoranthene 1.2

CA-SB-5/CA-MW-5
0-4 ft
20-22 ft, ND

NB-SS-3
1.5 ft, ND

CA-SS-8
0-2 ft

Former Armory

CA-SS-3
0-2 ft

NB-TP-1
3 ft
Benzo[a]anthracene 340
Benzo[a]pyrene 210
Benzo[b]fluoranthene 180
Benzo[k]fluoranthene 220
Chrysene 270
Dibenz[a,h]anthracene 42
Fluorene 140
Indeno[1,2,3-cd]pyrene 99
Naphthalene 64

SG-SM1
2 ft, ND

NB-TP-2
5 ft, ND

CA-SS-6
No Sample

CA-TP-3
3.5-8 ft, ND

NB-SS-6
1.5 ft

NB-SS-5
1-1.5 ft, ND

CA-SS-7
0-2 ft

NB-TP-4
1.5 ft, ND

NB-TP-6
4 ft
Benzo[a]anthracene 2.5
Benzo[a]pyrene 2.4
Benzo[b]fluoranthene 2.5

NB-TP-5
4 ft, ND

NB-SS-7
1 ft
Benzo[a]anthracene 8.1
Benzo[a]pyrene 5.4
Benzo[b]fluoranthene 4.8
Dibenz[a,h]anthracene 1.2
Indeno[1,2,3-cd]pyrene 3.0

CA-SB-3/CA-MW-3
16-18 ft
ND

NB-SS-8
1.3 ft, ND

CA-SB-2/CA-MW-2
0-2 ft

NB-3 S/D
0.3-2 ft
Benzo[a]anthracene 1.7
Benzo[a]pyrene 1.4
Benzo[b]fluoranthene 1.2
14-15 ft, ND
24-26 ft, ND

SG-SM3
2 ft
Benzo[a]anthracene 49
Benzo[a]pyrene 41
Benzo[b]fluoranthene 37
Benzo[k]fluoranthene 36
Dibenz[a,h]anthracene 5.1
Indeno[1,2,3-cd]pyrene 14
Naphthalene 5.1

CA-SS-2
0-2 ft
Benzo[a]anthracene 2.5
Benzo[a]pyrene 2.3
Benzo[b]fluoranthene 2.3

NB-SS-9
1.2 ft, ND

NB-SS-10
1.3 ft, ND

NB-TP-3
1 ft
Benzo[a]anthracene 9.8
Benzo[a]pyrene 7.1
Benzo[b]fluoranthene 5.8
Dibenz[a,h]anthracene 1.3
Indeno[1,2,3-cd]pyrene 3.9

NB-1 S/D
0.3-2 ft, ND
14-15 ft, ND
39-39.5 ft, ND

Former Stanley Mill

SG-SM2
2 ft
Benzo[a]anthracene 19
Benzo[a]pyrene 14
Benzo[b]fluoranthene 15
Dibenz[a,h]anthracene 2.7
Indeno[1,2,3-cd]pyrene 6.6

Memorial Street

CA-SS-1
0-2 ft
Benzo[a]anthracene 1.1
Benzo[a]pyrene 1.1
Benzo[b]fluoranthene 1.1

CA-SB-1/CA-MW-1
0-2 ft

Notes:

1. Site sketch was developed from several sources including, City of Franklin Tax Map N8, Figures created by Credere Associates, LLC, observations made by Nobis and from the aerial photography provided by ESRI.

2. Only results that exceed applicable SRS are shown. All results are reported in mg/kg, Results in RED exceed applicable SRS. PAHs were present at concentrations below SRS at sample locations marked in YELLOW.

3. Locations of site features depicted hereon are approximate and given for illustrative purposes only.

Legend

- New Monitoring Well Couplet
- New Deep Overburden Well
- Existing Monitoring Well
- Industrial Waste Soil Boring
- Shallow Soil Boring Location
- Previous Soil Boring Location
- Proposed Test Pit Location
- Previous Test Pit Location
- Sub-Slab Sample Location
- Floor Drain
- Outfall
- Retaining Wall
- Property Boundary
- Site Boundary
- Limit of Fill (Metal Shavings and Saw Blades)

N

0 15 30 60
Feet
1 inch = 30 feet

Nobis
Engineering a Sustainable Future
Nobis Engineering, Inc.
18 Chenell Drive
Concord, NH 03301
(603) 224-4182
www.nobiseng.com
Client-Focused, Employee-Owned

FIGURE 5

SOIL INVESTIGATION PAH RESULTS
FERRARI MILL
93-119 MEMORIAL STREET
FRANKLIN, NEW HAMPSHIRE

PREPARED BY: JRS	CHECKED BY: TA
PROJECT NO. 80108.08	DATE: FEBRUARY 2018

R:\80000 Task Orders\80108 Brownfields Multi-Site\GIS\Ferrari Mill\Figures\Figure 5 Ferrari Mill SO PAH.mxd 1/12/2018 08:59 jstewart

NB-4 S/D
0.3-2 ft
Arsenic 4.5
Barium 69
Cadmium 1.8
Chromium 25
Lead 29
5-6 ft
Barium 16
24-26 ft
Barium 15

NB-SS-1
1 ft
Arsenic 7.8
Barium 55
Chromium 160
Lead 77
Hex Chormium 0.62

CA-SS-11
0-2 ft
Arsenic 5
Chromium 53
Lead 34

NB-SS-2
1.5 ft
Arsenic 17
Barium 110
Chromium 49
Lead 300
Mercury 0.28

CA-SS-10
0-2 ft
Arsenic 55
Chromium 1300
Lead 220

NB-6
0.3-2 ft
Arsenic 33
Barium 38
Chromium 81
Lead 53
12-13 ft
Barium 28
Chromium 9
Lead 3.9
34-36 ft
Barium 60
Chromium 16

CA-SS-9
0-2 ft
Arsenic 35
Chromium 200
Lead 140

CA-SB-5/CA-MW-5
0-4 ft
Arsenic 47
Barium 29
Chromium 150
Lead 43
4-6 ft
Arsenic 10
Chromium 29

CA-SS-5
0-2 ft
Arsenic 37
Barium 60
Cadmium 0.7
Chromium 530
Lead 650
Selenium 11

NB-SS-3
1.5 ft
Arsenic 7.1
Barium 58
Chromium 26
Lead 360
Hex Chormium 1.3

CA-SB-4/CA-MW-4
0-7 ft
Arsenic 16
Barium 110
Chromium 83
Lead 250
Selenium 4
Silver 0.77
7-9 ft
Arsenic 4.1

CA-SS-8
0-2 ft
Arsenic 4.2
Chromium 30
Lead 74

NB-SS-4
1 ft
Arsenic 4.2
Barium 110
Chromium 30
Lead 48

NB-5
0.3-2 ft
Arsenic 5.8
Barium 77
Chromium 16
Lead 480
8-10 ft
Arsenic 4.1
Barium 38
Chromium 15
Lead 7.7
24-26 ft
Barium 51
Chromium 13
Lead 4.6

SG-AR1
Arsenic 8.3
Barium 26
Chromium 10
Lead 13

Former Armory

CA-SS-4
0-2 ft
Arsenic 8.1
Barium 35
Chromium 46
Lead 46

CA-TP-1
0-6 ft
Arsenic 19
Chromium 110
Lead 870

CA-TP-A3
0-4 ft
Arsenic 92
Chromium 460
Lead 380

CA-TP-4
1-4 ft
Hex Chromium 5.7

SG-SM2
Arsenic 3.4
Barium 30
Chromium 8
Lead 16

SG-SM3
Arsenic 7.9
Barium 49
Chromium 18
Lead 650
Mercury 0.4

CA-SB-6/CA-MW-6
0.5-10 ft
Arsenic 48
Barium 41
Chromium 210
Lead 98
10.5-12.5 ft
Arsenic 0.9
Chromium 10

SG-AR2
Arsenic 50
Barium 20
Chromium 280
Lead 17

CA-SS-3
0-2 ft
Arsenic 6.3
Barium 33
Chromium 16
Lead 36

SG-SM1
Arsenic 2.8
Barium 30
Chromium 11
Lead 12

NB-TP-6
4 ft
Arsenic 8.3
Barium 140
Chromium 130
Lead 440
Mercury 0.90

CA-TP-3
3.5-8 ft
Arsenic 24
Cadmium 0.5
Chromium 35
Lead 95

CA-SS-7
0-2 ft
Arsenic 6.3
Barium 190
Chromium 450
Lead 150
Selenium 5
Hex Chromium 4.4

NB-TP-5
4 ft
Barium 34
Chromium 10
Lead 4.2

CA-SB-2/CA-MW-2
0-2 ft
Arsenic 7
Barium 53
Chromium 11
Lead 31
15-17 ft
Arsenic 2
Barium 34
Chromium 13
Lead 3.5

NB-TP-1
3 ft
Arsenic 7.4
Barium 26
Chromium 14
Lead 85
Hex Chromium 0.69

CA-TP-2
0-3.5 ft
Arsenic 11
Cadmium 0.4
Chromium 41
Lead 90

CA-SS-2
0-2 ft
Arsenic 5.8
Barium 43
Cadmium 0.4
Chromium 150
Lead 97

NB-TP-3
1 ft
Arsenic 7.9
Barium 54
Chromium 17
Lead 180
Mercury 0.24

NB-2 S/D
0.5-2 ft
Arsenic 13
Barium 72
Cadmium 0.8
Chromium 160
Lead 730
12-13 ft
Barium 36
Chromium 10
Lead 4.4
29-31 ft
Barium 2.6
Cadmium140
Lead 27
Selenium 9.4

CA-SB-3/CA-MW-3
16-18 ft
Arsenic 1.7
Barium 31
Chromium 9
Lead 2.9

Former Stanley Mill

NB-1 S/D
0.3-2 ft
Arsenic 3.8
Barium 54
Chromium 15
Lead 12
14-15 ft
Barium 21
39-39.5 ft
Barium 23
Chromium 7

NB-TP-4
1.5 ft
Arsenic 11
Barium 54
Chromium 24
Lead 150
Mercury 0.28
Hex Chormium 2.2

CA-SS-1
0-2 ft
Arsenic 6.2
Barium 45
Chromium 27
Lead 80

NB-TP-2
5 ft
Arsenic 4.7
Barium 26
Chromium 10
Lead 3.5

NB-3 S/D
0.3-2 ft
Arsenic 19
Barium 180
Cadmium 0.8
Chromium 33
Lead 230
14-15 ft
Barium 49
Chromium 12
Lead 4.4
24-26 ft
Barium 46
Chromium 14
Lead 4.0

Memorial Street

CA-SB-1/CA-MW-1
0-2 ft
Barium 51
Chromium 12
Lead 130

Notes:

1. Site sketch was developed from several sources including, City of Franklin Tax Map N8, Figures created by Credere Associates, LLC, observations made by Nobis and from the aerial photography provided by ESRI.

2. All results are reported in mg/kg, Results in RED exceed applicable SRS.

3. Locations of site features depicted hereon are approximate and given for illustrative purposes only.

Legend

- New Monitoring Well Couplet
- New Deep Overburden Well
- Existing Monitoring Well
- Industrial Waste Soil Boring
- Shallow Soil Boring Location
- Previous Soil Boring Location
- Proposed Test Pit Location
- Previous Test Pit Location
- Sub-Slab Sample Location
- Floor Drain
- Outfall
- Retaining Wall
- Property Boundary
- Site Boundary
- Limit of Fill (Metal Shavings and Saw Blades)

N

0 15 30 60
Feet
1 inch = 30 feet

Nobis
Engineering a Sustainable Future
Nobis Engineering, Inc.
18 Chenell Drive
Concord, NH 03301
(603) 224-4182
www.nobiseng.com
Client-Focused, Employee-Owned

FIGURE 6

SOIL INVESTIGATION METAL RESULTS
FERRARI MILL
93-119 MEMORIAL STREET
FRANKLIN, NEW HAMPSHIRE

PREPARED BY: JRS	CHECKED BY: TA
PROJECT NO. 80108.08	DATE: FEBRUARY 2018

R:\80000 Task Orders\80108 Brownfields Multi-Site\GIS\Ferrari Mill\Figures\Figure 6 Ferrari Mill SO Metal.mxd 1/12/2018 09:31 jstewart

Former Foundation

NB-4 S
GW Elevation 80.38
1,2,4-Trimethylbenzene 7
Tetrachloroethene 10
Total Xylene 2

NB-4 D
GW Elevation 79.89
cis-1,2-Dichloroethene 82
Tetrachloroethene 42
Trichloroethene 140
Benzo[a]anthracene 0.2
Benzo[b]fluoranthene 0.2

CA-SB-6/CA-MW-6
GW Elevation 80.45
cis-1,2-Dichloroethene 9
Tetrachloroethene 30
Trichloroethene 6

BR-1
GW Elevation 80.34
1,4-Dioxane 0.63
cis-1,2-Dichloroethene 8
Trichloroethene 6
Chromium 0.09

NB-6
GW Elevation 80.79
1,4-Dioxane 0.30
cis-1,2-Dichloroethene 2
Methyl-t-butyl ether(MTBE) 12
Trichloroethene 5

CA-SB-5/CA-MW-5
GW Elevation 81.25
cis-1,2-Dichloroethene 16
Tetrachloroethene 120
Trichloroethene 12

WINNIPESAUKEE RIVER

80.5

NB-2 S
GW Elevation 80.96
1,4-Dioxane 0.30
Tetrachloroethene 21

NB-2 D
GW Elevation 80.68
cis-1,2-Dichloroethene 7
Tetrachloroethene 3
Trichloroethene 23

81

NB-3 S
GW Elevation 81.21
ND

NB-3 D
GW Elevation 80.67
ND

CA-SB-4/CA-MW-4
GW Elevation 81.26
1,4-Dioxane 0.69

NB-5
GW Elevation 82.06
Trichloroethene 2
Arsenic 5

Former Armory

NB-1 S
GW Elevation 81.64
Tetrachloroethene 2

NB-1 D
GW Elevation 81.02
cis-1,2-Dichloroethene 2
Tetrachloroethene 3
Trichloroethene 5

81.5

Former Garage Foundation

CA-SB-2/CA-MW-2
GW Elevation 82.85
1,4-Dioxane 0.40

CA-SB-3/CA-MW-3
GW Elevation 81.66
ND

82

82.5

Former Stanley Mill

83

83.5

84

Memorial Street

84.5

CA-SB-1/CA-MW-1
GW Elevation 84.63
1,4-Dioxane 0.71

Notes:

1. Site sketch was developed from several sources including, City of Franklin Tax Map N8, Figures created by Credere Associates, LLC, observations made by Nobis and from the aerial photography provided by ESRI.

2. Groundwater Elevation Contours were developed from shallow overburden data points using ArcGIS 10.5 Spatial Analyst extension Natural Neighbor method, other interpretations are possible.

3. All results are reported in ug/L, Results in RED exceed applicable AGQS Standard. Samples submitted for metals and PAH analysis were filtered in the field. Results in **BOLD** exceed trichloroethene GW-2 Standard of 20 ug/L.

4. Locations of site features depicted hereon are approximate and given for illustrative purposes only.

Legend

- New Monitoring Well Couplet
- New Deep Overburden Well
- Existing Monitoring Well
- New Bedrock Well
- Floor Drain
- Outfall
- Groundwater Elevation Contour June 2017
- Groundwater Flow Direction June 2017
- Retaining Wall
- Property Boundary
- Site Boundary
- Limit of Fill (Metal Shavings and Saw Blades)
- Foundation

N

0 15 30 60
Feet
1 inch = 30 feet

Nobis
Engineering a Sustainable Future
Nobis Engineering, Inc.
18 Chenell Drive
Concord, NH 03301
(603) 224-4182
www.nobiseng.com
Client-Focused, Employee-Owned

FIGURE 7

GROUNDWATER INVESTIGATION
FERRARI MILL
93-119 MEMORIAL STREET
FRANKLIN, NEW HAMPSHIRE

PREPARED BY: JRS	CHECKED BY: TA
PROJECT NO. 80108.08	DATE: FEBRUARY 2018

R:\80000 Task Orders\80108 Brownfields Multi-Site\GIS\Ferrari Mill\Figures\Figure 7 Ferrari Mill GW.mxd 1/12/2018 10:00 jstewart

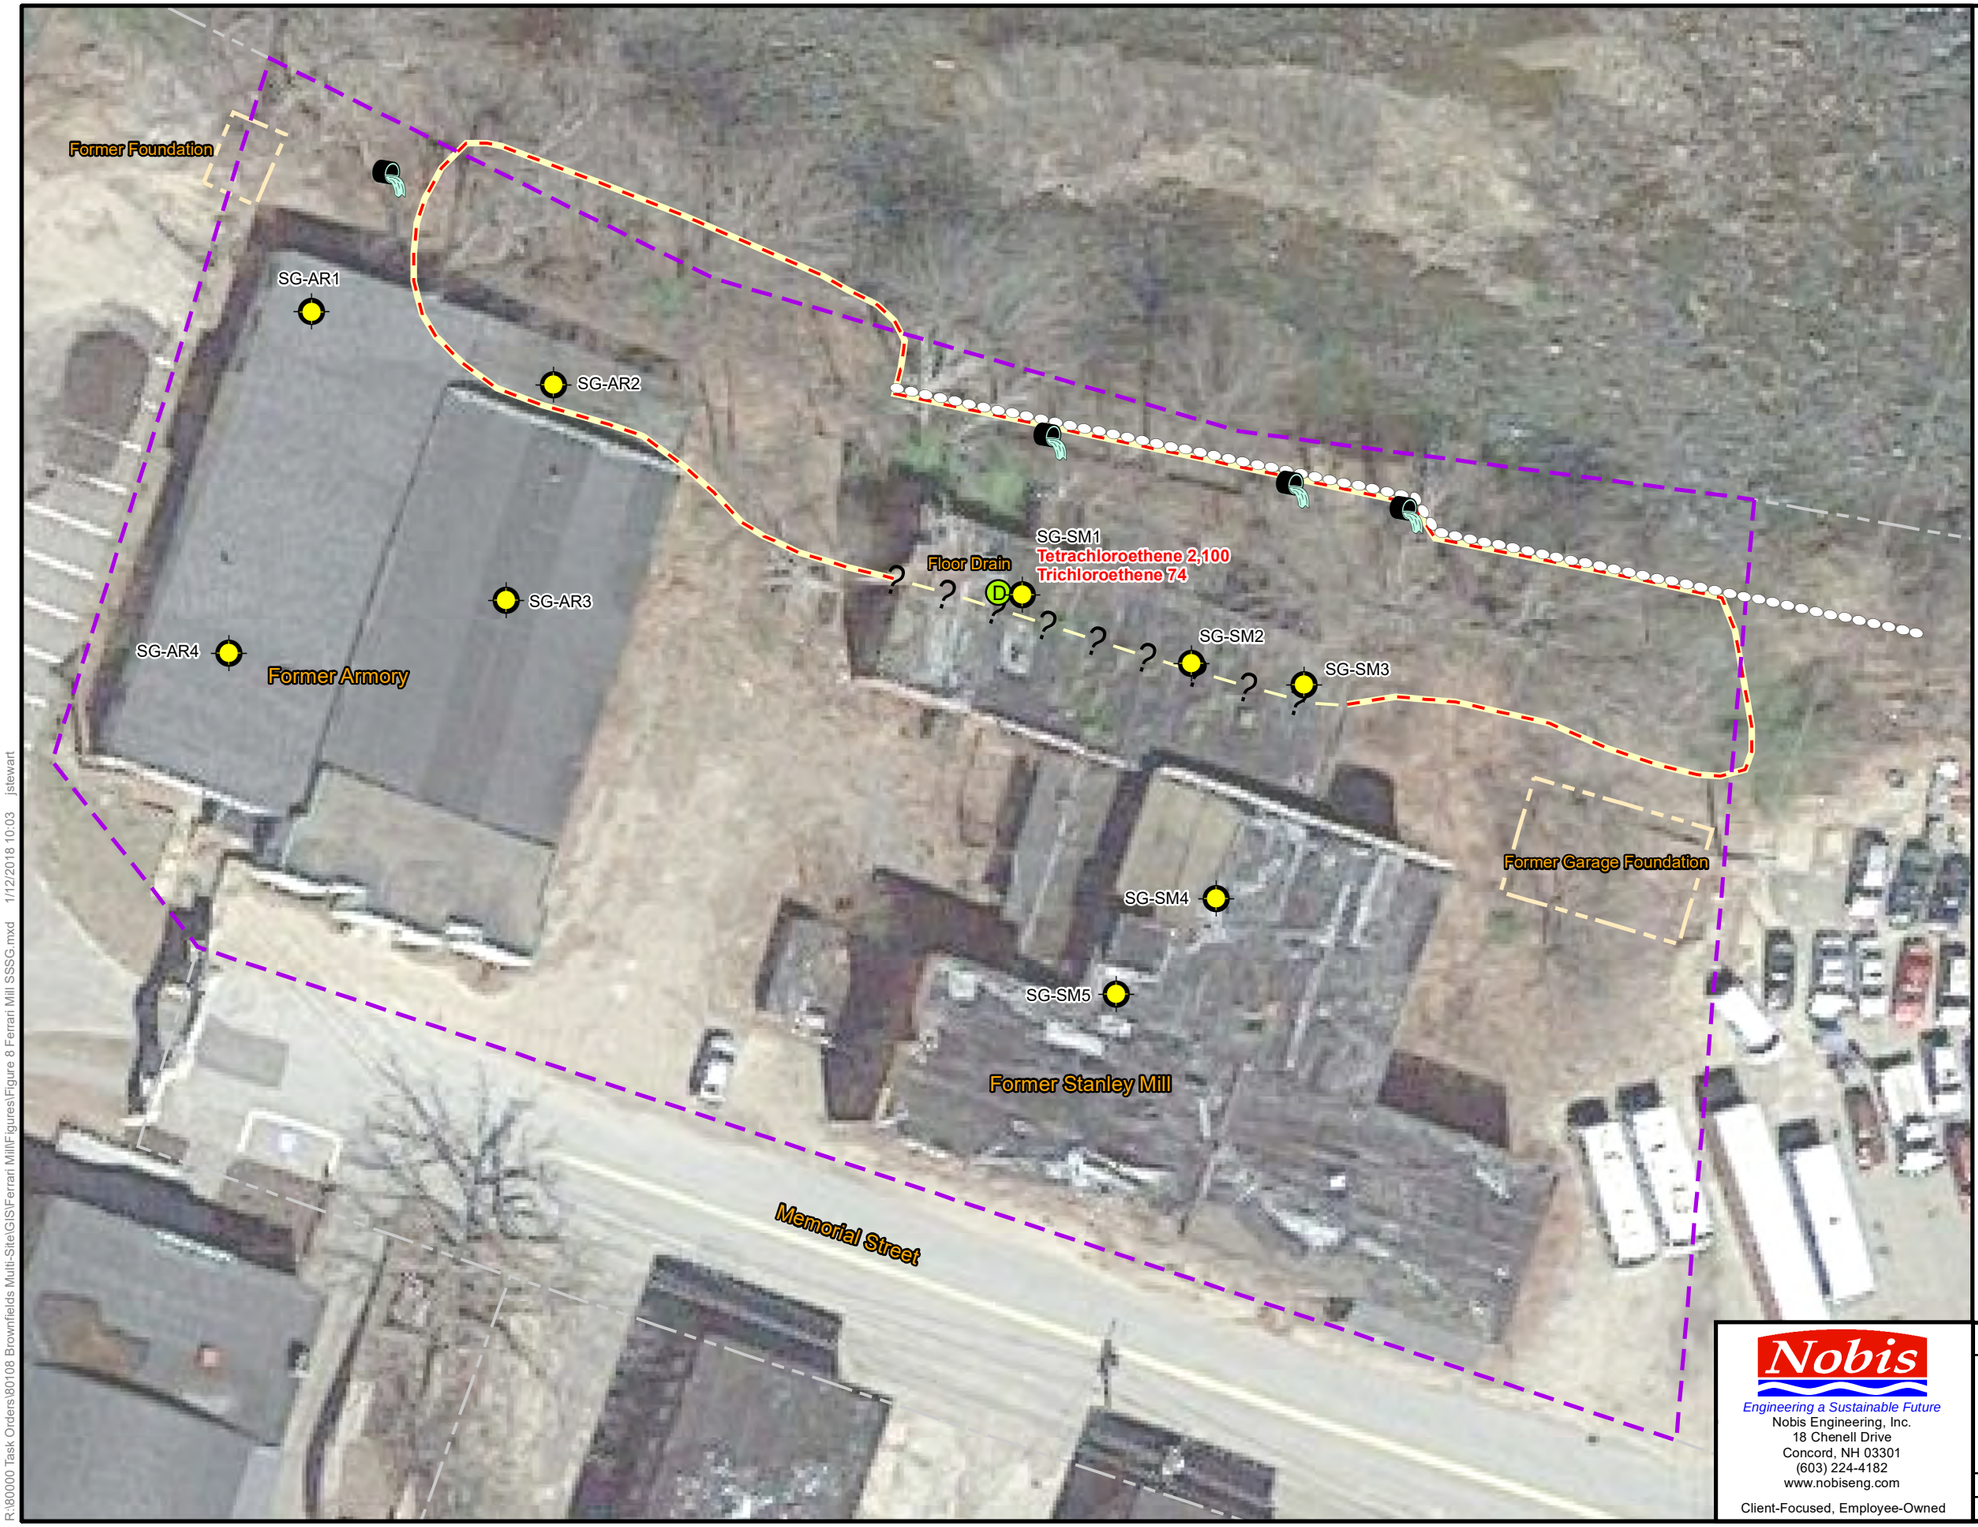

Notes:

1. Site sketch was developed from several sources including, City of Franklin Tax Map N8, Figures created by Credere Associates, LLC, observations made by Nobis and from the aerial photography provided by ESRI.

2. Results exceeding applicable NH Residential Soil Gas Screening Levels are shown in ug/m^3.

3. Locations of site features depicted hereon are approximate and given for illustrative purposes only.

Legend

- Sub-Slab Sample Location
- Floor Drain
- Outfall
- Retaining Wall
- Property Boundary
- Site Boundary
- Limit of Fill (Metal Shavings and Saw Blades)
- Foundation

N

0 15 30 60

Feet

1 inch = 30 feet

Nobis
Engineering a Sustainable Future
Nobis Engineering, Inc.
18 Chenell Drive
Concord, NH 03301
(603) 224-4182
www.nobiseng.com
Client-Focused, Employee-Owned

FIGURE 8

SUB-SLAB SOIL GAS INVESTIGATION
FERRARI MILL
93-119 MEMORIAL STREET
FRANKLIN, NEW HAMPSHIRE

PREPARED BY: JRS	CHECKED BY: TA
PROJECT NO. 80108.08	DATE: FEBRUARY 2018

R:\80000 Task Orders\80108 Brownfields Multi-Site\GIS\Ferrari Mill\Figures\Figure 8 Ferrari Mill SSSG.mxd 1/12/2018 10:03 jstewart

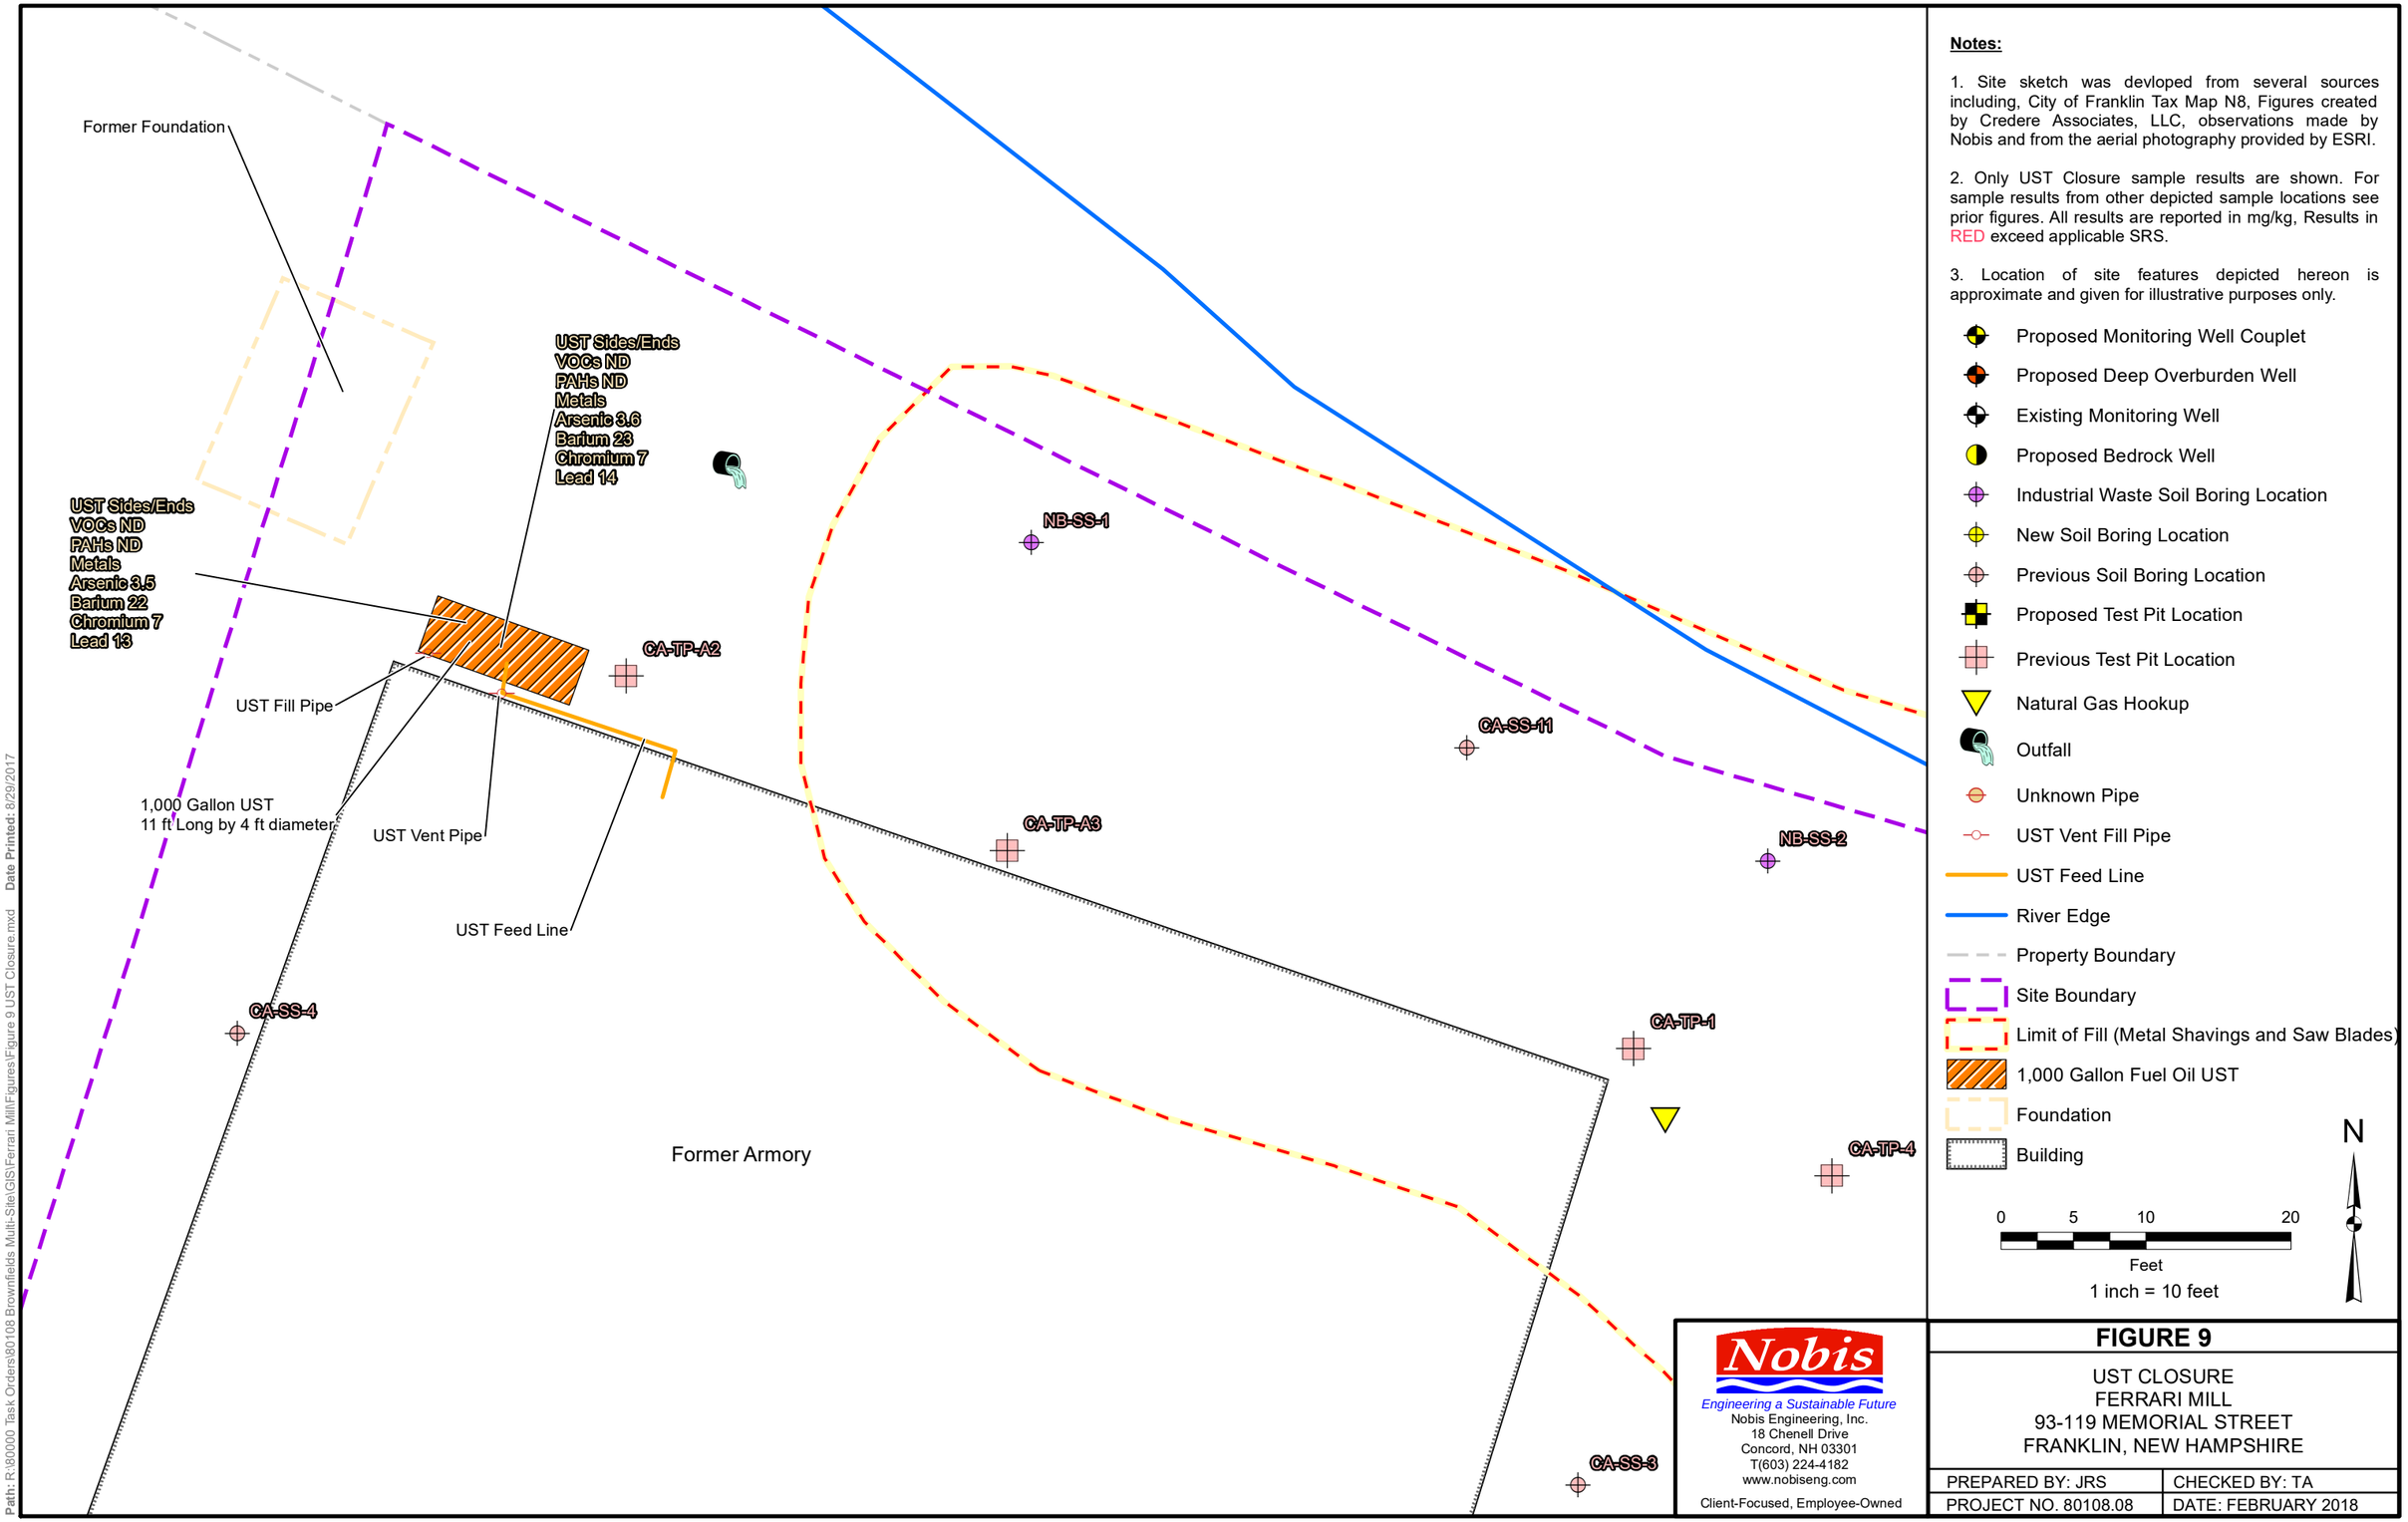

Notes:

1. Site sketch was devloped from several sources including, City of Franklin Tax Map N8, Figures created by Credere Associates, LLC, observations made by Nobis and from the aerial photography provided by ESRI.

2. Only UST Closure sample results are shown. For sample results from other depicted sample locations see prior figures. All results are reported in mg/kg, Results in RED exceed applicable SRS.

3. Location of site features depicted hereon is approximate and given for illustrative purposes only.

- Proposed Monitoring Well Couplet
- Proposed Deep Overburden Well
- Existing Monitoring Well
- Proposed Bedrock Well
- Industrial Waste Soil Boring Location
- New Soil Boring Location
- Previous Soil Boring Location
- Proposed Test Pit Location
- Previous Test Pit Location
- Natural Gas Hookup
- Outfall
- Unknown Pipe
- UST Vent Fill Pipe
- UST Feed Line
- River Edge
- Property Boundary
- Site Boundary
- Limit of Fill (Metal Shavings and Saw Blades)
- 1,000 Gallon Fuel Oil UST
- Foundation
- Building

N

0 5 10 20

Feet

1 inch = 10 feet

Nobis
Engineering a Sustainable Future
Nobis Engineering, Inc.
18 Chenell Drive
Concord, NH 03301
T(603) 224-4182
www.nobiseng.com
Client-Focused, Employee-Owned

FIGURE 9

UST CLOSURE
FERRARI MILL
93-119 MEMORIAL STREET
FRANKLIN, NEW HAMPSHIRE

PREPARED BY: JRS	CHECKED BY: TA
PROJECT NO. 80108.08	DATE: FEBRUARY 2018

Path: R:\80000 Task Orders\80108 Brownfields Multi-Site\GIS\Ferrari Mill\Figures\Figure 9 UST Closure.mxd **Date Printed:** 8/29/2017

Notes:

1. Site sketch was devloped from several sources including, City of Franklin Tax Map N8, Figures created by Credere Associates, LLC, observations made by Nobis and from the aerial photography provided by ESRI.

2. Sample locations in RED indicate presence of asbestos or PCBs exceeding applicable standards.

3. Location of site features depicted hereon is approximate and given for illustrative purposes only.

Legend

- Asbestos Sample Location
- PCB Sample Location
- Drum
- Floor Drain
- Outfall
- UST Vent Fill Line
- Retaining Wall
- Property Boundary
- Site Boundary

N

0 15 30 60

Feet

1 inch = 30 feet

Nobis

Engineering a Sustainable Future

Nobis Engineering, Inc.
18 Chenell Drive
Concord, NH 03301
T(603) 224-4182
www.nobiseng.com

Client-Focused, Employee-Owned

FIGURE 10

BUILDING MATERIALS SAMPLE LOCATION PLAN
FERRARI MILL
93-119 MEMORIAL STREET
FRANKLIN, NEW HAMPSHIRE

PREPARED BY: JRS	CHECKED BY: TA
PROJECT NO. 80108.08	DATE: FEBRUARY 2018

Path: R:\80000 Task Orders\80108 Brownfields Multi-Site\GIS\Ferrari Mill\Figures\Figure 10 Building Materials Sample Location Plan.mxd **Date Printed:** 8/29/2017

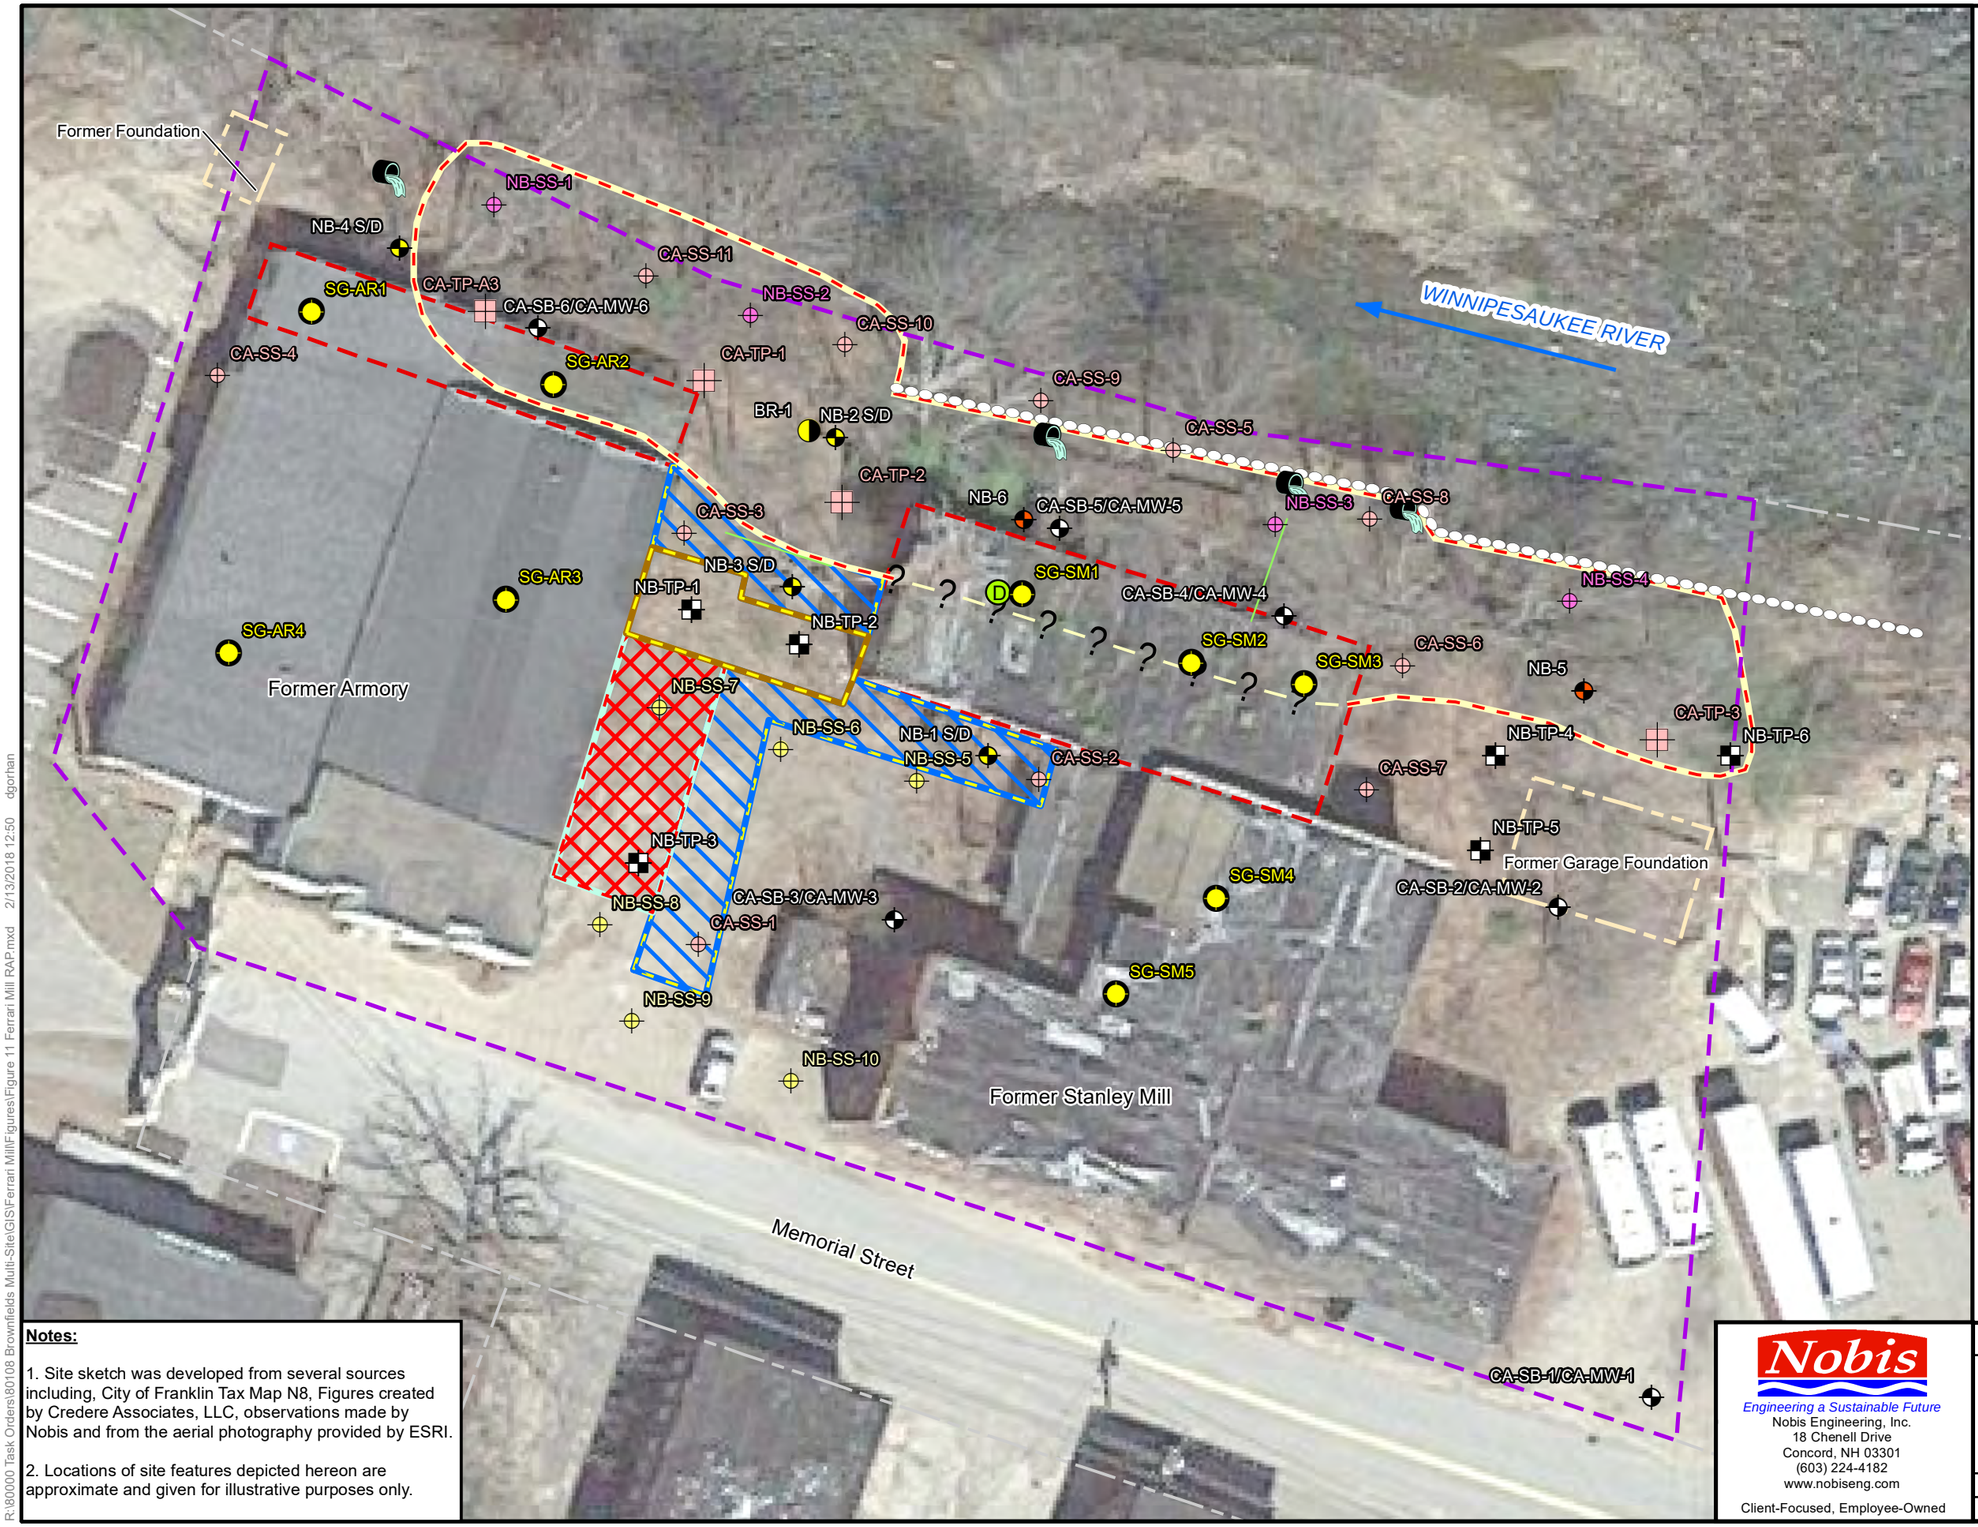

Legend

- Existing Overburden Monitoring Well
- New Overburden Monitoring Well Couplet
- New Deep Overburden Monitoring Well
- New Bedrock Monitoring Well
- Previous Soil Boring Location
- Nobis Industrial Waste Shallow Soil Boring
- Nobis Shallow Soil Boring
- Previous Test Pit Location
- Nobis Test Pit Location
- Nobis Sub-Slab Sample Location
- Floor Drain
- Outfall
- Pipe
- Retaining Wall
- Property Boundary
- Site Boundary
- Industrial Waste Fill Material
- Sub-Surface PAH Impacted Soil Area S-3 Exceedance; Excavate to 3.0 ft bgs
- Shallow PAH Impacted Soil Area S-3 Exceedance; Excavate to 1.5 ft bgs
- Shallow PAH Impacted Soil Area S-1 Exceedance; Excavate to 1.5 ft bgs
- Partial Building Demolition Areas
- Foundation

N

0 15 30 60

Feet

1 inch = 30 feet

Notes:

1. Site sketch was developed from several sources including, City of Franklin Tax Map N8, Figures created by Credere Associates, LLC, observations made by Nobis and from the aerial photography provided by ESRI.

2. Locations of site features depicted hereon are approximate and given for illustrative purposes only.

Nobis
Engineering a Sustainable Future
Nobis Engineering, Inc.
18 Chenell Drive
Concord, NH 03301
(603) 224-4182
www.nobiseng.com
Client-Focused, Employee-Owned

FIGURE 11

REMEDIAL ACTION PLAN
FERRARI MILL
93-119 MEMORIAL STREET
FRANKLIN, NEW HAMPSHIRE

PREPARED BY: JRS	CHECKED BY: TA
PROJECT NO. 80108.08	DATE: FEBRUARY 2018

R:\80000 Task Orders\80108 Brownfields Multi-Site\GIS\Ferrari Mill\Figures\Figure 11 Ferrari Mill RAP.mxd 2/13/2018 12:50 dgorhan

National Flood Hazard Layer FIRMette

FEMA

71°39'11"W 43°26'59"N

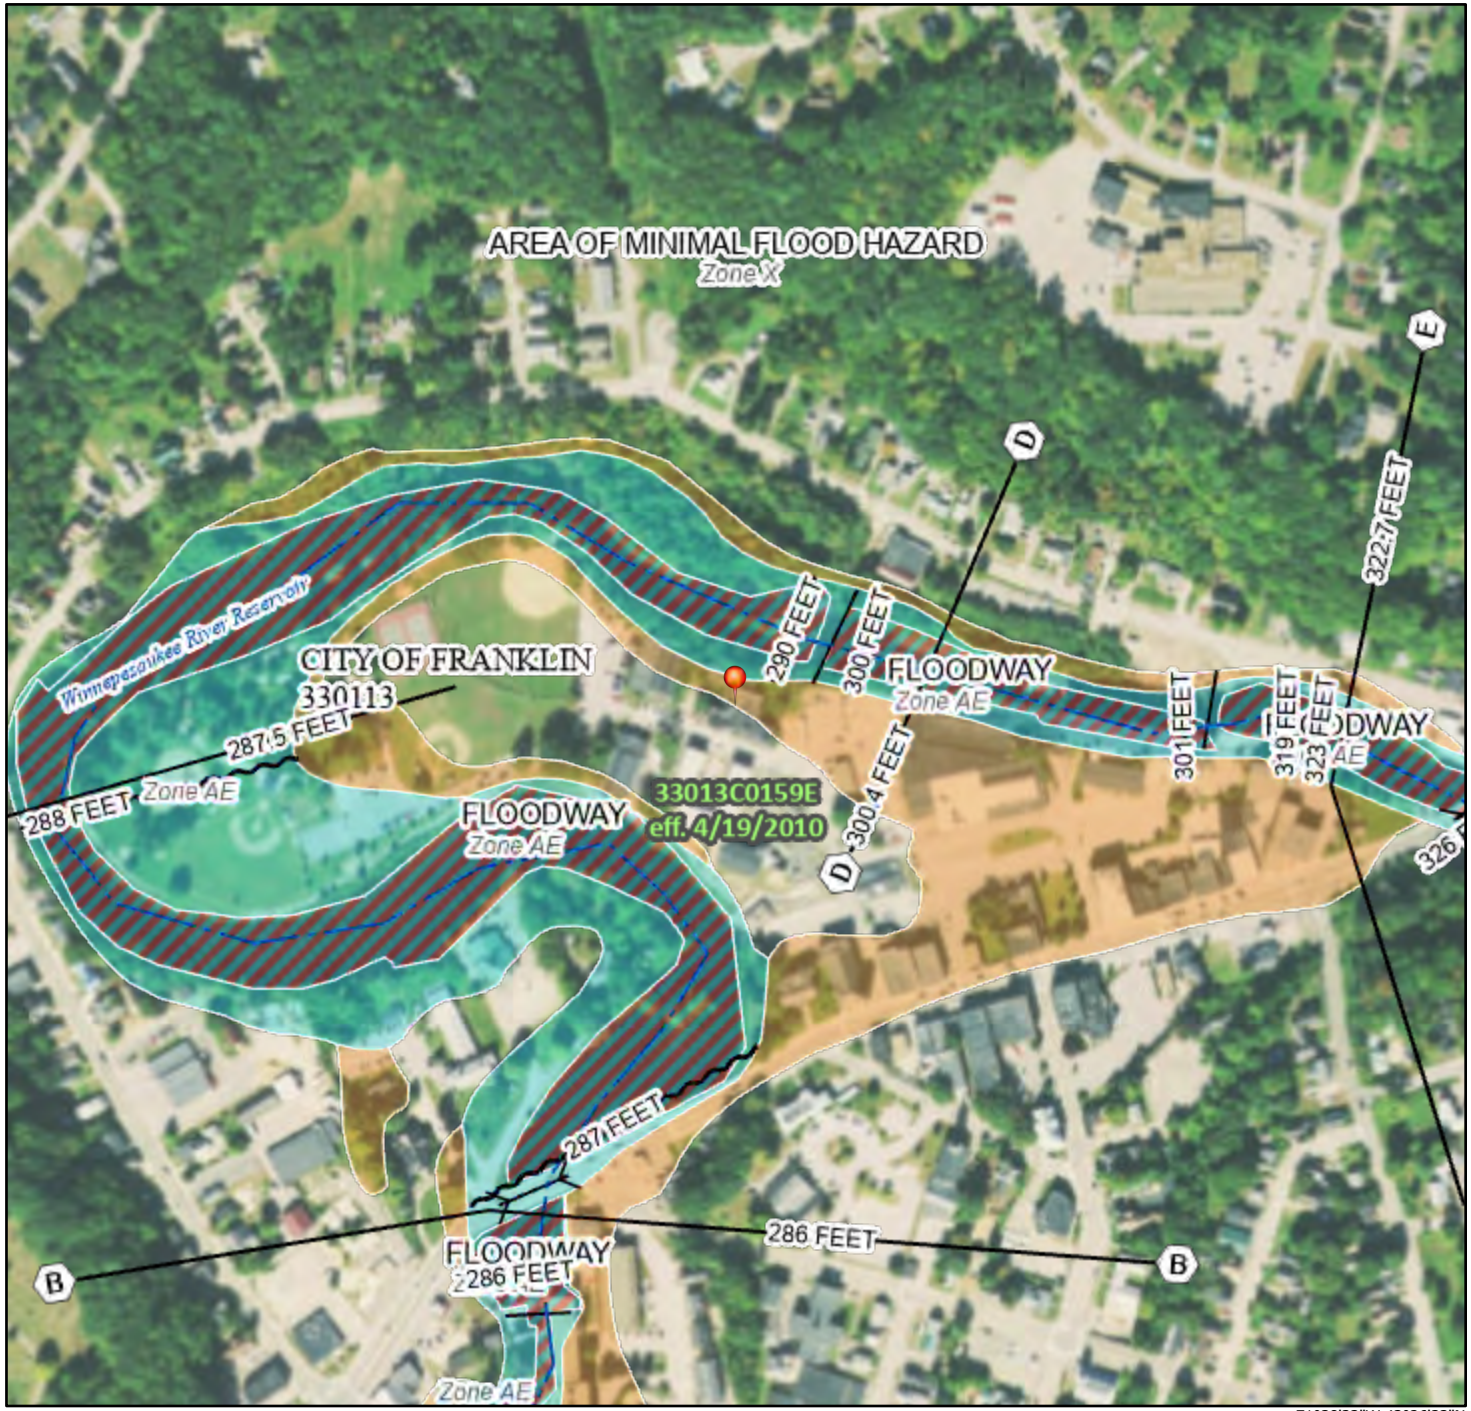

71°38'33"W 43°26'33"N

Feet

0 250 500 1,000 1,500 2,000

1:6,000

Basemap: USGS National Map: Orthoimagery: Data refreshed October, 2020

Legend

SEE FIS REPORT FOR DETAILED LEGEND AND INDEX MAP FOR FIRM PANEL LAYOUT

SPECIAL FLOOD HAZARD AREAS
- Without Base Flood Elevation (BFE) *Zone A, V, A99*
- With BFE or Depth *Zone AE, AO, AH, VE, AR*
- Regulatory Floodway

OTHER AREAS OF FLOOD HAZARD
- 0.2% Annual Chance Flood Hazard, Areas of 1% annual chance flood with average depth less than one foot or with drainage areas of less than one square mile *Zone X*
- Future Conditions 1% Annual Chance Flood Hazard *Zone X*
- Area with Reduced Flood Risk due to Levee. See Notes. *Zone X*
- Area with Flood Risk due to Levee *Zone D*

OTHER AREAS
- NO SCREEN Area of Minimal Flood Hazard *Zone X*
- Effective LOMRs
- Area of Undetermined Flood Hazard *Zone D*

GENERAL STRUCTURES
- Channel, Culvert, or Storm Sewer
- Levee, Dike, or Floodwall

OTHER FEATURES
- 20.2 Cross Sections with 1% Annual Chance
- 17.5 Water Surface Elevation
- Coastal Transect
- Base Flood Elevation Line (BFE)
- Limit of Study
- Jurisdiction Boundary
- Coastal Transect Baseline
- Profile Baseline
- Hydrographic Feature

MAP PANELS
- Digital Data Available
- No Digital Data Available
- Unmapped

N

The pin displayed on the map is an approximate point selected by the user and does not represent an authoritative property location.

This map complies with FEMA's standards for the use of digital flood maps if it is not void as described below. The basemap shown complies with FEMA's basemap accuracy standards

The flood hazard information is derived directly from the authoritative NFHL web services provided by FEMA. This map was exported on 9/27/2022 at 9:03 AM and does not reflect changes or amendments subsequent to this date and time. The NFHL and effective information may change or become superseded by new data over time.

This map image is void if the one or more of the following map elements do not appear: basemap imagery, flood zone labels, legend, scale bar, map creation date, community identifiers, FIRM panel number, and FIRM effective date. Map images for unmapped and unmodernized areas cannot be used for regulatory purposes.

APPENDIX D

Stanley Mill
93 Memorial Street
Franklin, NH 03235

Inquiry Number: 7125568.2s
September 21, 2022

The EDR Radius Map™ Report with GeoCheck®

6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

TABLE OF CONTENTS

SECTION	PAGE
Executive Summary	ES1
Overview Map	2
Detail Map	3
Map Findings Summary	4
Map Findings	8
Orphan Summary	382
Government Records Searched/Data Currency Tracking	GR-1

GEOCHECK ADDENDUM

Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting Source Map	A-8
Physical Setting Source Map Findings	A-9
Physical Setting Source Records Searched	PSGR-1

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, LLC. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. This Report is provided on an "AS IS", "AS AVAILABLE" basis. **NO WARRANTY EXPRESS OR IMPLIED IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, LLC AND ITS SUBSIDIARIES, AFFILIATES AND THIRD PARTY SUPPLIERS DISCLAIM ALL WARRANTIES, OF ANY KIND OR NATURE, EXPRESS OR IMPLIED, ARISING OUT OF OR RELATED TO THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT, INCLUDING WITHOUT LIMITATION, ANY WARRANTIES REGARDING ACCURACY, QUALITY, CORRECTNESS, COMPLETENESS, COMPREHENSIVENESS, SUITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, TITLE, NON-INFRINGEMENT, MISAPPROPRIATION, OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, LLC OR ITS SUBSIDIARIES, AFFILIATES OR THIRD PARTY SUPPLIERS BE LIABLE TO ANYONE FOR ANY DIRECT, INCIDENTAL, INDIRECT, SPECIAL, CONSEQUENTIAL OR OTHER DAMAGES OF ANY TYPE OR KIND (INCLUDING BUT NOT LIMITED TO LOSS OF PROFITS, LOSS OF USE, OR LOSS OF DATA) INFORMATION PROVIDED IN THIS REPORT.** Any analyses, estimates, ratings, environmental risk levels, or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only an assessment performed by a qualified environmental professional can provide findings, opinions or conclusions regarding the environmental risk or conditions in, on or at any property.

Copyright 2022 by Environmental Data Resources, LLC. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, LLC, or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, LLC or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E1527-21), the ASTM Standard Practice for Environmental Site Assessments for Forestland or Rural Property (E 2247-16), the ASTM Standard Practice for Limited Environmental Due Diligence: Transaction Screen Process (E 1528-14) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

93 MEMORIAL STREET
FRANKLIN, NH 03235

COORDINATES

Latitude (North):	43.4462090 - 43ˆ 26' 46.35''
Longitude (West):	71.6479210 - 71ˆ 38' 52.51''
Universal Tranverse Mercator:	Zone 19
UTM X (Meters):	285730.3
UTM Y (Meters):	4813558.0
Elevation:	300 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map:	11743457 FRANKLIN, NH
Version Date:	2018

AERIAL PHOTOGRAPHY IN THIS REPORT

Portions of Photo from:	20140725
Source:	USDA

MAPPED SITES SUMMARY

Target Property Address:
93 MEMORIAL STREET
FRANKLIN, NH 03235

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
A1	FERRARI MILL	93 MEMORIAL STREET	US BROWNFIELDS		TP
A2	FERRARI MILL	93 MEMORIAL STREET	FINDS		TP
A3	STANLEY MILL	93-119 MEMORIAL STRE	NH BROWNFIELDS, NH ALLSITES		TP
A4	FRANKLIN CITY OF	93 MEMORIAL ST	NH UST, RCRA NonGen / NLR		TP
A5	FRANKLIN CITY OF	93 MEMORIAL ST	FINDS, ECHO		TP
A6	ALGONQUIN POWER SYST	40 MEMORIAL ST	RCRA NonGen / NLR	Higher	35, 0.007, SE
B7	LEMIRE AIME J	31 MEMORIAL ST	EDR Hist Cleaner	Higher	99, 0.019, SE
C8	R & D PAVING	81 MEMORIAL STREET	NH BROWNFIELDS, NH ALLSITES	Lower	137, 0.026, WSW
C9	R&D PAVING	81 MEMORIAL STREET	US BROWNFIELDS	Lower	137, 0.026, WSW
B10	FRANKLIN BUSINESS	20 CANAL ST	RCRA NonGen / NLR	Higher	217, 0.041, SE
B11	FRANKLIN BUSINESS CE	20 CANAL STREET	US BROWNFIELDS, ICIS, US AIRS, FINDS, ECHO	Higher	217, 0.041, SE
B12	FRANKLIN BUSINESS CE	20 CANAL ST	NH SHWS, NH UST, NH AST, NH BROWNFIELDS, NH...	Higher	217, 0.041, SE
B13	R & D PAVING	20 MEMORIAL ST	RCRA NonGen / NLR	Higher	231, 0.044, SSE
C14	CATCH NEIGHBORHOOD H	100 MEMORIAL ST	RCRA NonGen / NLR	Lower	267, 0.051, WSW
C15	RIVERBEND MILL	100 MEMORIAL STREET	NH INST CONTROL, NH ALLSITES	Lower	267, 0.051, WSW
16	PROFORMA PIPER PRINT	102 E BOW ST	RCRA NonGen / NLR	Higher	290, 0.055, NE
D17	FRANKLIN CITY OF	316 CENTRAL ST	RCRA NonGen / NLR, FINDS	Higher	491, 0.093, SSE
D18	FRANKLIN CITY HALL	316 CENTRAL ST	NH UST	Higher	491, 0.093, SSE
D19	PETER CHRISTENSEN	336 CENTRAL STREET	NH ALLSITES	Higher	499, 0.095, SSE
D20	F M PIPER PRINTING L	338 CENTRAL ST	RCRA NonGen / NLR	Higher	501, 0.095, SSE
21	PROFILE ELECTRONICS	SMITH & CANAL STS	RCRA NonGen / NLR	Higher	523, 0.099, ESE
D22	FRANKLIN CLEANERS	333-335 CENTRAL ST	EDR Hist Cleaner	Higher	538, 0.102, SSE
D23	CITY SIDE CLEANERS	333 CENTRAL ST	RCRA NonGen / NLR, NH DRYCLEANERS, RI MANIFEST	Higher	538, 0.102, SSE
D24	COLPITTS GREGORY DMD	378 CENTRAL ST	RCRA NonGen / NLR	Higher	544, 0.103, SE
D25	C N BROWN CO	298 CENTRAL ST	RCRA NonGen / NLR	Higher	546, 0.103, South
D26	FRANKLIN BUSINESS&IN	380 CENTRAL ST	RCRA NonGen / NLR, NY MANIFEST	Higher	547, 0.104, SE
D27	REGAL AUCTION	349 CENTRAL ST	RCRA NonGen / NLR	Higher	548, 0.104, SE
D28	REGAL AUCTION SERVIC	349 CENTRAL ST	NH UST	Higher	548, 0.104, SE
D29	JJ NEWBERRY #6146	384 CENTRAL ST	NH UST	Higher	553, 0.105, SE
E30	ACCESS DENTAL	398 CENTRAL ST	RCRA NonGen / NLR	Higher	577, 0.109, SE
D31	FRANKLIN SAVINGS BAN	387 CENTRAL ST	RCRA NonGen / NLR	Higher	592, 0.112, SE
D32	BAPTIST CHURCH OF FR	21 CHURCH ST	RCRA NonGen / NLR, FINDS, ECHO	Higher	643, 0.122, SSE
33	FRANKLIN SAVINGS BAN	287 CENTRAL STREET	NH UST	Higher	643, 0.122, South
E34	FRANKLIN SAVINGS BAN	405 CENTRAL STREET	NH UST	Higher	647, 0.123, SE
F35	KEEGAN E J & CO	425 CENTRAL ST	RCRA NonGen / NLR	Higher	787, 0.149, ESE
F36	MERRIMACK MAGNETICS	SMITH & CANAL STS	RCRA NonGen / NLR	Higher	819, 0.155, ESE
F37	DANS PHARMACY	436 CENTRAL ST	RCRA NonGen / NLR	Higher	842, 0.159, ESE
G38	CUMBERLAND FARMS 280	233 CENTRAL ST	RCRA NonGen / NLR, RI MANIFEST	Lower	864, 0.164, SSW
H39	SCOTT FARAH	2 AYLES COURT	NH ALLSITES	Higher	889, 0.168, SE

MAPPED SITES SUMMARY

Target Property Address:
93 MEMORIAL STREET
FRANKLIN, NH 03235

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
G40	CORMIER CORPORATION	1 RIVER STREET	NH UST	Lower	929, 0.176, SSW
I41	NH DES WMD	38 E BOW ST	RCRA NonGen / NLR	Higher	939, 0.178, East
I42	FORMER JP STEVENS MI	38 E BOW ST	NH UST	Higher	939, 0.178, East
I43	FORMER JP STEVENS MI	38 E BOW ST	NH BROWNFIELDS, NH ALLSITES	Higher	939, 0.178, East
F44	SHOP EXPRESS	449 CENTRAL ST	NH LUST	Higher	968, 0.183, ESE
F45	SHOP EXPRESS	449 CENTRAL ST	NH UST	Higher	968, 0.183, ESE
F46	XTRA MART	449 CENTRAL ST	RCRA-VSQG, RI MANIFEST	Higher	968, 0.183, ESE
I47	ALGONQUIN POWER STAT	35 E BOW ST	RCRA NonGen / NLR	Higher	972, 0.184, East
H48	FARRAH SCOTT	42 FRANKLIN ST	RCRA NonGen / NLR	Higher	978, 0.185, SE
G49	CUMBERLAND FARMS 280	233 CENTRAL ST	NH UST, NH NPDES	Lower	1045, 0.198, SSW
G50	CUMBERLAND FARMS 280	233 CENTRAL ST	NH SHWS, NH LUST, NH ALLSITES	Lower	1045, 0.198, SSW
H51	TERHUNE JONATHAN H D	58 FRANKLIN ST	RCRA NonGen / NLR	Higher	1091, 0.207, SE
J52	U S POSTAL SERVICE	65 FRANKLIN ST	NH UST	Higher	1104, 0.209, SSE
53	PSNH FRANKLIN SUBSTA	145 WEST BOW ST	NH AST	Lower	1116, 0.211, West
K54	FRANKLIN FIRE DEPART	59 W BOW ST	RCRA NonGen / NLR, FINDS, ECHO	Lower	1193, 0.226, WSW
K55	FRANKLIN FIRE STATIO	59 W BOW ST	NH SHWS, NH LUST, NH UST, NH INST CONTROL, NH...	Lower	1193, 0.226, WSW
K56	FRANKLIN GAS WORKS	59 W BOW STREET	EDR MGP	Lower	1193, 0.226, WSW
J57	FAIRPOINT	76 FRANKLIN ST	NH LUST, NH UST	Higher	1196, 0.227, SSE
J58	FAIRPOINT COMMUNICAT	76 FRANKLIN ST	RCRA NonGen / NLR	Higher	1196, 0.227, SSE
K59	TRADEBE HHW	43 W BOW STRTE 127	RCRA-VSQG	Lower	1209, 0.229, SW
K60	CLEAN VENTURE HHW	43 W BOW ST	PA MANIFEST	Lower	1209, 0.229, SW
61	DAN HUGHES RESIDENCE	34 BEATON ST	NH ALLSITES	Higher	1244, 0.236, NE
62	DRUG ENFORCEMENT AGE	12 SPRING ST	RCRA NonGen / NLR, FINDS, ECHO	Higher	1267, 0.240, SE
63	STONE RESIDENCE	102 FRANKLIN ST	NH ALLSITES	Higher	1413, 0.268, SSE
L64	PACKERS OUTLET	195 CENTRAL ST	NH LUST, NH UST, NH ASBESTOS	Lower	1472, 0.279, SSW
L65	FMR CIAO PASTA	194 - 202 CENTRAL ST	NH BROWNFIELDS, NH ALLSITES, NH PFAS	Lower	1473, 0.279, SSW
L66	CIAO PASTA	194-202 CENTRAL STRE	US BROWNFIELDS, FINDS	Lower	1473, 0.279, SSW
L67	FRANKLIN ELKS LODGE	192 CENTRAL STREET	NH BROWNFIELDS, NH ALLSITES	Lower	1511, 0.286, SSW
L68	ANGELL PROPERTY	175 CENTRAL STREET	NH LUST	Lower	1695, 0.321, SSW
69	CASTLE MOTORS	168 CENTRAL ST	NH SHWS, NH LUST, NH INST CONTROL, FINDS, ECHO	Lower	1761, 0.334, SSW
70	CURTIS RESIDENCE	46 RIVER STREET	NH ALLSITES	Lower	2013, 0.381, South
71	SCOTT MARCHANT	23 GLORY DR	NH ALLSITES	Higher	2027, 0.384, North
72	PETRIGNI PROPERTY	75 ORCHARD STREET	NH ALLSITES	Higher	2036, 0.386, ESE
73	GARY DELISLE	46 VIEW STREET	NH ALLSITES	Higher	2047, 0.388, SSE
74	RUSSELL COX	624 CENTRAL ST	NH ALLSITES	Higher	2412, 0.457, East
75	LESTER RESIDENCE	52 FREEDOM DR	NH ALLSITES	Higher	2511, 0.476, North
M76	POLYCLAD LAMINATES I	45 TANNERY ST	NH LUST, NH BROWNFIELDS, NH ALLSITES, NH AIRS	Higher	2630, 0.498, WNW
M77	POLYCLAD LAMINATES,	45 TANNERY STREET	US BROWNFIELDS	Higher	2630, 0.498, WNW
78	QUICK TURN FLEX CIRC	174 N MAIN ST	NH SHWS, NH UST, RCRA NonGen / NLR, RI MANIFEST,...	Higher	3256, 0.617, WSW

MAPPED SITES SUMMARY

Target Property Address:
93 MEMORIAL STREET
FRANKLIN, NH 03235

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
79	CROWLEY TRUCKING	4 GREEN STREET	NH SHWS, NH INST CONTROL	Higher	4090, 0.775, East
80	FRANKLIN NON-FERROUS	293 SANBORN STREET	NH SHWS, NH ALLSITES	Higher	4692, 0.889, NE

EXECUTIVE SUMMARY

TARGET PROPERTY SEARCH RESULTS

The target property was identified in the following records. For more information on this property see page 8 of the attached EDR Radius Map report:

Site	Database(s)	EPA ID
FERRARI MILL 93 MEMORIAL STREET FRANKLIN, NH 3235	US BROWNFIELDS ACRES property ID: 174843 Cleanup Completion Date: -	N/A
FERRARI MILL 93 MEMORIAL STREET FRANKLIN, NH 03235	FINDS Registry ID:: 110061089762	N/A
STANLEY MILL 93-119 MEMORIAL STRE FRANKLIN, NH	NH BROWNFIELDS Facility Id: 198606087 NH ALLSITES Facility Id: 198606087 Project Manager: MCCLUSKEY	N/A
FRANKLIN CITY OF 93 MEMORIAL ST FRANKLIN, NH 03235	NH UST Status: INACTIVE Facility Id: 113000 Closure Date: 02/01/1999 RCRA NonGen / NLR EPA ID:: NHD095519823	NHD095519823
FRANKLIN CITY OF 93 MEMORIAL ST FRANKLIN, NH 03235	FINDS Registry ID:: 110004091795 ECHO Registry ID: 110004091795	N/A

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

STANDARD ENVIRONMENTAL RECORDS

Lists of Federal NPL (Superfund) sites

NPL ---------- National Priority List

EXECUTIVE SUMMARY

Proposed NPL ---------- Proposed National Priority List Sites
NPL LIENS ---------- Federal Superfund Liens

Lists of Federal Delisted NPL sites

Delisted NPL ---------- National Priority List Deletions

Lists of Federal sites subject to CERCLA removals and CERCLA orders

FEDERAL FACILITY ---------- Federal Facility Site Information listing
SEMS ---------- Superfund Enterprise Management System

Lists of Federal CERCLA sites with NFRAP

SEMS-ARCHIVE ---------- Superfund Enterprise Management System Archive

Lists of Federal RCRA facilities undergoing Corrective Action

CORRACTS ---------- Corrective Action Report

Lists of Federal RCRA TSD facilities

RCRA-TSDF ---------- RCRA - Treatment, Storage and Disposal

Lists of Federal RCRA generators

RCRA-LQG ---------- RCRA - Large Quantity Generators
RCRA-SQG ---------- RCRA - Small Quantity Generators

Federal institutional controls / engineering controls registries

LUCIS ---------- Land Use Control Information System
US ENG CONTROLS ---------- Engineering Controls Sites List
US INST CONTROLS ---------- Institutional Controls Sites List

Federal ERNS list

ERNS ---------- Emergency Response Notification System

Lists of state and tribal landfills and solid waste disposal facilities

NH SWF/LF ---------- Solid Waste Facility Information

Lists of state and tribal leaking storage tanks

NH LAST ---------- Listing of All Sites
INDIAN LUST ---------- Leaking Underground Storage Tanks on Indian Land

Lists of state and tribal registered storage tanks

FEMA UST ---------- Underground Storage Tank Listing
INDIAN UST ---------- Underground Storage Tanks on Indian Land

Lists of state and tribal voluntary cleanup sites

NH VCP ---------- Voluntary Cleanup Program Sites

INDIAN VCP ---- Voluntary Cleanup Priority Listing

ADDITIONAL ENVIRONMENTAL RECORDS

Local Lists of Landfill / Solid Waste Disposal Sites

NH SWRCY ---- Recycling Centers
INDIAN ODI ---- Report on the Status of Open Dumps on Indian Lands
DEBRIS REGION 9 ---- Torres Martinez Reservation Illegal Dump Site Locations
ODI ---- Open Dump Inventory
IHS OPEN DUMPS ---- Open Dumps on Indian Land

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL ---- Delisted National Clandestine Laboratory Register
NH CDL ---- Clandestine Drug Lab Listing
US CDL ---- National Clandestine Laboratory Register

Local Land Records

NH LIENS ---- Environmental Liens Information Listing
LIENS 2 ---- CERCLA Lien Information

Records of Emergency Release Reports

HMIRS ---- Hazardous Materials Information Reporting System
NH SPILLS 90 ---- SPILLS 90 data from FirstSearch

Other Ascertainable Records

FUDS ---- Formerly Used Defense Sites
DOD ---- Department of Defense Sites
SCRD DRYCLEANERS ---- State Coalition for Remediation of Drycleaners Listing
US FIN ASSUR ---- Financial Assurance Information
EPA WATCH LIST ---- EPA WATCH LIST
2020 COR ACTION ---- 2020 Corrective Action Program List
TSCA ---- Toxic Substances Control Act
TRIS ---- Toxic Chemical Release Inventory System
SSTS ---- Section 7 Tracking Systems
ROD ---- Records Of Decision
RMP ---- Risk Management Plans
RAATS ---- RCRA Administrative Action Tracking System
PRP ---- Potentially Responsible Parties
PADS ---- PCB Activity Database System
FTTS ---- FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
MLTS ---- Material Licensing Tracking System
COAL ASH DOE ---- Steam-Electric Plant Operation Data
COAL ASH EPA ---- Coal Combustion Residues Surface Impoundments List
PCB TRANSFORMER ---- PCB Transformer Registration Database
RADINFO ---- Radiation Information Database
HIST FTTS ---- FIFRA/TSCA Tracking System Administrative Case Listing
DOT OPS ---- Incident and Accident Data
CONSENT ---- Superfund (CERCLA) Consent Decrees

INDIAN RESERV Indian Reservations
FUSRAP Formerly Utilized Sites Remedial Action Program
UMTRA Uranium Mill Tailings Sites
LEAD SMELTERS Lead Smelter Sites
US MINES Mines Master Index File
ABANDONED MINES Abandoned Mines
DOCKET HWC Hazardous Waste Compliance Docket Listing
UXO Unexploded Ordnance Sites
FUELS PROGRAM EPA Fuels Program Registered Listing
NH Financial Assurance Financial Assurance Information Listing
NH LEAD Lead Inspection Database
NH MANIFEST Hazardous Waste Manifest Information Listing
MINES MRDS Mineral Resources Data System

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR Hist Auto EDR Exclusive Historical Auto Stations

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

NH RGA HWS Recovered Government Archive State Hazardous Waste Facilities List
NH RGA LF Recovered Government Archive Solid Waste Facilities List
NH RGA LUST Recovered Government Archive Leaking Underground Storage Tank

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property.
Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

STANDARD ENVIRONMENTAL RECORDS

Lists of Federal RCRA generators

RCRA-VSQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Very small quantity generators (VSQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

A review of the RCRA-VSQG list, as provided by EDR, and dated 06/20/2022 has revealed that there are

2 RCRA-VSQG sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
XTRA MART EPA ID:: NHD510105711	***449 CENTRAL ST***	***ESE 1/8 - 1/4 (0.183 mi.)***	***F46***	***190***

Lower Elevation	Address	Direction / Distance	Map ID	Page
TRADEBE HHW EPA ID:: NHD510080286	43 W BOW STRTE 127	SW 1/8 - 1/4 (0.229 mi.)	K59	243

Lists of state- and tribal hazardous waste facilities

NH SHWS: The State Hazardous Waste Sites records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. The data come from the Department of Environmental Services' Hazardous Waste Inventory list.

A review of the NH SHWS list, as provided by EDR, and dated 05/02/2022 has revealed that there are 7 NH SHWS sites within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
FRANKLIN BUSINESS CE Facility Id: 199608021 Project Manager: DREW	***20 CANAL ST***	***SE 0 - 1/8 (0.041 mi.)***	***B12***	***81***
QUICK TURN FLEX CIRC Facility Id: 199207032 Project Manager: CLOSED	***174 N MAIN ST***	***WSW 1/2 - 1 (0.617 mi.)***	***78***	***341***
CROWLEY TRUCKING Facility Id: 199802084 Project Manager: CLOSED-AUR	***4 GREEN STREET***	***E 1/2 - 1 (0.775 mi.)***	***79***	***380***
FRANKLIN NON-FERROUS Facility Id: 198709004 Project Manager: SWIONTEK	***293 SANBORN STREET***	***NE 1/2 - 1 (0.889 mi.)***	***80***	***381***

Lower Elevation	Address	Direction / Distance	Map ID	Page
CUMBERLAND FARMS 280 Facility Id: 199003013 Project Manager: UNASSIGNED	***233 CENTRAL ST***	***SSW 1/8 - 1/4 (0.198 mi.)***	***G50***	***210***
FRANKLIN FIRE STATIO Facility Id: 199306026 Project Manager: DREW	***59 W BOW ST***	***WSW 1/8 - 1/4 (0.226 mi.)***	***K55***	***227***
CASTLE MOTORS Facility Id: 199906054 Project Manager: CLOSED	***168 CENTRAL ST***	***SSW 1/4 - 1/2 (0.334 mi.)***	***69***	***295***

Lists of state and tribal leaking storage tanks

NH LUST: The Leaking Underground Storage Tank Incident Reports contain an inventory of reported leaking underground storage tank incidents. The data come from the Department of Environmental Services' LUST Sites Summary Report.

A review of the NH LUST list, as provided by EDR, and dated 05/02/2022 has revealed that there are 8 NH LUST sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SHOP EXPRESS Facility Id: 199610017 Project Manager: CLOSED	449 CENTRAL ST	ESE 1/8 - 1/4 (0.183 mi.)	F44	185
FAIRPOINT Facility Id: 199306005 Project Manager: CLOSED	***76 FRANKLIN ST***	***SSE 1/8 - 1/4 (0.227 mi.)***	***J57***	***235***
POLYCLAD LAMINATES I Facility Id: 199902062 Project Manager: CLOSED	***45 TANNERY ST***	***WNW 1/4 - 1/2 (0.498 mi.)***	***M76***	***298***

Lower Elevation	Address	Direction / Distance	Map ID	Page
CUMBERLAND FARMS 280 Facility Id: 199003013 Project Manager: CLOSED	***233 CENTRAL ST***	***SSW 1/8 - 1/4 (0.198 mi.)***	***G50***	***210***
FRANKLIN FIRE STATIO Facility Id: 199306026 Project Manager: CLOSED	***59 W BOW ST***	***WSW 1/8 - 1/4 (0.226 mi.)***	***K55***	***227***
PACKERS OUTLET Facility Id: 198904056 Project Manager: CLOSED	***195 CENTRAL ST***	***SSW 1/4 - 1/2 (0.279 mi.)***	***L64***	***259***
ANGELL PROPERTY Facility Id: 198805024 Project Manager: CLOSED	175 CENTRAL STREET	SSW 1/4 - 1/2 (0.321 mi.)	L68	295
CASTLE MOTORS Facility Id: 199906054 Project Manager: CLOSED-AUR	***168 CENTRAL ST***	***SSW 1/4 - 1/2 (0.334 mi.)***	***69***	***295***

Lists of state and tribal registered storage tanks

NH UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Services' list: Underground Storage Tank Registration Data.

A review of the NH UST list, as provided by EDR, and dated 05/02/2022 has revealed that there are 13 NH UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
FRANKLIN BUSINESS CE	***20 CANAL ST***	***SE 0 - 1/8 (0.041 mi.)***	***B12***	***81***

Status: INACTIVE Facility Id: 115227 Closure Date: 01/18/2013				
FRANKLIN CITY HALL Status: INACTIVE Facility Id: 114933 Closure Date: 08/27/1997	316 CENTRAL ST	SSE 0 - 1/8 (0.093 mi.)	D18	112
REGAL AUCTION SERVIC Status: INACTIVE Facility Id: 113592 Closure Date: 09/24/1998	349 CENTRAL ST	SE 0 - 1/8 (0.104 mi.)	D28	147
JJ NEWBERRY #6146 Status: INACTIVE Facility Id: 113615 Closure Date: 07/10/1997	384 CENTRAL ST	SE 0 - 1/8 (0.105 mi.)	D29	149
FRANKLIN SAVINGS BAN Status: INACTIVE Facility Id: 113043	287 CENTRAL STREET	S 0 - 1/8 (0.122 mi.)	33	159
FRANKLIN SAVINGS BAN Status: INACTIVE Facility Id: 114564 Closure Date: 02/11/1994	405 CENTRAL STREET	SE 0 - 1/8 (0.123 mi.)	E34	161
FORMER JP STEVENS MI Status: INACTIVE Facility Id: 115157	38 E BOW ST	E 1/8 - 1/4 (0.178 mi.)	I42	179
SHOP EXPRESS Status: INACTIVE Status: ACTIVE Facility Id: 112196 Closure Date: 10/02/1996	449 CENTRAL ST	ESE 1/8 - 1/4 (0.183 mi.)	F45	185
U S POSTAL SERVICE Status: INACTIVE Facility Id: 112790	65 FRANKLIN ST	SSE 1/8 - 1/4 (0.209 mi.)	J52	219
FAIRPOINT Status: INACTIVE Status: ACTIVE Facility Id: 220527 Closure Date: 01/26/1993	***76 FRANKLIN ST***	***SSE 1/8 - 1/4 (0.227 mi.)***	***J57***	***235***

Lower Elevation	Address	Direction / Distance	Map ID	Page
CORMIER CORPORATION	1 RIVER STREET	SSW 1/8 - 1/4 (0.176 mi.)	G40	176
CUMBERLAND FARMS 280 Status: INACTIVE Status: ACTIVE Facility Id: 110744 Closure Date: 04/11/2016	***233 CENTRAL ST***	***SSW 1/8 - 1/4 (0.198 mi.)***	***G49***	***201***
FRANKLIN FIRE STATIO Status: INACTIVE Facility Id: 110090 Closure Date: 06/14/1993	***59 W BOW ST***	***WSW 1/8 - 1/4 (0.226 mi.)***	***K55***	***227***

EXECUTIVE SUMMARY

Closure Date: 04/16/2015

NH AST: The Aboveground Storage Tank database contains registered ASTs. The data come from the Department of Environmental Services' list: Aboveground Storage Tank Registration Data.

A review of the NH AST list, as provided by EDR, and dated 05/02/2022 has revealed that there are 2 NH AST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
FRANKLIN BUSINESS CE	***20 CANAL ST***	***SE 0 - 1/8 (0.041 mi.)***	***B12***	***81***
Facility Id: 960821A				
Status: INACTIVE				

Lower Elevation	Address	Direction / Distance	Map ID	Page
PSNH FRANKLIN SUBSTA	145 WEST BOW ST	W 1/8 - 1/4 (0.211 mi.)	53	220
Facility Id: 9812139				
Status: INACTIVE				
Status: ACTIVE				

State and tribal institutional control / engineering control registries

An inventory of sites where Activity and Use Restrictions have been utilized.

A review of the NH INST CONTROL list, as provided by EDR, and dated 06/13/2022 has revealed that there are 3 NH INST CONTROL sites within approximately 0.5 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
RIVERBEND MILL	***100 MEMORIAL STREET***	***WSW 0 - 1/8 (0.051 mi.)***	***C15***	***103***
Facility Id: 200406004				
FRANKLIN FIRE STATIO	***59 W BOW ST***	***WSW 1/8 - 1/4 (0.226 mi.)***	***K55***	***227***
Facility Id: 199306026				
CASTLE MOTORS	***168 CENTRAL ST***	***SSW 1/4 - 1/2 (0.334 mi.)***	***69***	***295***
Facility Id: 199906054				

Lists of state and tribal brownfield sites

NH BROWNFIELDS: Sites that have benefited from one or more brownfields initiative.

A review of the NH BROWNFIELDS list, as provided by EDR, and dated 05/02/2022 has revealed that there are 6 NH BROWNFIELDS sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
FRANKLIN BUSINESS CE	***20 CANAL ST***	***SE 0 - 1/8 (0.041 mi.)***	***B12***	***81***
Facility Id: 199608021				
FORMER JP STEVENS MI	***38 E BOW ST***	***E 1/8 - 1/4 (0.178 mi.)***	***I43***	***184***

Facility Id: 200007059

POLYCLAD LAMINATES I Facility Id: 199902062	***45 TANNERY ST***	***WNW 1/4 - 1/2 (0.498 mi.)***	***M76***	***298***

Lower Elevation	Address	Direction / Distance	Map ID	Page
R & D PAVING Facility Id: 201409001	***81 MEMORIAL STREET***	***WSW 0 - 1/8 (0.026 mi.)***	***C8***	***44***
FMR CIAO PASTA Facility Id: 201704004	***194 - 202 CENTRAL ST***	***SSW 1/4 - 1/2 (0.279 mi.)***	***L65***	***264***
FRANKLIN ELKS LODGE Facility Id: 201704003	***192 CENTRAL STREET***	***SSW 1/4 - 1/2 (0.286 mi.)***	***L67***	***294***

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: The EPA's listing of Brownfields properties from the Cleanups in My Community program, which provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

A review of the US BROWNFIELDS list, as provided by EDR, and dated 02/23/2022 has revealed that there are 4 US BROWNFIELDS sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
FRANKLIN BUSINESS CE ACRES property ID: 144181 Cleanup Completion Date: -	***20 CANAL STREET***	***SE 0 - 1/8 (0.041 mi.)***	***B11***	***65***
POLYCLAD LAMINATES, ACRES property ID: 128562 Cleanup Completion Date: -	45 TANNERY STREET	WNW 1/4 - 1/2 (0.498 mi.)	M77	313

Lower Elevation	Address	Direction / Distance	Map ID	Page
R&D PAVING ACRES property ID: 174842 Cleanup Completion Date: -	81 MEMORIAL STREET	WSW 0 - 1/8 (0.026 mi.)	C9	45
CIAO PASTA ACRES property ID: 235063 Cleanup Completion Date: -	***194-202 CENTRAL STRE***	***SSW 1/4 - 1/2 (0.279 mi.)***	***L66***	***264***

Local Lists of Hazardous waste / Contaminated Sites

NH ALLSITES: Provides information on sites in New Hampshire, with activities that either have resulted in groundwater contamination or pose a potential hazard to groundwater supplies. The regulated activities and

groundwater hazards include: confirmed releases of oil or hazardous materials to the soil and/or groundwater as a result of discharges, spills, and removal of underground storage tanks; underground injection wells such as floor drains, leaching galleries, and septic systems anything other than domestic wastewater; large discharges of wastewater such as domestic wastewater septic systems which are designed to discharge more than 20,000 gpd, land application of wastewater treatment facility effluent (spray irrigation, rapid infiltration rapid infiltration basins, etc.) and unlined septage and wastewater lagoons; unpermitted hazardous waste storage facilities; landfills and other waste repositories in which groundwater quality is at risk.

A review of the NH ALLSITES list, as provided by EDR, and dated 05/02/2022 has revealed that there are 19 NH ALLSITES sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
FRANKLIN BUSINESS CE Facility Id: 199608021 Project Manager: CLOSED	***20 CANAL ST***	***SE 0 - 1/8 (0.041 mi.)***	***B12***	***81***
PETER CHRISTENSEN Facility Id: 199708018 Project Manager: CLOSED	336 CENTRAL STREET	SSE 0 - 1/8 (0.095 mi.)	D19	113
SCOTT FARAH Facility Id: 199702025 Project Manager: CLOSED	2 AYLES COURT	SE 1/8 - 1/4 (0.168 mi.)	H39	176
FORMER JP STEVENS MI Facility Id: 200007059 Project Manager: WATSON	***38 E BOW ST***	***E 1/8 - 1/4 (0.178 mi.)***	***I43***	***184***
DAN HUGHES RESIDENCE Facility Id: 200005051 Project Manager: CLOSED	34 BEATON ST	NE 1/8 - 1/4 (0.236 mi.)	61	255
STONE RESIDENCE Facility Id: 201101055 Project Manager: CLOSED	102 FRANKLIN ST	SSE 1/4 - 1/2 (0.268 mi.)	63	258
SCOTT MARCHANT Facility Id: 200511029 Project Manager: CLOSED	23 GLORY DR	N 1/4 - 1/2 (0.384 mi.)	71	296
PETRIGNI PROPERTY Facility Id: 200911019 Project Manager: CLOSED	75 ORCHARD STREET	ESE 1/4 - 1/2 (0.386 mi.)	72	297
GARY DELISLE Facility Id: 199903043 Project Manager: CLOSED	46 VIEW STREET	SSE 1/4 - 1/2 (0.388 mi.)	73	297
RUSSELL COX Facility Id: 200109034 Project Manager: CLOSED	624 CENTRAL ST	E 1/4 - 1/2 (0.457 mi.)	74	297
LESTER RESIDENCE Facility Id: 201509034 Project Manager: CLOSED	52 FREEDOM DR	N 1/4 - 1/2 (0.476 mi.)	75	298
POLYCLAD LAMINATES I Facility Id: 199902062 Project Manager: UNASSIGNED	***45 TANNERY ST***	***WNW 1/4 - 1/2 (0.498 mi.)***	***M76***	***298***

Lower Elevation	Address	Direction / Distance	Map ID	Page
R & D PAVING	***81 MEMORIAL STREET***	***WSW 0 - 1/8 (0.026 mi.)***	***C8***	***44***

Facility Id: 201409001 Project Manager: UNASSIGNED				
RIVERBEND MILL Facility Id: 200406004 Project Manager: STRONDAK Project Manager: CLOSED	***100 MEMORIAL STREET***	***WSW 0 - 1/8 (0.051 mi.)***	***C15***	***103***
CUMBERLAND FARMS 280 Facility Id: 199003013 Project Manager: CLOSED	***233 CENTRAL ST***	***SSW 1/8 - 1/4 (0.198 mi.)***	***G50***	***210***
FRANKLIN FIRE STATIO Facility Id: 199306026 Project Manager: CLOSED	***59 W BOW ST***	***WSW 1/8 - 1/4 (0.226 mi.)***	***K55***	***227***
FMR CIAO PASTA Facility Id: 201704004 Project Manager: DREW	***194 - 202 CENTRAL ST***	***SSW 1/4 - 1/2 (0.279 mi.)***	***L65***	***264***
FRANKLIN ELKS LODGE Facility Id: 201704003 Project Manager: CLOSED	***192 CENTRAL STREET***	***SSW 1/4 - 1/2 (0.286 mi.)***	***L67***	***294***
CURTIS RESIDENCE Facility Id: 201911021 Project Manager: CLOSED	46 RIVER STREET	S 1/4 - 1/2 (0.381 mi.)	70	296

NH PFAS: a listing (current as of today) of the Waste Management Division Remediation Programa??s sites where PFAS has been detected to date.

A review of the NH PFAS list, as provided by EDR, and dated 12/29/2021 has revealed that there are 2 NH PFAS sites within approximately 0.5 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
FRANKLIN FIRE STATIO	***59 W BOW ST***	***WSW 1/8 - 1/4 (0.226 mi.)***	***K55***	***227***
FMR CIAO PASTA	***194 - 202 CENTRAL ST***	***SSW 1/4 - 1/2 (0.279 mi.)***	***L65***	***264***

NH AQUEOUS FOAM: A listing of sites included in the New Hampshire Department of Environmental Services (DES) OneStop database where the project type is Class B Foam / AFF - Fire Fighting Use Area.

A review of the NH AQUEOUS FOAM list, as provided by EDR, and dated 02/01/2022 has revealed that there is 1 NH AQUEOUS FOAM site within approximately 0.5 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
FRANKLIN FIRE STATIO	***59 W BOW ST***	***WSW 1/8 - 1/4 (0.226 mi.)***	***K55***	***227***

Other Ascertainable Records

RCRA NonGen / NLR: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or

dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

A review of the RCRA NonGen / NLR list, as provided by EDR, and dated 06/20/2022 has revealed that there are 27 RCRA NonGen / NLR sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
ALGONQUIN POWER SYST EPA ID:: NHD510156714	40 MEMORIAL ST	SE 0 - 1/8 (0.007 mi.)	A6	42
FRANKLIN BUSINESS EPA ID:: NHD510114648	20 CANAL ST	SE 0 - 1/8 (0.041 mi.)	B10	62
R & D PAVING EPA ID:: NHD510208036	20 MEMORIAL ST	SSE 0 - 1/8 (0.044 mi.)	B13	97
PROFORMA PIPER PRINT EPA ID:: NHD510201411	102 E BOW ST	NE 0 - 1/8 (0.055 mi.)	16	103
FRANKLIN CITY OF EPA ID:: NHD510223217	***316 CENTRAL ST***	***SSE 0 - 1/8 (0.093 mi.)***	***D17***	***109***
F M PIPER PRINTING L EPA ID:: NHD500018676	338 CENTRAL ST	SSE 0 - 1/8 (0.095 mi.)	D20	113
PROFILE ELECTRONICS EPA ID:: NHD510053176	SMITH & CANAL STS	ESE 0 - 1/8 (0.099 mi.)	21	118
CITY SIDE CLEANERS EPA ID:: NHD018912329	***333 CENTRAL ST***	***SSE 0 - 1/8 (0.102 mi.)***	***D23***	***121***
COLPITTS GREGORY DMD EPA ID:: NHD510178718	378 CENTRAL ST	SE 0 - 1/8 (0.103 mi.)	D24	138
C N BROWN CO EPA ID:: NHD510064223	298 CENTRAL ST	S 0 - 1/8 (0.103 mi.)	D25	141
FRANKLIN BUSINESS&IN EPA ID:: NHD510001951	***380 CENTRAL ST***	***SE 0 - 1/8 (0.104 mi.)***	***D26***	***143***
REGAL AUCTION EPA ID:: NHD510006547	349 CENTRAL ST	SE 0 - 1/8 (0.104 mi.)	D27	145
ACCESS DENTAL EPA ID:: NHD510202567	398 CENTRAL ST	SE 0 - 1/8 (0.109 mi.)	E30	150
FRANKLIN SAVINGS BAN EPA ID:: NHD510068190	387 CENTRAL ST	SE 0 - 1/8 (0.112 mi.)	D31	153
BAPTIST CHURCH OF FR EPA ID:: NHD510217623	***21 CHURCH ST***	***SSE 0 - 1/8 (0.122 mi.)***	***D32***	***155***
KEEGAN E J & CO EPA ID:: NHD510091861	425 CENTRAL ST	ESE 1/8 - 1/4 (0.149 mi.)	F35	163
MERRIMACK MAGNETICS EPA ID:: NHD108871799	SMITH & CANAL STS	ESE 1/8 - 1/4 (0.155 mi.)	F36	165
DANS PHARMACY EPA ID:: NHD510175458	436 CENTRAL ST	ESE 1/8 - 1/4 (0.159 mi.)	F37	167
NH DES WMD EPA ID:: NHD510095631	38 E BOW ST	E 1/8 - 1/4 (0.178 mi.)	I41	177
ALGONQUIN POWER STAT EPA ID:: NHD510111123	35 E BOW ST	E 1/8 - 1/4 (0.184 mi.)	I47	197
FARRAH SCOTT	42 FRANKLIN ST	SE 1/8 - 1/4 (0.185 mi.)	H48	199

EPA ID:: NHD510112360				
TERHUNE JONATHAN H D EPA ID:: NHD510157985	58 FRANKLIN ST	SE 1/8 - 1/4 (0.207 mi.)	H51	211
FAIRPOINT COMMUNICAT EPA ID:: NHD980512057	76 FRANKLIN ST	SSE 1/8 - 1/4 (0.227 mi.)	J58	240
DRUG ENFORCEMENT AGE EPA ID:: NHD510218167	***12 SPRING ST***	***SE 1/8 - 1/4 (0.240 mi.)***	***62***	***255***

Lower Elevation	Address	Direction / Distance	Map ID	Page
CATCH NEIGHBORHOOD H EPA ID:: NHD510222227	100 MEMORIAL ST	WSW 0 - 1/8 (0.051 mi.)	C14	100
CUMBERLAND FARMS 280 EPA ID:: NHD986473619	***233 CENTRAL ST***	***SSW 1/8 - 1/4 (0.164 mi.)***	***G38***	***169***
FRANKLIN FIRE DEPART EPA ID:: NHD510060080	***59 W BOW ST***	***WSW 1/8 - 1/4 (0.226 mi.)***	***K54***	***223***

NH DRYCLEANERS: A listing of drycleaner locations in New Hampshire.

A review of the NH DRYCLEANERS list, as provided by EDR, and dated 06/13/2022 has revealed that there is 1 NH DRYCLEANERS site within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CITY SIDE CLEANERS Facility Id: 44893	***333 CENTRAL ST***	***SSE 0 - 1/8 (0.102 mi.)***	***D23***	***121***

PA MANIFEST: Hazardous waste manifest information.

A review of the PA MANIFEST list, as provided by EDR, and dated 06/30/2018 has revealed that there is 1 PA MANIFEST site within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
CLEAN VENTURE HHW Generator EPA Id: NHD510080286	43 W BOW ST	SW 1/8 - 1/4 (0.229 mi.)	K60	254

NY MANIFEST: Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

A review of the NY MANIFEST list, as provided by EDR, and dated 01/01/2019 has revealed that there is 1 NY MANIFEST site within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
FRANKLIN BUSINESS&IN EPA ID: NHD510001951	***380 CENTRAL ST***	***SE 0 - 1/8 (0.104 mi.)***	***D26***	***143***

RI MANIFEST: Hazardous waste manifest information

A review of the RI MANIFEST list, as provided by EDR, and dated 12/31/2020 has revealed that there are 3 RI MANIFEST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CITY SIDE CLEANERS EPA Id: NHD018912329 Manifest Document Number: RIG0213233	***333 CENTRAL ST***	***SSE 0 - 1/8 (0.102 mi.)***	***D23***	***121***
XTRA MART EPA Id: NHD510105711 Manifest Document Number: MAM128589	***449 CENTRAL ST***	***ESE 1/8 - 1/4 (0.183 mi.)***	***F46***	***190***

Lower Elevation	Address	Direction / Distance	Map ID	Page
CUMBERLAND FARMS 280 EPA Id: NHD986473619 Manifest Document Number: MAH425417	***233 CENTRAL ST***	***SSW 1/8 - 1/4 (0.164 mi.)***	***G38***	***169***

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP: The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

A review of the EDR MGP list, as provided by EDR, has revealed that there is 1 EDR MGP site within approximately 1 mile of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
FRANKLIN GAS WORKS	59 W BOW STREET	WSW 1/8 - 1/4 (0.226 mi.)	K56	235

EDR Hist Cleaner: EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

A review of the EDR Hist Cleaner list, as provided by EDR, has revealed that there are 2 EDR Hist Cleaner sites within approximately 0.125 miles of the target property.

EXECUTIVE SUMMARY

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
LEMIRE AIME J	31 MEMORIAL ST	SE 0 - 1/8 (0.019 mi.)	B7	44
FRANKLIN CLEANERS	333-335 CENTRAL ST	SSE 0 - 1/8 (0.102 mi.)	D22	120

EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped. Count: 5 records.

Site Name	Database(s)
GHI ASSOCIATES, INC.	NH SHWS
FRANKLIN RIVER ROAD LANDFILL	SEMS-ARCHIVE
FRANKLIN MUNICIPAL LANDFILL	NH SWF/LF
FRANKLIN FALLS DAM	NH LUST
STANLEY MILL	NH RGA LUST

OVERVIEW MAP - 7125568.2S

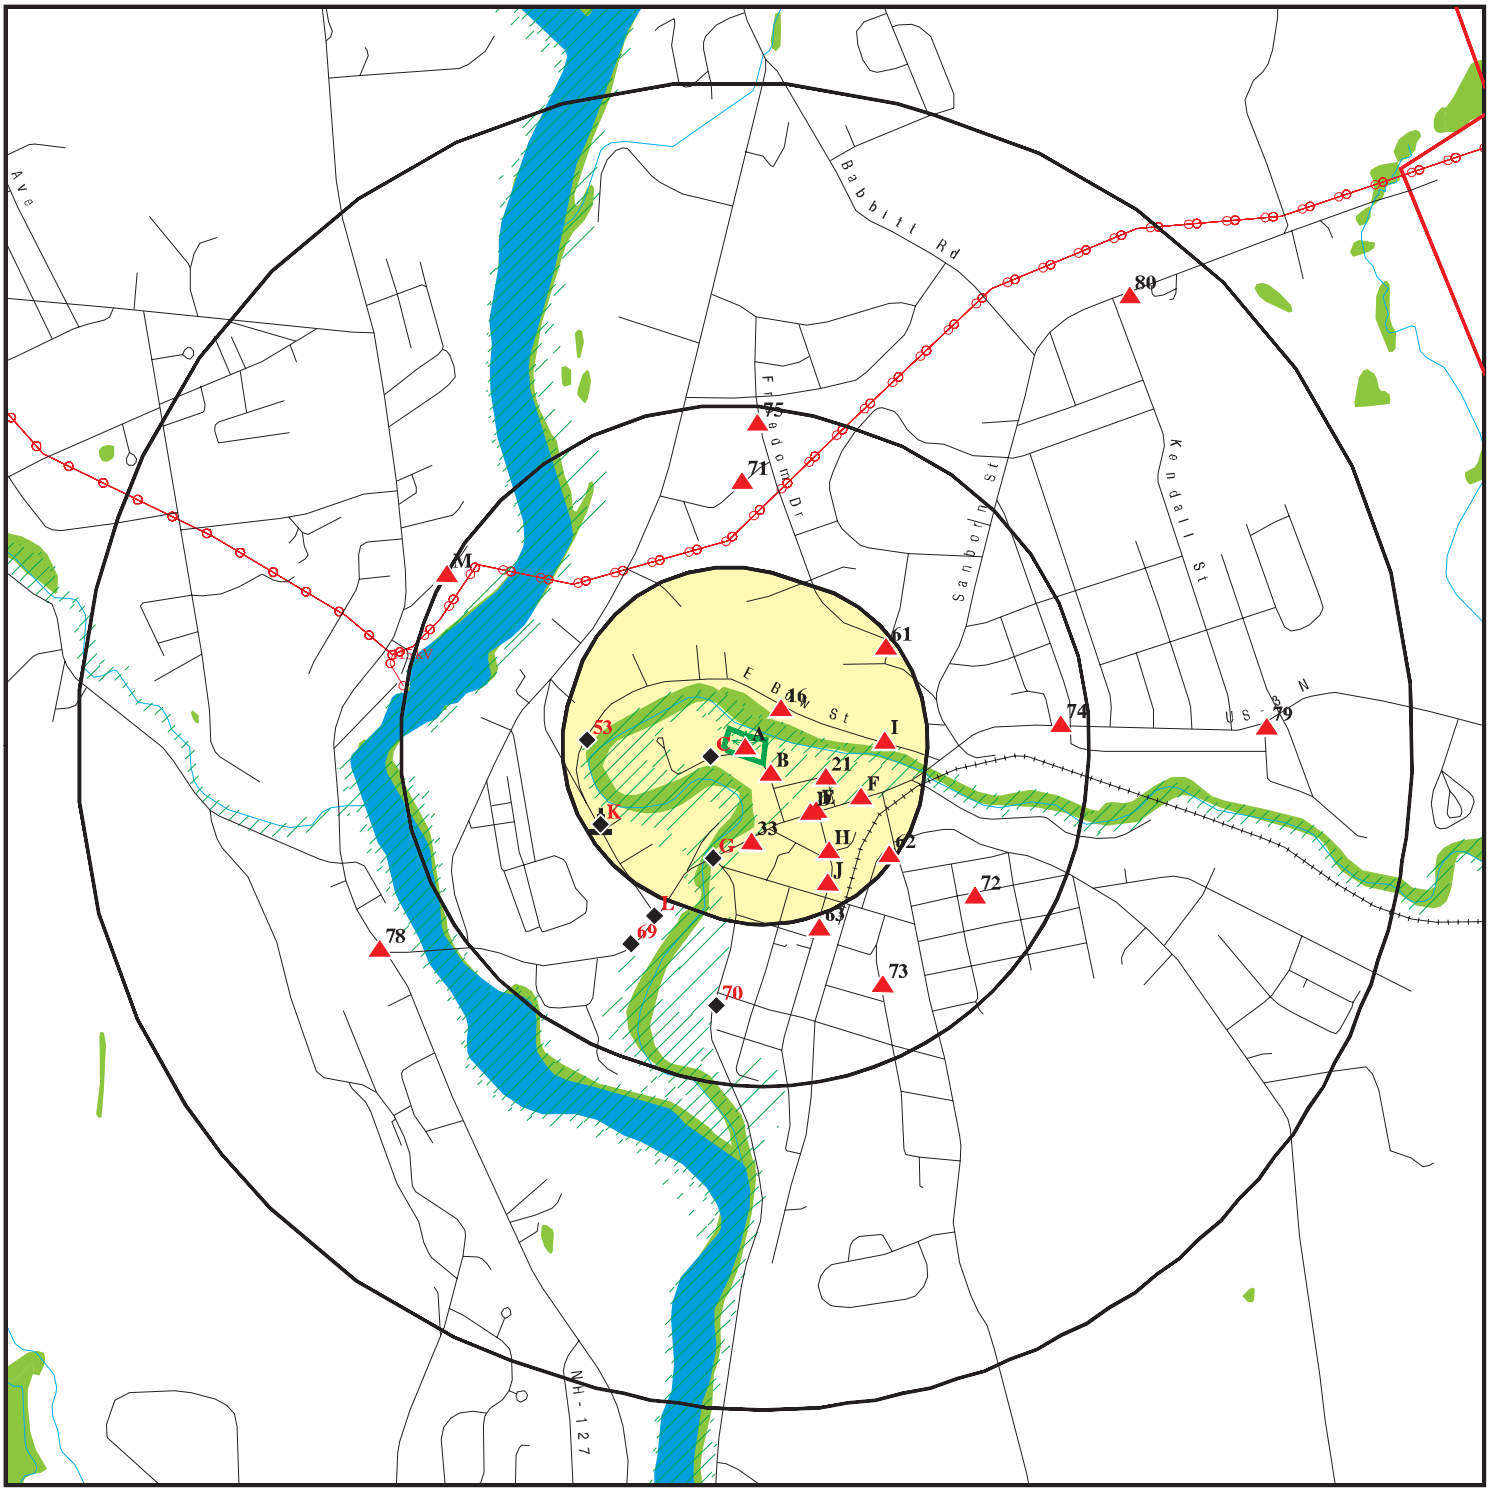

- Target Property
- Sites at elevations higher than or equal to the target property
- Sites at elevations lower than the target property
- Manufactured Gas Plants
- National Priority List Sites
- Dept. Defense Sites
- Indian Reservations BIA
- County Boundary
- Power transmission lines
- Special Flood Hazard Area (1%)
- 0.2% Annual Chance Flood Hazard
- National Wetland Inventory
- State Wetlands

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME:	Stanley Mill	CLIENT:	Nobis Group
ADDRESS:	93 Memorial Street Franklin NH 03235	CONTACT:	Karina Zawilinski
		INQUIRY #:	7125568.2s
LAT/LONG:	43.446209 / 71.647921	DATE:	September 21, 2022 4:50 pm

Copyright © 2022 EDR, Inc. © 2015 TomTom Rel. 2015.

DETAIL MAP - 7125568.2S

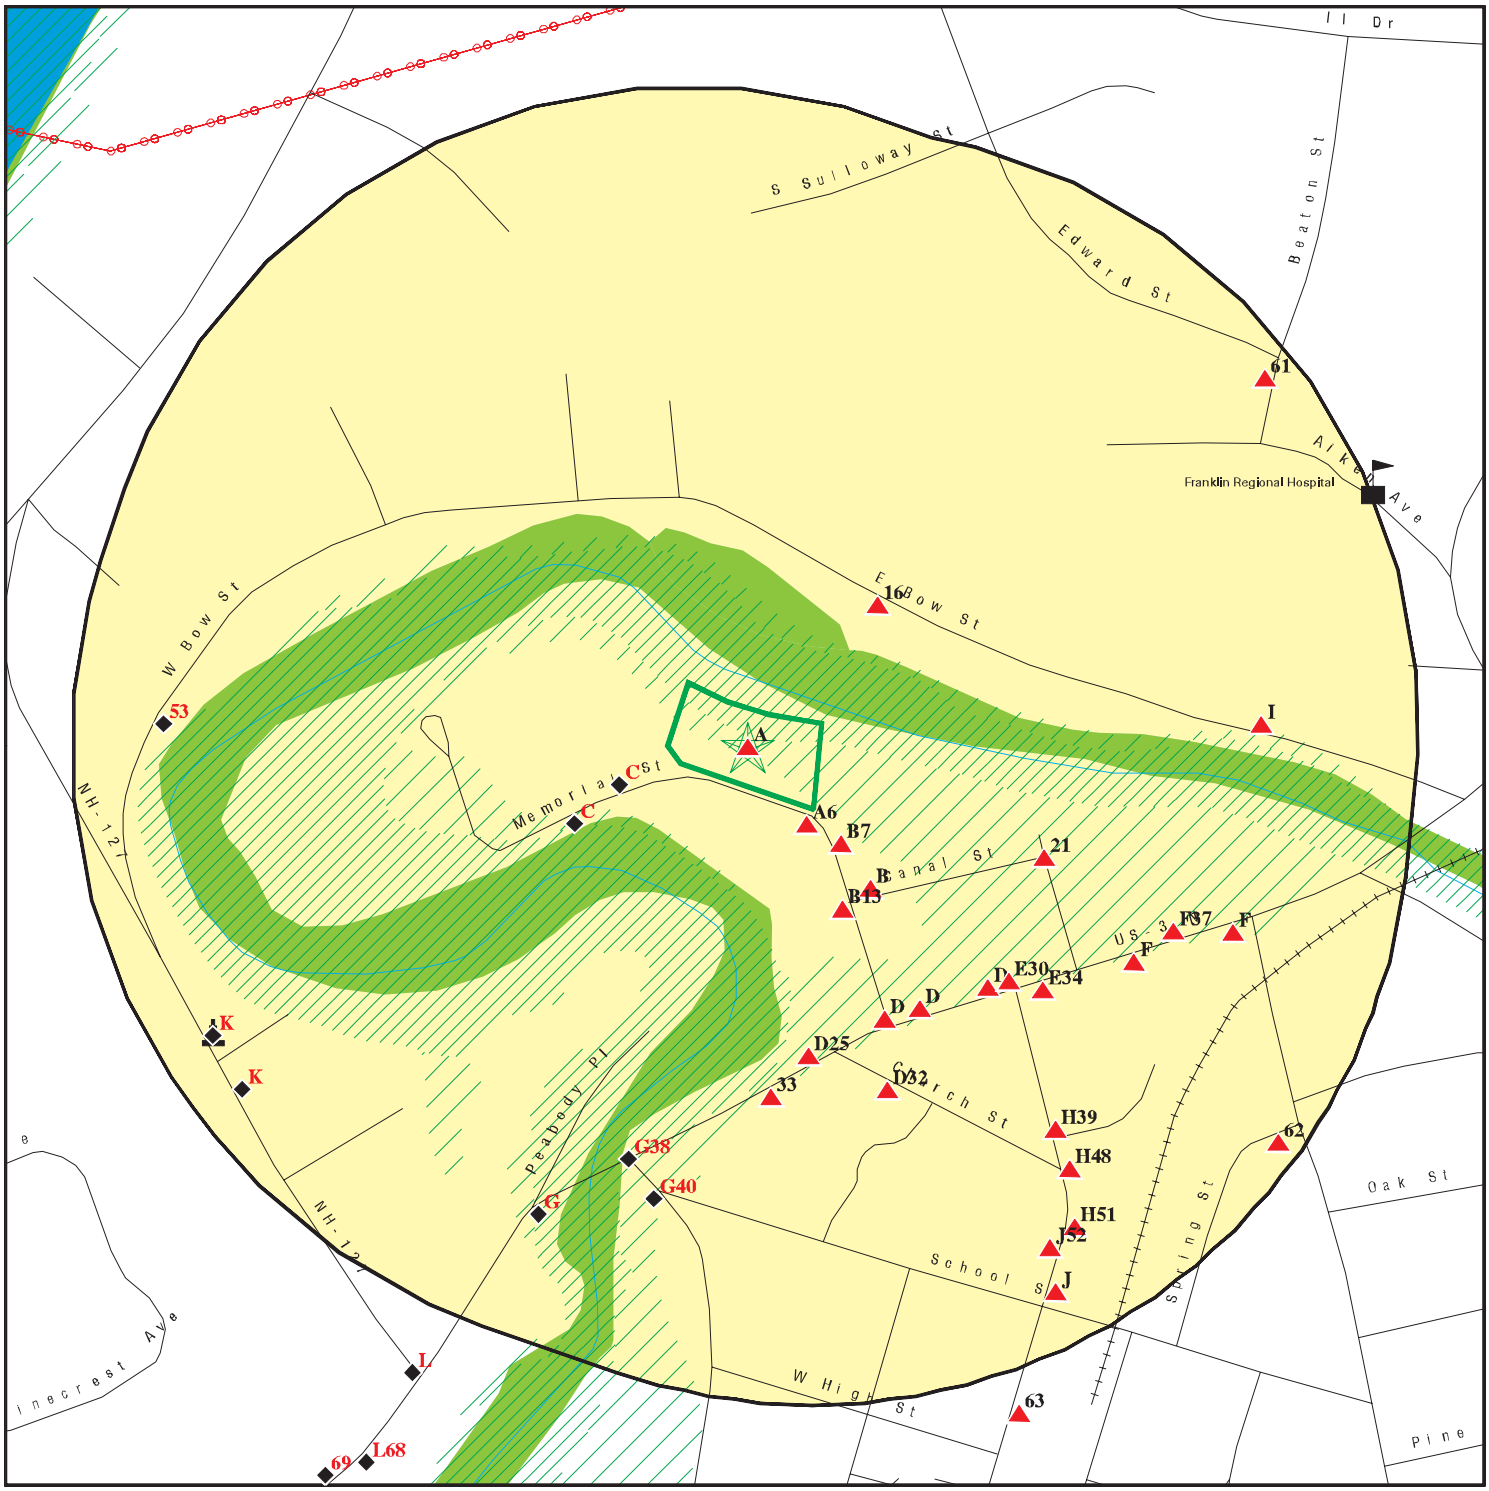

Target Property

Sites at elevations higher than or equal to the target property

Sites at elevations lower than the target property

Manufactured Gas Plants

Sensitive Receptors

National Priority List Sites

Dept. Defense Sites

0 1/16 1/8 1/4 Miles

Indian Reservations BIA

Power transmission lines

Special Flood Hazard Area (1%)

0.2% Annual Chance Flood Hazard

National Wetland Inventory

State Wetlands

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME:	Stanley Mill	CLIENT:	Nobis Group
ADDRESS:	93 Memorial Street Franklin NH 03235	CONTACT:	Karina Zawilinski
LAT/LONG:	43.446209 / 71.647921	INQUIRY #:	7125568.2s
		DATE:	September 21, 2022 4:52 pm

Copyright © 2022 EDR, Inc. © 2015 TomTom Rel. 2015.

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
STANDARD ENVIRONMENTAL RECORDS								
Lists of Federal NPL (Superfund) sites								
NPL	1.000		0	0	0	0	NR	0
Proposed NPL	1.000		0	0	0	0	NR	0
NPL LIENS	1.000		0	0	0	0	NR	0
Lists of Federal Delisted NPL sites								
Delisted NPL	1.000		0	0	0	0	NR	0
Lists of Federal sites subject to CERCLA removals and CERCLA orders								
FEDERAL FACILITY	0.500		0	0	0	NR	NR	0
SEMS	0.500		0	0	0	NR	NR	0
Lists of Federal CERCLA sites with NFRAP								
SEMS-ARCHIVE	0.500		0	0	0	NR	NR	0
Lists of Federal RCRA facilities undergoing Corrective Action								
CORRACTS	1.000		0	0	0	0	NR	0
Lists of Federal RCRA TSD facilities								
RCRA-TSDF	0.500		0	0	0	NR	NR	0
Lists of Federal RCRA generators								
RCRA-LQG	0.250		0	0	NR	NR	NR	0
RCRA-SQG	0.250		0	0	NR	NR	NR	0
RCRA-VSQG	0.250		0	2	NR	NR	NR	2
Federal institutional controls / engineering controls registries								
LUCIS	0.500		0	0	0	NR	NR	0
US ENG CONTROLS	0.500		0	0	0	NR	NR	0
US INST CONTROLS	0.500		0	0	0	NR	NR	0
Federal ERNS list								
ERNS	TP		NR	NR	NR	NR	NR	0
Lists of state- and tribal hazardous waste facilities								
NH SHWS	1.000		1	2	1	3	NR	7
Lists of state and tribal landfills and solid waste disposal facilities								
NH SWF/LF	0.500		0	0	0	NR	NR	0
Lists of state and tribal leaking storage tanks								
NH LUST	0.500		0	4	4	NR	NR	8

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
NH LAST	0.500		0	0	0	NR	NR	0
INDIAN LUST	0.500		0	0	0	NR	NR	0
Lists of state and tribal registered storage tanks								
FEMA UST	0.250		0	0	NR	NR	NR	0
NH UST	0.250	1	6	7	NR	NR	NR	14
NH AST	0.250		1	1	NR	NR	NR	2
INDIAN UST	0.250		0	0	NR	NR	NR	0
State and tribal institutional control / engineering control registries								
NH INST CONTROL	0.500		1	1	1	NR	NR	3
Lists of state and tribal voluntary cleanup sites								
NH VCP	0.500		0	0	0	NR	NR	0
INDIAN VCP	0.500		0	0	0	NR	NR	0
Lists of state and tribal brownfield sites								
NH BROWNFIELDS	0.500	1	2	1	3	NR	NR	7
ADDITIONAL ENVIRONMENTAL RECORDS								
Local Brownfield lists								
US BROWNFIELDS	0.500	1	2	0	2	NR	NR	5
Local Lists of Landfill / Solid Waste Disposal Sites								
NH SWRCY	0.500		0	0	0	NR	NR	0
INDIAN ODI	0.500		0	0	0	NR	NR	0
DEBRIS REGION 9	0.500		0	0	0	NR	NR	0
ODI	0.500		0	0	0	NR	NR	0
IHS OPEN DUMPS	0.500		0	0	0	NR	NR	0
Local Lists of Hazardous waste / Contaminated Sites								
US HIST CDL	TP		NR	NR	NR	NR	NR	0
NH ALLSITES	0.500	1	4	5	10	NR	NR	20
NH CDL	TP		NR	NR	NR	NR	NR	0
US CDL	TP		NR	NR	NR	NR	NR	0
NH PFAS	0.500		0	1	1	NR	NR	2
NH AQUEOUS FOAM	0.500		0	1	0	NR	NR	1
Local Land Records								
NH LIENS	TP		NR	NR	NR	NR	NR	0
LIENS 2	TP		NR	NR	NR	NR	NR	0
Records of Emergency Release Reports								
HMIRS	TP		NR	NR	NR	NR	NR	0
NH SPILLS	TP		NR	NR	NR	NR	NR	0
NH SPILLS 90	TP		NR	NR	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
Other Ascertainable Records								
RCRA NonGen / NLR	0.250	1	16	11	NR	NR	NR	28
FUDS	1.000		0	0	0	0	NR	0
DOD	1.000		0	0	0	0	NR	0
SCRD DRYCLEANERS	0.500		0	0	0	NR	NR	0
US FIN ASSUR	TP		NR	NR	NR	NR	NR	0
EPA WATCH LIST	TP		NR	NR	NR	NR	NR	0
2020 COR ACTION	0.250		0	0	NR	NR	NR	0
TSCA	TP		NR	NR	NR	NR	NR	0
TRIS	TP		NR	NR	NR	NR	NR	0
SSTS	TP		NR	NR	NR	NR	NR	0
ROD	1.000		0	0	0	0	NR	0
RMP	TP		NR	NR	NR	NR	NR	0
RAATS	TP		NR	NR	NR	NR	NR	0
PRP	TP		NR	NR	NR	NR	NR	0
PADS	TP		NR	NR	NR	NR	NR	0
ICIS	TP		NR	NR	NR	NR	NR	0
FTTS	TP		NR	NR	NR	NR	NR	0
MLTS	TP		NR	NR	NR	NR	NR	0
COAL ASH DOE	TP		NR	NR	NR	NR	NR	0
COAL ASH EPA	0.500		0	0	0	NR	NR	0
PCB TRANSFORMER	TP		NR	NR	NR	NR	NR	0
RADINFO	TP		NR	NR	NR	NR	NR	0
HIST FTTS	TP		NR	NR	NR	NR	NR	0
DOT OPS	TP		NR	NR	NR	NR	NR	0
CONSENT	1.000		0	0	0	0	NR	0
INDIAN RESERV	1.000		0	0	0	0	NR	0
FUSRAP	1.000		0	0	0	0	NR	0
UMTRA	0.500		0	0	0	NR	NR	0
LEAD SMELTERS	TP		NR	NR	NR	NR	NR	0
US AIRS	TP		NR	NR	NR	NR	NR	0
US MINES	0.250		0	0	NR	NR	NR	0
ABANDONED MINES	0.250		0	0	NR	NR	NR	0
FINDS	TP	2	NR	NR	NR	NR	NR	2
DOCKET HWC	TP		NR	NR	NR	NR	NR	0
ECHO	TP	1	NR	NR	NR	NR	NR	1
UXO	1.000		0	0	0	0	NR	0
FUELS PROGRAM	0.250		0	0	NR	NR	NR	0
NH AIRS	TP		NR	NR	NR	NR	NR	0
NH ASBESTOS	TP		NR	NR	NR	NR	NR	0
NH DRYCLEANERS	0.250		1	0	NR	NR	NR	1
NH Financial Assurance	TP		NR	NR	NR	NR	NR	0
NH LEAD	TP		NR	NR	NR	NR	NR	0
PA MANIFEST	0.250		0	1	NR	NR	NR	1
NY MANIFEST	0.250		1	0	NR	NR	NR	1
RI MANIFEST	0.250		1	2	NR	NR	NR	3
NH NPDES	TP		NR	NR	NR	NR	NR	0
NH MANIFEST	0.250		0	0	NR	NR	NR	0
MINES MRDS	TP		NR	NR	NR	NR	NR	0
EDR HIGH RISK HISTORICAL RECORDS								
EDR Exclusive Records								
EDR MGP	1.000		0	1	0	0	NR	1

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
EDR Hist Auto	0.125		0	NR	NR	NR	NR	0
EDR Hist Cleaner	0.125		2	NR	NR	NR	NR	2
EDR RECOVERED GOVERNMENT ARCHIVES								
Exclusive Recovered Govt. Archives								
NH RGA HWS	TP		NR	NR	NR	NR	NR	0
NH RGA LF	TP		NR	NR	NR	NR	NR	0
NH RGA LUST	TP		NR	NR	NR	NR	NR	0
- Totals --		8	38	40	22	3	0	111

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

A1 **FERRARI MILL** **US BROWNFIELDS** **1016952025**
Target **93 MEMORIAL STREET** **N/A**
Property **FRANKLIN, NH 3235**

Site 1 of 6 in cluster A

Actual: **300 ft.**

US BROWNFIELDS:

Name:	FERRARI MILL
Address:	93 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	R1 TBA - New Hampshire (STAG Funded)
Grant Type:	TBA
Property Number:	117-142-00
Parcel size:	1.22
Latitude:	43.4460623
Longitude:	-71.6484756
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	The Site contains two buildings including a former hacksaw and metal tool manufacturing mill, and a former armory. The site is situated on the bank of the Winnipesaukee River and is planned to be redeveloped as a boutique hotel and restaurant with an event center. A portion of the mill has significant structural issues and it planned to be partially demolished and reinforced to create a riverfront "mill ruins" outdoor seating/park area. The former armory was also used for storage by the mill and more recently as a mica depot in support of other manufacturing in the area. Former Use: To be updated upon Phase I completion.
Datum:	North American Datum of 1983
Acres Property ID:	174843
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	n/a
Start Date:	-
Ownership Entity:	Private
Completion Date:	-
Current Owner:	Ferrari Realty Trust
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	U

FERRARI MILL (Continued) **1016952025**

IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	1.22
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.22
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-

FERRARI MILL (Continued) **1016952025**

mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	Y
Cadmium contaminant found:	-
Chromium contaminant found:	Y
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	To be updated upon Phase I completion.
Below Poverty Number:	608
Below Poverty Percent:	24.17
Meidan Income:	9934
Meidan Income Number:	1208
Meidan Income Percent:	48.03
Vacant Housing Number:	82
Vacant Housing Percent:	8.28
Unemployed Number:	151
Unemployed Percent:	6

Name:	FERRARI MILL
Address:	93 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	117-142-00
Parcel size:	1.22
Latitude:	43.4460623
Longitude:	-71.6484756
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	The Site contains two buildings including a former hacksaw and metal tool manufacturing mill, and a former armory. The site is situated on the bank of the Winnipesaukee River and is planned to be redeveloped as a boutique hotel and restaurant with an event center. A portion of the mill has significant structural issues and it planned to be partially demolished and reinforced to create a riverfront "mill ruins" outdoor seating/park area. The former armory was also used for storage by the mill and more recently as a mica depot in support of

FERRARI MILL (Continued) **1016952025**

	other manufacturing in the area. Former Use: To be updated upon Phase I completion.
Datum:	North American Datum of 1983
Acres Property ID:	174843
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	1000
Assessment Funding Source:	City of Franklin
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	Local Funding
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	Phase II Environmental Assessment
Accomplishment Count:	N
Cooperative Agreement Number:	96176301
Start Date:	8/23/2014
Ownership Entity:	Private
Completion Date:	10/3/2014
Current Owner:	Ferrari Realty Trust
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	U
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-

FERRARI MILL (Continued) **1016952025**

Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	1.22
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.22
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	Y
Cadmium contaminant found:	-
Chromium contaminant found:	Y
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-

FERRARI MILL (Continued) **1016952025**

Past Use: Multistory	-
Property Description:	To be updated upon Phase I completion.
Below Poverty Number:	608
Below Poverty Percent:	24.17
Meidan Income:	9934
Meidan Income Number:	1208
Meidan Income Percent:	48.03
Vacant Housing Number:	82
Vacant Housing Percent:	8.28
Unemployed Number:	151
Unemployed Percent:	6
Name:	FERRARI MILL
Address:	93 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	117-142-00
Parcel size:	1.22
Latitude:	43.4460623
Longitude:	-71.6484756
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	The Site contains two buildings including a former hacksaw and metal tool manufacturing mill, and a former armory. The site is situated on the bank of the Winnipesaukee River and is planned to be redeveloped as a boutique hotel and restaurant with an event center. A portion of the mill has significant structural issues and it planned to be partially demolished and reinforced to create a riverfront "mill ruins" outdoor seating/park area. The former armory was also used for storage by the mill and more recently as a mica depot in support of other manufacturing in the area. Former Use: To be updated upon Phase I completion.
Datum:	North American Datum of 1983
Acres Property ID:	174843
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	4000
Assessment Funding Source:	EPA
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	Phase I Environmental Assessment
Accomplishment Count:	Y
Cooperative Agreement Number:	96176301
Start Date:	7/8/2014
Ownership Entity:	Private

FERRARI MILL (Continued) **1016952025**

Completion Date:	8/22/2014
Current Owner:	Ferrari Realty Trust
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	U
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	1.22
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.22

FERRARI MILL (Continued) **1016952025**

Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	Y
Cadmium contaminant found:	-
Chromium contaminant found:	Y
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	To be updated upon Phase I completion.
Below Poverty Number:	608
Below Poverty Percent:	24.17
Meidan Income:	9934
Meidan Income Number:	1208
Meidan Income Percent:	48.03
Vacant Housing Number:	82
Vacant Housing Percent:	8.28
Unemployed Number:	151
Unemployed Percent:	6

Name:	FERRARI MILL
Address:	93 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	R1 TBA - New Hampshire (STAG Funded)
Grant Type:	TBA
Property Number:	117-142-00
Parcel size:	1.22
Latitude:	43.4460623
Longitude:	-71.6484756
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	The Site contains two buildings including a former hacksaw and metal

FERRARI MILL (Continued) **1016952025**

tool manufacturing mill, and a former armory. The site is situated on the bank of the Winnipesaukee River and is planned to be redeveloped as a boutique hotel and restaurant with an event center. A portion of the mill has significant structural issues and it planned to be partially demolished and reinforced to create a riverfront "mill ruins" outdoor seating/park area. The former armory was also used for storage by the mill and more recently as a mica depot in support of other manufacturing in the area. Former Use: To be updated upon Phase I completion.

Datum:	North American Datum of 1983
Acres Property ID:	174843
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	n/a
Start Date:	-
Ownership Entity:	Private
Completion Date:	-
Current Owner:	Ferrari Realty Trust
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	U
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-

FERRARI MILL (Continued) **1016952025**

Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	1.22
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.22
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	Y
Cadmium contaminant found:	-
Chromium contaminant found:	Y
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-

FERRARI MILL (Continued) **1016952025**

Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	To be updated upon Phase I completion.
Below Poverty Number:	608
Below Poverty Percent:	24.17
Meidan Income:	9934
Meidan Income Number:	1208
Meidan Income Percent:	48.03
Vacant Housing Number:	82
Vacant Housing Percent:	8.28
Unemployed Number:	151
Unemployed Percent:	6

Name:	FERRARI MILL
Address:	93 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	R1 TBA - New Hampshire (STAG Funded)
Grant Type:	TBA
Property Number:	117-142-00
Parcel size:	1.22
Latitude:	43.4460623
Longitude:	-71.6484756
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	The Site contains two buildings including a former hacksaw and metal tool manufacturing mill, and a former armory. The site is situated on the bank of the Winnipesaukee River and is planned to be redeveloped as a boutique hotel and restaurant with an event center. A portion of the mill has significant structural issues and it planned to be partially demolished and reinforced to create a riverfront "mill ruins" outdoor seating/park area. The former armory was also used for storage by the mill and more recently as a mica depot in support of other manufacturing in the area. Former Use: To be updated upon Phase I completion.
Datum:	North American Datum of 1983
Acres Property ID:	174843
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	-

FERRARI MILL (Continued) **1016952025**

Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	n/a
Start Date:	-
Ownership Entity:	Private
Completion Date:	-
Current Owner:	Ferrari Realty Trust
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	U
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-

FERRARI MILL (Continued) **1016952025**

Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	1.22
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.22
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	Y
Cadmium contaminant found:	-
Chromium contaminant found:	Y
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	To be updated upon Phase I completion.
Below Poverty Number:	608
Below Poverty Percent:	24.17
Meidan Income:	9934
Meidan Income Number:	1208
Meidan Income Percent:	48.03
Vacant Housing Number:	82
Vacant Housing Percent:	8.28
Unemployed Number:	151
Unemployed Percent:	6

Name:	FERRARI MILL
Address:	93 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	117-142-00

FERRARI MILL (Continued) **1016952025**

Parcel size:	1.22
Latitude:	43.4460623
Longitude:	-71.6484756
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	The Site contains two buildings including a former hacksaw and metal tool manufacturing mill, and a former armory. The site is situated on the bank of the Winnipesaukee River and is planned to be redeveloped as a boutique hotel and restaurant with an event center. A portion of the mill has significant structural issues and it planned to be partially demolished and reinforced to create a riverfront "mill ruins" outdoor seating/park area. The former armory was also used for storage by the mill and more recently as a mica depot in support of other manufacturing in the area. Former Use: To be updated upon Phase I completion.
Datum:	North American Datum of 1983
Acres Property ID:	174843
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	2500
Assessment Funding Source:	EPA
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	Phase II Environmental Assessment
Accomplishment Count:	N
Cooperative Agreement Number:	96176301
Start Date:	8/23/2014
Ownership Entity:	Private
Completion Date:	10/3/2014
Current Owner:	Ferrari Realty Trust
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	U
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y

FERRARI MILL (Continued) **1016952025**

Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	1.22
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.22
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	Y
Cadmium contaminant found:	-
Chromium contaminant found:	Y
Copper contaminant found:	-

FERRARI MILL (Continued) **1016952025**

Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	To be updated upon Phase I completion.
Below Poverty Number:	608
Below Poverty Percent:	24.17
Meidan Income:	9934
Meidan Income Number:	1208
Meidan Income Percent:	48.03
Vacant Housing Number:	82
Vacant Housing Percent:	8.28
Unemployed Number:	151
Unemployed Percent:	6

Name:	FERRARI MILL
Address:	93 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	R1 TBA - New Hampshire (STAG Funded)
Grant Type:	TBA
Property Number:	117-142-00
Parcel size:	1.22
Latitude:	43.4460623
Longitude:	-71.6484756
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	The Site contains two buildings including a former hacksaw and metal tool manufacturing mill, and a former armory. The site is situated on the bank of the Winnipesaukee River and is planned to be redeveloped as a boutique hotel and restaurant with an event center. A portion of the mill has significant structural issues and it planned to be partially demolished and reinforced to create a riverfront "mill ruins" outdoor seating/park area. The former armory was also used for storage by the mill and more recently as a mica depot in support of other manufacturing in the area. Former Use: To be updated upon Phase I completion.
Datum:	North American Datum of 1983
Acres Property ID:	174843
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-

FERRARI MILL (Continued) **1016952025**

Assessment Funding:	156000
Assessment Funding Source:	EPA
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	US EPA - TBA Funding
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	Phase II Environmental Assessment
Accomplishment Count:	N
Cooperative Agreement Number:	n/a
Start Date:	3/20/2017
Ownership Entity:	Private
Completion Date:	2/21/2018
Current Owner:	Ferrari Realty Trust
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	U
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y

FERRARI MILL (Continued) **1016952025**

Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	1.22
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.22
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	Y
Cadmium contaminant found:	-
Chromium contaminant found:	Y
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	To be updated upon Phase I completion.
Below Poverty Number:	608
Below Poverty Percent:	24.17
Meidan Income:	9934
Meidan Income Number:	1208
Meidan Income Percent:	48.03
Vacant Housing Number:	82
Vacant Housing Percent:	8.28
Unemployed Number:	151
Unemployed Percent:	6

FERRARI MILL (Continued) **1016952025**

Name:	FERRARI MILL
Address:	93 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	R1 TBA - New Hampshire (STAG Funded)
Grant Type:	TBA
Property Number:	117-142-00
Parcel size:	1.22
Latitude:	43.4460623
Longitude:	-71.6484756
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	The Site contains two buildings including a former hacksaw and metal tool manufacturing mill, and a former armory. The site is situated on the bank of the Winnipesaukee River and is planned to be redeveloped as a boutique hotel and restaurant with an event center. A portion of the mill has significant structural issues and it planned to be partially demolished and reinforced to create a riverfront "mill ruins" outdoor seating/park area. The former armory was also used for storage by the mill and more recently as a mica depot in support of other manufacturing in the area. Former Use: To be updated upon Phase I completion.
Datum:	North American Datum of 1983
Acres Property ID:	174843
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	n/a
Start Date:	-
Ownership Entity:	Private
Completion Date:	-
Current Owner:	Ferrari Realty Trust
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	U
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-

FERRARI MILL (Continued) **1016952025**

IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	1.22
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.22
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-

FERRARI MILL (Continued) **1016952025**

SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	Y
Cadmium contaminant found:	-
Chromium contaminant found:	Y
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	To be updated upon Phase I completion.
Below Poverty Number:	608
Below Poverty Percent:	24.17
Meidan Income:	9934
Meidan Income Number:	1208
Meidan Income Percent:	48.03
Vacant Housing Number:	82
Vacant Housing Percent:	8.28
Unemployed Number:	151
Unemployed Percent:	6

Name:	FERRARI MILL
Address:	93 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	117-142-00
Parcel size:	1.22
Latitude:	43.4460623
Longitude:	-71.6484756
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	The Site contains two buildings including a former hacksaw and metal tool manufacturing mill, and a former armory. The site is situated on the bank of the Winnipesaukee River and is planned to be redeveloped as a boutique hotel and restaurant with an event center. A portion of the mill has significant structural issues and it planned to be partially demolished and reinforced to create a riverfront "mill ruins" outdoor seating/park area. The former armory was also used for storage by the mill and more recently as a mica depot in support of other manufacturing in the area. Former Use: To be updated upon Phase I completion.
Datum:	North American Datum of 1983
Acres Property ID:	174843
IC Data Access:	-

FERRARI MILL (Continued) **1016952025**

Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	42110
Assessment Funding Source:	EPA
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	Phase II Environmental Assessment
Accomplishment Count:	N
Cooperative Agreement Number:	96176301
Start Date:	8/23/2014
Ownership Entity:	Private
Completion Date:	10/3/2014
Current Owner:	Ferrari Realty Trust
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	U
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-

FERRARI MILL (Continued) **1016952025**

PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	1.22
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.22
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	Y
Cadmium contaminant found:	-
Chromium contaminant found:	Y
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	To be updated upon Phase I completion.
Below Poverty Number:	608
Below Poverty Percent:	24.17
Meidan Income:	9934

FERRARI MILL (Continued) **1016952025**

Meidan Income Number:	1208
Meidan Income Percent:	48.03
Vacant Housing Number:	82
Vacant Housing Percent:	8.28
Unemployed Number:	151
Unemployed Percent:	6
Name:	FERRARI MILL
Address:	93 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	R1 TBA - New Hampshire (STAG Funded)
Grant Type:	TBA
Property Number:	117-142-00
Parcel size:	1.22
Latitude:	43.4460623
Longitude:	-71.6484756
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	The Site contains two buildings including a former hacksaw and metal tool manufacturing mill, and a former armory. The site is situated on the bank of the Winnipesaukee River and is planned to be redeveloped as a boutique hotel and restaurant with an event center. A portion of the mill has significant structural issues and it planned to be partially demolished and reinforced to create a riverfront "mill ruins" outdoor seating/park area. The former armory was also used for storage by the mill and more recently as a mica depot in support of other manufacturing in the area. Former Use: To be updated upon Phase I completion.
Datum:	North American Datum of 1983
Acres Property ID:	174843
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	n/a
Start Date:	-
Ownership Entity:	Private
Completion Date:	-
Current Owner:	Ferrari Realty Trust
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-

FERRARI MILL (Continued) **1016952025**

Photo Available:	-
Institutional Controls Required:	U
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	1.22
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.22
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-

FERRARI MILL (Continued) **1016952025**

Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	Y
Cadmium contaminant found:	-
Chromium contaminant found:	Y
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	To be updated upon Phase I completion.
Below Poverty Number:	608
Below Poverty Percent:	24.17
Meidan Income:	9934
Meidan Income Number:	1208
Meidan Income Percent:	48.03
Vacant Housing Number:	82
Vacant Housing Percent:	8.28
Unemployed Number:	151
Unemployed Percent:	6

Click this hyperlink while viewing on your computer to access
1 additional US BROWNFIELDS: record(s) in the EDR Site Report.

Name:	FERRARI MILL
Address:	93 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	117-142-00
Parcel size:	1.22
Latitude:	43.4460623
Longitude:	-71.6484756
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	The Site contains two buildings including a former hacksaw and metal tool manufacturing mill, and a former armory. The site is situated on the bank of the Winnipesaukee River and is planned to be redeveloped

FERRARI MILL (Continued) **1016952025**

as a boutique hotel and restaurant with an event center. A portion of the mill has significant structural issues and it planned to be partially demolished and reinforced to create a riverfront "mill ruins" outdoor seating/park area. The former armory was also used for storage by the mill and more recently as a mica depot in support of other manufacturing in the area. Former Use: To be updated upon Phase I completion.

Datum:	North American Datum of 1983
Acres Property ID:	174843
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	96176301
Start Date:	-
Ownership Entity:	Private
Completion Date:	-
Current Owner:	Ferrari Realty Trust
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	U
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-

FERRARI MILL (Continued) **1016952025**

No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	1.22
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.22
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	Y
Cadmium contaminant found:	-
Chromium contaminant found:	Y
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-

FERRARI MILL (Continued) **1016952025**

Media affected Bluiding Material:	Y
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	To be updated upon Phase I completion.
Below Poverty Number:	608
Below Poverty Percent:	24.17
Meidan Income:	9934
Meidan Income Number:	1208
Meidan Income Percent:	48.03
Vacant Housing Number:	82
Vacant Housing Percent:	8.28
Unemployed Number:	151
Unemployed Percent:	6

Click this hyperlink while viewing on your computer to access
1 additional US BROWNFIELDS: record(s) in the EDR Site Report.

A2 **FERRARI MILL** **FINDS** **1017376084**
Target **93 MEMORIAL STREET** **N/A**
Property **FRANKLIN, NH 03235**

Site 2 of 6 in cluster A

Actual:
300 ft.

FINDS:
Registry ID: 110061089762

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
US EPA Assessment, Cleanup and Redevelopment Exchange System (ACRES)
is an federal online database for Brownfields Grantees to
electronically submit data directly to EPA.

Click this hyperlink while viewing on your computer to access
additional FINDS: detail in the EDR Site Report.

A3 **STANLEY MILL** **NH BROWNFIELDS** **S116715005**
Target **93-119 MEMORIAL STREET** **NH ALLSITES** **N/A**
Property **FRANKLIN, NH**

Site 3 of 6 in cluster A

Actual:
300 ft.

BROWNFIELDS:

Name:	STANLEY MILL
Address:	93-119 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH
Facility ID:	198606087
Site Latitude:	43.446077
Site Longitude:	-71.647312
Site Total Acreage:	1.219

ALLSITES:

Name:	STANLEY MILL
Address:	93-119 MEMORIAL STREET

STANLEY MILL (Continued) **S116715005**

City,State,Zip:	FRANKLIN, NH
Facility ID:	198606087
Project Type:	SITEEVALHW
Project Description:	UNSOLICITED SITE ASSESSMENT REVIEWED BY HWRB
Project Manager:	MCCLUSKEY
Expiration Date:	Not reported

A4 **FRANKLIN CITY OF** **NH UST** **1000317188**
Target **93 MEMORIAL ST** **RCRA NonGen / NLR** **NHD095519823**
Property **FRANKLIN, NH 03235**

Site 4 of 6 in cluster A

Actual: **300 ft.**

UST:

Name:	STANLEY MILL
Address:	93-119 MEMORIAL STREET
City:	FRANKLIN
Facility ID:	113000
Facility Type:	INDUSTRIAL
Site Number:	198606087
Owner Name:	FRANKLIN FALLS REALTY
Owner Type:	COMMERCIAL/RESIDENTIAL
Owner Title:	Not reported
Owner Address:	35 RIVER ST
Owner Address2:	Not reported
Owner City,St,Zip:	FRANKLIN, NH 03235
Manager Name:	LOUIS FERRARI
Manager Title:	MANAGER
Tank ID:	1
Status:	INACTIVE
Capacity (gal):	10000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported

FRANKLIN CITY OF (Continued) **1000317188**

CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	Not reported
Install Date:	01/01/1982
Last Test:	Not reported
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	12/07/1998
Tank Material:	STEEL - BARE/GALV
Closure Date:	02/01/1999
Tank Secondary:	NO
Product Stored:	#2 HEATING OIL
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	UNKNOWN
Pipe System:	SUCTION: OLD CODE

RCRA NonGen / NLR:

Date Form Received by Agency:		20171115
Handler Name:	FRANKLIN CITY OF	
Handler Address:		93 MEMORIAL ST
Handler City,State,Zip:		FRANKLIN, NH 03235
EPA ID:		NHD095519823
Contact Name:		DICK LEWIS
Contact Address:		Not reported
Contact City,State,Zip:		Not reported
Contact Telephone:		603-934-2341
Contact Fax:		Not reported
Contact Email:		DLEWIS@FRANKLINNH.ORG
Contact Title:		Not reported
EPA Region:		01
Land Type:		Municipal
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		316 CENTRAL ST
Mailing City,State,Zip:		FRANKLIN, NH 03235
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported

FRANKLIN CITY OF (Continued) **1000317188**

Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20171227
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

FRANKLIN CITY OF (Continued) **1000317188**

Hazardous Waste Summary:
Waste Code: D002
Waste Description: CORROSIVE WASTE

Handler - Owner Operator:
Owner/Operator Indicator: Owner
Owner/Operator Name: OWNERNAME
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: OWNERSTREET
Owner/Operator City,State,Zip: OWNERCITY, NH 99999
Owner/Operator Telephone: 603-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 19810812
Handler Name: STANLEY TOOLS FRANKLIN PLANT
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20170906
Handler Name: FRANKLIN CITY OF
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20170927
Handler Name: FRANKLIN CITY OF
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

FRANKLIN CITY OF (Continued) **1000317188**

Receive Date: 20171115
Handler Name: FRANKLIN CITY OF
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19810812
Handler Name: STANLEY TOOLS FRANKLIN PLANT
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

A5 **FRANKLIN CITY OF** **FINDS** **1016661987**
Target **93 MEMORIAL ST** **ECHO** **N/A**
Property **FRANKLIN, NH 03235**

Site 5 of 6 in cluster A

Actual:
300 ft.

FINDS:
Registry ID: 110004091795

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

FRANKLIN CITY OF (Continued) **1016661987**

ECHO:

Envid:	1016661987
Registry ID:	110004091795
DFR URL:	http://echo.epa.gov/detailed-facility-report?fid=110004091795
Name:	FRANKLIN CITY OF
Address:	93 MEMORIAL ST
City,State,Zip:	FRANKLIN, NH 03235

A6 **ALGONQUIN POWER SYSTEM** **RCRA NonGen / NLR** **1007204532**
SE **40 MEMORIAL ST** **NHD510156714**
< 1/8 **FRANKLIN, NH 03235**
0.007 mi.
35 ft. **Site 6 of 6 in cluster A**

Relative:
Higher

Actual:
301 ft.

RCRA NonGen / NLR:

Date Form Received by Agency:		20050111
Handler Name:	ALGONQUIN POWER SYSTEM	
Handler Address:		40 MEMORIAL ST
Handler City,State,Zip:		FRANKLIN, NH 03235
EPA ID:		NHD510156714
Contact Name:		RALPH TOMAT
Contact Address:		24 MILL ST
Contact City,State,Zip:		TILTON, NH 03276
Contact Telephone:		603-286-8471
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		24 MILL ST
Mailing City,State,Zip:		TILTON, NH 03276
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported

ALGONQUIN POWER SYSTEM (Continued) **1007204532**

Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20051020
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Historic Generators:

Receive Date:	20050111
Handler Name: ALGONQUIN POWER SYSTEM	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20000412

ALGONQUIN POWER SYSTEM (Continued) **1007204532**

Handler Name: ALGONQUIN POWER SYSTEM
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

B7 **LEMIRE AIME J** **EDR Hist Cleaner** **1018524041**
SE **31 MEMORIAL ST** **N/A**
< 1/8 **FRANKLIN, NH 03235**
0.019 mi.
99 ft. **Site 1 of 5 in cluster B**

Relative: EDR Hist Cleaner
Higher

Actual: **302 ft.**

Year:	Name:	Type:
1987	WASH BRITE LAUNDRY	Power Laundries, Family And Commercial
1989	WASH BRITE LAUNDRY & CLEANERS	Garment Pressing And Cleaners' Agents
1990	WASH BRITE LAUNDRY & CLEANERS	Garment Pressing And Cleaners' Agents
1991	WASH BRITE LAUNDRY & CLEANERS	Garment Pressing And Cleaners' Agents
1992	WASH BRITE LAUNDRY & CLEANERS	Garment Pressing And Cleaners' Agents
1993	WASH BRITE LAUNDRY & CLEANERS	Garment Pressing And Cleaners' Agents

---

C8 **R & D PAVING** **NH BROWNFIELDS** **S117326545**
WSW **81 MEMORIAL STREET** **NH ALLSITES** **N/A**
< 1/8 **FRANKLIN, NH**
0.026 mi.
137 ft. **Site 1 of 4 in cluster C**

Relative: BROWNFIELDS:
Lower
Name: R & D PAVING
Actual: Address: 81 MEMORIAL STREET
299 ft. City,State,Zip: FRANKLIN, NH
Facility ID: 201409001
Site Latitude: 43.445745
Site Longitude: -71.647028
Site Total Acreage: 0.242

ALLSITES:

R & D PAVING (Continued) **S117326545**

Name:	R & D PAVING
Address:	81 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH
Facility ID:	201409001
Project Type:	SITEEVALHW
Project Description:	UNSOLICITED SITE ASSESSMENT REVIEWED BY HWRB
Project Manager:	UNASSIGNED
Expiration Date:	Not reported

C9 **R&D PAVING** **US BROWNFIELDS** **1016952227**
WSW **81 MEMORIAL STREET** **N/A**
< 1/8 **FRANKLIN, NH 3235**
0.026 mi.
137 ft. **Site 2 of 4 in cluster C**

Relative: **Lower**

Actual: **299 ft.**

US BROWNFIELDS:

Name:	R&D PAVING
Address:	81 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	117-261-00
Parcel size:	0.24
Latitude:	43.4460623
Longitude:	-71.6484756
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	The Site currently contains a small building and parking area that are being vacated by a paving company. Historically the Site has been used for auto garages that supported the surrounding mill district. The City's mill district master plan indicates that the Site will be well suited for expansion of municipal parking in support of other redevelopments in the area. Former Use: To be updated following Phase I ESA
Datum:	North American Datum of 1983
Acres Property ID:	174842
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	96176301
Start Date:	-
Ownership Entity:	Private

R&D PAVING (Continued) **1016952227**

Completion Date:	-
Current Owner:	R&D Paving, Inc.
Did Owner Change:	N
Cleanup Required:	U
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	U
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	-
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	0.24
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	0.24

R&D PAVING (Continued) **1016952227**

Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	To be updated following Phase I ESA
Below Poverty Number:	608
Below Poverty Percent:	24.17
Meidan Income:	9934
Meidan Income Number:	1208
Meidan Income Percent:	48.03
Vacant Housing Number:	82
Vacant Housing Percent:	8.28
Unemployed Number:	151
Unemployed Percent:	6

Name:	R&D PAVING
Address:	81 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	117-261-00
Parcel size:	0.24
Latitude:	43.4460623
Longitude:	-71.6484756
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	The Site currently contains a small building and parking area that

R&D PAVING (Continued) **1016952227**

	are being vacated by a paving company. Historically the Site has been used for auto garages that supported the surrounding mill district. The City's mill district master plan indicates that the Site will be well suited for expansion of municipal parking in support of other redevelopments in the area. Former Use: To be updated following Phase I ESA
Datum:	North American Datum of 1983
Acres Property ID:	174842
IC Data Access:	-
Start Date:	-
Redev Completition Date:	2/1/2015
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	85000
Redev. Funding Source:	Franklin Business and Industry Development Corporation
Redev. Funding Entity Name:	Private/Other Funding
Redevelopment Start Date:	9/22/2014
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	96176301
Start Date:	-
Ownership Entity:	Private
Completion Date:	-
Current Owner:	R&D Paving, Inc.
Did Owner Change:	N
Cleanup Required:	U
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	U
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	-
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-

R&D PAVING (Continued) **1016952227**

Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	6
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	0.24
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	0.24
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-

R&D PAVING (Continued) **1016952227**

Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	To be updated following Phase I ESA
Below Poverty Number:	608
Below Poverty Percent:	24.17
Meidan Income:	9934
Meidan Income Number:	1208
Meidan Income Percent:	48.03
Vacant Housing Number:	82
Vacant Housing Percent:	8.28
Unemployed Number:	151
Unemployed Percent:	6

Name:	R&D PAVING
Address:	81 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	117-261-00
Parcel size:	0.24
Latitude:	43.4460623
Longitude:	-71.6484756
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	The Site currently contains a small building and parking area that are being vacated by a paving company. Historically the Site has been used for auto garages that supported the surrounding mill district. The City's mill district master plan indicates that the Site will be well suited for expansion of municipal parking in support of other redevelopments in the area. Former Use: To be updated following Phase I ESA
Datum:	North American Datum of 1983
Acres Property ID:	174842
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	18000
Assessment Funding Source:	EPA
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	Phase II Environmental Assessment
Accomplishment Count:	N
Cooperative Agreement Number:	96176301
Start Date:	9/12/2014

R&D PAVING (Continued) **1016952227**

Ownership Entity:	Private
Completion Date:	4/2/2015
Current Owner:	R&D Paving, Inc.
Did Owner Change:	N
Cleanup Required:	U
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	U
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	-
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	0.24
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-

R&D PAVING (Continued) **1016952227**

Future use commercial acreage:	0.24
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	To be updated following Phase I ESA
Below Poverty Number:	608
Below Poverty Percent:	24.17
Meidan Income:	9934
Meidan Income Number:	1208
Meidan Income Percent:	48.03
Vacant Housing Number:	82
Vacant Housing Percent:	8.28
Unemployed Number:	151
Unemployed Percent:	6

Name:	R&D PAVING
Address:	81 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	117-261-00
Parcel size:	0.24
Latitude:	43.4460623
Longitude:	-71.6484756
HCM Label:	-
Map Scale:	-
Point of Reference:	-

R&D PAVING (Continued) **1016952227**

Highlights:	The Site currently contains a small building and parking area that are being vacated by a paving company. Historically the Site has been used for auto garages that supported the surrounding mill district. The City's mill district master plan indicates that the Site will be well suited for expansion of municipal parking in support of other redevelopments in the area. Former Use: To be updated following Phase I ESA
Datum:	North American Datum of 1983
Acres Property ID:	174842
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	96176301
Start Date:	-
Ownership Entity:	Private
Completion Date:	-
Current Owner:	R&D Paving, Inc.
Did Owner Change:	N
Cleanup Required:	U
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	U
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	-
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-

R&D PAVING (Continued) **1016952227**

No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	0.24
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	0.24
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-

R&D PAVING (Continued) **1016952227**

Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	To be updated following Phase I ESA
Below Poverty Number:	608
Below Poverty Percent:	24.17
Meidan Income:	9934
Meidan Income Number:	1208
Meidan Income Percent:	48.03
Vacant Housing Number:	82
Vacant Housing Percent:	8.28
Unemployed Number:	151
Unemployed Percent:	6
Name:	R&D PAVING
Address:	81 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	117-261-00
Parcel size:	0.24
Latitude:	43.4460623
Longitude:	-71.6484756
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	The Site currently contains a small building and parking area that are being vacated by a paving company. Historically the Site has been used for auto garages that supported the surrounding mill district. The City's mill district master plan indicates that the Site will be well suited for expansion of municipal parking in support of other redevelopments in the area. Former Use: To be updated following Phase I ESA
Datum:	North American Datum of 1983
Acres Property ID:	174842
IC Data Access:	-
Start Date:	-
Redev Completition Date:	2/1/2015
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	20000
Redev. Funding Source:	Building Tenant
Redev. Funding Entity Name:	Private/Other Funding
Redevelopment Start Date:	9/22/2014
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	96176301

R&D PAVING (Continued) **1016952227**

Start Date:	-
Ownership Entity:	Private
Completion Date:	-
Current Owner:	R&D Paving, Inc.
Did Owner Change:	N
Cleanup Required:	U
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	U
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	-
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	6
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	0.24
Past use industrial acreage:	-
Future use greenspace acreage:	-

R&D PAVING (Continued) **1016952227**

Future use residential acreage:	-
Future use commercial acreage:	0.24
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	To be updated following Phase I ESA
Below Poverty Number:	608
Below Poverty Percent:	24.17
Meidan Income:	9934
Meidan Income Number:	1208
Meidan Income Percent:	48.03
Vacant Housing Number:	82
Vacant Housing Percent:	8.28
Unemployed Number:	151
Unemployed Percent:	6

Name:	R&D PAVING
Address:	81 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	117-261-00
Parcel size:	0.24
Latitude:	43.4460623
Longitude:	-71.6484756
HCM Label:	-
Map Scale:	-

R&D PAVING (Continued) **1016952227**

Point of Reference:	-
Highlights:	The Site currently contains a small building and parking area that are being vacated by a paving company. Historically the Site has been used for auto garages that supported the surrounding mill district. The City's mill district master plan indicates that the Site will be well suited for expansion of municipal parking in support of other redevelopments in the area. Former Use: To be updated following Phase I ESA
Datum:	North American Datum of 1983
Acres Property ID:	174842
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	4000
Assessment Funding Source:	EPA
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	Phase I Environmental Assessment
Accomplishment Count:	Y
Cooperative Agreement Number:	96176301
Start Date:	7/8/2014
Ownership Entity:	Private
Completion Date:	9/11/2014
Current Owner:	R&D Paving, Inc.
Did Owner Change:	N
Cleanup Required:	U
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	U
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	-
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-

R&D PAVING (Continued) **1016952227**

Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	0.24
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	0.24
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-

R&D PAVING (Continued) **1016952227**

Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	To be updated following Phase I ESA
Below Poverty Number:	608
Below Poverty Percent:	24.17
Meidan Income:	9934
Meidan Income Number:	1208
Meidan Income Percent:	48.03
Vacant Housing Number:	82
Vacant Housing Percent:	8.28
Unemployed Number:	151
Unemployed Percent:	6
Name:	R&D PAVING
Address:	81 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	117-261-00
Parcel size:	0.24
Latitude:	43.4460623
Longitude:	-71.6484756
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	The Site currently contains a small building and parking area that are being vacated by a paving company. Historically the Site has been used for auto garages that supported the surrounding mill district. The City's mill district master plan indicates that the Site will be well suited for expansion of municipal parking in support of other redevelopments in the area. Former Use: To be updated following Phase I ESA
Datum:	North American Datum of 1983
Acres Property ID:	174842
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	2500
Assessment Funding Source:	EPA
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	Phase II Environmental Assessment
Accomplishment Count:	N

R&D PAVING (Continued) **1016952227**

Cooperative Agreement Number:	96176301
Start Date:	9/12/2014
Ownership Entity:	Private
Completion Date:	4/2/2015
Current Owner:	R&D Paving, Inc.
Did Owner Change:	N
Cleanup Required:	U
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	U
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	-
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	0.24
Past use industrial acreage:	-

R&D PAVING (Continued) **1016952227**

Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	0.24
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	To be updated following Phase I ESA
Below Poverty Number:	608
Below Poverty Percent:	24.17
Meidan Income:	9934
Meidan Income Number:	1208
Meidan Income Percent:	48.03
Vacant Housing Number:	82
Vacant Housing Percent:	8.28
Unemployed Number:	151
Unemployed Percent:	6

B10 **FRANKLIN BUSINESS** **RCRA NonGen / NLR** **1008888079**
SE **20 CANAL ST** **NHD510114648**
< 1/8 **FRANKLIN, NH 03235**
0.041 mi.
217 ft. **Site 2 of 5 in cluster B**

Relative: **Higher**
Actual: **303 ft.**

RCRA NonGen / NLR:

Date Form Received by Agency:		20030306
Handler Name:	FRANKLIN BUSINESS	
Handler Address:		20 CANAL ST
Handler City,State,Zip:		FRANKLIN, NH 03235

FRANKLIN BUSINESS (Continued) **1008888079**

EPA ID:		NHD510114648
Contact Name:		DAN PETRINI
Contact Address:		47 COLLISION RD
Contact City,State,Zip:		SANBORNTON, NH 03269
Contact Telephone:		603-528-5920
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		47 COLLISION RD
Mailing City,State,Zip:		SANBORNTON, NH 03269
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		NN
Sub-Part K Indicator:		Not reported
Commercial TSD Indicator:		No
Treatment Storage and Disposal Type:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
Permit Renewals Workload Universe:		Not reported
Permit Workload Universe:		Not reported
Permit Progress Universe:		Not reported
Post-Closure Workload Universe:		Not reported
Closure Workload Universe:		Not reported
202 GPRA Corrective Action Baseline:		No
Corrective Action Workload Universe:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:		No

FRANKLIN BUSINESS (Continued) **1008888079**

TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20051020
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Historic Generators:

Receive Date:	20030306
Handler Name: FRANKLIN BUSINESS	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:

NAICS Codes:	No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations:	No Violations Found

Evaluation Action Summary:

Evaluations:	No Evaluations Found

B11 **FRANKLIN BUSINESS CENTER** **US BROWNFIELDS** **1004558843**
SE **20 CANAL STREET** **ICIS** **N/A**
< 1/8 **FRANKLIN, NH 3235** **US AIRS**
0.041 mi. **FINDS**
217 ft. **Site 3 of 5 in cluster B** **ECHO**

Relative: Higher
Actual: 303 ft.

US BROWNFIELDS:

Name:	FRANKLIN BUSINESS CENTER
Address:	20 CANAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	117-365-00 & 117-153-00
Parcel size:	4.14
Latitude:	43.445717
Longitude:	-71.645306
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	Two (2) large mill buildings are located on the site that was constructed in the early 1900s. The current owner of the property is interested in redeveloping an underutilized parking lot on the parcel 117-153, but a Red Tagged 20,000-gallon UST occupies part of this area. According to available information, the Site was reportedly first developed sometime before 1884. The site appears to have only been used as a parking lot, for bulk oil storage of fuel oil to run the heating system(s) in the adjacent building(s). The former use of the very small brick storage building remains unknown, but this area of Franklin has had a long history of industrial use beginning in the 1800 s extending to the 1970 s. In fact, the Site was likely used as mill yard that served the previous mill operation known to have occupied the building surrounding (including the building extension and very small brick building). Known past uses of the surrounding buildings and properties in the general area of the Site include: Metal fabrication and machining, paper making, electric generation, wool milling (including dying), and carpentry. On November 7, 2011, the NHDES requested that this UST system be removed and permanently closed due to corrosion protection testing non-compliance. Due to the fact that the tank was in service since at least 1984, there is the potential for spills or releases to have occurred and impacted soil and/or groundwater at the site. Former Use: The Franklin Business Center site is located at 20 Canal Street in Franklin and is comprised of two (2) parcels of land (Parcel ID s 117-365-00 & 117-153-00) totaling 4.14-acres. The current owner of the site is Mass Investment Group, LLC c/o Edward Bussiere, Jr. The Mass Investment Group, LLC acquired the property from Joseph Romano Realty, Inc. in December of 2006.
Datum:	North American Datum of 1983
Acres Property ID:	144181
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	11597
Assessment Funding Source:	NHDES
Redevelopment Funding:	-

FRANKLIN BUSINESS CENTER (Continued) **1004558843**

Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	State/Tribal Funding (non-section 128(a))
Cleanup Funding Entity:	-
Grant Type:	Petroleum
Accomplishment Type:	Supplemental Assessment
Accomplishment Count:	N
Cooperative Agreement Number:	96111801
Start Date:	7/15/2014
Ownership Entity:	Private
Completion Date:	12/11/2014
Current Owner:	Mass Investment Group, LLC c/o Edward Bussiere, Jr.
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	U
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	-
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y

FRANKLIN BUSINESS CENTER (Continued) **1004558843**

VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	4.14
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	-
Future use industrial acreage:	4.14
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	The Franklin Business Center site is located at 20 Canal Street in Franklin and is comprised of two (2) parcels of land (Parcel ID s 117-365-00 & 117-153-00) totaling 4.14-acres. The current owner of the site is Mass Investment Group, LLC c/o Edward Bussiere, Jr. The Mass Investment Group, LLC acquired the property from Joseph Romano Realty, Inc. in December of 2006.
Below Poverty Number:	672
Below Poverty Percent:	24.91
Meidan Income:	11182
Meidan Income Number:	1298
Meidan Income Percent:	48.11
Vacant Housing Number:	92
Vacant Housing Percent:	8.59

FRANKLIN BUSINESS CENTER (Continued) **1004558843**

Unemployed Number:	161
Unemployed Percent:	5.97
Name:	FRANKLIN BUSINESS CENTER
Address:	20 CANAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	117-365-00 & 117-153-00
Parcel size:	4.14
Latitude:	43.445717
Longitude:	-71.645306
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	Two (2) large mill buildings are located on the site that was constructed in the early 1900s. The current owner of the property is interested in redeveloping an underutilized parking lot on the parcel 117-153, but a Red Tagged 20,000-gallon UST occupies part of this area. According to available information, the Site was reportedly first developed sometime before 1884. The site appears to have only been used as a parking lot, for bulk oil storage of fuel oil to run the heating system(s) in the adjacent building(s). The former use of the very small brick storage building remains unknown, but this area of Franklin has had a long history of industrial use beginning in the 1800 s extending to the 1970 s. In fact, the Site was likely used as mill yard that served the previous mill operation known to have occupied the building surrounding (including the building extension and very small brick building). Known past uses of the surrounding buildings and properties in the general area of the Site include: Metal fabrication and machining, paper making, electric generation, wool milling (including dying), and carpentry. On November 7, 2011, the NHDES requested that this UST system be removed and permanently closed due to corrosion protection testing non-compliance. Due to the fact that the tank was in service since at least 1984, there is the potential for spills or releases to have occurred and impacted soil and/or groundwater at the site. Former Use: The Franklin Business Center site is located at 20 Canal Street in Franklin and is comprised of two (2) parcels of land (Parcel ID s 117-365-00 & 117-153-00) totaling 4.14-acres. The current owner of the site is Mass Investment Group, LLC c/o Edward Bussiere, Jr. The Mass Investment Group, LLC acquired the property from Joseph Romano Realty, Inc. in December of 2006.
Datum:	North American Datum of 1983
Acres Property ID:	144181
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	6275
Assessment Funding Source:	NHDES
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-

FRANKLIN BUSINESS CENTER (Continued) **1004558843**

Redevelopment Start Date:	-
Assessment Funding Entity:	State/Tribal Funding (non-section 128(a))
Cleanup Funding Entity:	-
Grant Type:	Petroleum
Accomplishment Type:	Supplemental Assessment
Accomplishment Count:	N
Cooperative Agreement Number:	96111801
Start Date:	7/15/2015
Ownership Entity:	Private
Completion Date:	-
Current Owner:	Mass Investment Group, LLC c/o Edward Bussiere, Jr.
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	U
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	-
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-

FRANKLIN BUSINESS CENTER (Continued) **1004558843**

Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	4.14
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	-
Future use industrial acreage:	4.14
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	The Franklin Business Center site is located at 20 Canal Street in Franklin and is comprised of two (2) parcels of land (Parcel ID s 117-365-00 & 117-153-00) totaling 4.14-acres. The current owner of the site is Mass Investment Group, LLC c/o Edward Bussiere, Jr. The Mass Investment Group, LLC acquired the property from Joseph Romano Realty, Inc. in December of 2006.
Below Poverty Number:	672
Below Poverty Percent:	24.91
Meidan Income:	11182
Meidan Income Number:	1298
Meidan Income Percent:	48.11
Vacant Housing Number:	92
Vacant Housing Percent:	8.59
Unemployed Number:	161
Unemployed Percent:	5.97

FRANKLIN BUSINESS CENTER (Continued) **1004558843**

Name:	FRANKLIN BUSINESS CENTER
Address:	20 CANAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	117-365-00 & 117-153-00
Parcel size:	4.14
Latitude:	43.445717
Longitude:	-71.645306
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	Two (2) large mill buildings are located on the site that was constructed in the early 1900s. The current owner of the property is interested in redeveloping an underutilized parking lot on the parcel 117-153, but a Red Tagged 20,000-gallon UST occupies part of this area. According to available information, the Site was reportedly first developed sometime before 1884. The site appears to have only been used as a parking lot, for bulk oil storage of fuel oil to run the heating system(s) in the adjacent building(s). The former use of the very small brick storage building remains unknown, but this area of Franklin has had a long history of industrial use beginning in the 1800 s extending to the 1970 s. In fact, the Site was likely used as mill yard that served the previous mill operation known to have occupied the building surrounding (including the building extension and very small brick building). Known past uses of the surrounding buildings and properties in the general area of the Site include: Metal fabrication and machining, paper making, electric generation, wool milling (including dying), and carpentry. On November 7, 2011, the NHDES requested that this UST system be removed and permanently closed due to corrosion protection testing non-compliance. Due to the fact that the tank was in service since at least 1984, there is the potential for spills or releases to have occurred and impacted soil and/or groundwater at the site. Former Use: The Franklin Business Center site is located at 20 Canal Street in Franklin and is comprised of two (2) parcels of land (Parcel ID s 117-365-00 & 117-153-00) totaling 4.14-acres. The current owner of the site is Mass Investment Group, LLC c/o Edward Bussiere, Jr. The Mass Investment Group, LLC acquired the property from Joseph Romano Realty, Inc. in December of 2006.
Datum:	North American Datum of 1983
Acres Property ID:	144181
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	29081
Assessment Funding Source:	EPA
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity:	-

FRANKLIN BUSINESS CENTER (Continued) **1004558843**

Grant Type:	Petroleum
Accomplishment Type:	Phase II Environmental Assessment
Accomplishment Count:	N
Cooperative Agreement Number:	96111801
Start Date:	9/13/2012
Ownership Entity:	Private
Completion Date:	3/25/2013
Current Owner:	Mass Investment Group, LLC c/o Edward Bussiere, Jr.
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	U
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	-
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-

FRANKLIN BUSINESS CENTER (Continued) **1004558843**

Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	4.14
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	-
Future use industrial acreage:	4.14
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	The Franklin Business Center site is located at 20 Canal Street in Franklin and is comprised of two (2) parcels of land (Parcel ID s 117-365-00 & 117-153-00) totaling 4.14-acres. The current owner of the site is Mass Investment Group, LLC c/o Edward Bussiere, Jr. The Mass Investment Group, LLC acquired the property from Joseph Romano Realty, Inc. in December of 2006.
Below Poverty Number:	672
Below Poverty Percent:	24.91
Meidan Income:	11182
Meidan Income Number:	1298
Meidan Income Percent:	48.11
Vacant Housing Number:	92
Vacant Housing Percent:	8.59
Unemployed Number:	161
Unemployed Percent:	5.97
Name:	FRANKLIN BUSINESS CENTER
Address:	20 CANAL STREET

FRANKLIN BUSINESS CENTER (Continued) **1004558843**

City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	117-365-00 & 117-153-00
Parcel size:	4.14
Latitude:	43.445717
Longitude:	-71.645306
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	Two (2) large mill buildings are located on the site that was constructed in the early 1900s. The current owner of the property is interested in redeveloping an underutilized parking lot on the parcel 117-153, but a Red Tagged 20,000-gallon UST occupies part of this area. According to available information, the Site was reportedly first developed sometime before 1884. The site appears to have only been used as a parking lot, for bulk oil storage of fuel oil to run the heating system(s) in the adjacent building(s). The former use of the very small brick storage building remains unknown, but this area of Franklin has had a long history of industrial use beginning in the 1800 s extending to the 1970 s. In fact, the Site was likely used as mill yard that served the previous mill operation known to have occupied the building surrounding (including the building extension and very small brick building). Known past uses of the surrounding buildings and properties in the general area of the Site include: Metal fabrication and machining, paper making, electric generation, wool milling (including dying), and carpentry. On November 7, 2011, the NHDES requested that this UST system be removed and permanently closed due to corrosion protection testing non-compliance. Due to the fact that the tank was in service since at least 1984, there is the potential for spills or releases to have occurred and impacted soil and/or groundwater at the site. Former Use: The Franklin Business Center site is located at 20 Canal Street in Franklin and is comprised of two (2) parcels of land (Parcel ID s 117-365-00 & 117-153-00) totaling 4.14-acres. The current owner of the site is Mass Investment Group, LLC c/o Edward Bussiere, Jr. The Mass Investment Group, LLC acquired the property from Joseph Romano Realty, Inc. in December of 2006.
Datum:	North American Datum of 1983
Acres Property ID:	144181
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Petroleum
Accomplishment Type:	-

FRANKLIN BUSINESS CENTER (Continued) **1004558843**

Accomplishment Count:	-
Cooperative Agreement Number:	96111801
Start Date:	-
Ownership Entity:	Private
Completion Date:	-
Current Owner:	Mass Investment Group, LLC c/o Edward Bussiere, Jr.
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	U
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	-
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-

FRANKLIN BUSINESS CENTER (Continued) **1004558843**

Past use industrial acreage:	4.14
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	-
Future use industrial acreage:	4.14
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	The Franklin Business Center site is located at 20 Canal Street in Franklin and is comprised of two (2) parcels of land (Parcel ID s 117-365-00 & 117-153-00) totaling 4.14-acres. The current owner of the site is Mass Investment Group, LLC c/o Edward Bussiere, Jr. The Mass Investment Group, LLC acquired the property from Joseph Romano Realty, Inc. in December of 2006.
Below Poverty Number:	672
Below Poverty Percent:	24.91
Meidan Income:	11182
Meidan Income Number:	1298
Meidan Income Percent:	48.11
Vacant Housing Number:	92
Vacant Housing Percent:	8.59
Unemployed Number:	161
Unemployed Percent:	5.97
Name:	FRANKLIN BUSINESS CENTER
Address:	20 CANAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission

FRANKLIN BUSINESS CENTER (Continued) **1004558843**

Grant Type:	Assessment
Property Number:	117-365-00 & 117-153-00
Parcel size:	4.14
Latitude:	43.445717
Longitude:	-71.645306
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	Two (2) large mill buildings are located on the site that was constructed in the early 1900s. The current owner of the property is interested in redeveloping an underutilized parking lot on the parcel 117-153, but a Red Tagged 20,000-gallon UST occupies part of this area. According to available information, the Site was reportedly first developed sometime before 1884. The site appears to have only been used as a parking lot, for bulk oil storage of fuel oil to run the heating system(s) in the adjacent building(s). The former use of the very small brick storage building remains unknown, but this area of Franklin has had a long history of industrial use beginning in the 1800 s extending to the 1970 s. In fact, the Site was likely used as mill yard that served the previous mill operation known to have occupied the building surrounding (including the building extension and very small brick building). Known past uses of the surrounding buildings and properties in the general area of the Site include: Metal fabrication and machining, paper making, electric generation, wool milling (including dying), and carpentry. On November 7, 2011, the NHDES requested that this UST system be removed and permanently closed due to corrosion protection testing non-compliance. Due to the fact that the tank was in service since at least 1984, there is the potential for spills or releases to have occurred and impacted soil and/or groundwater at the site. Former Use: The Franklin Business Center site is located at 20 Canal Street in Franklin and is comprised of two (2) parcels of land (Parcel ID s 117-365-00 & 117-153-00) totaling 4.14-acres. The current owner of the site is Mass Investment Group, LLC c/o Edward Bussiere, Jr. The Mass Investment Group, LLC acquired the property from Joseph Romano Realty, Inc. in December of 2006.
Datum:	North American Datum of 1983
Acres Property ID:	144181
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	3000
Assessment Funding Source:	EPA
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity:	-
Grant Type:	Petroleum
Accomplishment Type:	Phase I Environmental Assessment
Accomplishment Count:	Y
Cooperative Agreement Number:	96111801

FRANKLIN BUSINESS CENTER (Continued) **1004558843**

Start Date:	5/1/2012
Ownership Entity:	Private
Completion Date:	9/12/2012
Current Owner:	Mass Investment Group, LLC c/o Edward Bussiere, Jr.
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	U
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	-
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	4.14
Future use greenspace acreage:	-

FRANKLIN BUSINESS CENTER (Continued) **1004558843**

Future use residential acreage:	-
Future use commercial acreage:	-
Future use industrial acreage:	4.14
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	The Franklin Business Center site is located at 20 Canal Street in Franklin and is comprised of two (2) parcels of land (Parcel ID s 117-365-00 & 117-153-00) totaling 4.14-acres. The current owner of the site is Mass Investment Group, LLC c/o Edward Bussiere, Jr. The Mass Investment Group, LLC acquired the property from Joseph Romano Realty, Inc. in December of 2006.
Below Poverty Number:	672
Below Poverty Percent:	24.91
Meidan Income:	11182
Meidan Income Number:	1298
Meidan Income Percent:	48.11
Vacant Housing Number:	92
Vacant Housing Percent:	8.59
Unemployed Number:	161
Unemployed Percent:	5.97

ICIS:

Enforcement Action ID:	NH000A0000330130005700012
FRS ID:	110001522415
Action Name:	FRANKLIN BUSINESS CENTER 330130005700012
Facility Name:	FRANKLIN BUSINESS CENTER
Facility Address:	20 CANAL ST

FRANKLIN BUSINESS CENTER (Continued) **1004558843**

FRANKLIN, NH 03235
Enforcement Action Type: Administrative Order
Facility County: MERRIMACK
Program System Acronym: AIR
Enforcement Action Forum Desc: Administrative - Formal
EA Type Code: SCAAAO
Facility SIC Code: Not reported
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 43.445498
Longitude in Decimal Degrees: -71.645768
Permit Type Desc: Not reported
Program System Acronym: NH0000003301300057
Facility NAICS Code: 531120
Tribal Land Code: Not reported

Enforcement Action ID: NH000A0000330130005700011
FRS ID: 110001522415
Action Name: FRANKLIN BUSINESS CENTER 330130005700011
Facility Name: FRANKLIN BUSINESS CENTER
Facility Address: 20 CANAL ST
FRANKLIN, NH 03235
Enforcement Action Type: Notice of Violation
Facility County: MERRIMACK
Program System Acronym: AIR
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: NOV
Facility SIC Code: Not reported
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 43.445498
Longitude in Decimal Degrees: -71.645768
Permit Type Desc: Not reported
Program System Acronym: NH0000003301300057
Facility NAICS Code: 531120
Tribal Land Code: Not reported

US AIRS MINOR:
Envid: 1004558843
Region Code: 01
Programmatic ID: AIR NH0000003301300057
Facility Registry ID: 110001522415
D and B Number: Not reported
Primary SIC Code: Not reported
NAICS Code: 531120
Default Air Classification Code: MIN
Facility Type of Ownership Code: POF
Air CMS Category Code: Not reported
HPV Status: Not reported

FINDS:
Registry ID: 110001522415

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the

FRANKLIN BUSINESS CENTER (Continued) **1004558843**

National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.
US EPA Assessment, Cleanup and Redevelopment Exchange System (ACRES) is an federal online database for Brownfields Grantees to electronically submit data directly to EPA.
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.
AIR MINOR

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid:	1004558843
Registry ID:	110001522415
DFR URL:	http://echo.epa.gov/detailed-facility-report?fid=110001522415
Name:	FRANKLIN BUSINESS CENTER
Address:	20 CANAL STREET
City,State,Zip:	FRANKLIN, NH 03235

B12 **FRANKLIN BUSINESS CENTER** **NH SHWS** **U003654171**
SE **20 CANAL ST** **NH UST** **N/A**
< 1/8 **FRANKLIN, NH** **NH AST**
0.041 mi. **NH BROWNFIELDS**
217 ft. **Site 4 of 5 in cluster B** **NH ALLSITES**
NH SPILLS
Relative: Higher **NH AIRS**
NH ASBESTOS
Actual: 303 ft. **NH NPDES**

SHWS:

Name:	FRANKLIN BUSINESS CENTER
Address:	20 CANAL ST
City,State,Zip:	FRANKLIN, NH
Facility ID:	199608021
Proj Type:	HAZWASTE
Project Manager:	**DREW**
Project Site Description:	**HAZARDOUS WASTE DISCHARGE PROJECT**
Expired Date:	**Not reported**

UST:

Name:	FRANKLIN BUSINESS CENTER
Address:	20 CANAL ST
City:	FRANKLIN
Facility ID:	115227
Facility Type:	COMMERCIAL
Site Number:	199608021

FRANKLIN BUSINESS CENTER (Continued) **U003654171**

Owner Name:	PETRINI LLC
Owner Type:	COMMERCIAL/RESIDENTIAL
Owner Title:	Not reported
Owner Address:	20 CANAL ST
Owner Address2:	Not reported
Owner City,St,Zip:	FRANKLIN, NH 03235
Manager Name:	ALEX GORELIX
Manager Title:	Not reported
Tank ID:	1
Status:	INACTIVE
Capacity (gal):	20000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	02/01/1999
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	SACRAFICIAL ANODE
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	02/13/2002
CP Tank Test Pass Fail:	PASS
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	ABOVE GROUND PIPING
Install Date:	01/01/1984
Last Test:	Not reported
Spill Installed:	Not reported
Overfill:	02/01/1999
Line Leak Detection:	Not reported

FRANKLIN BUSINESS CENTER (Continued) **U003654171**

Permanent Closure:	12/18/2013
Tank Material:	STEEL-CORR. PROT.
Closure Date:	01/18/2013
Tank Secondary:	NO
Product Stored:	#2 HEATING OIL
Overfill Type:	AUDIBLE ALARM
Pipe Secondary:	NO
Pipe Material:	Not reported
Pipe System:	SUCTION: OLD CODE

AST:

Facility ID:	960821A
Manager Title:	OWNER
Site Number:	199608021
Manager Name:	DANIEL PETRINI
Tank Number:	1
Status:	INACTIVE
Date Install:	01/01/1984
Capacity:	20000
Closure Date:	Not reported
Pipe Secondary:	Not reported
Capacity Comments:	Not reported
Permanent Closed Date:	05/17/2001
Tank Secondary:	NONE
Substance Store:	#2 HEATING OIL
Compartment:	Not reported
Construction Material Comments:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Piping Type:	Not reported
RD Piping Installed Date:	Not reported
Release Detection (RD) Tank Type:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
RD Tank Type Test Pass Fail:	Not reported
Interstitial Monitoring:	Not reported
High Level Alarm:	OTHER
High Level Alarm Sensor Tested Date:	Not reported
High Level Alarm Sensor Test Pass Fail:	Not reported
Fill Remove:	Not reported
Overfill Shutoff:	Not reported
Overfill Shutoff Test Date:	Not reported
Overfill Shutoff Pass Fail:	Not reported
Proper Labelling:	NO
Last Internal Inspection Date:	Not reported
Inspection Results:	Not reported
Next Internal Inspection Date:	Not reported
Gauge Type:	NONE
Tank Wholly Aboveground On Cradles:	Not reported
Tank Cathodic Protection Last Test Date:	Not reported
Piping Location:	ABOVE GROUND
Piping Material:	CARBON STEEL/BLACK IRON
Piping Material Comments:	Not reported
Piping System:	Not reported

FRANKLIN BUSINESS CENTER (Continued) **U003654171**

Piping Cathodic Protection: Not reported
Piping Cathodic Protection Last Test Date: Not reported
Tank Cathodic Protection: Not reported
Tank Material: SHOP-FABRICATED STEEL TANK (UL 142)

Owner:
Facility ID: 960821A
Site Number: 199608021
Owner Name: PETRINI LLC
Owner Address: 20 CANAL ST STE 4
Owner Address 2: Not reported
Owner State: NH
Owner City: FRANKLIN
Owner Zip: 03235-1637
Facility Type: COMMERCIAL
Owner Type: COMMERCIAL/RESIDENTIAL
Owner Title: Not reported

BROWNFIELDS:
Name: FRANKLIN BUSINESS CENTER
Address: 20 CANAL ST
City,State,Zip: FRANKLIN, NH
Facility ID: 199608021
Site Latitude: 43.445679
Site Longitude: -71.64549
Site Total Acreage Not reported

ALLSITES:
Name: FRANKLIN BUSINESS CENTER
Address: 20 CANAL ST
City,State,Zip: FRANKLIN, NH
Facility ID: 199608021
Project Type: OPUF
Project Description: ON-PREMISE USE FAC. CONTAINING FUEL OIL
Project Manager: CLOSED
Expiration Date: Not reported

NH SPILLS:
Name: ALGONQUIN POWER SYSTEMS INC
Address: 20 CANAL STREET
City,State,Zip: FRANKLIN, NH
Facility ID: 201003081
Project Type: IRSPILL
Project Manager: **CLOSED**
Project Site Description: INITIAL RESPONSE SPILL (IMMEDIATELY CLEANED UP)
Expired Date: Not reported

Name: FRANKLIN BUSINESS CENTER
Address: 20 CANAL ST
City,State,Zip: FRANKLIN, NH
Facility ID: 199608021
Project Type: IRSPILL
Project Manager: **CLOSED**
Project Site Description: INITIAL RESPONSE SPILL (IMMEDIATELY CLEANED UP)
Expired Date: Not reported

FRANKLIN BUSINESS CENTER (Continued) **U003654171**

AIRS:

Name:	FRANKLIN BUSINESS CENTER
Address:	20 CANAL ST
City,State,Zip:	FRANKLIN, NH 03235
Facility Id:	3301300057
Operating Status:	OPERATING-NPR
Year Of Record:	2018
Latitude/Longitude:	43.445893 / -71.645896
Sic Code:	6512
Naics:	531120
Emergency Contact:	OLEG GORELIK, MANAGER
Contact Title:	Not reported
Tel Emiss:	Not reported
Mailing Street:	PO BOX 82
Mailing City:	SHARON
Mailing State:	MA
Mailing Zip Code:	02067
Contact Method Type:	Not reported
Company Name:	Not reported

AIRS:

Facility Id:	3301300057
Operating Status:	No longer requires a permit
Year Of Record:	2005
Pollutant:	CO
Estimated Emissions:	0.08005
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300057
Operating Status:	No longer requires a permit
Year Of Record:	2005
Pollutant:	NO2
Estimated Emissions:	0.3202
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300057
Operating Status:	No longer requires a permit
Year Of Record:	2005
Pollutant:	PM10
Estimated Emissions:	0.01601
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

FRANKLIN BUSINESS CENTER (Continued) **U003654171**

Facility Id:	3301300057
Operating Status:	No longer requires a permit
Year Of Record:	2005
Pollutant:	PM2.5
Estimated Emissions:	0.003842
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300057
Operating Status:	No longer requires a permit
Year Of Record:	2005
Pollutant:	PT
Estimated Emissions:	0.03202
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300057
Operating Status:	No longer requires a permit
Year Of Record:	2005
Pollutant:	SO2
Estimated Emissions:	0.909368
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300057
Operating Status:	No longer requires a permit
Year Of Record:	2005
Pollutant:	VOC
Estimated Emissions:	0.003202
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Name:	FRANKLIN BUSINESS CENTER
Address:	20 CANAL ST
City,State,Zip:	FRANKLIN, NH 03235
Facility Id:	3301300057
Operating Status:	OPERATING-NPR
Year Of Record:	2017
Latitude/Longitude:	43.445893 / -71.645896
Sic Code:	6512

FRANKLIN BUSINESS CENTER (Continued) **U003654171**

Naics:	531120
Emergency Contact:	OLEG GORELIK, MANAGER
Contact Title:	Not reported
Tel Emiss:	Not reported
Mailing Street:	PO BOX 82
Mailing City:	SHARON
Mailing State:	MA
Mailing Zip Code:	02067
Contact Method Type:	Not reported
Company Name:	Not reported

AIRS:

Facility Id:	3301300057
Operating Status:	No longer requires a permit
Year Of Record:	2005
Pollutant:	CO
Estimated Emissions:	0.08005
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300057
Operating Status:	No longer requires a permit
Year Of Record:	2005
Pollutant:	NO2
Estimated Emissions:	0.3202
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300057
Operating Status:	No longer requires a permit
Year Of Record:	2005
Pollutant:	PM10
Estimated Emissions:	0.01601
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300057
Operating Status:	No longer requires a permit
Year Of Record:	2005
Pollutant:	PM2.5
Estimated Emissions:	0.003842
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported

FRANKLIN BUSINESS CENTER (Continued) **U003654171**

Report Product ID:	Not reported
Facility Id:	3301300057
Operating Status:	No longer requires a permit
Year Of Record:	2005
Pollutant:	PT
Estimated Emissions:	0.03202
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported
Facility Id:	3301300057
Operating Status:	No longer requires a permit
Year Of Record:	2005
Pollutant:	SO2
Estimated Emissions:	0.909368
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported
Facility Id:	3301300057
Operating Status:	No longer requires a permit
Year Of Record:	2005
Pollutant:	VOC
Estimated Emissions:	0.003202
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Name:	FRANKLIN BUSINESS CENTER
Address:	20 CANAL ST
City,State,Zip:	FRANKLIN, NH 03235
Facility Id:	3301300057
Operating Status:	OPERATING-NPR
Year Of Record:	Not reported
Latitude/Longitude:	43.445893 / -71.645896
Sic Code:	6512
Naics:	531120
Emergency Contact:	OLEG GORELIK
Contact Title:	Not reported
Tel Emiss:	Not reported
Mailing Street:	PO BOX 82
Mailing City:	SHARON
Mailing State:	MA
Mailing Zip Code:	02067
Contact Method Type:	Not reported
Company Name:	Not reported

FRANKLIN BUSINESS CENTER (Continued) **U003654171**

AIRS:

Facility Id:	3301300057
Operating Status:	No longer requires a permit
Year Of Record:	2005
Pollutant:	CO
Estimated Emissions:	0.08005
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300057
Operating Status:	No longer requires a permit
Year Of Record:	2005
Pollutant:	NO2
Estimated Emissions:	0.3202
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300057
Operating Status:	No longer requires a permit
Year Of Record:	2005
Pollutant:	PM10
Estimated Emissions:	0.01601
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300057
Operating Status:	No longer requires a permit
Year Of Record:	2005
Pollutant:	PM2.5
Estimated Emissions:	0.003842
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300057
Operating Status:	No longer requires a permit
Year Of Record:	2005
Pollutant:	PT
Estimated Emissions:	0.03202
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported

FRANKLIN BUSINESS CENTER (Continued) **U003654171**

Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: SO2
Estimated Emissions: 0.909368
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: VOC
Estimated Emissions: 0.003202
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Name: FRANKLIN BUSINESS CENTER
Address: 20 CANAL ST
City,State,Zip: FRANKLIN, NH 03235
Facility Id: 3301300057
Operating Status: OPERATING-NPR
Year Of Record: Not reported
Latitude/Longitude: 43.445893 / -71.645896
Sic Code: 6512
Naics: 531120
Emergency Contact: OLEG GORELIK
Contact Title: Not reported
Tel Emiss: Not reported
Mailing Street: PO BOX 82
Mailing City: SHARON
Mailing State: MA
Mailing Zip Code: 02067
Contact Method Type: Not reported
Company Name: Not reported

AIRS:
Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: CO
Estimated Emissions: 0.08005
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported

FRANKLIN BUSINESS CENTER (Continued) **U003654171**

Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: NO2
Estimated Emissions: 0.3202
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: PM10
Estimated Emissions: 0.01601
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: PM2.5
Estimated Emissions: 0.003842
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: PT
Estimated Emissions: 0.03202
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: SO2
Estimated Emissions: 0.909368
Estimated Emissions Units: Not reported

FRANKLIN BUSINESS CENTER (Continued) **U003654171**

Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: VOC
Estimated Emissions: 0.003202
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Name: FRANKLIN BUSINESS CENTER
Address: 20 CANAL ST
City,State,Zip: FRANKLIN, NH 03235
Facility Id: 3301300057
Operating Status: OPERATING-NPR
Year Of Record: Not reported
Latitude/Longitude: 43.445893 / -71.645896
Sic Code: 6512
Naics: 531120
Emergency Contact: OLEG GORELIK
Contact Title: Not reported
Tel Emiss: Not reported
Mailing Street: PO BOX 82
Mailing City: SHARON
Mailing State: MA
Mailing Zip Code: 02067
Contact Method Type: Not reported
Company Name: Not reported

AIRS:
Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: CO
Estimated Emissions: 0.08005
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: NO2
Estimated Emissions: 0.3202
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported

FRANKLIN BUSINESS CENTER (Continued) **U003654171**

Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: PM10
Estimated Emissions: 0.01601
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: PM2.5
Estimated Emissions: 0.003842
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: PT
Estimated Emissions: 0.03202
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: SO2
Estimated Emissions: 0.909368
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: VOC

FRANKLIN BUSINESS CENTER (Continued) **U003654171**

Estimated Emissions: 0.003202
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Name: FRANKLIN BUSINESS CENTER
Address: 20 CANAL ST
City,State,Zip: FRANKLIN, NH 03235
Facility Id: 3301300057
Operating Status: OPERATING-NPR
Year Of Record: 2020
Latitude/Longitude: 43.445893 / -71.645896
Sic Code: 6512
Naics: 531120
Emergency Contact: OLEG GORELIK
Contact Title: MANAGER
Tel Emiss: Not reported
Mailing Street: PO BOX 82
Mailing City: SHARON
Mailing State: MA
Mailing Zip Code: 02067
Contact Method Type: Not reported
Company Name: MASS. NVESTMENT GROUP

AIRS:
Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: CO
Estimated Emissions: 0.08005
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: NO2
Estimated Emissions: 0.3202
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: PM10
Estimated Emissions: 0.01601

FRANKLIN BUSINESS CENTER (Continued) **U003654171**

Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: PM2.5
Estimated Emissions: 0.003842
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: PT
Estimated Emissions: 0.03202
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: SO2
Estimated Emissions: 0.909368
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300057
Operating Status: No longer requires a permit
Year Of Record: 2005
Pollutant: VOC
Estimated Emissions: 0.003202
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

FRANKLIN BUSINESS CENTER (Continued) **U003654171**

ASBESTOS:

Name:	NORTH RIDGE CONTRACTING, INC
Address:	20 CANAL ST
City,State,Zip:	FRANKLIN, NH
ID Number:	NH104626
Pipes Reg Asb Containing Material:	Not reported
Surface Area RACM:	Not reported
Surface Area of Category 1:	Not reported
Surface Area of Category 2:	Not reported
Start Date:	10/11/2021
End Date:	10/22/2021
Record Date:	10/08/2021
Friable LF:	Not reported
Friable SqFt:	Not reported
Friable CY:	Not reported
NonFriable LF:	Not reported
NonFriable SqFt:	Not reported
NonFriable CY:	Not reported

NPDES:

Name:	FRANKLIN BUSINESS CTR.
Address:	20 CANAL ST.
City,State,Zip:	FRANKLIN, NH
Permit Number:	NH0000876
Mailing Address Line 1:	20 Canal St.
Mailing Address Line 2:	Not reported
Mailing Address Line 3:	Not reported
Mailing Address City,St,Zip:	Franklin, NH 03235
Contact Name:	Daniel Petrini
Contact Title:	Not reported
Contact Phone:	Not reported
Issuance Date:	Not reported
Expire Date:	Not reported
Facility Status:	Inactive
Facility Type:	Not reported
Receiving Strem:	Winnipesaukee River
Responsible Official:	Not reported
Responsible Official Title:	Not reported
Responsible Official Title 2:	Not reported
Responsible Official Address:	Not reported
Responsible Official Address 2:	Not reported
Responsible Official Address 3:	Not reported
Responsible Official City:	Not reported
Responsible Official State:	Not reported
Responsible Official Zip:	Not reported
Responsible Official Phone:	Not reported
Responsible Official Phone 2:	Not reported
Responsible Official Fax:	Not reported
Responsible Official Email:	Not reported
expr1023:	Not reported

B13 **R & D PAVING** **RCRA NonGen / NLR** **1015745712**
SSE **20 MEMORIAL ST** **NHD510208036**
< 1/8 **FRANKLIN, NH 03235**
0.044 mi.
231 ft. **Site 5 of 5 in cluster B**

Relative: **Higher**
Actual: **301 ft.**

RCRA NonGen / NLR:

Date Form Received by Agency:		20120507
Handler Name:	R & D PAVING	
Handler Address:		20 MEMORIAL ST
Handler City,State,Zip:		FRANKLIN, NH 03235
EPA ID:		NHD510208036
Contact Name:		DON DUBREUIL
Contact Address:		Not reported
Contact City,State,Zip:		Not reported
Contact Telephone:		603-934-6745
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		41 STERLING DR
Mailing City,State,Zip:		FRANKLIN, NH 03235
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		NN
Sub-Part K Indicator:		Not reported
Commercial TSD Indicator:		No
Treatment Storage and Disposal Type:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
Permit Renewals Workload Universe:		Not reported

R & D PAVING (Continued) **1015745712**

Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20130131
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	IGNITABLE WASTE

Historic Generators:

Receive Date:	20120109
Handler Name: R & D PAVING	
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20120109
Handler Name: R & D PAVING	
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No

R & D PAVING (Continued) **1015745712**

Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20120109
Handler Name: R & D PAVING	
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20120109
Handler Name: R & D PAVING	
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20120109
Handler Name: R & D PAVING	
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20120507
Handler Name: R & D PAVING	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported

R & D PAVING (Continued) **1015745712**

Electronic Manifest Broker:	Not reported
Receive Date:	20120507
Handler Name: R & D PAVING	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported
Receive Date:	20120507
Handler Name: R & D PAVING	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

C14 **CATCH NEIGHBORHOOD HOUSING** **RCRA NonGen / NLR** **1023968388**
WSW **100 MEMORIAL ST** **NHD510222227**
< 1/8 **FRANKLIN, NH 03235**
0.051 mi.
267 ft. **Site 3 of 4 in cluster C**

Relative: RCRA NonGen / NLR:
Lower

Date Form Received by Agency:	20170816
Handler Name:	CATCH NEIGHBORHOOD HOUSING
Handler Address:	100 MEMORIAL ST
Handler City,State,Zip:	FRANKLIN, NH 03235
EPA ID:	NHD510222227
Contact Name:	TOM FURTADO
Contact Address:	Not reported
Contact City,State,Zip:	Not reported
Contact Telephone:	603-225-8835
Contact Fax:	Not reported
Contact Email:	Not reported

Actual:
295 ft.

CATCH NEIGHBORHOOD HOUSING (Continued) **1023968388**

Contact Title:		Not reported
EPA Region:		01
Land Type:		Federal
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		76 SOUTH ST
Mailing City,State,Zip:		CONCORD, NH 03301
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site State-Reg Handler:		---
Federal Facility Indicator:		The land is federally-owned
Hazardous Secondary Material Indicator:		NN
Sub-Part K Indicator:		Not reported
Commercial TSD Indicator:		No
Treatment Storage and Disposal Type:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
Permit Renewals Workload Universe:		Not reported
Permit Workload Universe:		Not reported
Permit Progress Universe:		Not reported
Post-Closure Workload Universe:		Not reported
Closure Workload Universe:		Not reported
202 GPRA Corrective Action Baseline:		No
Corrective Action Workload Universe:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:		No
TSDFs Only Subject to CA under Discretionary Auth Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No
Institutional Control Indicator:		No
Human Exposure Controls Indicator:		N/A
Groundwater Controls Indicator:		N/A
Operating TSDF Universe:		Not reported

CATCH NEIGHBORHOOD HOUSING (Continued) **1023968388**

Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20170821
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	IGNITABLE WASTE

Historic Generators:

Receive Date:	20170615
Handler Name:	CATCH NEIGHBORHOOD HOUSING
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20170816
Handler Name:	CATCH NEIGHBORHOOD HOUSING
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:

NAICS Codes:	No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations:	No Violations Found

Evaluation Action Summary:

Evaluations:	No Evaluations Found

C15 **RIVERBEND MILL** **NH INST CONTROL** **S106425888**
WSW **100 MEMORIAL STREET** **NH ALLSITES** **N/A**
< 1/8 **FRANKLIN, NH**
0.051 mi.
267 ft. **Site 4 of 4 in cluster C**

Relative: **Lower**

Actual: **295 ft.**

Inst Control:

Name:	RIVERBEND MILL
Address:	100 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH
Facility ID:	200406004
Action Date:	03/30/2007
Action Description:	AUR RECORDED 1/18/07. BOOK 2957, PAGE 1296-1304.
Project Type:	OPUF
Project Management:	UNASSIGNED

ALLSITES:

Name:	RIVERBEND MILL
Address:	100 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH
Facility ID:	200406004
Project Type:	OPUF
Project Description:	ON-PREMISE USE FAC. CONTAINING FUEL OIL
Project Manager:	STRONDAK
Expiration Date:	Not reported

Name:	RIVERBEND MILL
Address:	100 MEMORIAL STREET
City,State,Zip:	FRANKLIN, NH
Facility ID:	200406004
Project Type:	NDW
Project Description:	NON DOMESTIC WASTEWATER
Project Manager:	CLOSED
Expiration Date:	Not reported

---

16 **PROFORMA PIPER PRINTING** **RCRA NonGen / NLR** **1012184283**
NE **102 E BOW ST** **NHD510201411**
< 1/8 **FRANKLIN, NH 03235**
0.055 mi.
290 ft.

Relative: **Higher**

Actual: **308 ft.**

RCRA NonGen / NLR:

Date Form Received by Agency:	20150702
Handler Name:	PROFORMA PIPER PRINTING
Handler Address:	102 E BOW ST
Handler City,State,Zip:	FRANKLIN, NH 03235
EPA ID:	NHD510201411
Contact Name:	CRAIG SHUFELT
Contact Address:	Not reported
Contact City,State,Zip:	Not reported
Contact Telephone:	603-934-5055
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	01
Land Type:	Private
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported

PROFORMA PIPER PRINTING (Continued) **1012184283**

Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		42 GILFORD EAST DR
Mailing City,State,Zip:		GILFORD, NH 03249
Owner Name:	DAVE BARBUTO TR	
Owner Type:		Private
Operator Name:	PROFORMA PIPER	
Operator Type:		Private
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		NN
Sub-Part K Indicator:		Not reported
Commercial TSD Indicator:		No
Treatment Storage and Disposal Type:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
Permit Renewals Workload Universe:		Not reported
Permit Workload Universe:		Not reported
Permit Progress Universe:		Not reported
Post-Closure Workload Universe:		Not reported
Closure Workload Universe:		Not reported
202 GPRA Corrective Action Baseline:		No
Corrective Action Workload Universe:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:		No
TSDFs Only Subject to CA under Discretionary Auth Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No
Institutional Control Indicator:		No
Human Exposure Controls Indicator:		N/A
Groundwater Controls Indicator:		N/A
Operating TSDF Universe:		Not reported
Full Enforcement Universe:		Not reported
Significant Non-Complier Universe:		No
Unaddressed Significant Non-Complier Universe:		No
Addressed Significant Non-Complier Universe:		No
Significant Non-Complier With a Compliance Schedule Universe:		No
Financial Assurance Required:		Not reported

PROFORMA PIPER PRINTING (Continued) **1012184283**

Handler Date of Last Change:	20151002
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	IGNITABLE WASTE
Waste Code:	D011
Waste Description:	SILVER
Waste Code:	D039
Waste Description:	TETRACHLOROETHYLENE

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name: PROFORMA PIPER	
Legal Status:	Private
Date Became Current:	20090615
Date Ended Current:	Not reported
Owner/Operator Address:	102 E BOW ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5055
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name: PROFORMA PIPER	
Legal Status:	Private
Date Became Current:	20090615
Date Ended Current:	Not reported
Owner/Operator Address:	102 E BOW ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5055
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name: DAVE BARBUTO TR	
Legal Status:	Private
Date Became Current:	20090615
Date Ended Current:	Not reported
Owner/Operator Address:	512 W MAIN ST
Owner/Operator City,State,Zip:	TILTON, NH 03276
Owner/Operator Telephone:	603-286-4845
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

PROFORMA PIPER PRINTING (Continued) **1012184283**

Owner/Operator Indicator: Owner
Owner/Operator Name: DAVE BARBUTO TR
Legal Status: Private
Date Became Current: 20090615
Date Ended Current: Not reported
Owner/Operator Address: 512 W MAIN ST
Owner/Operator City,State,Zip: TILTON, NH 03276
Owner/Operator Telephone: 603-286-4845
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: DAVE BARBUTO TRUST
Legal Status: Private
Date Became Current: 20090615
Date Ended Current: Not reported
Owner/Operator Address: 512 W MAIN ST
Owner/Operator City,State,Zip: TILTON, NH 03276
Owner/Operator Telephone: 603-286-4845
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: PROFORMA PIPER PRINTING
Legal Status: Private
Date Became Current: 20090615
Date Ended Current: Not reported
Owner/Operator Address: 102 E BOW ST
Owner/Operator City,State,Zip: FRANKLIN, NH 03235
Owner/Operator Telephone: 603-934-5055
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: PROFORMA PIPER
Legal Status: Private
Date Became Current: 20090615
Date Ended Current: Not reported
Owner/Operator Address: 102 E BOW ST
Owner/Operator City,State,Zip: FRANKLIN, NH 03235
Owner/Operator Telephone: 603-934-5055
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: DAVE BARBUTO TR
Legal Status: Private
Date Became Current: 20090615
Date Ended Current: Not reported
Owner/Operator Address: 512 W MAIN ST
Owner/Operator City,State,Zip: TILTON, NH 03276
Owner/Operator Telephone: 603-286-4845
Owner/Operator Telephone Ext: Not reported

PROFORMA PIPER PRINTING (Continued) **1012184283**

Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: DAVE BARBUTO TRUST
Legal Status: Private
Date Became Current: 20090615
Date Ended Current: Not reported
Owner/Operator Address: 512 W MAIN ST
Owner/Operator City,State,Zip: TILTON, NH 03276
Owner/Operator Telephone: 603-286-4845
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: PROFORMA PIPER
Legal Status: Private
Date Became Current: 20090615
Date Ended Current: Not reported
Owner/Operator Address: 102 E BOW ST
Owner/Operator City,State,Zip: FRANKLIN, NH 03235
Owner/Operator Telephone: 603-934-5055
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: DAVE BARBUTO TR
Legal Status: Private
Date Became Current: 20090615
Date Ended Current: Not reported
Owner/Operator Address: 512 W MAIN ST
Owner/Operator City,State,Zip: TILTON, NH 03276
Owner/Operator Telephone: 603-286-4845
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: PROFORMA PIPER PRINTING
Legal Status: Private
Date Became Current: 20090615
Date Ended Current: Not reported
Owner/Operator Address: 102 E BOW ST
Owner/Operator City,State,Zip: FRANKLIN, NH 03235
Owner/Operator Telephone: 603-934-5055
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20120525
Handler Name: PROFORMA PIPER PRINTING
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No

PROFORMA PIPER PRINTING (Continued) **1012184283**

Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20120525
Handler Name: PROFORMA PIPER PRINTING
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20120525
Handler Name: PROFORMA PIPER PRINTING
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150702
Handler Name: PROFORMA PIPER PRINTING
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20090622
Handler Name: PROFORMA PIPER PRINTING
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No

PROFORMA PIPER PRINTING (Continued) **1012184283**

Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20090622
Handler Name: PROFORMA PIPER PRINTING
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 32311
NAICS Description: PRINTING

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

D17 **FRANKLIN CITY OF** **RCRA NonGen / NLR** **1024090609**
SSE **316 CENTRAL ST** **FINDS** **NHD510223217**
< 1/8 **FRANKLIN, NH 03235**
0.093 mi.
491 ft. **Site 1 of 14 in cluster D**

Relative: Higher
Actual: 310 ft.

RCRA NonGen / NLR:
Date Form Received by Agency: 20180305
Handler Name: FRANKLIN CITY OF
Handler Address: 316 CENTRAL ST
Handler City,State,Zip: FRANKLIN, NH 03235
EPA ID: NHD510223217
Contact Name: DICK LEWIS
Contact Address: Not reported
Contact City,State,Zip: Not reported
Contact Telephone: 603-934-2341
Contact Fax: Not reported
Contact Email: Not reported
Contact Title: Not reported
EPA Region: 01
Land Type: Municipal
Federal Waste Generator Description: Not a generator, verified
Non-Notifier: Not reported
Biennial Report Cycle: Not reported
Accessibility: Not reported
Active Site Indicator: Not reported
State District Owner: Not reported
State District: Not reported
Mailing Address: 316 CENTRAL ST

FRANKLIN CITY OF (Continued) **1024090609**

Mailing City,State,Zip:		FRANKLIN, NH 03235
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		NN
Sub-Part K Indicator:		Not reported
Commercial TSD Indicator:		No
Treatment Storage and Disposal Type:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
Permit Renewals Workload Universe:		Not reported
Permit Workload Universe:		Not reported
Permit Progress Universe:		Not reported
Post-Closure Workload Universe:		Not reported
Closure Workload Universe:		Not reported
202 GPRA Corrective Action Baseline:		No
Corrective Action Workload Universe:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:		No
TSDFs Only Subject to CA under Discretionary Auth Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No
Institutional Control Indicator:		No
Human Exposure Controls Indicator:		N/A
Groundwater Controls Indicator:		N/A
Operating TSDF Universe:		Not reported
Full Enforcement Universe:		Not reported
Significant Non-Complier Universe:		No
Unaddressed Significant Non-Complier Universe:		No
Addressed Significant Non-Complier Universe:		No
Significant Non-Complier With a Compliance Schedule Universe:		No
Financial Assurance Required:		Not reported
Handler Date of Last Change:		20180709
Recognized Trader-Importer:		No
Recognized Trader-Exporter:		No
Importer of Spent Lead Acid Batteries:		No
Exporter of Spent Lead Acid Batteries:		No

FRANKLIN CITY OF (Continued) **1024090609**

Recycler Activity Without Storage: No
Manifest Broker: No
Sub-Part P Indicator: No

Hazardous Waste Summary:
Waste Code: D008
Waste Description: LEAD

Historic Generators:
Receive Date: 20171101
Handler Name: FRANKLIN CITY OF
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20180305
Handler Name: FRANKLIN CITY OF
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

FINDS:
Registry ID: 110070208426

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport,

FRANKLIN CITY OF (Continued) **1024090609**

and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

D18 **FRANKLIN CITY HALL** **NH UST** **U003133277**
SSE **316 CENTRAL ST** **N/A**
< 1/8 **FRANKLIN, NH**
0.093 mi.
491 ft. **Site 2 of 14 in cluster D**

Relative: **Higher**

Actual: **310 ft.**

UST:

Name:	FRANKLIN CITY HALL
Address:	316 CENTRAL ST
City:	FRANKLIN
Facility ID:	114933
Facility Type:	LOCAL GOVERNMENT
Site Number:	199610051
Owner Name:	CITY OF FRANKLIN
Owner Type:	STATE OR LOCAL GOVERNMENT
Owner Title:	Not reported
Owner Address:	316 CENTRAL ST
Owner Address2:	Not reported
Owner City,St,Zip:	FRANKLIN, NH 03235
Manager Name:	SCOTT CLARENBACH
Manager Title:	FIRE CHIEF
Tank ID:	1
Status:	INACTIVE
Capacity (gal):	3000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported

FRANKLIN CITY HALL (Continued) **U003133277**

CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	Not reported
Install Date:	11/11/1911
Last Test:	Not reported
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	08/20/1996
Tank Material:	STEEL - BARE/GALV
Closure Date:	08/27/1997
Tank Secondary:	NO
Product Stored:	#2 HEATING OIL
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	COPPER
Pipe System:	SUCTION: OLD CODE

D19 **PETER CHRISTENSEN** **NH ALLSITES** **S105771402**
SSE **336 CENTRAL STREET** **N/A**
< 1/8 **FRANKLIN, NH**
0.095 mi.
499 ft. **Site 3 of 14 in cluster D**

Relative: ALLSITES:
Higher

Name:	PETER CHRISTENSEN
Address:	336 CENTRAL STREET
City,State,Zip:	FRANKLIN, NH
Facility ID:	199708018
Project Type:	OPUF
Project Description:	ON-PREMISE USE FAC. CONTAINING FUEL OIL
Project Manager:	CLOSED
Expiration Date:	Not reported

Actual:
312 ft.

D20 **F M PIPER PRINTING LLC** **RCRA NonGen / NLR** **1004749085**
SSE **338 CENTRAL ST** **NHD500018676**
< 1/8 **FRANKLIN, NH 03235**
0.095 mi.
501 ft. **Site 4 of 14 in cluster D**

Relative: RCRA NonGen / NLR:
Higher

Date Form Received by Agency:		20090622
Handler Name:	F M PIPER PRINTING LLC	
Handler Address:		338 CENTRAL ST
Handler City,State,Zip:		FRANKLIN, NH 03235
EPA ID:		NHD500018676

Actual:
312 ft.

F M PIPER PRINTING LLC (Continued) **1004749085**

Contact Name:		CRAIG SHUFELT
Contact Address:		102 E BOW ST
Contact City,State,Zip:		FRANKLIN, NH 03235
Contact Telephone:		603-934-5055
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		102 E BOW ST
Mailing City,State,Zip:		FRANKLIN, NH 03235
Owner Name:	CENTRAL MEMORIAL LLC	
Owner Type:		Private
Operator Name:	FM PIPER PRINTING LLC	
Operator Type:		Private
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		NN
Sub-Part K Indicator:		Not reported
Commercial TSD Indicator:		No
Treatment Storage and Disposal Type:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
Permit Renewals Workload Universe:		Not reported
Permit Workload Universe:		Not reported
Permit Progress Universe:		Not reported
Post-Closure Workload Universe:		Not reported
Closure Workload Universe:		Not reported
202 GPRA Corrective Action Baseline:		No
Corrective Action Workload Universe:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:		No
TSDFs Only Subject to CA under Discretionary Auth Universe:		No

F M PIPER PRINTING LLC (Continued) **1004749085**

Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20101105
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	IGNITABLE WASTE
Waste Code:	D011
Waste Description:	SILVER
Waste Code:	D039
Waste Description:	TETRACHLOROETHYLENE

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name: FM PIPER PRINTING LLC	
Legal Status:	Private
Date Became Current:	20051216
Date Ended Current:	Not reported
Owner/Operator Address:	338 CENTRAL ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5055
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name: CENTRAL MEMORIAL LLC	
Legal Status:	Private
Date Became Current:	20051001
Date Ended Current:	Not reported
Owner/Operator Address:	PO BOX 487
Owner/Operator City,State,Zip:	DEDHAM, MA 02026
Owner/Operator Telephone:	617-290-1121
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

F M PIPER PRINTING LLC (Continued) **1004749085**

Owner/Operator Indicator:	Owner
Owner/Operator Name: DENNIS R AMES	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	338 CENTRAL ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5055
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: CENTRAL MEMORIAL LLC	
Legal Status:	Private
Date Became Current:	20051001
Date Ended Current:	Not reported
Owner/Operator Address:	PO BOX 487
Owner/Operator City,State,Zip:	DEDHAM, MA 02026
Owner/Operator Telephone:	617-290-1121
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name: FM PIPER PRINTING LLC	
Legal Status:	Private
Date Became Current:	20051216
Date Ended Current:	Not reported
Owner/Operator Address:	338 CENTRAL ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5055
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: CENTRAL MEMORIAL LLC	
Legal Status:	Private
Date Became Current:	20051001
Date Ended Current:	Not reported
Owner/Operator Address:	PO BOX 487
Owner/Operator City,State,Zip:	DEDHAM, MA 02026
Owner/Operator Telephone:	617-290-1121
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: SAMUEL SCHNIDER	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	336 CENTRAL ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-3032
Owner/Operator Telephone Ext:	Not reported

F M PIPER PRINTING LLC (Continued) **1004749085**

Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: FM PIPER PRINTING LLC
Legal Status: Private
Date Became Current: 20051216
Date Ended Current: Not reported
Owner/Operator Address: 338 CENTRAL ST
Owner/Operator City,State,Zip: FRANKLIN, NH 03235
Owner/Operator Telephone: 603-934-5055
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 19990306
Handler Name: F M PIPER PRINTING
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20090622
Handler Name: F M PIPER PRINTING LLC
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20090622
Handler Name: F M PIPER PRINTING LLC
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19970219
Handler Name: F M PIPER PRINTING

F M PIPER PRINTING LLC (Continued) **1004749085**

Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20051216
Handler Name:	F M PIPER PRINTING LLC
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:

NAICS Code:	32311
NAICS Description:	PRINTING

Facility Has Received Notices of Violations:

Violations:	No Violations Found

Evaluation Action Summary:

Evaluations:	No Evaluations Found

21
ESE
< 1/8
0.099 mi.
523 ft.

PROFILE ELECTRONICS
SMITH & CANAL STS
FRANKLIN, NH 03235

RCRA NonGen / NLR **1008883395**
NHD510053176

Relative:
Higher

Actual:
307 ft.

RCRA NonGen / NLR:

Date Form Received by Agency:		19990306
Handler Name:	PROFILE ELECTRONICS	
Handler Address:		SMITH & CANAL STS
Handler City,State,Zip:		FRANKLIN, NH 03235
EPA ID:		NHD510053176
Contact Name:		ALAN W WRIGHT
Contact Address:		SMITH & CANAL STS
Contact City,State,Zip:		FRANKLIN, NH 03235
Contact Telephone:		603-934-6880
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private

PROFILE ELECTRONICS (Continued) **1008883395**

Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		SMITH & CANAL STS
Mailing City,State,Zip:		FRANKLIN, NH 03235
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		NN
Sub-Part K Indicator:		Not reported
Commercial TSD Indicator:		No
Treatment Storage and Disposal Type:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
Permit Renewals Workload Universe:		Not reported
Permit Workload Universe:		Not reported
Permit Progress Universe:		Not reported
Post-Closure Workload Universe:		Not reported
Closure Workload Universe:		Not reported
202 GPRA Corrective Action Baseline:		No
Corrective Action Workload Universe:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:		No
TSDFs Only Subject to CA under Discretionary Auth Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No
Institutional Control Indicator:		No
Human Exposure Controls Indicator:		N/A
Groundwater Controls Indicator:		N/A
Operating TSDF Universe:		Not reported
Full Enforcement Universe:		Not reported
Significant Non-Complier Universe:		No
Unaddressed Significant Non-Complier Universe:		No

PROFILE ELECTRONICS (Continued) **1008883395**

Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20051020
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Historic Generators:

Receive Date:	19990306
Handler Name: PROFILE ELECTRONICS	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:

NAICS Codes:	No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations:	No Violations Found

Evaluation Action Summary:

Evaluations:	No Evaluations Found

D22 **FRANKLIN CLEANERS** **EDR Hist Cleaner** **1018931865**
SSE **333-335 CENTRAL ST** **N/A**
< 1/8 **FRANKLIN, NH 03235**
0.102 mi.
538 ft. **Site 5 of 14 in cluster D**

Relative: EDR Hist Cleaner
Higher

Actual: **314 ft.**

Year:	Name:	Type:
1969	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs
1970	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs
1971	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs
1972	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs
1973	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs
1974	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs
1975	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs
1976	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs
1977	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs
1978	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs

FRANKLIN CLEANERS (Continued) **1018931865**

1979	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs
1980	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs
1982	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs
1983	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs
1985	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs
1986	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs
1987	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs
1988	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs
1989	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs, NEC
1990	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs, NEC
1991	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs, NEC
1992	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs, NEC
1993	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs, NEC
1994	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs, NEC
1995	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs, NEC
1996	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs, NEC
1997	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs, NEC
1998	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs, NEC
1999	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs, NEC
2002	FRANKLIN CLEANERS	Drycleaning Plants, Except Rugs, NEC

D23 **CITY SIDE CLEANERS** **RCRA NonGen / NLR** **1000316845**
SSE **333 CENTRAL ST** **NH DRYCLEANERS** **NHD018912329**
< 1/8 **FRANKLIN, NH 03235** **RI MANIFEST**
0.102 mi.
538 ft. **Site 6 of 14 in cluster D**

Relative: **Higher**

Actual: **314 ft.**

RCRA NonGen / NLR:

Date Form Received by Agency:		20050304
Handler Name:	CITY SIDE CLEANERS	
Handler Address:		333 CENTRAL ST
Handler City,State,Zip:		FRANKLIN, NH 03235-1614
EPA ID:		NHD018912329
Contact Name:		CAMERON PRATT
Contact Address:		333 CENTRAL ST
Contact City,State,Zip:		FRANKLIN, NH 03235-1614
Contact Telephone:		603-934-4241
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		333 CENTRAL ST
Mailing City,State,Zip:		FRANKLIN, NH 03235-1614
Owner Name:	CAMERONPRATT	
Owner Type:		Private
Operator Name:	CAMERONPRATT	
Operator Type:		Private
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No

CITY SIDE CLEANERS (Continued) **1000316845**

Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20051020
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	F002
Waste Description:	THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE,

CITY SIDE CLEANERS (Continued) **1000316845**

METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name: CAMERONPRATT	
Legal Status:	Private
Date Became Current:	20031110
Date Ended Current:	Not reported
Owner/Operator Address:	159 RUMFORD ST
Owner/Operator City,State,Zip:	CONCORD, NH 03301
Owner/Operator Telephone:	603-229-0639
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: OWNERNAME	
Legal Status:	Other
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	OWNERSTREET
Owner/Operator City,State,Zip:	OWNERCITY, NH 99999
Owner/Operator Telephone:	603-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name: CAMERON PRATT	
Legal Status:	Private
Date Became Current:	20031110
Date Ended Current:	Not reported
Owner/Operator Address:	159 RUMFORD ST
Owner/Operator City,State,Zip:	CONCORD, NH 03301
Owner/Operator Telephone:	603-229-0639
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: OWNERNAME	
Legal Status:	Other
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	OWNERSTREET
Owner/Operator City,State,Zip:	OWNERCITY, NH 99999
Owner/Operator Telephone:	603-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

CITY SIDE CLEANERS (Continued) **1000316845**

Owner/Operator Indicator:	Owner
Owner/Operator Name: OWNERNAME	
Legal Status:	Other
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	OWNERSTREET
Owner/Operator City,State,Zip:	OWNERCITY, NH 99999
Owner/Operator Telephone:	603-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: CAMERON PRATT	
Legal Status:	Private
Date Became Current:	20031110
Date Ended Current:	Not reported
Owner/Operator Address:	159 RUMFORD ST
Owner/Operator City,State,Zip:	CONCORD, NH 03301
Owner/Operator Telephone:	603-229-0639
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: CAMERONPRATT	
Legal Status:	Private
Date Became Current:	20031110
Date Ended Current:	Not reported
Owner/Operator Address:	159 RUMFORD ST
Owner/Operator City,State,Zip:	CONCORD, NH 03301
Owner/Operator Telephone:	603-229-0639
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	20030114
Handler Name: FRANKLIN CLEANERS	
Federal Waste Generator Description:	Not reported
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20030310
Handler Name: FRANKLIN CLEANERS	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No

CITY SIDE CLEANERS (Continued) **1000316845**

Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20050304
Handler Name: CITY SIDE CLEANERS
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19840117
Handler Name: FRANKLIN CLEANERS
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20031113
Handler Name: CITY SIDE CLEANERS
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20000412
Handler Name: FRANKLIN CLEANERS
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

CITY SIDE CLEANERS (Continued) **1000316845**

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violation:
Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: Generators - Pre-transport
Date Violation was Determined: 20031029
Actual Return to Compliance Date: 20031113
Return to Compliance Qualifier: Observed
Violation Responsible Agency: State
Scheduled Compliance Date: 20031129
Enforcement Identifier: 001
Date of Enforcement Action: 20031029
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No

CITY SIDE CLEANERS (Continued) **1000316845**

Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FIELD NOTICE OF VIOLATION
Enforcement Responsible Person:	CFWNH
Enforcement Responsible Sub-Organization:	SI
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported

Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Generators - Pre-transport
Date Violation was Determined:	20031029
Actual Return to Compliance Date:	20031113
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	20031129
Enforcement Identifier:	001
Date of Enforcement Action:	20031029
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FIELD NOTICE OF VIOLATION
Enforcement Responsible Person:	CFWNH
Enforcement Responsible Sub-Organization:	SI
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported

CITY SIDE CLEANERS (Continued) **1000316845**

Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: Generators - General
Date Violation was Determined: 20031029
Actual Return to Compliance Date: 20031113
Return to Compliance Qualifier: Observed
Violation Responsible Agency: State
Scheduled Compliance Date: 20031129
Enforcement Identifier: 001
Date of Enforcement Action: 20031029
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number:Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: FIELD NOTICE OF VIOLATION
Enforcement Responsible Person: CFWNH
Enforcement Responsible Sub-Organization: SI
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:
Evaluation Date: 20031113
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE SCHEDULE EVALUATION
Evaluation Responsible Person Identifier: CFWNH
Evaluation Responsible Sub-Organization: SI
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

CITY SIDE CLEANERS (Continued) **1000316845**

Evaluation Date:	20031029
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	CFWNH
Evaluation Responsible Sub-Organization:	SI
Actual Return to Compliance Date:	20031113
Scheduled Compliance Date:	20031129
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Evaluation Date:	20031029
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	CFWNH
Evaluation Responsible Sub-Organization:	SI
Actual Return to Compliance Date:	20031113
Scheduled Compliance Date:	20031129
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Evaluation Date:	20031029
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	CFWNH
Evaluation Responsible Sub-Organization:	SI
Actual Return to Compliance Date:	20031113
Scheduled Compliance Date:	20031129
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

DRYCLEANERS:

Name:	FRANKLIN CLEANERS CITY SIDE CLEANERS
Address:	333 CENTRAL ST
City,State,Zip:	FRANKLIN, NH
Facility ID:	44893
Program:	Hazardous Waste Generator Hazardous Waste Generator
Primary ID:	EPA Id: NHD018912329 EPA Id: NHD018912329
Secondary ID:	Handler Id: 0012425 Handler Id: 0017141

RI MANIFEST:

Name:	CITY SIDE CLEANERS
Address:	333 CENTRAL ST
City,State,Zip:	FRANKLIN, NH 03235
EPA Id:	NHD018912329
GEN Cert Date:	4/22/2004
Manifest Document Number:	RIG0213233

CITY SIDE CLEANERS (Continued) **1000316845**

Waste Description:	RQ WASTE TETRACHLOROETHYLENE
TSDF Id:	RID084802842
TSDF Name:	United Oil Recovery Inc
Qty:	300
WT/Vol Units:	P
TSDF Date:	4/22/2004
Transporter 2 Id:	Not reported
Item Number:	17648
Transporter 2 Name:	Not reported
Transporter Name 2:	CYCLE SOLVE CORPORATION
Transporter EPAID:	RID982194987
Transporter Receipt Date:	4/22/2004
Number Of Containers:	2
Container Type:	DF
Waste Code1:	F002
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Fee Exempt Code:	Not reported
Comment:	Not reported
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
Quarter:	Not reported
Transporter Contact Name:	Not reported
Transporter Contact Email:	Not reported
Filing Date:	Not reported
Total Fee:	Not reported
Billing Name:	Not reported
Paid Date:	Not reported
Paid Time:	Not reported
Facility Receipt Date:	Not reported
Fee:	Not reported
Manifest Created Date:	Not reported
Manifest Updated Date:	Not reported

RI MANIFEST:

Transporter Receipt Date:	4/22/2004
Number Of Containers:	2
Container Type:	DF
Waste Code1:	F002
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	United Oil Recovery Inc
TSDF Id:	RID084802842
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD018912329
Manifest Docket Number:	RIG0213233
Quarter:	Not reported

CITY SIDE CLEANERS (Continued) **1000316845**

Waste Description:	RQ WASTE TETRACHLOROETHYLENE
Transporter Contact Name:	Not reported
Quantity:	300
Transporter Contact Email:	Not reported
WT/Vol Units:	P
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	15666
Transporter Name:	CYCLE SOLVE CORPORATION
Billing Name:	Not reported
Transporter EPA ID:	RID982194987
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	4/22/2004
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	4/22/2004
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	4/22/2004
Number Of Containers:	2
Container Type:	DF
Waste Code1:	F002
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	United Oil Recovery Inc
TSDF Id:	RID084802842
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD018912329
Manifest Docket Number:	RIG0213233
Quarter:	Not reported
Waste Description:	RQ WASTE TETRACHLOROETHYLENE
Transporter Contact Name:	Not reported
Quantity:	300
Transporter Contact Email:	Not reported
WT/Vol Units:	P
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	a
Transporter Name:	CYCLE SOLVE CORPORATION
Billing Name:	Not reported
Transporter EPA ID:	RID982194987
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	4/22/2004
Facility Receipt Date:	Not reported
Fee:	Not reported

CITY SIDE CLEANERS (Continued) **1000316845**

Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	4/22/2004
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	4/22/2004
Number Of Containers:	2
Container Type:	DF
Waste Code1:	F002
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	United Oil Recovery Inc
TSDF Id:	RID084802842
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD018912329
Manifest Docket Number:	RIG0213233
Quarter:	Not reported
Waste Description:	RQ WASTE TETRACHLOROETHYLENE
Transporter Contact Name:	Not reported
Quantity:	300
Transporter Contact Email:	Not reported
WT/Vol Units:	P
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	17648
Transporter Name:	CYCLE SOLVE CORPORATION
Billing Name:	Not reported
Transporter EPA ID:	RID982194987
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	4/22/2004
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	4/22/2004
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	4/22/2004
Number Of Containers:	2
Container Type:	DF
Waste Code1:	F002
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported

CITY SIDE CLEANERS (Continued) **1000316845**

Fee Exempt Code:	Not reported
TSDF Name:	United Oil Recovery Inc
TSDF Id:	RID084802842
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD018912329
Manifest Docket Number:	RIG0213233
Quarter:	Not reported
Waste Description:	RQ WASTE TETRACHLOROETHYLENE
Transporter Contact Name:	Not reported
Quantity:	300
Transporter Contact Email:	Not reported
WT/Vol Units:	P
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	3265
Transporter Name:	CYCLE SOLVE CORPORATION
Billing Name:	Not reported
Transporter EPA ID:	RID982194987
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	4/22/2004
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	4/22/2004
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	4/22/2004
Number Of Containers:	2
Container Type:	DF
Waste Code1:	F002
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	United Oil Recovery Inc
TSDF Id:	RID084802842
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD018912329
Manifest Docket Number:	RIG0213233
Quarter:	Not reported
Waste Description:	RQ WASTE TETRACHLOROETHYLENE
Transporter Contact Name:	Not reported
Quantity:	300
Transporter Contact Email:	Not reported
WT/Vol Units:	P
Filing Date:	Not reported
Total Fee:	Not reported

CITY SIDE CLEANERS (Continued) **1000316845**

Item Number:	15666
Transporter Name:	CYCLE SOLVE CORPORATION
Billing Name:	Not reported
Transporter EPA ID:	RID982194987
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	4/22/2004
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	4/22/2004
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	4/22/2004
Number Of Containers:	2
Container Type:	DF
Waste Code1:	F002
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	United Oil Recovery Inc
TSDF Id:	RID084802842
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD018912329
Manifest Docket Number:	RIG0213233
Quarter:	Not reported
Waste Description:	RQ WASTE TETRACHLOROETHYLENE
Transporter Contact Name:	Not reported
Quantity:	300
Transporter Contact Email:	Not reported
WT/Vol Units:	P
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	a
Transporter Name:	CYCLE SOLVE CORPORATION
Billing Name:	Not reported
Transporter EPA ID:	RID982194987
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	4/22/2004
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	4/22/2004
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	11/1/2004

CITY SIDE CLEANERS (Continued) **1000316845**

Number Of Containers:	3
Container Type:	DF
Waste Code1:	F002
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	United Oil Recovery Inc
TSDF Id:	RID084802842
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD018912329
Manifest Docket Number:	RIG0211720
Quarter:	Not reported
Waste Description:	RQ WASTE TETRACHLOROETHYLENE
Transporter Contact Name:	Not reported
Quantity:	450
Transporter Contact Email:	Not reported
WT/Vol Units:	P
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	22249
Transporter Name:	CYCLE SOLVE CORPORATION
Billing Name:	Not reported
Transporter EPA ID:	RID982194987
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	11/1/2004
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	11/1/2004
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	4/22/2004
Number Of Containers:	2
Container Type:	DF
Waste Code1:	F002
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	United Oil Recovery Inc
TSDF Id:	RID084802842
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD018912329

CITY SIDE CLEANERS (Continued) **1000316845**

Manifest Docket Number:	RIG0213233
Quarter:	Not reported
Waste Description:	RQ WASTE TETRACHLOROETHYLENE
Transporter Contact Name:	Not reported
Quantity:	300
Transporter Contact Email:	Not reported
WT/Vol Units:	P
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	3265
Transporter Name:	CYCLE SOLVE CORPORATION
Billing Name:	Not reported
Transporter EPA ID:	RID982194987
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	4/22/2004
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	4/22/2004
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	11/1/2004
Number Of Containers:	3
Container Type:	DF
Waste Code1:	F002
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	United Oil Recovery Inc
TSDF Id:	RID084802842
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD018912329
Manifest Docket Number:	RIG0211720
Quarter:	Not reported
Waste Description:	RQ WASTE TETRACHLOROETHYLENE
Transporter Contact Name:	Not reported
Quantity:	450
Transporter Contact Email:	Not reported
WT/Vol Units:	P
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	23680
Transporter Name:	CYCLE SOLVE CORPORATION
Billing Name:	Not reported
Transporter EPA ID:	RID982194987
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	11/1/2004

CITY SIDE CLEANERS (Continued) **1000316845**

Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	11/1/2004
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	11/1/2004
Number Of Containers:	3
Container Type:	DF
Waste Code1:	F002
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	United Oil Recovery Inc
TSDF Id:	RID084802842
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD018912329
Manifest Docket Number:	RIG0211720
Quarter:	Not reported
Waste Description:	RQ WASTE TETRACHLOROETHYLENE
Transporter Contact Name:	Not reported
Quantity:	450
Transporter Contact Email:	Not reported
WT/Vol Units:	P
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	a
Transporter Name:	CYCLE SOLVE CORPORATION
Billing Name:	Not reported
Transporter EPA ID:	RID982194987
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	11/1/2004
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	11/1/2004
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	11/1/2004
Number Of Containers:	3
Container Type:	DF
Waste Code1:	F002
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported

CITY SIDE CLEANERS (Continued) **1000316845**

Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	United Oil Recovery Inc
TSDF Id:	RID084802842
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD018912329
Manifest Docket Number:	RIG0211720
Quarter:	Not reported
Waste Description:	RQ WASTE TETRACHLOROETHYLENE
Transporter Contact Name:	Not reported
Quantity:	450
Transporter Contact Email:	Not reported
WT/Vol Units:	P
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	22249
Transporter Name:	CYCLE SOLVE CORPORATION
Billing Name:	Not reported
Transporter EPA ID:	RID982194987
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	11/1/2004
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	11/1/2004
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported

Click this hyperlink while viewing on your computer to access
4 additional RI_MANIFEST: record(s) in the EDR Site Report.

D24 **COLPITTS GREGORY DMD** **RCRA NonGen / NLR** **1008890749**
SE **378 CENTRAL ST** **NHD510178718**
< 1/8 **FRANKLIN, NH 03235**
0.103 mi.
544 ft. **Site 7 of 14 in cluster D**

Relative: RCRA NonGen / NLR:
Higher

Actual:
312 ft.

Date Form Received by Agency:		20100326
Handler Name:	COLPITTS GREGORY DMD	
Handler Address:		378 CENTRAL ST
Handler City,State,Zip:		FRANKLIN, NH 03235
EPA ID:		NHD510178718
Contact Name:		GREGORY COLPITTS
Contact Address:		378 CENTRAL ST
Contact City,State,Zip:		FRANKLIN, NH 03235
Contact Telephone:		603-934-4014
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private

COLPITTS GREGORY DMD (Continued) **1008890749**

Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		378 CENTRAL ST
Mailing City,State,Zip:		FRANKLIN, NH 03235
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		NN
Sub-Part K Indicator:		Not reported
Commercial TSD Indicator:		No
Treatment Storage and Disposal Type:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
Permit Renewals Workload Universe:		Not reported
Permit Workload Universe:		Not reported
Permit Progress Universe:		Not reported
Post-Closure Workload Universe:		Not reported
Closure Workload Universe:		Not reported
202 GPRA Corrective Action Baseline:		No
Corrective Action Workload Universe:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:		No
TSDFs Only Subject to CA under Discretionary Auth Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No
Institutional Control Indicator:		No
Human Exposure Controls Indicator:		N/A
Groundwater Controls Indicator:		N/A
Operating TSDF Universe:		Not reported
Full Enforcement Universe:		Not reported
Significant Non-Complier Universe:		No
Unaddressed Significant Non-Complier Universe:		No

COLPITTS GREGORY DMD (Continued) **1008890749**

Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20101108
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Historic Generators:

Receive Date:	20030311
Handler Name: COLPITTS GREGORY DMD	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20100326
Handler Name: COLPITTS GREGORY DMD	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20100326
Handler Name: COLPITTS GREGORY DMD	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:

NAICS Codes:	No NAICS Codes Found

COLPITTS GREGORY DMD (Continued) **1008890749**

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

D25 **C N BROWN CO** **RCRA NonGen / NLR** **1008884188**
South **298 CENTRAL ST** **NHD510064223**
< 1/8 **FRANKLIN, NH 03235**
0.103 mi.
546 ft. **Site 8 of 14 in cluster D**

Relative: **Higher**
Actual: **301 ft.**

RCRA NonGen / NLR:

Date Form Received by Agency:		19990306
Handler Name:	C N BROWN CO	
Handler Address:		298 CENTRAL ST
Handler City,State,Zip:		FRANKLIN, NH 03235
EPA ID:		NHD510064223
Contact Name:		LEV PARKER
Contact Address:		ADG 298 CENTRAL ST
Contact City,State,Zip:		FRANKLIN, NH 03235
Contact Telephone:		207-743-9212
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		ADG 298 CENTRAL ST
Mailing City,State,Zip:		FRANKLIN, NH 03235
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported

C N BROWN CO (Continued) **1008884188**

Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20051020
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Historic Generators:

Receive Date:	19990306
Handler Name: C N BROWN CO	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:

C N BROWN CO (Continued) **1008884188**

NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

D26 **FRANKLIN BUSINESS&IND DEV CORP** **RCRA NonGen / NLR** **1008882815**
SE **380 CENTRAL ST** **NY MANIFEST** **NHD510001951**
< 1/8 **FRANKLIN, NH 03235**
0.104 mi.
547 ft. **Site 9 of 14 in cluster D**

Relative:
Higher

Actual:
312 ft.

RCRA NonGen / NLR:

Date Form Received by Agency:		19990306
Handler Name:	FRANKLIN BUSINESS&IND DEV CORP	
Handler Address:		380 CENTRAL ST
Handler City,State,Zip:		FRANKLIN, NH 03235
EPA ID:		NHD510001951
Contact Name:		RAMONA GOUTIERE
Contact Address:		PO BOX 174
Contact City,State,Zip:		FRANKLIN, NH 03235
Contact Telephone:		603-934-5508
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		PO BOX 174
Mailing City,State,Zip:		FRANKLIN, NH 03235
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported

FRANKLIN BUSINESS&IND DEV CORP (Continued) **1008882815**

Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20051020
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Historic Generators:

Receive Date:	19990306
Handler Name:	FRANKLIN BUSINESS&IND DEV CORP
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

FRANKLIN BUSINESS&IND DEV CORP (Continued) **1008882815**

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

NY MANIFEST:

Name:	FRANKLIN BUSINESS & INDUSTRIAL DEV
Address:	380 CENTRAL ST
City,State,Zip:	FRANKLIN, NH 03235
Country:	USA
EPA ID:	NHD510001951
Facility Status:	Not reported
Location Address 1:	380 CENTRAL ST
Code:	BP
Location Address 2:	Not reported
Total Tanks:	Not reported
Location City:	FRANKLIN
Location State:	NH
Location Zip:	Not reported
Location Zip 4:	Not reported

NY MANIFEST:

EPAID:	NHD510001951
Mailing Name:	FRANKLIN BUSINESS & INDUSTRIAL DEV
Mailing Contact:	RAMONE GOUTIER
Mailing Address 1:	380 CENTRAL ST
Mailing Address 2:	Not reported
Mailing City:	FRANKLIN
Mailing State:	NH
Mailing Zip:	03235
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	6039345508

D27 **REGAL AUCTION** **RCRA NonGen / NLR** **1008882976**
SE **349 CENTRAL ST** **NHD510006547**
< 1/8 **FRANKLIN, NH 03235**
0.104 mi.
548 ft. **Site 10 of 14 in cluster D**

Relative:
Higher

Actual:
314 ft.

RCRA NonGen / NLR:

Date Form Received by Agency:		19990306
Handler Name:	REGAL AUCTION	
Handler Address:		349 CENTRAL ST
Handler City,State,Zip:		FRANKLIN, NH 03235
EPA ID:		NHD510006547
Contact Name:		PAUL MORRISSETTE
Contact Address:		349 CENTRAL ST
Contact City,State,Zip:		FRANKLIN, NH 03235
Contact Telephone:		603-934-5410

REGAL AUCTION (Continued) **1008882976**

Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		349 CENTRAL ST
Mailing City,State,Zip:		FRANKLIN, NH 03235
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		NN
Sub-Part K Indicator:		Not reported
Commercial TSD Indicator:		No
Treatment Storage and Disposal Type:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
Permit Renewals Workload Universe:		Not reported
Permit Workload Universe:		Not reported
Permit Progress Universe:		Not reported
Post-Closure Workload Universe:		Not reported
Closure Workload Universe:		Not reported
202 GPRA Corrective Action Baseline:		No
Corrective Action Workload Universe:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:		No
TSDFs Only Subject to CA under Discretionary Auth Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No
Institutional Control Indicator:		No
Human Exposure Controls Indicator:		N/A

REGAL AUCTION (Continued) **1008882976**

Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20051020
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Historic Generators:

Receive Date:	19990306
Handler Name: REGAL AUCTION	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:

NAICS Codes:	No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations:	No Violations Found

Evaluation Action Summary:

Evaluations:	No Evaluations Found

D28 **REGAL AUCTION SERVICES** **NH UST** **U001150953**
SE **349 CENTRAL ST** **N/A**
< 1/8 **FRANKLIN, NH**
0.104 mi.
548 ft. **Site 11 of 14 in cluster D**

Relative: **Higher**
Actual: **314 ft.**

UST:

Name:	REGAL AUCTION SERVICES
Address:	349 CENTRAL ST
City:	FRANKLIN
Facility ID:	113592
Facility Type:	COMMERCIAL
Site Number:	198605479
Owner Name:	PAUL MORRISSETTE

REGAL AUCTION SERVICES (Continued) **U001150953**

Owner Type:	COMMERCIAL/RESIDENTIAL
Owner Title:	Not reported
Owner Address:	349 CENTRAL ST
Owner Address2:	Not reported
Owner City,St,Zip:	FRANKLIN, NH 03235
Manager Name:	PAUL MORRISSETTE
Manager Title:	OWNER
Tank ID:	1
Status:	INACTIVE
Capacity (gal):	1000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	Not reported
Install Date:	11/11/1911
Last Test:	Not reported
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	09/03/1998

REGAL AUCTION SERVICES (Continued) **U001150953**

Tank Material:	STEEL - BARE/GALV
Closure Date:	09/24/1998
Tank Secondary:	NO
Product Stored:	#2 HEATING OIL
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	UNKNOWN
Pipe System:	Not reported

D29 **JJ NEWBERRY #6146** **NH UST** **U001557370**
SE **384 CENTRAL ST** **N/A**
< 1/8 **FRANKLIN, NH**
0.105 mi.
553 ft. **Site 12 of 14 in cluster D**

Relative:
Higher

Actual:
312 ft.

UST:

Name:	JJ NEWBERRY #6146
Address:	384 CENTRAL ST
City:	FRANKLIN
Facility ID:	113615
Facility Type:	COMMERCIAL
Site Number:	198605485
Owner Name:	FBIDC FRANKLIN BUSINESS IDC
Owner Type:	COMMERCIAL/RESIDENTIAL
Owner Title:	Not reported
Owner Address:	PO BOX 174
Owner Address2:	Not reported
Owner City,St,Zip:	FRANKLIN, NH 03235
Manager Name:	RAMONA GOUTIERE
Manager Title:	EXECUTIVE DIR.
Tank ID:	1
Status:	INACTIVE
Capacity (gal):	2000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported

JJ NEWBERRY #6146 (Continued) **U001557370**

CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	10/15/1987
Piping Tightness Test Pass Fail:	PASS
Piping Material Comments:	Not reported
Install Date:	01/01/1966
Last Test:	10/15/1987
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	06/13/1997
Tank Material:	STEEL - BARE/GALV
Closure Date:	07/10/1997
Tank Secondary:	NO
Product Stored:	#2 HEATING OIL
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	COPPER
Pipe System:	SUCTION: OLD CODE

E30 **ACCESS DENTAL** **RCRA NonGen / NLR** **1014394319**
SE **398 CENTRAL ST** **NHD510202567**
< 1/8 **FRANKLIN, NH 03235**
0.109 mi.
577 ft. **Site 1 of 2 in cluster E**

Relative: **Higher**

Actual: **313 ft.**

RCRA NonGen / NLR:

Date Form Received by Agency:		20100817
Handler Name:	ACCESS DENTAL	
Handler Address:		398 CENTRAL ST
Handler City,State,Zip:		FRANKLIN, NH 03235
EPA ID:		NHD510202567
Contact Name:		GREGORY COLPITTS
Contact Address:		398 CENTRAL ST
Contact City,State,Zip:		FRANKLIN, NH 03235
Contact Telephone:		603-934-4014
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported

ACCESS DENTAL (Continued) **1014394319**

State District:		Not reported
Mailing Address:		398 CENTRAL ST
Mailing City,State,Zip:		FRANKLIN, NH 03235
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		NN
Sub-Part K Indicator:		Not reported
Commercial TSD Indicator:		No
Treatment Storage and Disposal Type:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
Permit Renewals Workload Universe:		Not reported
Permit Workload Universe:		Not reported
Permit Progress Universe:		Not reported
Post-Closure Workload Universe:		Not reported
Closure Workload Universe:		Not reported
202 GPRA Corrective Action Baseline:		No
Corrective Action Workload Universe:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:		No
TSDFs Only Subject to CA under Discretionary Auth Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No
Institutional Control Indicator:		No
Human Exposure Controls Indicator:		N/A
Groundwater Controls Indicator:		N/A
Operating TSDF Universe:		Not reported
Full Enforcement Universe:		Not reported
Significant Non-Complier Universe:		No
Unaddressed Significant Non-Complier Universe:		No
Addressed Significant Non-Complier Universe:		No
Significant Non-Complier With a Compliance Schedule Universe:		No
Financial Assurance Required:		Not reported
Handler Date of Last Change:		20101108
Recognized Trader-Importer:		No
Recognized Trader-Exporter:		No

ACCESS DENTAL (Continued) **1014394319**

Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Historic Generators:

Receive Date:	20100617
Handler Name: ACCESS DENTAL	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20100817
Handler Name: ACCESS DENTAL	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20100617
Handler Name: ACCESS DENTAL	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20100817
Handler Name: ACCESS DENTAL	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes

ACCESS DENTAL (Continued) **1014394319**

Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20100326
Handler Name: ACCESS DENTAL
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20100326
Handler Name: ACCESS DENTAL
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 62121
NAICS Description: OFFICES OF DENTISTS

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

D31 **FRANKLIN SAVINGS BANK** **RCRA NonGen / NLR** **1008884481**
SE **387 CENTRAL ST** **NHD510068190**
< 1/8 **FRANKLIN, NH 03235**
0.112 mi.
592 ft. **Site 13 of 14 in cluster D**

Relative:
Higher

Actual:
314 ft.

RCRA NonGen / NLR:
Date Form Received by Agency: 19990306
Handler Name: FRANKLIN SAVINGS BANK
Handler Address: 387 CENTRAL ST
Handler City,State,Zip: FRANKLIN, NH 03235
EPA ID: NHD510068190
Contact Name: FRED COOK MAINTENANCE SUP
Contact Address: 387 CENTRAL ST
Contact City,State,Zip: FRANKLIN, NH 03235
Contact Telephone: 603-934-4445

FRANKLIN SAVINGS BANK (Continued) **1008884481**

Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		387 CENTRAL ST
Mailing City,State,Zip:		FRANKLIN, NH 03235
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		NN
Sub-Part K Indicator:		Not reported
Commercial TSD Indicator:		No
Treatment Storage and Disposal Type:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
Permit Renewals Workload Universe:		Not reported
Permit Workload Universe:		Not reported
Permit Progress Universe:		Not reported
Post-Closure Workload Universe:		Not reported
Closure Workload Universe:		Not reported
202 GPRA Corrective Action Baseline:		No
Corrective Action Workload Universe:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:		No
TSDFs Only Subject to CA under Discretionary Auth Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No
Institutional Control Indicator:		No
Human Exposure Controls Indicator:		N/A

FRANKLIN SAVINGS BANK (Continued) **1008884481**

Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20051020
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Historic Generators:

Receive Date:	19990306
Handler Name: FRANKLIN SAVINGS BANK	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:

NAICS Codes:	No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations:	No Violations Found

Evaluation Action Summary:

Evaluations:	No Evaluations Found

D32 **BAPTIST CHURCH OF FRANKLIN** **RCRA NonGen / NLR** **1018158375**
SSE **21 CHURCH ST** **FINDS** **NHD510217623**
< 1/8 **FRANKLIN, NH 03235** **ECHO**
0.122 mi.
643 ft. **Site 14 of 14 in cluster D**

Relative:
Higher

Actual:
320 ft.

RCRA NonGen / NLR:

Date Form Received by Agency:	20160204
Handler Name:	BAPTIST CHURCH OF FRANKLIN
Handler Address:	21 CHURCH ST
Handler City,State,Zip:	FRANKLIN, NH 03235
EPA ID:	NHD510217623
Contact Name:	BETTY POITRAS
Contact Address:	Not reported

BAPTIST CHURCH OF FRANKLIN (Continued) **1018158375**

Contact City,State,Zip:		Not reported
Contact Telephone:		603-393-7757
Contact Fax:		Not reported
Contact Email:		GRAMMIEBOOP5@YAHOO.COM
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		21 CHURCH ST
Mailing City,State,Zip:		FRANKLIN, NH 03235
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		NN
Sub-Part K Indicator:		Not reported
Commercial TSD Indicator:		No
Treatment Storage and Disposal Type:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
Permit Renewals Workload Universe:		Not reported
Permit Workload Universe:		Not reported
Permit Progress Universe:		Not reported
Post-Closure Workload Universe:		Not reported
Closure Workload Universe:		Not reported
202 GPRA Corrective Action Baseline:		No
Corrective Action Workload Universe:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:		No
TSDFs Only Subject to CA under Discretionary Auth Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No

BAPTIST CHURCH OF FRANKLIN (Continued) **1018158375**

Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20160212
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	IGNITABLE WASTE
Waste Code:	D002
Waste Description:	CORROSIVE WASTE
Waste Code:	D008
Waste Description:	LEAD

Historic Generators:

Receive Date:	20150717
Handler Name:	BAPTIST CHURCH OF FRANKLIN
Federal Waste Generator Description:	Small Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20150915
Handler Name:	BAPTIST CHURCH OF FRANKLIN
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

BAPTIST CHURCH OF FRANKLIN (Continued) **1018158375**

Receive Date: 20151120
Handler Name: BAPTIST CHURCH OF FRANKLIN
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20160204
Handler Name: BAPTIST CHURCH OF FRANKLIN
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

FINDS:
Registry ID: 110066977515

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1018158375
Registry ID: 110066977515
DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110066977515

BAPTIST CHURCH OF FRANKLIN (Continued) **1018158375**

Name: BAPTIST CHURCH OF FRANKLIN
Address: 21 CHURCH ST
City,State,Zip: FRANKLIN, NH 03235

---

33 **FRANKLIN SAVINGS BANK** **NH UST** **U001557076**
South **287 CENTRAL STREET** **N/A**
< 1/8 **FRANKLIN, NH**
0.122 mi.
643 ft.

Relative:
Higher

Actual:
303 ft.

UST:

Name:	FRANKLIN SAVINGS BANK
Address:	287 CENTRAL STREET
City:	FRANKLIN
Facility ID:	113043
Facility Type:	CONTRACTOR
Site Number:	198605458
Owner Name:	FRANKLIN SAVINGS BANK
Owner Type:	COMMERCIAL/RESIDENTIAL
Owner Title:	Not reported
Owner Address:	287 CENTRAL STREET
Owner Address2:	Not reported
Owner City,St,Zip:	FRANKLIN, NH 03235
Manager Name:	M
Manager Title:	PRESIDENT
Tank ID:	1
Status:	INACTIVE
Capacity (gal):	6280
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	Not reported
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported

FRANKLIN SAVINGS BANK (Continued) **U001557076**

CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	Not reported
Install Date:	05/02/1961
Last Test:	Not reported
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	09/01/1990
Tank Material:	STEEL - BARE/GALV
Closure Date:	Not reported
Tank Secondary:	NO
Product Stored:	#2 HEATING OIL
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	UNKNOWN
Pipe System:	Not reported

Tank ID:	2
Status:	INACTIVE
Capacity (gal):	7110
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	Not reported
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported

FRANKLIN SAVINGS BANK (Continued) **U001557076**

CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	Not reported
Install Date:	05/02/1977
Last Test:	Not reported
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	09/01/1990
Tank Material:	STEEL - BARE/GALV
Closure Date:	Not reported
Tank Secondary:	NO
Product Stored:	#2 HEATING OIL
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	STEEL - BARE/GALV
Pipe System:	Not reported

E34 **FRANKLIN SAVINGS BANK** **NH UST** **U001623398**
SE **405 CENTRAL STREET** **N/A**
< 1/8 **FRANKLIN, NH**
0.123 mi.
647 ft. **Site 2 of 2 in cluster E**

Relative: **Higher**

Actual: **314 ft.**

UST:

Name:	FRANKLIN SAVINGS BANK
Address:	405 CENTRAL STREET
City:	FRANKLIN
Facility ID:	114564
Facility Type:	COMMERCIAL
Site Number:	199404048
Owner Name:	ELWOOD & GEORGETTE MACDONALD
Owner Type:	COMMERCIAL/RESIDENTIAL
Owner Title:	Not reported
Owner Address:	PO BOX 400
Owner Address2:	Not reported
Owner City,St,Zip:	FRANKLIN, NH 03235
Manager Name:	ELWOOD E. MACDONALD
Manager Title:	OWNER
Tank ID:	1
Status:	INACTIVE
Capacity (gal):	2000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	Not reported
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported

FRANKLIN SAVINGS BANK (Continued) **U001623398**

Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	12/06/1993
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	Not reported
Install Date:	01/01/1973
Last Test:	Not reported
Spill Installed:	Not reported
Overfill:	12/06/1993
Line Leak Detection:	Not reported
Permanent Closure:	01/11/1994
Tank Material:	STEEL - BARE/GALV
Closure Date:	02/11/1994
Tank Secondary:	NO
Product Stored:	#2 HEATING OIL
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	COPPER
Pipe System:	Not reported

F35 **KEEGAN E J & CO** **RCRA NonGen / NLR** **1008886320**
ESE **425 CENTRAL ST** **NHD510091861**
1/8-1/4 **FRANKLIN, NH 03235**
0.149 mi.
787 ft. **Site 1 of 6 in cluster F**

Relative: **Higher**
Actual: **317 ft.**

RCRA NonGen / NLR:

Date Form Received by Agency:		19990306
Handler Name:	KEEGAN E J & CO	
Handler Address:		425 CENTRAL ST
Handler City,State,Zip:		FRANKLIN, NH 03235
EPA ID:		NHD510091861
Contact Name:		THOMAS KEEGAN
Contact Address:		425 CENTRAL ST
Contact City,State,Zip:		FRANKLIN, NH 03235
Contact Telephone:		603-744-2751
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		425 CENTRAL ST
Mailing City,State,Zip:		FRANKLIN, NH 03235
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		NN
Sub-Part K Indicator:		Not reported
Commercial TSD Indicator:		No
Treatment Storage and Disposal Type:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
Permit Renewals Workload Universe:		Not reported

KEEGAN E J & CO (Continued) **1008886320**

Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20051020
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Historic Generators:

Receive Date:	19990306
Handler Name: KEEGAN E J & CO	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:

NAICS Codes:	No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations:	No Violations Found

Evaluation Action Summary:

Evaluations:	No Evaluations Found

F36 **MERRIMACK MAGNETICS CORP** **RCRA NonGen / NLR** **1000362024**
ESE **SMITH & CANAL STS** **NHD108871799**
1/8-1/4 **FRANKLIN, NH 03235**
0.155 mi.
819 ft. **Site 2 of 6 in cluster F**

Relative: **Higher**
Actual: **319 ft.**

RCRA NonGen / NLR:

Date Form Received by Agency:		19850403
Handler Name:	MERRIMACK MAGNETICS CORP	
Handler Address:		SMITH & CANAL STS
Handler City,State,Zip:		FRANKLIN, NH 03235
EPA ID:		NHD108871799
Contact Name:		RICHARD DEJESUS
Contact Address:		SMITH & CANAL STS
Contact City,State,Zip:		FRANKLIN, NH 03235
Contact Telephone:		603-934-2162
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		SMITH & CANAL STS
Mailing City,State,Zip:		FRANKLIN, NH 03235
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		NN
Sub-Part K Indicator:		Not reported
Commercial TSD Indicator:		No
Treatment Storage and Disposal Type:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
Permit Renewals Workload Universe:		Not reported

MERRIMACK MAGNETICS CORP (Continued) **1000362024**

Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20051020
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	IGNITABLE WASTE
Waste Code:	D002
Waste Description:	CORROSIVE WASTE

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name: OWNERNAME	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	OWNERSTREET
Owner/Operator City,State,Zip:	OWNERCITY, NH 99999
Owner/Operator Telephone:	603-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	19850403
Handler Name: MERRIMACK MAGNETICS CORP	
Federal Waste Generator Description:	Not a generator, verified

MERRIMACK MAGNETICS CORP (Continued) **1000362024**

State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19850403
Handler Name: MERRIMACK MAGNETICS CORP
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

F37 **DANS PHARMACY** **RCRA NonGen / NLR** **1008890518**
ESE **436 CENTRAL ST** **NHD510175458**
1/8-1/4 **FRANKLIN, NH 03235**
0.159 mi.
842 ft. **Site 3 of 6 in cluster F**

Relative: **Higher**
Actual: **318 ft.**

RCRA NonGen / NLR:
Date Form Received by Agency: 20020730
Handler Name: DANS PHARMACY
Handler Address: 436 CENTRAL ST
Handler City,State,Zip: FRANKLIN, NH 03235
EPA ID: NHD510175458
Contact Name: RON MESSII
Contact Address: 436 CENTRAL ST
Contact City,State,Zip: FRANKLIN, NH 03235
Contact Telephone: 603-934-2550
Contact Fax: Not reported
Contact Email: Not reported
Contact Title: Not reported
EPA Region: 01
Land Type: Private
Federal Waste Generator Description: Not a generator, verified
Non-Notifier: Not reported

DANS PHARMACY (Continued) **1008890518**

Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		436 CENTRAL ST
Mailing City,State,Zip:		FRANKLIN, NH 03235
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		NN
Sub-Part K Indicator:		Not reported
Commercial TSD Indicator:		No
Treatment Storage and Disposal Type:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
Permit Renewals Workload Universe:		Not reported
Permit Workload Universe:		Not reported
Permit Progress Universe:		Not reported
Post-Closure Workload Universe:		Not reported
Closure Workload Universe:		Not reported
202 GPRA Corrective Action Baseline:		No
Corrective Action Workload Universe:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:		No
TSDFs Only Subject to CA under Discretionary Auth Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No
Institutional Control Indicator:		No
Human Exposure Controls Indicator:		N/A
Groundwater Controls Indicator:		N/A
Operating TSDF Universe:		Not reported
Full Enforcement Universe:		Not reported
Significant Non-Complier Universe:		No
Unaddressed Significant Non-Complier Universe:		No
Addressed Significant Non-Complier Universe:		No
Significant Non-Complier With a Compliance Schedule Universe:		No

DANS PHARMACY (Continued) **1008890518**

Financial Assurance Required:	Not reported
Handler Date of Last Change:	20051020
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Historic Generators:

Receive Date:	20020730
Handler Name: DANS PHARMACY	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:

NAICS Codes:	No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations:	No Violations Found

Evaluation Action Summary:

Evaluations:	No Evaluations Found

G38 **CUMBERLAND FARMS 2806** **RCRA NonGen / NLR** **1004750888**
SSW **233 CENTRAL ST** **RI MANIFEST** **NHD986473619**
1/8-1/4 **FRANKLIN, NH 03235**
0.164 mi.
864 ft. **Site 1 of 4 in cluster G**

Relative: **Lower**
Actual: **291 ft.**

RCRA NonGen / NLR:

Date Form Received by Agency:	20041221
Handler Name: CUMBERLAND FARMS 2806	
Handler Address:	233 CENTRAL ST
Handler City,State,Zip:	FRANKLIN, NH 03235
EPA ID:	NHD986473619
Contact Name:	RICHARD ETZOLD
Contact Address:	777 DEDHAM ST
Contact City,State,Zip:	CANTON, MA 02021
Contact Telephone:	781-828-4900
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	01
Land Type:	Private

CUMBERLAND FARMS 2806 (Continued) **1004750888**

Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		777 DEDHAM ST
Mailing City,State,Zip:		CANTON, MA 02021
Owner Name:	CUMBERLAND FARMS INC	
Owner Type:		Private
Operator Name:	CUMBERLAND FARMS INC	
Operator Type:		Private
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		NN
Sub-Part K Indicator:		Not reported
Commercial TSD Indicator:		No
Treatment Storage and Disposal Type:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
Permit Renewals Workload Universe:		Not reported
Permit Workload Universe:		Not reported
Permit Progress Universe:		Not reported
Post-Closure Workload Universe:		Not reported
Closure Workload Universe:		Not reported
202 GPRA Corrective Action Baseline:		No
Corrective Action Workload Universe:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:		No
TSDFs Only Subject to CA under Discretionary Auth Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No
Institutional Control Indicator:		No
Human Exposure Controls Indicator:		N/A
Groundwater Controls Indicator:		N/A
Operating TSDF Universe:		Not reported
Full Enforcement Universe:		Not reported
Significant Non-Complier Universe:		No
Unaddressed Significant Non-Complier Universe:		No

CUMBERLAND FARMS 2806 (Continued) **1004750888**

Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20051020
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	IGNITABLE WASTE
Waste Code:	D018
Waste Description:	BENZENE

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name: CUMBERLAND FARMS INC	
Legal Status:	Private
Date Became Current:	19731228
Date Ended Current:	Not reported
Owner/Operator Address:	777 DEDHAM ST
Owner/Operator City,State,Zip:	CANTON, MA 02021
Owner/Operator Telephone:	781-828-4900
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: CUMBERLAND FARMS INC	
Legal Status:	Private
Date Became Current:	19731228
Date Ended Current:	Not reported
Owner/Operator Address:	777 DEDHAM ST
Owner/Operator City,State,Zip:	CANTON, MA 02021
Owner/Operator Telephone:	781-828-4900
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name: CUMBERLAND FARMS INC	
Legal Status:	Private
Date Became Current:	19731228
Date Ended Current:	Not reported
Owner/Operator Address:	777 DEDHAM ST
Owner/Operator City,State,Zip:	CANTON, MA 02021
Owner/Operator Telephone:	781-828-4900
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

CUMBERLAND FARMS 2806 (Continued) **1004750888**

Owner/Operator Indicator:	Owner
Owner/Operator Name: CUMBERLAND FARMS INC	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	777 DEDHAM ST
Owner/Operator City,State,Zip:	CANTON, MA 02021
Owner/Operator Telephone:	617-828-4900
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: CUMBERLAND FARMS INC	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	777 DEDHAM ST
Owner/Operator City,State,Zip:	CANTON, MA 02021
Owner/Operator Telephone:	617-828-4900
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: CUMBERLAND FARMS INC	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	777 DEDHAM ST
Owner/Operator City,State,Zip:	CANTON, MA 02021
Owner/Operator Telephone:	617-828-4900
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name: CUMBERLAND FARMS INC	
Legal Status:	Private
Date Became Current:	19731228
Date Ended Current:	Not reported
Owner/Operator Address:	777 DEDHAM ST
Owner/Operator City,State,Zip:	CANTON, MA 02021
Owner/Operator Telephone:	781-828-4900
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	20030103
Handler Name: CUMBERLAND FARMS #2806	
Federal Waste Generator Description:	Not reported
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No

CUMBERLAND FARMS 2806 (Continued) **1004750888**

Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20041221
Handler Name: CUMBERLAND FARMS 2806
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19920313
Handler Name: CUMBERLAND FARMS #2806
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20031117
Handler Name: CUMBERLAND FARMS #2806
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20000412
Handler Name: CUMBERLAND FARMS #2806
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

CUMBERLAND FARMS 2806 (Continued) **1004750888**

List of NAICS Codes and Descriptions:
NAICS Code: 44711
NAICS Description: GASOLINE STATIONS WITH CONVENIENCE STORES

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

RI MANIFEST:

Name:	Not reported
Address:	CENTRAL RIVER & SCHOOL STS
City,State,Zip:	FRANKLIN, NH 03235
EPA Id:	NHD986473619
GEN Cert Date:	10/22/1996
Manifest Document Number:	MAH425417
Waste Description:	GASOLINE/WATER
TSDF Id:	MED019051069
TSDF Name:	ENVIRONMENTAL COMPLIANCE CORP
Qty:	100
WT/Vol Units:	G
TSDF Date:	Not reported
Transporter 2 Id:	Not reported
Item Number:	1
Transporter 2 Name:	Not reported
Transporter Name 2:	C Y N OIL CORP
Transporter EPAID:	MAD082303777
Transporter Receipt Date:	Not reported
Number Of Containers:	0
Container Type:	Not reported
Waste Code1:	D001
Waste Code2:	D018
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Fee Exempt Code:	Not reported
Comment:	Not reported
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
Quarter:	Not reported
Transporter Contact Name:	Not reported
Transporter Contact Email:	Not reported
Filing Date:	Not reported
Total Fee:	Not reported
Billing Name:	Not reported
Paid Date:	Not reported
Paid Time:	Not reported
Facility Receipt Date:	Not reported
Fee:	Not reported
Manifest Created Date:	Not reported
Manifest Updated Date:	Not reported

CUMBERLAND FARMS 2806 (Continued) **1004750888**

RI MANIFEST:

Transporter Receipt Date:	Not reported
Number Of Containers:	0
Container Type:	Not reported
Waste Code1:	D001
Waste Code2:	D018
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	ENVIRONMENTAL COMPLIANCE CORP
TSDF Id:	MED019051069
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD986473619
Manifest Docket Number:	MAH425417
Quarter:	Not reported
Waste Description:	GASOLINE/WATER
Transporter Contact Name:	Not reported
Quantity:	100
Transporter Contact Email:	Not reported
WT/Vol Units:	G
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	1
Transporter Name:	C Y N OIL CORP
Billing Name:	Not reported
Transporter EPA ID:	MAD082303777
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	10/22/1996
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	Not reported
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported

Transporter Receipt Date:	Not reported
Number Of Containers:	0
Container Type:	Not reported
Waste Code1:	D001
Waste Code2:	D018
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	ENVIRONMENTAL COMPLIANCE CORP
TSDF Id:	MED019051069
Transporter Name 2:	Not reported
Company Permit Number:	Not reported

CUMBERLAND FARMS 2806 (Continued) **1004750888**

Year:	Not reported
EPA ID:	NHD986473619
Manifest Docket Number:	MAH425417
Quarter:	Not reported
Waste Description:	GASOLINE/WATER
Transporter Contact Name:	Not reported
Quantity:	100
Transporter Contact Email:	Not reported
WT/Vol Units:	G
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	1
Transporter Name:	C Y N OIL CORP
Billing Name:	Not reported
Transporter EPA ID:	MAD082303777
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	10/22/1996
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	Not reported
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported

H39 **SCOTT FARAH** **NH ALLSITES** **S105771400**
SE **2 AYLES COURT** **N/A**
1/8-1/4 **FRANKLIN, NH**
0.168 mi.
889 ft. **Site 1 of 3 in cluster H**

Relative: **Higher**

Actual: **325 ft.**

ALLSITES:

Name:	SCOTT FARAH
Address:	2 AYLES COURT
City,State,Zip:	FRANKLIN, NH
Facility ID:	199702025
Project Type:	OPUF
Project Description:	ON-PREMISE USE FAC. CONTAINING FUEL OIL
Project Manager:	CLOSED
Expiration Date:	Not reported

G40 **CORMIER CORPORATION** **NH UST** **U004221327**
SSW **1 RIVER STREET** **N/A**
1/8-1/4 **FRANKLIN, NH**
0.176 mi.
929 ft. **Site 2 of 4 in cluster G**

Relative: **Lower**

Actual: **292 ft.**

NH UST:

No Details:	No Details

I41 **NH DES WMD** **RCRA NonGen / NLR** **1008886630**
East **38 E BOW ST** **NHD510095631**
1/8-1/4 **FRANKLIN, NH 03235**
0.178 mi.
939 ft. **Site 1 of 4 in cluster I**

Relative: **Higher**
Actual: **321 ft.**

RCRA NonGen / NLR:

Date Form Received by Agency:		19990306
Handler Name:	NH DES WMD	
Handler Address:		38 E BOW ST
Handler City,State,Zip:		FRANKLIN, NH 03235
EPA ID:		NHD510095631
Contact Name:		JIM ZEPPIERI
Contact Address:		6 HAZEN DR
Contact City,State,Zip:		CONCORD, NH 03301
Contact Telephone:		603-271-2800
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		6 HAZEN DR
Mailing City,State,Zip:		CONCORD, NH 03301
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		NN
Sub-Part K Indicator:		Not reported
Commercial TSD Indicator:		No
Treatment Storage and Disposal Type:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
Permit Renewals Workload Universe:		Not reported

NH DES WMD (Continued) **1008886630**

Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20051020
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Historic Generators:

Receive Date:	19990306
Handler Name: NH DES WMD	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:

NAICS Codes:	No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations:	No Violations Found

Evaluation Action Summary:

Evaluations:	No Evaluations Found

I42 **FORMER JP STEVENS MILL (FORMER ADS 16)** **NH UST** **U003745229**
East **38 E BOW ST** **N/A**
1/8-1/4 **FRANKLIN, NH**
0.178 mi.
939 ft. **Site 2 of 4 in cluster I**

Relative:
Higher

Actual:
321 ft.

UST:

Name:	FORMER JP STEVENS MILL (FORMER ADS 16)
Address:	38 E BOW ST
City:	FRANKLIN
Facility ID:	115157
Facility Type:	INDUSTRIAL
Site Number:	200007059
Owner Name:	GHI ASSOCIATES INC
Owner Type:	COMMERCIAL/RESIDENTIAL
Owner Title:	Not reported
Owner Address:	55 CONSTITUTION DR
Owner Address2:	Not reported
Owner City,St,Zip:	BEDFORD, NH 03110
Manager Name:	Not reported
Manager Title:	Not reported
Tank ID:	1
Status:	INACTIVE
Capacity (gal):	20000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported

FORMER JP STEVENS MILL (FORMER ADS 16) (Continued) **U003745229**

CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	Not reported
Install Date:	11/11/1911
Last Test:	Not reported
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	09/04/1998
Tank Material:	STEEL - BARE/GALV
Closure Date:	Not reported
Tank Secondary:	NO
Product Stored:	#6 HEATING OIL
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	STEEL - BARE/GALV
Pipe System:	Not reported

Tank ID:	2
Status:	INACTIVE
Capacity (gal):	20000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported

FORMER JP STEVENS MILL (FORMER ADS 16) (Continued) **U003745229**

CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	Not reported
Install Date:	11/11/1911
Last Test:	Not reported
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	09/04/1998
Tank Material:	STEEL - BARE/GALV
Closure Date:	Not reported
Tank Secondary:	NO
Product Stored:	#6 HEATING OIL
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	STEEL - BARE/GALV
Pipe System:	Not reported

Tank ID:	3
Status:	INACTIVE
Capacity (gal):	20000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported

FORMER JP STEVENS MILL (FORMER ADS 16) (Continued) **U003745229**

CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	Not reported
Install Date:	11/11/1911
Last Test:	Not reported
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	09/03/1998
Tank Material:	STEEL - BARE/GALV
Closure Date:	Not reported
Tank Secondary:	NO
Product Stored:	#6 HEATING OIL
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	STEEL - BARE/GALV
Pipe System:	Not reported

Tank ID:	4
Status:	INACTIVE
Capacity (gal):	20000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported

FORMER JP STEVENS MILL (FORMER ADS 16) (Continued) **U003745229**

CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	Not reported
Install Date:	11/11/1911
Last Test:	Not reported
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	09/03/1998
Tank Material:	STEEL - BARE/GALV
Closure Date:	Not reported
Tank Secondary:	NO
Product Stored:	#6 HEATING OIL
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	STEEL - BARE/GALV
Pipe System:	Not reported

Tank ID:	5
Status:	INACTIVE
Capacity (gal):	20000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported

FORMER JP STEVENS MILL (FORMER ADS 16) (Continued) **U003745229**

CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	Not reported
Install Date:	11/11/1911
Last Test:	Not reported
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	09/02/1998
Tank Material:	STEEL - BARE/GALV
Closure Date:	Not reported
Tank Secondary:	NO
Product Stored:	#6 HEATING OIL
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	STEEL - BARE/GALV
Pipe System:	Not reported

I43 **FORMER JP STEVENS MILL (FORMER ADS 16)** **NH BROWNFIELDS S106697154**
East **38 E BOW ST** **NH ALLSITES N/A**
1/8-1/4 **FRANKLIN, NH**
0.178 mi.
939 ft. **Site 3 of 4 in cluster I**

Relative:
Higher

Actual:
321 ft.

BROWNFIELDS:

Name:	FORMER JP STEVENS MILL (FORMER ADS 16)
Address:	38 E BOW ST
City,State,Zip:	FRANKLIN, NH
Facility ID:	200007059
Site Latitude:	43.446259
Site Longitude:	-71.644428
Site Total Acreage	Not reported

ALLSITES:

Name:	FORMER JP STEVENS MILL (FORMER ADS 16)
Address:	38 E BOW ST
City,State,Zip:	FRANKLIN, NH
Facility ID:	200007059
Project Type:	ASBESTOS
Project Description:	ASBESTOS DISPOSAL SITE - INACTIVE
Project Manager:	WATSON
Expiration Date:	Not reported

F44 **SHOP EXPRESS** **NH LUST** **S106534687**
ESE **449 CENTRAL ST** **N/A**
1/8-1/4 **FRANKLIN, NH**
0.183 mi.
968 ft. **Site 4 of 6 in cluster F**

Relative: LUST:
Higher

Actual: Name: SHOP EXPRESS
321 ft. Address: 449 CENTRAL ST
City,State,Zip: FRANKLIN, NH
Facility ID: 199610017
Project Type: LUST
Project Manager: **CLOSED**
Project Site Description: **LEAKING UNDERGROUND STORAGE TANK PROJECT**
Expired Date: **04/16/2005**

F45 **SHOP EXPRESS** **NH UST** **U001556625**
ESE **449 CENTRAL ST** **N/A**
1/8-1/4 **FRANKLIN, NH**
0.183 mi.
968 ft. **Site 5 of 6 in cluster F**

Relative: UST:
Higher

Actual: Name: SHOP EXPRESS
321 ft. Address: 449 CENTRAL ST
City: FRANKLIN
Facility ID: 112196
Facility Type: GAS STATION
Site Number: 199610017
Owner Name: TANVEER CHAUDHRY
Owner Type: COMMERCIAL/RESIDENTIAL
Owner Title: KAREN O'CONNOR
Owner Address: 449 CENTRAL ST
Owner Address2: Not reported
Owner City,St,Zip: FRANKLIN, NH 03235
Manager Name: TANVEER CHAUDHRY
Manager Title: OWNER

Tank ID: 1
Status: INACTIVE
Capacity (gal): 10000
Temporary Closed Date: Not reported
Tank Filled Removed: Not reported
Compartment: NO
Tank Diameter In Inches: Not reported
Construction Material Comments: Not reported
Meets Dec 22 2015 Deadline: Not reported
Leak Line Detection: Not reported
Leak Line Detection Installed Date: 10/29/1993
Leak Line Detection Test Pass Fail: Not reported
Drop Tube Pass Fail: Not reported
Drain Valve Replaced Date: Not reported
Dry Beak Installed Date: Not reported
Inv Monitor Review Date: Not reported
Dispenser Pan: Not reported
Overfill Length In Inches: Not reported
Release Detection (RD) Tank Type: NONE LISTED
RD Tank Type Installed Date: Not reported
RD Tank Type Tested Date: Not reported
RD Tank Type Test Pass Fail: Not reported

SHOP EXPRESS (Continued) **U001556625**

RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	05/16/1991
Piping Tightness Test Pass Fail:	PASS
Piping Material Comments:	Not reported
Install Date:	01/01/1971
Last Test:	05/16/1991
Spill Installed:	Not reported
Overfill:	10/29/1993
Line Leak Detection:	Not reported
Permanent Closure:	08/06/1996
Tank Material:	STEEL - BARE/GALV
Closure Date:	10/02/1996
Tank Secondary:	NO
Product Stored:	GASOLINE
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	STEEL - BARE/GALV
Pipe System:	PRESSURE

Tank ID:	2
Status:	INACTIVE
Capacity (gal):	5000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported

SHOP EXPRESS (Continued) **U001556625**

RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	09/01/1992
Piping Tightness Test Pass Fail:	PASS
Piping Material Comments:	Not reported
Install Date:	01/01/1971
Last Test:	09/01/1992
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	08/06/1996
Tank Material:	STEEL - BARE/GALV
Closure Date:	10/02/1996
Tank Secondary:	NO
Product Stored:	GASOLINE
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	FIBERGLASS
Pipe System:	PRESSURE

Tank ID:	3
Status:	INACTIVE
Capacity (gal):	8000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	10/29/1993
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported

SHOP EXPRESS (Continued) **U001556625**

Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	05/16/1991
Piping Tightness Test Pass Fail:	PASS
Piping Material Comments:	Not reported
Install Date:	07/01/1982
Last Test:	05/16/1991
Spill Installed:	Not reported
Overfill:	10/29/1993
Line Leak Detection:	Not reported
Permanent Closure:	08/06/1996
Tank Material:	STEEL - BARE/GALV
Closure Date:	10/02/1996
Tank Secondary:	NO
Product Stored:	GASOLINE
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	STEEL - BARE/GALV
Pipe System:	PRESSURE

Tank ID:	4
Status:	ACTIVE
Capacity (gal):	6000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	96
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	YES
Leak Line Detection:	RED JACKET
Leak Line Detection Installed Date:	08/19/1996
Leak Line Detection Test Pass Fail:	PASS
Drop Tube Pass Fail:	PASS
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	10/31/1996

SHOP EXPRESS (Continued) **U001556625**

Dispenser Pan:	Not reported
Overfill Length In Inches:	76.5
Release Detection (RD) Tank Type:	VEEDER ROOT
RD Tank Type Installed Date:	08/19/1996
RD Tank Type Tested Date:	04/01/2021
RD Tank Type Test Pass Fail:	PASS
RD Piping Type:	VEEDER ROOT
RD Piping Installed Date:	09/19/1996
RD Piping Tested Date:	04/01/2021
RD Piping Test Pass Fail:	PASS
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	09/18/2019
Piping Tightness Test Pass Fail:	PASS
Piping Material Comments:	TC PP1501 & SP4500
Install Date:	08/19/1996
Last Test:	09/14/2017
Spill Installed:	08/19/1996
Overfill:	08/19/1996
Line Leak Detection:	04/01/2021
Permanent Closure:	Not reported
Tank Material:	FIBERGLASS
Closure Date:	Not reported
Tank Secondary:	YES
Product Stored:	REGULAR MASTER
Overfill Type:	AUDIBLE ALARM
Pipe Secondary:	YES
Pipe Material:	PLASTIC PIPING
Pipe System:	PRESSURE

Tank ID:	5
Status:	ACTIVE
Capacity (gal):	6000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	96
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	YES
Leak Line Detection:	RED JACKET
Leak Line Detection Installed Date:	08/19/1996
Leak Line Detection Test Pass Fail:	PASS
Drop Tube Pass Fail:	PASS
Drain Valve Replaced Date:	Not reported

SHOP EXPRESS (Continued) **U001556625**

Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	10/31/1996
Dispenser Pan:	Not reported
Overfill Length In Inches:	76.5
Release Detection (RD) Tank Type:	VEEDER ROOT
RD Tank Type Installed Date:	08/19/1996
RD Tank Type Tested Date:	04/01/2021
RD Tank Type Test Pass Fail:	PASS
RD Piping Type:	VEEDER ROOT
RD Piping Installed Date:	08/19/1996
RD Piping Tested Date:	04/01/2021
RD Piping Test Pass Fail:	PASS
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	PASS
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	09/18/2019
Piping Tightness Test Pass Fail:	PASS
Piping Material Comments:	TC PP1501 & SP4500
Install Date:	08/19/1996
Last Test:	09/14/2017
Spill Installed:	08/19/1996
Overfill:	08/19/1996
Line Leak Detection:	04/01/2021
Permanent Closure:	Not reported
Tank Material:	FIBERGLASS
Closure Date:	Not reported
Tank Secondary:	YES
Product Stored:	REGULAR SLAVE
Overfill Type:	AUDIBLE ALARM
Pipe Secondary:	YES
Pipe Material:	PLASTIC PIPING
Pipe System:	PRESSURE

F46 **XTRA MART** **RCRA-VSQG** **1004749839**
ESE **449 CENTRAL ST** **RI MANIFEST** **NHD510105711**
1/8-1/4 **FRANKLIN, NH 03235**
0.183 mi.
968 ft. **Site 6 of 6 in cluster F**

Relative: **Higher**
Actual: **321 ft.**

RCRA-VSQG:

Date Form Received by Agency:		20000918
Handler Name:	XTRA MART	
Handler Address:		449 CENTRAL ST
Handler City,State,Zip:		FRANKLIN, NH 03235
EPA ID:		NHD510105711
Contact Name:		ART HURLY
Contact Address:		P O BOX 866

XTRA MART (Continued) **1004749839**

Contact City,State,Zip:		NORTH GROSVENORDALE, CT 06255
Contact Telephone:		860-935-5200
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private
Federal Waste Generator Description:		Conditionally Exempt Small Quantity Generator
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Handler Activities
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		P O BOX 866
Mailing City,State,Zip:		NORTH GROSVENORDALE, CT 06255
Owner Name:	DAVID PREBLE	
Owner Type:		Private
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		NN
Sub-Part K Indicator:		Not reported
Commercial TSD Indicator:		No
Treatment Storage and Disposal Type:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
Permit Renewals Workload Universe:		Not reported
Permit Workload Universe:		Not reported
Permit Progress Universe:		Not reported
Post-Closure Workload Universe:		Not reported
Closure Workload Universe:		Not reported
202 GPRA Corrective Action Baseline:		No
Corrective Action Workload Universe:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:		No
TSDFs Only Subject to CA under Discretionary Auth Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No

XTRA MART (Continued) **1004749839**

Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20051020
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	IGNITABLE WASTE
Waste Code:	D018
Waste Description:	BENZENE

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name: DAVID PREBLE	
Legal Status:	Private
Date Became Current:	20000919
Date Ended Current:	Not reported
Owner/Operator Address:	221 QUINEBANG RD
Owner/Operator City,State,Zip:	N GROSVONORDALE, CT 06255
Owner/Operator Telephone:	860-935-5200
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name: LAWRENCE R CRAMPSEY SR	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	113 LAFAYETTE RD
Owner/Operator City,State,Zip:	HAMPTON FALLS, NH 03844
Owner/Operator Telephone:	603-926-6742
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	20000918
Handler Name: XTRA MART	
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator

XTRA MART (Continued) **1004749839**

State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20000918
Handler Name: XTRA MART
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

RI MANIFEST:
Name: KENYON OIL (FRANKLIN XTRA MART)
Address: 499 CENTRAL ST
City,State,Zip: FRANKLIN, NH 03235
EPA Id: NHD510105711
GEN Cert Date: 2/8/2001
Manifest Document Number: MAM128589
Waste Description: WASTE OIL
TSDF Id: RID040098352
TSDF Name: NORTHLAND ENVIRONMENTAL INC.
Qty: 100
WT/Vol Units: G
TSDF Date: Not reported
Transporter 2 Id: Not reported
Item Number: 12502
Transporter 2 Name: Not reported
Transporter Name 2: Western Oil
Transporter EPAID: RID980906580
Transporter Receipt Date: Not reported
Number Of Containers: 0
Container Type: Not reported
Waste Code1: NH01

XTRA MART (Continued) **1004749839**

Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Fee Exempt Code:	Not reported
Comment:	Not reported
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
Quarter:	Not reported
Transporter Contact Name:	Not reported
Transporter Contact Email:	Not reported
Filing Date:	Not reported
Total Fee:	Not reported
Billing Name:	Not reported
Paid Date:	Not reported
Paid Time:	Not reported
Facility Receipt Date:	Not reported
Fee:	Not reported
Manifest Created Date:	Not reported
Manifest Updated Date:	Not reported

RI MANIFEST:

Transporter Receipt Date:	Not reported
Number Of Containers:	0
Container Type:	Not reported
Waste Code1:	NH01
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	NORTHLAND ENVIRONMENTAL INC.
TSDF Id:	RID040098352
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD510105711
Manifest Docket Number:	MAM128589
Quarter:	Not reported
Waste Description:	WASTE OIL
Transporter Contact Name:	Not reported
Quantity:	100
Transporter Contact Email:	Not reported
WT/Vol Units:	G
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	12502
Transporter Name:	Western Oil
Billing Name:	Not reported
Transporter EPA ID:	RID980906580
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	2/8/2001
Facility Receipt Date:	Not reported

XTRA MART (Continued) **1004749839**

Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	Not reported
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	Not reported
Number Of Containers:	0
Container Type:	Not reported
Waste Code1:	NH01
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	NORTHLAND ENVIRONMENTAL INC.
TSDF Id:	RID040098352
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD510105711
Manifest Docket Number:	MAM128589
Quarter:	Not reported
Waste Description:	WASTE OIL
Transporter Contact Name:	Not reported
Quantity:	100
Transporter Contact Email:	Not reported
WT/Vol Units:	G
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	14163
Transporter Name:	Western Oil
Billing Name:	Not reported
Transporter EPA ID:	RID980906580
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	2/8/2001
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	Not reported
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	Not reported
Number Of Containers:	0
Container Type:	Not reported
Waste Code1:	NH01
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported

XTRA MART (Continued) **1004749839**

Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	NORTHLAND ENVIRONMENTAL INC.
TSDF Id:	RID040098352
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD510105711
Manifest Docket Number:	MAM128589
Quarter:	Not reported
Waste Description:	WASTE OIL
Transporter Contact Name:	Not reported
Quantity:	100
Transporter Contact Email:	Not reported
WT/Vol Units:	G
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	12502
Transporter Name:	Western Oil
Billing Name:	Not reported
Transporter EPA ID:	RID980906580
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	2/8/2001
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	Not reported
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	Not reported
Number Of Containers:	0
Container Type:	Not reported
Waste Code1:	NH01
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	NORTHLAND ENVIRONMENTAL INC.
TSDF Id:	RID040098352
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD510105711
Manifest Docket Number:	MAM128589
Quarter:	Not reported
Waste Description:	WASTE OIL
Transporter Contact Name:	Not reported
Quantity:	100
Transporter Contact Email:	Not reported
WT/Vol Units:	G
Filing Date:	Not reported

XTRA MART (Continued) **1004749839**

Total Fee:	Not reported
Item Number:	14163
Transporter Name:	Western Oil
Billing Name:	Not reported
Transporter EPA ID:	RID980906580
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	2/8/2001
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	Not reported
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported

I47 **ALGONQUIN POWER STATION** **RCRA NonGen / NLR** **1008887792**
East **35 E BOW ST** **NHD510111123**
1/8-1/4 **FRANKLIN, NH 03235**
0.184 mi.
972 ft. **Site 4 of 4 in cluster I**

Relative: **Higher**
Actual: **325 ft.**

RCRA NonGen / NLR:

Date Form Received by Agency:		20050111
Handler Name:	ALGONQUIN POWER STATION	
Handler Address:		35 E BOW ST
Handler City,State,Zip:		FRANKLIN, NH 03235
EPA ID:		NHD510111123
Contact Name:		SEAN FAIRFIELD
Contact Address:		2085 HURONTARIO ST
Contact City,State,Zip:		MISSISSAUGA,ONTARIO, ON, ON 03235
Contact Telephone:		9052738918
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		2085 HURONTARIO ST
Mailing City,State,Zip:		MISSISSAUGA,ONTARIO, ON, ON 03235
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No

ALGONQUIN POWER STATION (Continued) **1008887792**

Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20080501
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Historic Generators:

Receive Date:	20050111
Handler Name:	ALGONQUIN POWER STATION
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No

ALGONQUIN POWER STATION (Continued) **1008887792**

Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

H48 **FARRAH SCOTT** **RCRA NonGen / NLR** **1008887898**
SE **42 FRANKLIN ST** **NHD510112360**
1/8-1/4 **FRANKLIN, NH 03235**
0.185 mi.
978 ft. **Site 2 of 3 in cluster H**

Relative: **Higher**
Actual: **331 ft.**

RCRA NonGen / NLR:

Date Form Received by Agency:		19990306
Handler Name:	FARRAH SCOTT	
Handler Address:		42 FRANKLIN ST
Handler City,State,Zip:		FRANKLIN, NH 03235
EPA ID:		NHD510112360
Contact Name:		SCOTT FARAH
Contact Address:		HATCH CORNER RD
Contact City,State,Zip:		MEREDITH, NH 03253
Contact Telephone:		603-279-3395
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		HATCH CORNER RD
Mailing City,State,Zip:		MEREDITH, NH 03253
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No

FARRAH SCOTT (Continued) **1008887898**

Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20051020
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Historic Generators:

Receive Date:	19990306
Handler Name: FARRAH SCOTT	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported

FARRAH SCOTT (Continued) **1008887898**

Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

G49 **CUMBERLAND FARMS 2806** **NH UST** **U001555827**
SSW **233 CENTRAL ST** **NH NPDES** **N/A**
1/8-1/4 **FRANKLIN, NH**
0.198 mi.
1045 ft. **Site 3 of 4 in cluster G**

Relative:
Lower

Actual:
284 ft.

UST:

Name:	CUMBERLAND FARMS 2806
Address:	233 CENTRAL ST
City:	FRANKLIN
Facility ID:	110744
Facility Type:	GAS STATION
Site Number:	199003013
Owner Name:	CUMBERLAND FARMS INC C/O ATC ECLIPSE
Owner Type:	COMMERCIAL/RESIDENTIAL
Owner Title:	MATT YOUNG - CUMBERLAND FARMS
Owner Address:	73 WILLIAM FRANKS DRIVE
Owner Address2:	Not reported
Owner City,St,Zip:	WEST SPRINGFIELD, MA 01089
Manager Name:	MARTIN HILFINGER
Manager Title:	SR MGR ENVIRONMENTAL OPERATIONS
Tank ID:	1
Status:	INACTIVE
Capacity (gal):	4000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	PASS
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported

CUMBERLAND FARMS 2806 (Continued) **U001555827**

Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	09/06/1988
Piping Tightness Test Pass Fail:	PASS
Piping Material Comments:	Not reported
Install Date:	01/01/1978
Last Test:	09/06/1988
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	07/01/1990
Tank Material:	STEEL - BARE/GALV
Closure Date:	Not reported
Tank Secondary:	NO
Product Stored:	GASOLINE
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	STEEL - BARE/GALV
Pipe System:	SUCTION: OLD CODE

Tank ID:	2
Status:	INACTIVE
Capacity (gal):	4000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	PASS

CUMBERLAND FARMS 2806 (Continued) **U001555827**

Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	09/06/1988
Piping Tightness Test Pass Fail:	PASS
Piping Material Comments:	Not reported
Install Date:	01/01/1978
Last Test:	09/06/1988
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	07/01/1990
Tank Material:	STEEL - BARE/GALV
Closure Date:	Not reported
Tank Secondary:	NO
Product Stored:	GASOLINE
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	STEEL - BARE/GALV
Pipe System:	SUCTION: OLD CODE

Tank ID:	3
Status:	INACTIVE
Capacity (gal):	4000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported

CUMBERLAND FARMS 2806 (Continued) **U001555827**

Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	PASS
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	09/06/1988
Piping Tightness Test Pass Fail:	PASS
Piping Material Comments:	Not reported
Install Date:	01/01/1978
Last Test:	09/06/1988
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	07/01/1990
Tank Material:	STEEL - BARE/GALV
Closure Date:	Not reported
Tank Secondary:	NO
Product Stored:	GASOLINE
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	STEEL - BARE/GALV
Pipe System:	SUCTION: OLD CODE

Tank ID:	4
Status:	INACTIVE
Capacity (gal):	4000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported

CUMBERLAND FARMS 2806 (Continued) **U001555827**

Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	PASS
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	01/18/1988
Piping Tightness Test Pass Fail:	PASS
Piping Material Comments:	Not reported
Install Date:	01/01/1978
Last Test:	01/18/1988
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	07/01/1990
Tank Material:	STEEL - BARE/GALV
Closure Date:	Not reported
Tank Secondary:	NO
Product Stored:	GASOLINE
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	STEEL - BARE/GALV
Pipe System:	SUCTION: OLD CODE

Tank ID:	5
Status:	INACTIVE
Capacity (gal):	4000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported

CUMBERLAND FARMS 2806 (Continued) **U001555827**

Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	PASS
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	09/06/1988
Piping Tightness Test Pass Fail:	PASS
Piping Material Comments:	Not reported
Install Date:	01/01/1978
Last Test:	09/06/1988
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	07/01/1990
Tank Material:	STEEL - BARE/GALV
Closure Date:	Not reported
Tank Secondary:	NO
Product Stored:	GASOLINE
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	STEEL - BARE/GALV
Pipe System:	SUCTION: OLD CODE

Tank ID:	6
Status:	ACTIVE
Capacity (gal):	6000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported

CUMBERLAND FARMS 2806 (Continued) **U001555827**

Compartment:	NO
Tank Diameter In Inches:	72
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	YES
Leak Line Detection:	RED JACKET
Leak Line Detection Installed Date:	07/12/1990
Leak Line Detection Test Pass Fail:	PASS
Drop Tube Pass Fail:	PASS
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	7.13
Release Detection (RD) Tank Type:	VEEDER ROOT
RD Tank Type Installed Date:	02/08/1999
RD Tank Type Tested Date:	01/04/2022
RD Tank Type Test Pass Fail:	PASS
RD Piping Type:	VEEDER ROOT
RD Piping Installed Date:	02/08/1999
RD Piping Tested Date:	01/04/2022
RD Piping Test Pass Fail:	PASS
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	01/25/2018
Piping Tightness Test Pass Fail:	PASS
Piping Material Comments:	SIPHON W/TANK 7; SHUTDOWN SENSORS INSTALLED - MAJ
Install Date:	07/12/1990
Last Test:	01/25/2018
Spill Installed:	07/12/1990
Overfill:	12/04/2020
Line Leak Detection:	01/04/2022
Permanent Closure:	Not reported
Tank Material:	FIBERGLASS
Closure Date:	04/11/2016
Tank Secondary:	YES
Product Stored:	REGULAR MASTER
Overfill Type:	FLOW SHUTOFF - FLAPPER VALVE
Pipe Secondary:	YES
Pipe Material:	FIBERGLASS
Pipe System:	PRESSURE

Tank ID:	7
Status:	ACTIVE
Capacity (gal):	6000

CUMBERLAND FARMS 2806 (Continued) **U001555827**

Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	72
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	YES
Leak Line Detection:	RED JACKET
Leak Line Detection Installed Date:	07/12/1990
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	PASS
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	7.13
Release Detection (RD) Tank Type:	VEEDER ROOT
RD Tank Type Installed Date:	02/08/1999
RD Tank Type Tested Date:	01/04/2022
RD Tank Type Test Pass Fail:	PASS
RD Piping Type:	VEEDER ROOT
RD Piping Installed Date:	02/08/1999
RD Piping Tested Date:	01/04/2022
RD Piping Test Pass Fail:	PASS
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	SIPHON W/TANK 6; SHUTDOWN SENSORS INSTALLED - MAJ
Install Date:	07/12/1990
Last Test:	01/25/2018
Spill Installed:	07/12/1990
Overfill:	12/04/2020
Line Leak Detection:	Not reported
Permanent Closure:	Not reported
Tank Material:	FIBERGLASS
Closure Date:	04/11/2016
Tank Secondary:	YES
Product Stored:	REGULAR SLAVE
Overfill Type:	FLOW SHUTOFF - FLAPPER VALVE
Pipe Secondary:	YES
Pipe Material:	FIBERGLASS
Pipe System:	SIPHON

Tank ID:	8

CUMBERLAND FARMS 2806 (Continued) **U001555827**

Status:	ACTIVE
Capacity (gal):	6000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	72
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	YES
Leak Line Detection:	RED JACKET
Leak Line Detection Installed Date:	03/03/2021
Leak Line Detection Test Pass Fail:	PASS
Drop Tube Pass Fail:	PASS
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	7.13
Release Detection (RD) Tank Type:	VEEDER ROOT
RD Tank Type Installed Date:	02/08/1999
RD Tank Type Tested Date:	01/04/2022
RD Tank Type Test Pass Fail:	PASS
RD Piping Type:	VEEDER ROOT
RD Piping Installed Date:	02/08/1999
RD Piping Tested Date:	01/04/2022
RD Piping Test Pass Fail:	PASS
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	01/25/2018
Piping Tightness Test Pass Fail:	PASS
Piping Material Comments:	SHUTDOWN SENSORS INSTALLED - MAJ
Install Date:	07/12/1990
Last Test:	04/15/2021
Spill Installed:	07/12/1990
Overfill:	12/04/2020
Line Leak Detection:	01/04/2022
Permanent Closure:	Not reported
Tank Material:	FIBERGLASS
Closure Date:	04/11/2016
Tank Secondary:	YES
Product Stored:	SUPER
Overfill Type:	FLOW SHUTOFF - FLAPPER VALVE
Pipe Secondary:	YES
Pipe Material:	FIBERGLASS
Pipe System:	PRESSURE

CUMBERLAND FARMS 2806 (Continued) **U001555827**

NPDES:

Name:	CUMBERLAND FARMS - FRANKLIN
Address:	239 CENTRAL STREET
City,State,Zip:	FRANKLIN, NH
Permit Number:	NH0023051
Mailing Address Line 1:	155 Otis Street
Mailing Address Line 2:	Not reported
Mailing Address Line 3:	Not reported
Mailing Address City,St,Zip:	Northborough, MA 01532-2414
Contact Name:	David Espy
Contact Title:	CFI Program Mgr; ENSR Consultants
Contact Phone:	508-393-8558
Issuance Date:	Not reported
Expire Date:	Not reported
Facility Status:	inactive
Facility Type:	Not reported
Receiving Strem:	Not reported
Responsible Official:	Oliver Udemba
Responsible Official Title:	Project Manager
Responsible Official Title 2:	Not reported
Responsible Official Address:	77 Dedham Street
Responsible Official Address 2:	Not reported
Responsible Official Address 3:	Not reported
Responsible Official City:	Canton
Responsible Official State:	MA
Responsible Official Zip:	02021
Responsible Official Phone:	800-225-9702
Responsible Official Phone 2:	Not reported
Responsible Official Fax:	Not reported
Responsible Official Email:	Not reported
expr1023:	Not reported

G50 **CUMBERLAND FARMS 2806** **NH SHWS** **S125358214**
SSW **233 CENTRAL ST** **NH LUST** **N/A**
1/8-1/4 **FRANKLIN, NH** **NH ALLSITES**
0.198 mi.
1045 ft. **Site 4 of 4 in cluster G**

Relative:
Lower

Actual:
284 ft.

SHWS:

Name:	CUMBERLAND FARMS 2806
Address:	233 CENTRAL ST
City,State,Zip:	FRANKLIN, NH
Facility ID:	199003013
Proj Type:	HAZWASTE
Project Manager:	**UNASSIGNED**
Project Site Description:	**HAZARDOUS WASTE DISCHARGE PROJECT**
Expired Date:	**05/10/2021**

LUST:

Name:	CUMBERLAND FARMS 2806
Address:	233 CENTRAL ST
City,State,Zip:	FRANKLIN, NH
Facility ID:	199003013
Project Type:	LUST
Project Manager:	**CLOSED**
Project Site Description:	**LEAKING UNDERGROUND STORAGE TANK PROJECT**
Expired Date:	**02/21/2001**

CUMBERLAND FARMS 2806 (Continued) **S125358214**

Name:	CUMBERLAND FARMS 2806
Address:	233 CENTRAL ST
City,State,Zip:	FRANKLIN, NH
Facility ID:	199003013
Project Type:	LUST
Project Manager:	**CLOSED**
Project Site Description:	**LEAKING UNDERGROUND STORAGE TANK PROJECT**
Expired Date:	**Not reported**

ALLSITES:

Name:	CUMBERLAND FARMS 2806
Address:	233 CENTRAL ST
City,State,Zip:	FRANKLIN, NH
Facility ID:	199003013
Project Type:	UIC
Project Description:	UNDERGROUND INJECTION CONTROL
Project Manager:	CLOSED
Expiration Date:	Not reported

H51 **TERHUNE JONATHAN H DMD** **RCRA NonGen / NLR** **1004750107**
SE **58 FRANKLIN ST** **NHD510157985**
1/8-1/4 **FRANKLIN, NH 03235**
0.207 mi.
1091 ft. **Site 3 of 3 in cluster H**

Relative: **Higher**

Actual: **335 ft.**

RCRA NonGen / NLR:

Date Form Received by Agency:		20141121
Handler Name:	TERHUNE JONATHAN H DMD	
Handler Address:		58 FRANKLIN ST
Handler City,State,Zip:		FRANKLIN, NH 03235
EPA ID:		NHD510157985
Contact Name:		JONATHAN TERHUNE
Contact Address:		Not reported
Contact City,State,Zip:		Not reported
Contact Telephone:		603-934-5503
Contact Fax:		Not reported
Contact Email:		PJ-CAT@COMCAST.NET
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		PO BOX 399
Mailing City,State,Zip:		FRANKLIN, NH 03235
Owner Name:	DR JONATHAN H T	
Owner Type:		Private
Operator Name:	DR JONATHAN H T	
Operator Type:		Private
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No

TERHUNE JONATHAN H DMD (Continued) **1004750107**

Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150608
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D011
Waste Description:	SILVER

TERHUNE JONATHAN H DMD (Continued) **1004750107**

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name: DR JONATHAN H T	
Legal Status:	Private
Date Became Current:	20000228
Date Ended Current:	Not reported
Owner/Operator Address:	58 FRANKLIN ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5503
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name: DR JONATHAN H T	
Legal Status:	Private
Date Became Current:	20000228
Date Ended Current:	Not reported
Owner/Operator Address:	58 FRANKLIN ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5503
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name: DR JONATHAN H T	
Legal Status:	Private
Date Became Current:	20000228
Date Ended Current:	Not reported
Owner/Operator Address:	58 FRANKLIN ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5503
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: DR JONATHAN H TERHUNE	
Legal Status:	Private
Date Became Current:	20000228
Date Ended Current:	Not reported
Owner/Operator Address:	58 FRANKLIN ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5503
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: DR JONATHAN H T	
Legal Status:	Private
Date Became Current:	20000228
Date Ended Current:	Not reported
Owner/Operator Address:	58 FRANKLIN ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5503

TERHUNE JONATHAN H DMD (Continued) **1004750107**

Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name: DR JONATHAN H T	
Legal Status:	Private
Date Became Current:	20000228
Date Ended Current:	Not reported
Owner/Operator Address:	58 FRANKLIN ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5503
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name: DR JONATHAN H TERHUNE	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	58 FRANKLIN ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5503
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name: DR JONATHAN H TERHUNE	
Legal Status:	Private
Date Became Current:	20000228
Date Ended Current:	Not reported
Owner/Operator Address:	58 FRANKLIN ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5503
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name: DR JONATHAN H TERHUNE	
Legal Status:	Private
Date Became Current:	20000228
Date Ended Current:	Not reported
Owner/Operator Address:	58 FRANKLIN ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5503
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name: DR JONATHAN H T	
Legal Status:	Private
Date Became Current:	20000228
Date Ended Current:	Not reported

TERHUNE JONATHAN H DMD (Continued) **1004750107**

Owner/Operator Address:	58 FRANKLIN ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5503
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name: DR JONATHAN H T	
Legal Status:	Private
Date Became Current:	20000228
Date Ended Current:	Not reported
Owner/Operator Address:	58 FRANKLIN ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5503
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name: DR JONATHAN H TERHUNE	
Legal Status:	Private
Date Became Current:	20000228
Date Ended Current:	Not reported
Owner/Operator Address:	58 FRANKLIN ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5503
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name: DR JONATHAN H T	
Legal Status:	Private
Date Became Current:	20000228
Date Ended Current:	Not reported
Owner/Operator Address:	58 FRANKLIN ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5503
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name: DR JONATHAN H TERHUNE	
Legal Status:	Private
Date Became Current:	20000228
Date Ended Current:	Not reported
Owner/Operator Address:	58 FRANKLIN ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5503
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name: DR JONATHAN H TERHUNE	

TERHUNE JONATHAN H DMD (Continued) **1004750107**

Legal Status:	Private
Date Became Current:	20000228
Date Ended Current:	Not reported
Owner/Operator Address:	58 FRANKLIN ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5503
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name: DR JONATHAN H TERHUNE	
Legal Status:	Private
Date Became Current:	20000228
Date Ended Current:	Not reported
Owner/Operator Address:	58 FRANKLIN ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5503
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name: DR JONATHAN H T	
Legal Status:	Private
Date Became Current:	20000228
Date Ended Current:	Not reported
Owner/Operator Address:	58 FRANKLIN ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5503
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name: DR JONATHAN H T	
Legal Status:	Private
Date Became Current:	20000228
Date Ended Current:	Not reported
Owner/Operator Address:	58 FRANKLIN ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-5503
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	20000228
Handler Name: TERHUNE JONATHAN H DMD	
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No

TERHUNE JONATHAN H DMD (Continued) **1004750107**

Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20000228
Handler Name: TERHUNE DR JONATHAN H DMD
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20051015
Handler Name: TERHUNE JONATHAN H DMD
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20081202
Handler Name: TERHUNE JONATHAN H DMD
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20081202
Handler Name: TERHUNE JONATHAN H DMD
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20111205
Handler Name: TERHUNE JONATHAN H DMD

TERHUNE JONATHAN H DMD (Continued) **1004750107**

Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20111205
Handler Name: TERHUNE JONATHAN H DMD
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20111205
Handler Name: TERHUNE JONATHAN H DMD
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20111205
Handler Name: TERHUNE JONATHAN H DMD
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20141121
Handler Name: TERHUNE JONATHAN H DMD
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No

TERHUNE JONATHAN H DMD (Continued) **1004750107**

Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 62121
NAICS Description: OFFICES OF DENTISTS

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

J52 **U S POSTAL SERVICE** **NH UST** **U001150956**
SSE **65 FRANKLIN ST** **N/A**
1/8-1/4 **FRANKLIN, NH**
0.209 mi.
1104 ft. **Site 1 of 3 in cluster J**

Relative: **Higher**
Actual: **334 ft.**

UST:
Name: U S POSTAL SERVICE
Address: 65 FRANKLIN ST
City: FRANKLIN
Facility ID: 112790
Facility Type: FEDERAL- NON-MILITARY
Site Number: 198606048
Owner Name: U S POSTAL SERVICE
Owner Type: FEDERAL GOVERNMENT
Owner Title: Not reported
Owner Address: 65 FRANKLIN ST
Owner Address2: Not reported
Owner City,St,Zip: FRANKLIN, NH 03235
Manager Name: GERARD P. BURKE
Manager Title: POSTMASTER

Tank ID: 1
Status: INACTIVE
Capacity (gal): 3000
Temporary Closed Date: Not reported
Tank Filled Removed: Not reported
Compartment: Not reported
Tank Diameter In Inches: Not reported
Construction Material Comments: Not reported
Meets Dec 22 2015 Deadline: Not reported
Leak Line Detection: Not reported
Leak Line Detection Installed Date: Not reported
Leak Line Detection Test Pass Fail: Not reported
Drop Tube Pass Fail: Not reported
Drain Valve Replaced Date: Not reported
Dry Beak Installed Date: Not reported
Inv Monitor Review Date: Not reported
Dispenser Pan: Not reported

U S POSTAL SERVICE (Continued) **U001150956**

Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	Not reported
Install Date:	01/01/1967
Last Test:	Not reported
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	09/12/1988
Tank Material:	STEEL - BARE/GALV
Closure Date:	Not reported
Tank Secondary:	NO
Product Stored:	#2 HEATING OIL
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	UNKNOWN
Pipe System:	Not reported

53
West
1/8-1/4
0.211 mi.
1116 ft.

PSNH FRANKLIN SUBSTATION
145 WEST BOW ST
FRANKLIN, NH

NH AST **A100228206**
N/A

Relative:
Lower

Actual:
297 ft.

AST:

Facility ID:	9812139
Manager Title:	ENVIRONMENTAL SUPV
Site Number:	199812139
Manager Name:	RICHARD DUMORE
Tank Number:	T6443
Status:	INACTIVE
Date Install:	10/24/1954
Capacity:	1650
Closure Date:	Not reported
Pipe Secondary:	Not reported

PSNH FRANKLIN SUBSTATION (Continued) **A100228206**

Capacity Comments:	Not reported
Permanent Closed Date:	04/13/2012
Tank Secondary:	NONE
Substance Store:	TRANSFORMER OIL
Compartment:	N
Construction Material Comments:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Piping Type:	Not reported
RD Piping Installed Date:	Not reported
Release Detection (RD) Tank Type:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
RD Tank Type Test Pass Fail:	Not reported
Interstitial Monitoring:	Not reported
High Level Alarm:	Not reported
High Level Alarm Sensor Tested Date:	Not reported
High Level Alarm Sensor Test Pass Fail:	Not reported
Fill Remove:	Not reported
Overfill Shutoff:	Not reported
Overfill Shutoff Test Date:	Not reported
Overfill Shutoff Pass Fail:	Not reported
Proper Labelling:	Not reported
Last Internal Inspection Date:	Not reported
Inspection Results:	Not reported
Next Internal Inspection Date:	Not reported
Gauge Type:	Not reported
Tank Wholly Aboveground On Cradles:	Not reported
Tank Cathodic Protection Last Test Date:	Not reported
Piping Location:	Not reported
Piping Material:	NONE
Piping Material Comments:	Not reported
Piping System:	Not reported
Piping Cathodic Protection:	Not reported
Piping Cathodic Protection Last Test Date:	Not reported
Tank Cathodic Protection:	Not reported
Tank Material:	OIL FILLED ELECTRICAL EQUIPMENT

Owner:

Facility ID:	9812139
Site Number:	199812139
Owner Name:	PUBLIC SERVICE CO OF NH
Owner Address:	PO BOX 330
Owner Address 2:	Not reported
Owner State:	NH
Owner City:	MANCHESTER
Owner Zip:	03105-0330
Facility Type:	UTILITIES
Owner Type:	COMMERCIAL/RESIDENTIAL
Owner Title:	PSNH SCIENTIST

Facility ID:	9812139
Manager Title:	ENVIRONMENTAL SUPV
Site Number:	199812139

PSNH FRANKLIN SUBSTATION (Continued) **A100228206**

Manager Name:	RICHARD DUMORE
Tank Number:	T9661
Status:	ACTIVE
Date Install:	04/13/2012
Capacity:	3291
Closure Date:	Not reported
Pipe Secondary:	Not reported
Capacity Comments:	Not reported
Permanent Closed Date:	Not reported
Tank Secondary:	NONE
Substance Store:	TRANSFORMER OIL
Compartment:	N
Construction Material Comments:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Piping Type:	Not reported
RD Piping Installed Date:	Not reported
Release Detection (RD) Tank Type:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
RD Tank Type Test Pass Fail:	Not reported
Interstitial Monitoring:	Not reported
High Level Alarm:	Not reported
High Level Alarm Sensor Tested Date:	Not reported
High Level Alarm Sensor Test Pass Fail:	Not reported
Fill Remove:	Not reported
Overfill Shutoff:	Not reported
Overfill Shutoff Test Date:	Not reported
Overfill Shutoff Pass Fail:	Not reported
Proper Labelling:	Not reported
Last Internal Inspection Date:	Not reported
Inspection Results:	Not reported
Next Internal Inspection Date:	Not reported
Gauge Type:	Not reported
Tank Wholly Aboveground On Cradles:	Not reported
Tank Cathodic Protection Last Test Date:	Not reported
Piping Location:	Not reported
Piping Material:	NONE
Piping Material Comments:	Not reported
Piping System:	Not reported
Piping Cathodic Protection:	Not reported
Piping Cathodic Protection Last Test Date:	Not reported
Tank Cathodic Protection:	Not reported
Tank Material:	OIL FILLED ELECTRICAL EQUIPMENT

Owner:

Facility ID:	9812139
Site Number:	199812139
Owner Name:	PUBLIC SERVICE CO OF NH
Owner Address:	PO BOX 330
Owner Address 2:	Not reported
Owner State:	NH
Owner City:	MANCHESTER
Owner Zip:	03105-0330
Facility Type:	UTILITIES

PSNH FRANKLIN SUBSTATION (Continued) **A100228206**

Owner Type: COMMERCIAL/RESIDENTIAL
Owner Title: PSNH SCIENTIST

K54 **FRANKLIN FIRE DEPARTMENT** **RCRA NonGen / NLR** **1004749747**
WSW **59 W BOW ST** **FINDS** **NHD510060080**
1/8-1/4 **FRANKLIN, NH 03235** **ECHO**
0.226 mi.
1193 ft. **Site 1 of 5 in cluster K**

Relative:
Lower

Actual:
295 ft.

RCRA NonGen / NLR:

Date Form Received by Agency:		20150915
Handler Name:	FRANKLIN FIRE DEPARTMENT	
Handler Address:		59 W BOW ST
Handler City,State,Zip:		FRANKLIN, NH 03235
EPA ID:		NHD510060080
Contact Name:		KEVIN LACHAPELLE
Contact Address:		Not reported
Contact City,State,Zip:		Not reported
Contact Telephone:		603-934-2205
Contact Fax:		Not reported
Contact Email:		KLACHAPELLE@FRANKLINNH.ORG
Contact Title:		Not reported
EPA Region:		01
Land Type:		Municipal
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		59 W BOW ST
Mailing City,State,Zip:		FRANKLIN, NH 03235
Owner Name:	PUBLIC SERVICE	
Owner Type:		Private
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		NN
Sub-Part K Indicator:		Not reported

FRANKLIN FIRE DEPARTMENT (Continued) **1004749747**

Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20151002
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	IGNITABLE WASTE
Waste Code:	D018
Waste Description:	BENZENE

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name: PUBLIC SERVICE	
Legal Status:	Private
Date Became Current:	20001220
Date Ended Current:	Not reported
Owner/Operator Address:	1000 ELM ST
Owner/Operator City,State,Zip:	MANCHESTER, NH 03105
Owner/Operator Telephone:	603-634-2617
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

FRANKLIN FIRE DEPARTMENT (Continued) **1004749747**

Owner/Operator Indicator: Owner
Owner/Operator Name: PUBLIC SERVICE CO OF NH
Legal Status: Private
Date Became Current: 20001220
Date Ended Current: Not reported
Owner/Operator Address: 1000 ELM ST
Owner/Operator City,State,Zip: MANCHESTER, NH 03105
Owner/Operator Telephone: 603-634-2617
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: PUBLIC SERVICE
Legal Status: Private
Date Became Current: 20001220
Date Ended Current: Not reported
Owner/Operator Address: 1000 ELM ST
Owner/Operator City,State,Zip: MANCHESTER, NH 03105
Owner/Operator Telephone: 603-634-2617
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: PUBLIC SERVICE CO OF NH
Legal Status: Municipal
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: P O BOX 330
Owner/Operator City,State,Zip: MANCHESTER, NH 03105
Owner/Operator Telephone: 603-634-2617
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 19990306
Handler Name: PSNH
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150331
Handler Name: FRANKLIN FIRE DEPARTMENT
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No

FRANKLIN FIRE DEPARTMENT (Continued) **1004749747**

Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150915
Handler Name: FRANKLIN FIRE DEPARTMENT
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20001220
Handler Name: PUBLIC SERVICE CO OF NH/FRANKLIN MGP
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

FINDS:
Registry ID: 110066976179

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

FRANKLIN FIRE DEPARTMENT (Continued) **1004749747**

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid:	1004749747
Registry ID:	110066976179
DFR URL:	http://echo.epa.gov/detailed-facility-report?fid=110066976179
Name:	FRANKLIN FIRE DEPARTMENT
Address:	59 W BOW ST
City,State,Zip:	FRANKLIN, NH 03235

K55 **FRANKLIN FIRE STATION** **NH SHWS** **U001555487**
WSW **59 W BOW ST** **NH LUST** **N/A**
1/8-1/4 **FRANKLIN, NH** **NH UST**
0.226 mi. **NH INST CONTROL**
1193 ft. **Site 2 of 5 in cluster K** **NH ALLSITES**
NH AQUEOUS FOAM
Relative: Lower **NH PFAS**

Actual: 295 ft.

SHWS:

Name:	FRANKLIN FIRE STATION
Address:	59 W BOW ST
City,State,Zip:	FRANKLIN, NH
Facility ID:	199306026
Proj Type:	HAZWASTE
Project Manager:	**DREW**
Project Site Description:	**HAZARDOUS WASTE DISCHARGE PROJECT**
Expired Date:	**06/12/2024**

Name:	FRANKLIN FIRE STATION
Address:	59 W BOW ST
City,State,Zip:	FRANKLIN, NH
Facility ID:	199306026
Proj Type:	HAZWASTE
Project Manager:	**DREW**
Project Site Description:	**HAZARDOUS WASTE DISCHARGE PROJECT**
Expired Date:	**Not reported**

LUST:

Name:	FRANKLIN FIRE STATION
Address:	59 W BOW ST
City,State,Zip:	FRANKLIN, NH
Facility ID:	199306026
Project Type:	LUST
Project Manager:	**CLOSED**
Project Site Description:	**LEAKING UNDERGROUND STORAGE TANK PROJECT**
Expired Date:	**Not reported**

UST:

Name:	FRANKLIN FIRE STATION
Address:	59 W BOW ST
City:	FRANKLIN
Facility ID:	110090
Facility Type:	LOCAL GOVERNMENT
Site Number:	199306026
Owner Name:	CITY OF FRANKLIN

FRANKLIN FIRE STATION (Continued) **U001555487**

Owner Type:	STATE OR LOCAL GOVERNMENT
Owner Title:	Not reported
Owner Address:	316 CENTRAL ST
Owner Address2:	Not reported
Owner City,St,Zip:	FRANKLIN, NH 03235
Manager Name:	KEVIN LACHAPELLE
Manager Title:	FIRE CHIEF
Tank ID:	1
Status:	INACTIVE
Capacity (gal):	10000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	Not reported
Install Date:	01/01/1976
Last Test:	Not reported
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	05/01/1988

FRANKLIN FIRE STATION (Continued) **U001555487**

Tank Material:	STEEL - BARE/GALV
Closure Date:	Not reported
Tank Secondary:	NO
Product Stored:	GASOLINE
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	STEEL - BARE/GALV
Pipe System:	Not reported

Tank ID:	2
Status:	INACTIVE
Capacity (gal):	10000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	02/01/1988
Piping Tightness Test Pass Fail:	PASS
Piping Material Comments:	Not reported
Install Date:	01/01/1971
Last Test:	02/01/1988
Spill Installed:	Not reported
Overfill:	Not reported

FRANKLIN FIRE STATION (Continued) **U001555487**

Line Leak Detection:	Not reported
Permanent Closure:	05/18/1993
Tank Material:	STEEL - BARE/GALV
Closure Date:	06/14/1993
Tank Secondary:	NO
Product Stored:	GASOLINE
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	STEEL - BARE/GALV
Pipe System:	Not reported

Tank ID:	3
Status:	INACTIVE
Capacity (gal):	2000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	Not reported
Install Date:	11/11/1911
Last Test:	Not reported

FRANKLIN FIRE STATION (Continued) **U001555487**

Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	10/01/1980
Tank Material:	STEEL - BARE/GALV
Closure Date:	Not reported
Tank Secondary:	NO
Product Stored:	#2 HEATING OIL
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	STEEL - BARE/GALV
Pipe System:	Not reported

Tank ID:	4
Status:	INACTIVE
Capacity (gal):	2000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	Not reported

FRANKLIN FIRE STATION (Continued) **U001555487**

Install Date:	01/01/1970
Last Test:	Not reported
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	05/18/1993
Tank Material:	STEEL - BARE/GALV
Closure Date:	06/14/1993
Tank Secondary:	NO
Product Stored:	#2 HEATING OIL
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	STEEL - BARE/GALV
Pipe System:	Not reported

Tank ID:	5
Status:	INACTIVE
Capacity (gal):	10000
Temporary Closed Date:	02/27/2015
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	96
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	NO
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	12/08/1992
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	PASS
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	11
Release Detection (RD) Tank Type:	VEEDER ROOT
RD Tank Type Installed Date:	12/08/1992
RD Tank Type Tested Date:	07/26/2013
RD Tank Type Test Pass Fail:	PASS
RD Piping Type:	TIGHTNESS TEST
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	11/04/2005
RD Piping Test Pass Fail:	PASS
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	11/04/2005

FRANKLIN FIRE STATION (Continued) **U001555487**

Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	Not reported
Install Date:	12/08/1992
Last Test:	11/04/2005
Spill Installed:	Not reported
Overfill:	07/30/2010
Line Leak Detection:	Not reported
Permanent Closure:	04/01/2015
Tank Material:	COMPOSITE
Closure Date:	04/16/2015
Tank Secondary:	YES
Product Stored:	GASOLINE
Overfill Type:	FLOW SHUTOFF - FLAPPER VALVE
Pipe Secondary:	NO
Pipe Material:	FIBERGLASS
Pipe System:	SUCTION: NO VALVE AT TANK

Tank ID:	6
Status:	INACTIVE
Capacity (gal):	10000
Temporary Closed Date:	02/27/2015
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	96
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	NO
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	12/08/1992
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	PASS
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	8
Release Detection (RD) Tank Type:	VEEDER ROOT
RD Tank Type Installed Date:	12/08/1992
RD Tank Type Tested Date:	07/26/2013
RD Tank Type Test Pass Fail:	PASS
RD Piping Type:	TIGHTNESS TEST
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	11/04/2005
RD Piping Test Pass Fail:	PASS
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported

FRANKLIN FIRE STATION (Continued) **U001555487**

Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	11/04/2005
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	Not reported
Install Date:	12/08/1992
Last Test:	11/04/2005
Spill Installed:	Not reported
Overfill:	12/08/1992
Line Leak Detection:	Not reported
Permanent Closure:	04/01/2015
Tank Material:	COMPOSITE
Closure Date:	04/16/2015
Tank Secondary:	YES
Product Stored:	DIESEL FUEL
Overfill Type:	FLOW SHUTOFF - FLAPPER VALVE
Pipe Secondary:	NO
Pipe Material:	FIBERGLASS
Pipe System:	SUCTION: NO VALVE AT TANK

Inst Control:

Name:	FRANKLIN FIRE STATION
Address:	59 W BOW ST
City,State,Zip:	FRANKLIN, NH
Facility ID:	199306026
Action Date:	05/11/2007
Action Description:	COPY OF RECORDED AUR ACCEPTED
Project Type:	HAZWASTE
Project Management:	DREW

ALLSITES:

Name:	FRANKLIN FIRE STATION
Address:	59 W BOW ST
City,State,Zip:	FRANKLIN, NH
Facility ID:	199306026
Project Type:	TCEVAL
Project Description:	TANK CLOSURE EVALUATION
Project Manager:	CLOSED
Expiration Date:	Not reported

Name:	FRANKLIN FIRE STATION
Address:	59 W BOW ST
City,State,Zip:	FRANKLIN, NH
Facility ID:	199306026
Project Type:	UIC
Project Description:	UNDERGROUND INJECTION CONTROL
Project Manager:	CLOSED
Expiration Date:	Not reported

AQUEOUS FOAM:

Facility ID:	199306026
Name:	FRANKLIN FIRE STATION
Address:	59 W BOW ST
City,State,Zip:	FRANKLIN, NH

PFAS:

FRANKLIN FIRE STATION (Continued) **U001555487**

Name:	FRANKLIN FIRE STATION
Address:	59 W BOW ST
City,State,Zip:	FRANKLIN, NH
Site Number:	199306026
Max PFOA Detected ng/L:	890
Max PFOS Detected ng/L:	10000
Max PFNA Detected ng/L:	480
Max PFHxS Detected ng/L:	1500
Facility Type:	HWRB - Haz Sites
Project Type:	HAZWASTE
Project Manager:	CLOSED

K56 **FRANKLIN GAS WORKS** **EDR MGP** **1008407178**
WSW **59 W BOW STREET** **N/A**
1/8-1/4 **FRANKLIN, NH 03235**
0.226 mi.
1193 ft. **Site 3 of 5 in cluster K**

Relative: **Lower**

Actual: **295 ft.**

Manufactured Gas Plants:
No additional information available

J57 **FAIRPOINT** **NH LUST** **U001558118**
SSE **76 FRANKLIN ST** **NH UST** **N/A**
1/8-1/4 **FRANKLIN, NH**
0.227 mi.
1196 ft. **Site 2 of 3 in cluster J**

Relative: **Higher**

Actual: **336 ft.**

LUST:

Name:	FAIRPOINT
Address:	76 FRANKLIN ST
City,State,Zip:	FRANKLIN, NH
Facility ID:	199306005
Project Type:	LUST
Project Manager:	**CLOSED**
Project Site Description:	**LEAKING UNDERGROUND STORAGE TANK PROJECT**
Expired Date:	**Not reported**

UST:

Name:	FAIRPOINT
Address:	76 FRANKLIN ST
City:	FRANKLIN
Facility ID:	220527
Facility Type:	UTILITIES
Site Number:	199306005
Owner Name:	CONSOLIDATED COMMUNICATIONS OF NORTHERN NEW ENGLAND CO LLC
Owner Type:	COMMERCIAL/RESIDENTIAL
Owner Title:	Not reported
Owner Address:	5 DAVIS FARM RD FL 2
Owner Address2:	Not reported
Owner City,St,Zip:	PORTLAND, ME 04103
Manager Name:	GEORGE SAUNDERS
Manager Title:	DIRECTOR CENTRALIZED SERVICES
Tank ID:	1

FAIRPOINT (Continued) **U001558118**

Status:	INACTIVE
Capacity (gal):	1000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	07/17/1989
Piping Tightness Test Pass Fail:	PASS
Piping Material Comments:	Not reported
Install Date:	01/01/1947
Last Test:	07/17/1989
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	11/11/1911
Tank Material:	STEEL - BARE/GALV
Closure Date:	Not reported
Tank Secondary:	NO
Product Stored:	#2 HEATING OIL
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	COPPER
Pipe System:	SUCTION: OLD CODE

FAIRPOINT (Continued) **U001558118**

Tank ID:	2
Status:	INACTIVE
Capacity (gal):	1000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	07/17/1989
Piping Tightness Test Pass Fail:	PASS
Piping Material Comments:	Not reported
Install Date:	01/01/1955
Last Test:	07/17/1989
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	12/28/1992
Tank Material:	STEEL - BARE/GALV
Closure Date:	01/26/1993
Tank Secondary:	NO
Product Stored:	DIESEL FUEL
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	STEEL - BARE/GALV
Pipe System:	SUCTION: OLD CODE

FAIRPOINT (Continued) **U001558118**

Tank ID:	3
Status:	INACTIVE
Capacity (gal):	500
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	Not reported
Install Date:	01/01/1947
Last Test:	Not reported
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	12/23/1992
Tank Material:	STEEL - BARE/GALV
Closure Date:	01/26/1993
Tank Secondary:	NO
Product Stored:	DIESEL FUEL
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	STEEL - BARE/GALV
Pipe System:	Not reported

FAIRPOINT (Continued) **U001558118**

Tank ID:	4
Status:	ACTIVE
Capacity (gal):	1000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	48
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	YES
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	08/25/2008
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	PASS
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	40.12
Release Detection (RD) Tank Type:	VEEDER ROOT
RD Tank Type Installed Date:	12/30/1992
RD Tank Type Tested Date:	11/01/2021
RD Tank Type Test Pass Fail:	PASS
RD Piping Type:	VEEDER ROOT
RD Piping Installed Date:	12/30/1992
RD Piping Tested Date:	11/01/2021
RD Piping Test Pass Fail:	PASS
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	PVC SLEEVE
Install Date:	12/30/1992
Last Test:	06/26/1996
Spill Installed:	Not reported
Overfill:	12/30/1992
Line Leak Detection:	Not reported
Permanent Closure:	Not reported
Tank Material:	FIBERGLASS
Closure Date:	Not reported
Tank Secondary:	YES
Product Stored:	EMERGENCY GENERATOR FUEL
Overfill Type:	AUDIBLE ALARM
Pipe Secondary:	YES
Pipe Material:	COPPER
Pipe System:	SUCTION: OLD CODE

J58 **FAIRPOINT COMMUNICATIONS** **RCRA NonGen / NLR** **1000112331**
SSE **76 FRANKLIN ST** **NHD980512057**
1/8-1/4 **FRANKLIN, NH 03235**
0.227 mi.
1196 ft. **Site 3 of 3 in cluster J**

Relative: **Higher**
Actual: **336 ft.**

RCRA NonGen / NLR:

Date Form Received by Agency:		20141119
Handler Name:	FAIRPOINT COMMUNICATIONS	
Handler Address:		76 FRANKLIN ST
Handler City,State,Zip:		FRANKLIN, NH 03235
EPA ID:		NHD980512057
Contact Name:		SCOTT ALLOCCA
Contact Address:		Not reported
Contact City,State,Zip:		Not reported
Contact Telephone:		207-535-4157
Contact Fax:		Not reported
Contact Email:		SALLOCCA@FAIRPOINT.COM
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		1 DAVIS FARM RD
Mailing City,State,Zip:		PORTLAND, ME 04101
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		NN
Sub-Part K Indicator:		Not reported
Commercial TSD Indicator:		No
Treatment Storage and Disposal Type:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
Permit Renewals Workload Universe:		Not reported

FAIRPOINT COMMUNICATIONS (Continued) **1000112331**

Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150109
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	IGNITABLE WASTE
Waste Code:	D002
Waste Description:	CORROSIVE WASTE

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	NEW ENGLAND TELEPHONE CO BOS
Legal Status:	Other
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	OWNERSTREET
Owner/Operator City,State,Zip:	OWNERCITY, NH 99999
Owner/Operator Telephone:	603-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	19990306
Handler Name:	NEW ENGLAND TELEPHONE CO
Federal Waste Generator Description:	Not a generator, verified

FAIRPOINT COMMUNICATIONS (Continued) **1000112331**

State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20140909
Handler Name: FAIRPOINT COMMUNICATIONS
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20141119
Handler Name: FAIRPOINT COMMUNICATIONS
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19810302
Handler Name: NEW ENGLAND TELEPHONE CENTRAL OFF
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

FAIRPOINT COMMUNICATIONS (Continued) **1000112331**

Evaluation Action Summary:
Evaluations: No Evaluations Found

K59 **TRADEBE HHW** **RCRA-VSQG** **1007203826**
SW **43 W BOW STRTE 127** **NHD510080286**
1/8-1/4 **FRANKLIN, NH 03235**
0.229 mi.
1209 ft. **Site 4 of 5 in cluster K**

Relative: RCRA-VSQG:
Lower

Actual:
294 ft.

Date Form Received by Agency:		20210728
Handler Name:	TRADEBE HHW	
Handler Address:		43 W BOW STRTE 127
Handler City,State,Zip:		FRANKLIN, NH 03235
EPA ID:		NHD510080286
Contact Name:		KYLE DUSSAULT
Contact Address:		Not reported
Contact City,State,Zip:		Not reported
Contact Telephone:		603-380-4910
Contact Fax:		Not reported
Contact Email:		KYLE.DUSSAULT@TRADEBE.COM
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private
Federal Waste Generator Description:		Conditionally Exempt Small Quantity Generator
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Handler Activities
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		410 SHATTUCK WAY
Mailing City,State,Zip:		NEWINGTON, NH 03801
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		N

TRADEBE HHW (Continued) **1007203826**

Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20210812
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	IGNITABLE WASTE

Historic Generators:

Receive Date:	20050328
Handler Name:	CLEAN HARBORS LRPC HHWC
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

TRADEBE HHW (Continued) **1007203826**

Receive Date: 20050505
Handler Name: CLEAN HARBORS LRPC HHWC
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20050725
Handler Name: CLEAN HARBORS LRPC HHWC
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20050902
Handler Name: CLEAN HARBORS LRPC HHWC
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070723
Handler Name: CLEAN HARBORS HHWC
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20081009
Handler Name: CLEAN HARBORS HHWC
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No

TRADEBE HHW (Continued) **1007203826**

Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20090722
Handler Name:	CLEAN HARBORS HHWC
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20100726
Handler Name:	CLEAN HARBORS HHWC
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20081009
Handler Name:	CLEAN HARBORS HHWC
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20090722
Handler Name:	CLEAN HARBORS HHWC
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No

TRADEBE HHW (Continued) **1007203826**

Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20090904
Handler Name: CLEAN HARBORS HHWC
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20100726
Handler Name: CLEAN HARBORS HHWC
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20100929
Handler Name: CLEAN HARBORS HHWC
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20110726
Handler Name: CLEAN HARBORS HHWC
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20110915
Handler Name: CLEAN HARBORS HHWC

TRADEBE HHW (Continued) **1007203826**

Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20110915
Handler Name: CLEAN HARBORS HHWC	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20110915
Handler Name: CLEAN HARBORS HHWC	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20110915
Handler Name: CLEAN HARBORS HHWC	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20110915
Handler Name: CLEAN HARBORS HHWC	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No

TRADEBE HHW (Continued) **1007203826**

Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20110915
Handler Name: CLEAN HARBORS HHWC
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20120725
Handler Name: CLEAN HARBORS HHWC
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20110915
Handler Name: CLEAN HARBORS HHWC
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20120725
Handler Name: CLEAN HARBORS HHWC
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

TRADEBE HHW (Continued) **1007203826**

Receive Date: 20110915
Handler Name: CLEAN HARBORS HHWC
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20120725
Handler Name: CLEAN HARBORS HHWC
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20121001
Handler Name: CLEAN HARBORS HHWC
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20130723
Handler Name: CLEAN HARBORS HHWC
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20130723
Handler Name: CLEAN HARBORS HHWC
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No

TRADEBE HHW (Continued) **1007203826**

Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20130723
Handler Name:	CLEAN HARBORS HHWC
Federal Waste Generator Description:	Small Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20131106
Handler Name:	CLEAN HARBORS HHWC
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20140724
Handler Name:	CLEAN HARBORS HHWC
Federal Waste Generator Description:	Small Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20140918
Handler Name:	CLEAN HARBORS HHWC
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No

TRADEBE HHW (Continued) **1007203826**

Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150722
Handler Name: CLEAN HARBORS HHWC
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150915
Handler Name: CLEAN HARBORS HHWC
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20170628
Handler Name: CLEAN VENTURE HHW
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20170905
Handler Name: CLEAN VENTURE HHW
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20190718
Handler Name: TRADEBE HHW

TRADEBE HHW (Continued) **1007203826**

Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20190828
Handler Name: TRADEBE HHW	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20200720
Handler Name: TRADEBE HHW	
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20200908
Handler Name: TRADEBE HHW	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20210728
Handler Name: TRADEBE HHW	
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No

TRADEBE HHW (Continued) **1007203826**

Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 20000412
Handler Name: SAFETY-KLEEN (NE) INC
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

K60 **CLEAN VENTURE HHW** **PA MANIFEST** **S123092486**
SW **43 W BOW ST** **N/A**
1/8-1/4 **FRANKLIN, NH 03235**
0.229 mi.
1209 ft. **Site 5 of 5 in cluster K**

Relative:
Lower

Actual:
294 ft.

Manifest Details:
Year: 2017
Manifest Number: 015625212JJK
Manifest Type: TSD Copy
Generator EPA Id: NHD510080286
Generator Date: 08/11/2017
Mailing Address: Not reported
Mailing City,St,Zip: Not reported
Contact Name: Not reported
Contact Phone: Not reported
TSD EPA Id: Not reported
TSD Date: Not reported
TSD Facility Name: Cycle Chem Inc
TSD Facility Address: 550 Industrial Rd
TSD Facility City: Lewisberry
TSD Facility State: PA
Facility Telephone: Not reported
Page Number: 1
Line Number: 1
Waste Number: D001
Container Number: 1

CLEAN VENTURE HHW (Continued) **S123092486**

Container Type:	Fiberboard or plastic drums, barrels, kegs
Waste Quantity:	10
Unit:	Pounds
Handling Code:	Not reported
TSP EPA Id:	PAD067098822
Date TSP Sig:	Not reported

61
NE
1/8-1/4
0.236 mi.
1244 ft.

DAN HUGHES RESIDENCE **NH ALLSITES** **S105771407**
34 BEATON ST **N/A**
FRANKLIN, NH

Relative:
Higher

Actual:
434 ft.

ALLSITES:

Name:	DAN HUGHES RESIDENCE
Address:	34 BEATON ST
City,State,Zip:	FRANKLIN, NH
Facility ID:	200005051
Project Type:	OPUF
Project Description:	ON-PREMISE USE FAC. CONTAINING FUEL OIL
Project Manager:	CLOSED
Expiration Date:	Not reported

62
SE
1/8-1/4
0.240 mi.
1267 ft.

DRUG ENFORCEMENT AGENCY **RCRA NonGen / NLR** **1018277036**
12 SPRING ST **FINDS** **NHD510218167**
FRANKLIN, NH 03235 **ECHO**

Relative:
Higher

Actual:
370 ft.

RCRA NonGen / NLR:

Date Form Received by Agency:		20151101
Handler Name:	DRUG ENFORCEMENT AGENCY	
Handler Address:		12 SPRING ST
Handler City,State,Zip:		FRANKLIN, NH 03235
EPA ID:		NHD510218167
Contact Name:		MICHAEL LECUYER
Contact Address:		Not reported
Contact City,State,Zip:		Not reported
Contact Telephone:		603-628-7411
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		01
Land Type:		Federal
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		324 S RIVER RD
Mailing City,State,Zip:		BEDFORD, NH 03110
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	

DRUG ENFORCEMENT AGENCY (Continued) **1018277036**

Operator Type:	Not reported
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	The land is federally-owned
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20160525
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

DRUG ENFORCEMENT AGENCY (Continued) **1018277036**

Historic Generators:

Receive Date: 20151022
Handler Name: DRUG ENFORCEMENT AGENCY
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20151021
Handler Name: DRUG ENFORCEMENT AGENCY
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20151022
Handler Name: DRUG ENFORCEMENT AGENCY
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20151021
Handler Name: DRUG ENFORCEMENT AGENCY
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20151101
Handler Name: DRUG ENFORCEMENT AGENCY
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported

DRUG ENFORCEMENT AGENCY (Continued) **1018277036**

Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

FINDS:
Registry ID: 110067203635

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid:	1018277036
Registry ID:	110067203635
DFR URL:	http://echo.epa.gov/detailed-facility-report?fid=110067203635
Name:	DRUG ENFORCEMENT AGENCY
Address:	12 SPRING ST
City,State,Zip:	FRANKLIN, NH 03235

63
SSE
1/4-1/2
0.268 mi.
1413 ft.

STONE RESIDENCE **NH ALLSITES** **S110703326**
102 FRANKLIN ST **N/A**
FRANKLIN, NH

Relative: Higher

Actual: 325 ft.

ALLSITES:

Name:	STONE RESIDENCE
Address:	102 FRANKLIN ST
City,State,Zip:	FRANKLIN, NH
Facility ID:	201101055
Project Type:	OPUF
Project Description:	ON-PREMISE USE FAC. CONTAINING FUEL OIL
Project Manager:	CLOSED

STONE RESIDENCE (Continued) **S110703326**

Expiration Date: Not reported

L64 **PACKERS OUTLET** **NH LUST** **U000347336**
SSW **195 CENTRAL ST** **NH UST** **N/A**
1/4-1/2 **FRANKLIN, NH** **NH ASBESTOS**
0.279 mi.
1472 ft. **Site 1 of 5 in cluster L**

Relative:
Lower

Actual:
284 ft.

LUST:

Name:	PACKERS OUTLET
Address:	195 CENTRAL ST
City,State,Zip:	FRANKLIN, NH
Facility ID:	198904056
Project Type:	LUST
Project Manager:	**CLOSED**
Project Site Description:	**LEAKING UNDERGROUND STORAGE TANK PROJECT**
Expired Date:	**04/06/1994**

UST:

Name:	PACKERS OUTLET
Address:	195 CENTRAL ST
City:	FRANKLIN
Facility ID:	110673
Facility Type:	GAS STATION
Site Number:	198904056
Owner Name:	RALPH BOLES
Owner Type:	COMMERCIAL/RESIDENTIAL
Owner Title:	Not reported
Owner Address:	PO BOX 264
Owner Address2:	Not reported
Owner City,St,Zip:	BELMONT, NH 03220-0264
Manager Name:	RALPH BOLES
Manager Title:	OWNER
Tank ID:	1
Status:	INACTIVE
Capacity (gal):	4000
Temporary Closed Date:	02/17/2010
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	64
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	04/01/1985
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	PASS
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	04/30/2005
Dispenser Pan:	Not reported
Overfill Length In Inches:	8
Release Detection (RD) Tank Type:	VEEDER ROOT
RD Tank Type Installed Date:	10/12/1994
RD Tank Type Tested Date:	05/10/2005
RD Tank Type Test Pass Fail:	PASS
RD Piping Type:	TIGHTNESS TEST

PACKERS OUTLET (Continued) **U000347336**

RD Piping Installed Date:	Not reported
RD Piping Tested Date:	10/12/1994
RD Piping Test Pass Fail:	PASS
Corrosion Protection (CP) Tank:	IMPRESSED CURRENT
CP Tank Installed Date:	04/14/1985
CP Tank Tested Date:	08/17/2007
CP Tank Test Pass Fail:	PASS
CP Piping:	IMPRESSED CURRENT
CP Piping Installed Date:	04/14/1985
CP Piping Tested Date:	08/17/2007
CP Piping Test Pass Fail:	PASS
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	10/12/1994
Piping Tightness Test Pass Fail:	PASS
Piping Material Comments:	IMPRESSED CURRRENT
Install Date:	04/01/1985
Last Test:	10/12/1994
Spill Installed:	Not reported
Overfill:	04/01/1985
Line Leak Detection:	Not reported
Permanent Closure:	07/23/2010
Tank Material:	STEEL-CORR. PROT.
Closure Date:	09/03/2010
Tank Secondary:	NO
Product Stored:	GASOLINE
Overfill Type:	FLOW SHUTOFF - FLAPPER VALVE
Pipe Secondary:	NO
Pipe Material:	STEEL-CORR. PROT.
Pipe System:	SUCTION: NO VALVE AT TANK

Tank ID:	2
Status:	INACTIVE
Capacity (gal):	4000
Temporary Closed Date:	02/17/2010
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	64
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	04/01/1985
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	04/30/2005
Dispenser Pan:	Not reported
Overfill Length In Inches:	7
Release Detection (RD) Tank Type:	VEEDER ROOT
RD Tank Type Installed Date:	10/12/1994
RD Tank Type Tested Date:	05/10/2005

PACKERS OUTLET (Continued) **U000347336**

RD Tank Type Test Pass Fail:	PASS
RD Piping Type:	TIGHTNESS TEST
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	10/12/1994
RD Piping Test Pass Fail:	PASS
Corrosion Protection (CP) Tank:	IMPRESSED CURRENT
CP Tank Installed Date:	04/14/1985
CP Tank Tested Date:	08/17/2007
CP Tank Test Pass Fail:	PASS
CP Piping:	IMPRESSED CURRENT
CP Piping Installed Date:	04/14/1985
CP Piping Tested Date:	08/17/2007
CP Piping Test Pass Fail:	PASS
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	10/12/1994
Piping Tightness Test Pass Fail:	PASS
Piping Material Comments:	IMPRESSED CURRENT
Install Date:	04/01/1985
Last Test:	10/12/1994
Spill Installed:	Not reported
Overfill:	04/01/1985
Line Leak Detection:	Not reported
Permanent Closure:	07/23/2010
Tank Material:	STEEL-CORR. PROT.
Closure Date:	09/03/2010
Tank Secondary:	NO
Product Stored:	DIESEL FUEL
Overfill Type:	FLOW SHUTOFF - FLAPPER VALVE
Pipe Secondary:	NO
Pipe Material:	STEEL-CORR. PROT.
Pipe System:	SUCTION: NO VALVE AT TANK

Tank ID:	3
Status:	INACTIVE
Capacity (gal):	4000
Temporary Closed Date:	02/17/2010
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	64
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	04/01/1985
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	PASS
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	04/30/2005
Dispenser Pan:	Not reported
Overfill Length In Inches:	13.5
Release Detection (RD) Tank Type:	VEEDER ROOT

PACKERS OUTLET (Continued) **U000347336**

RD Tank Type Installed Date:	10/13/1994
RD Tank Type Tested Date:	05/10/2005
RD Tank Type Test Pass Fail:	PASS
RD Piping Type:	TIGHTNESS TEST
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	10/13/1994
RD Piping Test Pass Fail:	PASS
Corrosion Protection (CP) Tank:	IMPRESSED CURRENT
CP Tank Installed Date:	04/14/1985
CP Tank Tested Date:	08/17/2007
CP Tank Test Pass Fail:	PASS
CP Piping:	IMPRESSED CURRENT
CP Piping Installed Date:	04/14/1985
CP Piping Tested Date:	08/17/2007
CP Piping Test Pass Fail:	PASS
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	10/13/1994
Piping Tightness Test Pass Fail:	PASS
Piping Material Comments:	IMPRESSED CURRENT
Install Date:	04/01/1985
Last Test:	10/13/1994
Spill Installed:	Not reported
Overfill:	04/01/1985
Line Leak Detection:	Not reported
Permanent Closure:	07/23/2010
Tank Material:	STEEL-CORR. PROT.
Closure Date:	09/03/2010
Tank Secondary:	NO
Product Stored:	GASOLINE
Overfill Type:	FLOW SHUTOFF - FLAPPER VALVE
Pipe Secondary:	NO
Pipe Material:	STEEL-CORR. PROT.
Pipe System:	SUCTION: NO VALVE AT TANK

Tank ID:	4
Status:	INACTIVE
Capacity (gal):	4000
Temporary Closed Date:	02/17/2010
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	64
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	04/01/1985
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	PASS
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	04/30/2005
Dispenser Pan:	Not reported

PACKERS OUTLET (Continued) **U000347336**

Overfill Length In Inches:	8
Release Detection (RD) Tank Type:	VEEDER ROOT
RD Tank Type Installed Date:	10/13/1994
RD Tank Type Tested Date:	05/10/2005
RD Tank Type Test Pass Fail:	PASS
RD Piping Type:	TIGHTNESS TEST
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	10/13/1994
RD Piping Test Pass Fail:	PASS
Corrosion Protection (CP) Tank:	IMPRESSED CURRENT
CP Tank Installed Date:	04/14/1985
CP Tank Tested Date:	08/17/2007
CP Tank Test Pass Fail:	PASS
CP Piping:	IMPRESSED CURRENT
CP Piping Installed Date:	04/14/1985
CP Piping Tested Date:	08/17/2007
CP Piping Test Pass Fail:	PASS
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	10/13/1994
Piping Tightness Test Pass Fail:	PASS
Piping Material Comments:	IMPRESSED CURRENT
Install Date:	04/01/1985
Last Test:	10/13/1994
Spill Installed:	Not reported
Overfill:	04/01/1985
Line Leak Detection:	Not reported
Permanent Closure:	07/23/2010
Tank Material:	STEEL-CORR. PROT.
Closure Date:	09/03/2010
Tank Secondary:	NO
Product Stored:	GASOLINE
Overfill Type:	FLOW SHUTOFF - FLAPPER VALVE
Pipe Secondary:	NO
Pipe Material:	STEEL-CORR. PROT.
Pipe System:	SUCTION: NO VALVE AT TANK

ASBESTOS:

Name:	ALL-WAYS WRECKING ALL-WAYS RECYCLING
Address:	195 CENTRAL ST
City,State,Zip:	FRANKLIN, NH
ID Number:	NH102348
Pipes Reg Asb Containing Material:	Not reported
Surface Area RACM:	Not reported
Surface Area of Category 1:	Not reported
Surface Area of Category 2:	Not reported
Start Date:	11/04/2019
End Date:	11/06/2019
Record Date:	10/18/2019
Friable LF:	Not reported
Friable SqFt:	Not reported
Friable CY:	Not reported
NonFriable LF:	Not reported

PACKERS OUTLET (Continued) **U000347336**

NonFriable SqFt: Not reported
NonFriable CY: Not reported

L65 **FMR CIAO PASTA** **NH BROWNFIELDS** **S122219863**
SSW **194 - 202 CENTRAL ST** **NH ALLSITES** **N/A**
1/4-1/2 **FRANKLIN, NH** **NH PFAS**
0.279 mi.
1473 ft. **Site 2 of 5 in cluster L**

Relative: **Lower**
Actual: **287 ft.**

BROWNFIELDS:
Name: FMR CIAO PASTA
Address: 194 - 202 CENTRAL ST
City,State,Zip: FRANKLIN, NH
Facility ID: 201704004
Site Latitude: 43.443548
Site Longitude: -71.650436
Site Total Acreage: Not reported

ALLSITES:
Name: FMR CIAO PASTA
Address: 194 - 202 CENTRAL ST
City,State,Zip: FRANKLIN, NH
Facility ID: 201704004
Project Type: SITEEVALHW
Project Description: UNSOLICITED SITE ASSESSMENT REVIEWED BY HWRB
Project Manager: DREW
Expiration Date: Not reported

PFAS:
Name: FMR CIAO PASTA
Address: 194 - 202 CENTRAL ST
City,State,Zip: FRANKLIN, NH
Site Number: 201704004
Max PFOA Detected ng/L: 120
Max PFOS Detected ng/L: 210
Max PFNA Detected ng/L: 16
Max PFHxS Detected ng/L: 120
Facility Type: HWRB - Haz Sites
Project Type: SITEEVALHW
Project Manager: DREW

L66 **CIAO PASTA** **US BROWNFIELDS** **1024008538**
SSW **194-202 CENTRAL STREET** **FINDS** **N/A**
1/4-1/2 **FRANKLIN, NH 3235**
0.279 mi.
1473 ft. **Site 3 of 5 in cluster L**

Relative: **Lower**
Actual: **287 ft.**

US BROWNFIELDS:
Name: CIAO PASTA
Address: 194-202 CENTRAL STREET
City,State,Zip: FRANKLIN, NH 3235
Recipient Name: Lakes Region Planning Commission
Grant Type: Assessment
Property Number: Lot 131, Lot 135, Lot 136
Parcel size: 1.07

CIAO PASTA (Continued) **1024008538**

Latitude:	43.4433918
Longitude:	-71.6505545
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	Former Use: The target property consists of three (3) individual parcels collectively referred to as the target property and according to the Franklin Assessor s Office are identified as follows: TAX MAP PARCEL NUMBERS ADDRESS ACREAGE N8 117-131-00 196 Central Street 0.19 N8 117-135-00 194 Central Street 0.53 N8 117-136-00 202 Central Street 0.35 Lot 131 formerly contained an approximately 1,994 square-foot (sq. ft.) one (1) story vacant restaurant building (formerly known as Ciao Pasta) with an approximate 50 sq. ft. storage shed and associated asphalt-paved parking areas. Lot 135 contains an approximate 7,900 sq. ft. concrete slab with a partial basement, and formerly contained an approximately 2,000 sq. ft. metal frame storage shed, as well as associated asphalt-paved parking areas. Lot 136 contains an approximate 1,200 sq. ft. wooden garage building with associated unpaved and asphalt-paved parking areas. The former restaurant building and metal frame storage shed were removed during previous phases of investigation to facilitate underground tank and hydraulic reservoir removals.
Datum:	-
Acres Property ID:	235063
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	00A00022
Start Date:	-
Ownership Entity:	Government
Completion Date:	-
Current Owner:	City of Franklin, NH
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	Y
IC in place date:	-

CIAO PASTA (Continued) **1024008538**

IC in place:	N
State/tribal program date:	4/10/2017
State/tribal program ID:	201704004
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	Y
Other contams found description:	PFAS
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	-
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	1.07
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.07
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-

CIAO PASTA (Continued) **1024008538**

SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	Y
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	Not reported
Below Poverty Number:	625
Below Poverty Percent:	26.3
Meidan Income:	9252
Meidan Income Number:	1210
Meidan Income Percent:	50.93
Vacant Housing Number:	75
Vacant Housing Percent:	8.04
Unemployed Number:	153
Unemployed Percent:	6.44

Name:	CIAO PASTA
Address:	194-202 CENTRAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	Lot 131, Lot 135, Lot 136
Parcel size:	1.07
Latitude:	43.4433918
Longitude:	-71.6505545
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	Former Use: The target property consists of three (3) individual parcels collectively referred to as the target property and according to the Franklin Assessor s Office are identified as follows: TAX MAP PARCEL NUMBERS ADDRESS ACREAGE N8 117-131-00 196 Central Street 0.19 N8 117-135-00 194 Central Street 0.53 N8 117-136-00 202 Central Street 0.35 Lot 131 formerly contained an approximately 1,994 square-foot (sq. ft.) one (1) story vacant restaurant building (formerly known as Ciao Pasta) with an approximate 50 sq. ft. storage shed and associated asphalt-paved parking areas. Lot 135 contains an approximate 7,900 sq. ft. concrete slab with a partial basement, and formerly contained an approximately 2,000 sq. ft. metal frame storage shed, as well as associated asphalt-paved parking areas. Lot 136 contains an approximate 1,200 sq. ft. wooden garage building with

CIAO PASTA (Continued) **1024008538**

associated unpaved and asphalt-paved parking areas. The former restaurant building and metal frame storage shed were removed during previous phases of investigation to facilitate underground tank and hydraulic reservoir removals.

Datum:	-
Acres Property ID:	235063
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	25500
Redev. Funding Source:	City of Franklin
Redev. Funding Entity Name:	Local Funding
Redevelopment Start Date:	9/8/2017
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	00A00022
Start Date:	-
Ownership Entity:	Government
Completion Date:	-
Current Owner:	City of Franklin, NH
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	Y
IC in place date:	-
IC in place:	N
State/tribal program date:	4/10/2017
State/tribal program ID:	201704004
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-

CIAO PASTA (Continued) **1024008538**

Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	Y
Other contams found description:	PFAS
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	-
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	1.07
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.07
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	Y
Building material media cleaned up:	-

CIAO PASTA (Continued) **1024008538**

Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	Not reported
Below Poverty Number:	625
Below Poverty Percent:	26.3
Meidan Income:	9252
Meidan Income Number:	1210
Meidan Income Percent:	50.93
Vacant Housing Number:	75
Vacant Housing Percent:	8.04
Unemployed Number:	153
Unemployed Percent:	6.44
Name:	CIAO PASTA
Address:	194-202 CENTRAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	R1 TBA - New Hampshire (STAG Funded)
Grant Type:	TBA
Property Number:	Lot 131, Lot 135, Lot 136
Parcel size:	1.07
Latitude:	43.4433918
Longitude:	-71.6505545
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	Former Use: The target property consists of three (3) individual parcels collectively referred to as the target property and according to the Franklin Assessor s Office are identified as follows: TAX MAP PARCEL NUMBERS ADDRESS ACREAGE N8 117-131-00 196 Central Street 0.19 N8 117-135-00 194 Central Street 0.53 N8 117-136-00 202 Central Street 0.35 Lot 131 formerly contained an approximately 1,994 square-foot (sq. ft.) one (1) story vacant restaurant building (formerly known as Ciao Pasta) with an approximate 50 sq. ft. storage shed and associated asphalt-paved parking areas. Lot 135 contains an approximate 7,900 sq. ft. concrete slab with a partial basement, and formerly contained an approximately 2,000 sq. ft. metal frame storage shed, as well as associated asphalt-paved parking areas. Lot 136 contains an approximate 1,200 sq. ft. wooden garage building with associated unpaved and asphalt-paved parking areas. The former restaurant building and metal frame storage shed were removed during previous phases of investigation to facilitate underground tank and hydraulic reservoir removals.
Datum:	-
Acres Property ID:	235063
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	100000
Assessment Funding Source:	EPA
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-

CIAO PASTA (Continued) **1024008538**

Redevelopment Start Date:	-
Assessment Funding Entity:	US EPA - TBA Funding
Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	Phase II Environmental Assessment
Accomplishment Count:	N
Cooperative Agreement Number:	n/a
Start Date:	4/13/2020
Ownership Entity:	Government
Completion Date:	7/14/2020
Current Owner:	City of Franklin, NH
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	Y
IC in place date:	-
IC in place:	N
State/tribal program date:	4/10/2017
State/tribal program ID:	201704004
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	Y
Other contams found description:	PFAS
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	-
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-

CIAO PASTA (Continued) **1024008538**

Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	1.07
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.07
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	Y
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	Not reported
Below Poverty Number:	625
Below Poverty Percent:	26.3
Meidan Income:	9252
Meidan Income Number:	1210
Meidan Income Percent:	50.93
Vacant Housing Number:	75
Vacant Housing Percent:	8.04
Unemployed Number:	153
Unemployed Percent:	6.44

Name:	CIAO PASTA
Address:	194-202 CENTRAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	R1 TBA - New Hampshire (STAG Funded)

CIAO PASTA (Continued) **1024008538**

Grant Type:	TBA
Property Number:	Lot 131, Lot 135, Lot 136
Parcel size:	1.07
Latitude:	43.4433918
Longitude:	-71.6505545
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	Former Use: The target property consists of three (3) individual parcels collectively referred to as the target property and according to the Franklin Assessor s Office are identified as follows: TAX MAP PARCEL NUMBERS ADDRESS ACREAGE N8 117-131-00 196 Central Street 0.19 N8 117-135-00 194 Central Street 0.53 N8 117-136-00 202 Central Street 0.35 Lot 131 formerly contained an approximately 1,994 square-foot (sq. ft.) one (1) story vacant restaurant building (formerly known as Ciao Pasta) with an approximate 50 sq. ft. storage shed and associated asphalt-paved parking areas. Lot 135 contains an approximate 7,900 sq. ft. concrete slab with a partial basement, and formerly contained an approximately 2,000 sq. ft. metal frame storage shed, as well as associated asphalt-paved parking areas. Lot 136 contains an approximate 1,200 sq. ft. wooden garage building with associated unpaved and asphalt-paved parking areas. The former restaurant building and metal frame storage shed were removed during previous phases of investigation to facilitate underground tank and hydraulic reservoir removals.
Datum:	-
Acres Property ID:	235063
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	n/a
Start Date:	-
Ownership Entity:	Government
Completion Date:	-
Current Owner:	City of Franklin, NH
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y

CIAO PASTA (Continued) **1024008538**

IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	Y
IC in place date:	-
IC in place:	N
State/tribal program date:	4/10/2017
State/tribal program ID:	201704004
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	Y
Other contams found description:	PFAS
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	-
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	1.07
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.07
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-

CIAO PASTA (Continued) **1024008538**

No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	Y
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	Not reported
Below Poverty Number:	625
Below Poverty Percent:	26.3
Meidan Income:	9252
Meidan Income Number:	1210
Meidan Income Percent:	50.93
Vacant Housing Number:	75
Vacant Housing Percent:	8.04
Unemployed Number:	153
Unemployed Percent:	6.44

Name:	CIAO PASTA
Address:	194-202 CENTRAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	Lot 131, Lot 135, Lot 136
Parcel size:	1.07
Latitude:	43.4433918
Longitude:	-71.6505545
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	Former Use: The target property consists of three (3) individual parcels collectively referred to as the target property and according to the Franklin Assessor s Office are identified as follows: TAX MAP PARCEL NUMBERS ADDRESS ACREAGE N8 117-131-00 196 Central Street 0.19 N8 117-135-00 194 Central Street 0.53 N8 117-136-00 202 Central Street 0.35 Lot 131 formerly contained an approximately 1,994 square-foot (sq. ft.) one (1) story vacant restaurant building (formerly known as Ciao Pasta) with an approximate 50 sq. ft. storage shed and associated asphalt-paved parking areas. Lot 135 contains an approximate 7,900 sq. ft. concrete slab with a partial basement, and

CIAO PASTA (Continued) **1024008538**

formerly contained an approximately 2,000 sq. ft. metal frame storage shed, as well as associated asphalt-paved parking areas. Lot 136 contains an approximate 1,200 sq. ft. wooden garage building with associated unpaved and asphalt-paved parking areas. The former restaurant building and metal frame storage shed were removed during previous phases of investigation to facilitate underground tank and hydraulic reservoir removals.

Datum:	-
Acres Property ID:	235063
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	84200
Assessment Funding Source:	EPA
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	Phase II Environmental Assessment
Accomplishment Count:	Y
Cooperative Agreement Number:	00A00022
Start Date:	5/10/2017
Ownership Entity:	Government
Completion Date:	4/24/2018
Current Owner:	City of Franklin, NH
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	Y
IC in place date:	-
IC in place:	N
State/tribal program date:	4/10/2017
State/tribal program ID:	201704004
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-

CIAO PASTA (Continued) **1024008538**

No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	Y
Other contams found description:	PFAS
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	-
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	1.07
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.07
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-

CIAO PASTA (Continued) **1024008538**

Media affected Bluiding Material:	Y
Media affected indoor air:	Y
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	Not reported
Below Poverty Number:	625
Below Poverty Percent:	26.3
Meidan Income:	9252
Meidan Income Number:	1210
Meidan Income Percent:	50.93
Vacant Housing Number:	75
Vacant Housing Percent:	8.04
Unemployed Number:	153
Unemployed Percent:	6.44
Name:	CIAO PASTA
Address:	194-202 CENTRAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	R1 TBA - New Hampshire (STAG Funded)
Grant Type:	TBA
Property Number:	Lot 131, Lot 135, Lot 136
Parcel size:	1.07
Latitude:	43.4433918
Longitude:	-71.6505545
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	Former Use: The target property consists of three (3) individual parcels collectively referred to as the target property and according to the Franklin Assessor s Office are identified as follows: TAX MAP PARCEL NUMBERS ADDRESS ACREAGE N8 117-131-00 196 Central Street 0.19 N8 117-135-00 194 Central Street 0.53 N8 117-136-00 202 Central Street 0.35 Lot 131 formerly contained an approximately 1,994 square-foot (sq. ft.) one (1) story vacant restaurant building (formerly known as Ciao Pasta) with an approximate 50 sq. ft. storage shed and associated asphalt-paved parking areas. Lot 135 contains an approximate 7,900 sq. ft. concrete slab with a partial basement, and formerly contained an approximately 2,000 sq. ft. metal frame storage shed, as well as associated asphalt-paved parking areas. Lot 136 contains an approximate 1,200 sq. ft. wooden garage building with associated unpaved and asphalt-paved parking areas. The former restaurant building and metal frame storage shed were removed during previous phases of investigation to facilitate underground tank and hydraulic reservoir removals.
Datum:	-
Acres Property ID:	235063
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-

CIAO PASTA (Continued) **1024008538**

Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	n/a
Start Date:	-
Ownership Entity:	Government
Completion Date:	-
Current Owner:	City of Franklin, NH
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	Y
IC in place date:	-
IC in place:	N
State/tribal program date:	4/10/2017
State/tribal program ID:	201704004
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	Y
Other contams found description:	PFAS
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	-
Soil cleaned up:	-
Surface water cleaned:	-

CIAO PASTA (Continued) **1024008538**

VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	1.07
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.07
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	Y
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	Not reported
Below Poverty Number:	625
Below Poverty Percent:	26.3
Meidan Income:	9252
Meidan Income Number:	1210
Meidan Income Percent:	50.93
Vacant Housing Number:	75
Vacant Housing Percent:	8.04
Unemployed Number:	153
Unemployed Percent:	6.44

Name: CIAO PASTA

CIAO PASTA (Continued) **1024008538**

Address:	194-202 CENTRAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	Lot 131, Lot 135, Lot 136
Parcel size:	1.07
Latitude:	43.4433918
Longitude:	-71.6505545
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	Former Use: The target property consists of three (3) individual parcels collectively referred to as the target property and according to the Franklin Assessor s Office are identified as follows: TAX MAP PARCEL NUMBERS ADDRESS ACREAGE N8 117-131-00 196 Central Street 0.19 N8 117-135-00 194 Central Street 0.53 N8 117-136-00 202 Central Street 0.35 Lot 131 formerly contained an approximately 1,994 square-foot (sq. ft.) one (1) story vacant restaurant building (formerly known as Ciao Pasta) with an approximate 50 sq. ft. storage shed and associated asphalt-paved parking areas. Lot 135 contains an approximate 7,900 sq. ft. concrete slab with a partial basement, and formerly contained an approximately 2,000 sq. ft. metal frame storage shed, as well as associated asphalt-paved parking areas. Lot 136 contains an approximate 1,200 sq. ft. wooden garage building with associated unpaved and asphalt-paved parking areas. The former restaurant building and metal frame storage shed were removed during previous phases of investigation to facilitate underground tank and hydraulic reservoir removals.
Datum:	-
Acres Property ID:	235063
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	12000
Assessment Funding Source:	EPA
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	Supplemental Assessment
Accomplishment Count:	N
Cooperative Agreement Number:	00A00022
Start Date:	2/3/2020
Ownership Entity:	Government
Completion Date:	6/1/2020
Current Owner:	City of Franklin, NH
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-

CIAO PASTA (Continued) **1024008538**

Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	Y
IC in place date:	-
IC in place:	N
State/tribal program date:	4/10/2017
State/tribal program ID:	201704004
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	Y
Other contams found description:	PFAS
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	-
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	1.07
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.07
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-

CIAO PASTA (Continued) **1024008538**

Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	Y
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	Not reported
Below Poverty Number:	625
Below Poverty Percent:	26.3
Meidan Income:	9252
Meidan Income Number:	1210
Meidan Income Percent:	50.93
Vacant Housing Number:	75
Vacant Housing Percent:	8.04
Unemployed Number:	153
Unemployed Percent:	6.44

Name:	CIAO PASTA
Address:	194-202 CENTRAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	R1 TBA - New Hampshire (STAG Funded)
Grant Type:	TBA
Property Number:	Lot 131, Lot 135, Lot 136
Parcel size:	1.07
Latitude:	43.4433918
Longitude:	-71.6505545
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	Former Use: The target property consists of three (3) individual parcels collectively referred to as the target property and according to the Franklin Assessor s Office are identified as follows: TAX MAP PARCEL NUMBERS ADDRESS ACREAGE N8 117-131-00 196 Central Street 0.19 N8 117-135-00 194 Central Street 0.53 N8 117-136-00 202 Central Street 0.35 Lot 131 formerly contained an approximately 1,994 square-foot (sq. ft.) one (1) story vacant restaurant building

CIAO PASTA (Continued) **1024008538**

(formerly known as Ciao Pasta) with an approximate 50 sq. ft. storage shed and associated asphalt-paved parking areas. Lot 135 contains an approximate 7,900 sq. ft. concrete slab with a partial basement, and formerly contained an approximately 2,000 sq. ft. metal frame storage shed, as well as associated asphalt-paved parking areas. Lot 136 contains an approximate 1,200 sq. ft. wooden garage building with associated unpaved and asphalt-paved parking areas. The former restaurant building and metal frame storage shed were removed during previous phases of investigation to facilitate underground tank and hydraulic reservoir removals.

Datum:	-
Acres Property ID:	235063
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	n/a
Start Date:	-
Ownership Entity:	Government
Completion Date:	-
Current Owner:	City of Franklin, NH
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	Y
IC in place date:	-
IC in place:	N
State/tribal program date:	4/10/2017
State/tribal program ID:	201704004
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y

CIAO PASTA (Continued) **1024008538**

Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	Y
Other contams found description:	PFAS
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	-
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	1.07
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.07
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-

CIAO PASTA (Continued) **1024008538**

SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	Y
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	Not reported
Below Poverty Number:	625
Below Poverty Percent:	26.3
Meidan Income:	9252
Meidan Income Number:	1210
Meidan Income Percent:	50.93
Vacant Housing Number:	75
Vacant Housing Percent:	8.04
Unemployed Number:	153
Unemployed Percent:	6.44

Name:	CIAO PASTA
Address:	194-202 CENTRAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	Lot 131, Lot 135, Lot 136
Parcel size:	1.07
Latitude:	43.4433918
Longitude:	-71.6505545
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	Former Use: The target property consists of three (3) individual parcels collectively referred to as the target property and according to the Franklin Assessor s Office are identified as follows: TAX MAP PARCEL NUMBERS ADDRESS ACREAGE N8 117-131-00 196 Central Street 0.19 N8 117-135-00 194 Central Street 0.53 N8 117-136-00 202 Central Street 0.35 Lot 131 formerly contained an approximately 1,994 square-foot (sq. ft.) one (1) story vacant restaurant building (formerly known as Ciao Pasta) with an approximate 50 sq. ft. storage shed and associated asphalt-paved parking areas. Lot 135 contains an approximate 7,900 sq. ft. concrete slab with a partial basement, and formerly contained an approximately 2,000 sq. ft. metal frame storage shed, as well as associated asphalt-paved parking areas. Lot 136 contains an approximate 1,200 sq. ft. wooden garage building with associated unpaved and asphalt-paved parking areas. The former restaurant building and metal frame storage shed were removed during previous phases of investigation to facilitate underground tank and hydraulic reservoir removals.
Datum:	-
Acres Property ID:	235063
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-

CIAO PASTA (Continued) **1024008538**

Cleanup Funding Source:	-
Assessment Funding:	60375.09
Assessment Funding Source:	NHDES
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	State/Tribal Funding (non-section 128(a))
Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	Supplemental Assessment
Accomplishment Count:	N
Cooperative Agreement Number:	00A00022
Start Date:	8/8/2018
Ownership Entity:	Government
Completion Date:	6/26/2019
Current Owner:	City of Franklin, NH
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	Y
IC in place date:	-
IC in place:	N
State/tribal program date:	4/10/2017
State/tribal program ID:	201704004
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	Y
Other contams found description:	PFAS
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-

CIAO PASTA (Continued) **1024008538**

Soil affected:	-
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	1.07
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.07
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	Y
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	Not reported
Below Poverty Number:	625
Below Poverty Percent:	26.3
Meidan Income:	9252
Meidan Income Number:	1210
Meidan Income Percent:	50.93
Vacant Housing Number:	75
Vacant Housing Percent:	8.04
Unemployed Number:	153

CIAO PASTA (Continued) **1024008538**

Unemployed Percent:	6.44
Name:	CIAO PASTA
Address:	194-202 CENTRAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	Lot 131, Lot 135, Lot 136
Parcel size:	1.07
Latitude:	43.4433918
Longitude:	-71.6505545
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	Former Use: The target property consists of three (3) individual parcels collectively referred to as the target property and according to the Franklin Assessor s Office are identified as follows: TAX MAP PARCEL NUMBERS ADDRESS ACREAGE N8 117-131-00 196 Central Street 0.19 N8 117-135-00 194 Central Street 0.53 N8 117-136-00 202 Central Street 0.35 Lot 131 formerly contained an approximately 1,994 square-foot (sq. ft.) one (1) story vacant restaurant building (formerly known as Ciao Pasta) with an approximate 50 sq. ft. storage shed and associated asphalt-paved parking areas. Lot 135 contains an approximate 7,900 sq. ft. concrete slab with a partial basement, and formerly contained an approximately 2,000 sq. ft. metal frame storage shed, as well as associated asphalt-paved parking areas. Lot 136 contains an approximate 1,200 sq. ft. wooden garage building with associated unpaved and asphalt-paved parking areas. The former restaurant building and metal frame storage shed were removed during previous phases of investigation to facilitate underground tank and hydraulic reservoir removals.
Datum:	-
Acres Property ID:	235063
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	00A00022
Start Date:	-
Ownership Entity:	Government
Completion Date:	-
Current Owner:	City of Franklin, NH
Did Owner Change:	N

CIAO PASTA (Continued) **1024008538**

Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	Y
IC in place date:	-
IC in place:	N
State/tribal program date:	4/10/2017
State/tribal program ID:	201704004
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	Y
Other contams found description:	PFAS
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	-
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	1.07
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.07
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-

CIAO PASTA (Continued) **1024008538**

Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	Y
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	Not reported
Below Poverty Number:	625
Below Poverty Percent:	26.3
Meidan Income:	9252
Meidan Income Number:	1210
Meidan Income Percent:	50.93
Vacant Housing Number:	75
Vacant Housing Percent:	8.04
Unemployed Number:	153
Unemployed Percent:	6.44

Click this hyperlink while viewing on your computer to access
8 additional US BROWNFIELDS: record(s) in the EDR Site Report.

Name:	CIAO PASTA
Address:	194-202 CENTRAL STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	New Hampshire Department of Environmental Services
Grant Type:	Section 128(a) State/Tribal
Property Number:	Lot 131, Lot 135, Lot 136
Parcel size:	1.07
Latitude:	43.4433918
Longitude:	-71.6505545
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	Former Use: The target property consists of three (3) individual

CIAO PASTA (Continued) **1024008538**

parcels collectively referred to as the target property and according to the Franklin Assessor s Office are identified as follows: TAX MAP PARCEL NUMBERS ADDRESS ACREAGE N8 117-131-00 196 Central Street 0.19 N8 117-135-00 194 Central Street 0.53 N8 117-136-00 202 Central Street 0.35 Lot 131 formerly contained an approximately 1,994 square-foot (sq. ft.) one (1) story vacant restaurant building (formerly known as Ciao Pasta) with an approximate 50 sq. ft. storage shed and associated asphalt-paved parking areas. Lot 135 contains an approximate 7,900 sq. ft. concrete slab with a partial basement, and formerly contained an approximately 2,000 sq. ft. metal frame storage shed, as well as associated asphalt-paved parking areas. Lot 136 contains an approximate 1,200 sq. ft. wooden garage building with associated unpaved and asphalt-paved parking areas. The former restaurant building and metal frame storage shed were removed during previous phases of investigation to facilitate underground tank and hydraulic reservoir removals.

Datum:	-
Acres Property ID:	235063
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	00A00266
Start Date:	-
Ownership Entity:	Government
Completion Date:	-
Current Owner:	City of Franklin, NH
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	Y
IC in place date:	-
IC in place:	N
State/tribal program date:	4/10/2017
State/tribal program ID:	201704004
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y

CIAO PASTA (Continued) **1024008538**

Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	Y
Other contams found description:	PFAS
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	-
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	1.07
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.07
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-

CIAO PASTA (Continued) **1024008538**

Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	Y
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	Not reported
Below Poverty Number:	625
Below Poverty Percent:	26.3
Meidan Income:	9252
Meidan Income Number:	1210
Meidan Income Percent:	50.93
Vacant Housing Number:	75
Vacant Housing Percent:	8.04
Unemployed Number:	153
Unemployed Percent:	6.44

Click this hyperlink while viewing on your computer to access
8 additional US BROWNFIELDS: record(s) in the EDR Site Report.

FINDS:
Registry ID: 110070149194

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
US EPA Assessment, Cleanup and Redevelopment Exchange System (ACRES)
is an federal online database for Brownfields Grantees to
electronically submit data directly to EPA.

Click this hyperlink while viewing on your computer to access
additional FINDS: detail in the EDR Site Report.

L67 **FRANKLIN ELKS LODGE #1280** **NH BROWNFIELDS S120765282**
SSW **192 CENTRAL STREET** **NH ALLSITES N/A**
1/4-1/2 **FRANKLIN, NH**
0.286 mi.
1511 ft. **Site 4 of 5 in cluster L**

Relative:
Lower

Actual:
288 ft.

BROWNFIELDS:

Name:	FRANKLIN ELKS LODGE #1280
Address:	192 CENTRAL STREET
City,State,Zip:	FRANKLIN, NH
Facility ID:	201704003
Site Latitude:	44.443051
Site Longitude:	-71.650783
Site Total Acreage	Not reported

ALLSITES:

FRANKLIN ELKS LODGE #1280 (Continued) **S120765282**

Name:	FRANKLIN ELKS LODGE #1280
Address:	192 CENTRAL STREET
City,State,Zip:	FRANKLIN, NH
Facility ID:	201704003
Project Type:	SITEEVALHW
Project Description:	UNSOLICITED SITE ASSESSMENT REVIEWED BY HWRB
Project Manager:	CLOSED
Expiration Date:	Not reported

L68 **ANGELL PROPERTY** **NH LUST** **S101000902**
SSW **175 CENTRAL STREET** **N/A**
1/4-1/2 **FRANKLIN, NH**
0.321 mi.
1695 ft. **Site 5 of 5 in cluster L**

Relative:
Lower

Actual:
287 ft.

LUST:

Name:	ANGELL PROPERTY
Address:	175 CENTRAL STREET
City,State,Zip:	FRANKLIN, NH
Facility ID:	198805024
Project Type:	LUST
Project Manager:	**CLOSED**
Project Site Description:	**LEAKING UNDERGROUND STORAGE TANK PROJECT**
Expired Date:	**Not reported**

---

69 **CASTLE MOTORS** **NH SHWS** **1008918056**
SSW **168 CENTRAL ST** **NH LUST** **N/A**
1/4-1/2 **FRANKLIN, NH 03235** **NH INST CONTROL**
0.334 mi. **FINDS**
1761 ft. **ECHO**

Relative:
Lower

Actual:
292 ft.

SHWS:

Name:	CASTLE MOTORS
Address:	168 CENTRAL ST
City,State,Zip:	FRANKLIN, NH
Facility ID:	199906054
Proj Type:	HAZWASTE
Project Manager:	**CLOSED**
Project Site Description:	**HAZARDOUS WASTE DISCHARGE PROJECT**
Expired Date:	**Not reported**

LUST:

Name:	CASTLE MOTORS
Address:	168 CENTRAL ST
City,State,Zip:	FRANKLIN, NH
Facility ID:	199906054
Project Type:	LUST
Project Manager:	**CLOSED-AUR**
Project Site Description:	**LEAKING UNDERGROUND STORAGE TANK PROJECT**
Expired Date:	**Not reported**

Inst Control:

Name:	CASTLE MOTORS
Address:	168 CENTRAL ST
City,State,Zip:	FRANKLIN, NH

CASTLE MOTORS (Continued) **1008918056**

Facility ID: 199906054
Action Date: 11/27/2006
Action Description: COPY OF RECORDED AUR ACCEPTED
Project Type: LUST
Project Management: CLOSED-AUR

FINDS:
Registry ID: 110023090723

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1008918056
Registry ID: 110023090723
DFR URL: http://echo.epa.gov/detailed-facility-report?fid=110023090723
Name: CASTLE MOTORS
Address: 168 CENTRAL ST
City,State,Zip: FRANKLIN, NH 03235

70
South
1/4-1/2
0.381 mi.
2013 ft.

CURTIS RESIDENCE **NH ALLSITES** **S125913848**
46 RIVER STREET **N/A**
FRANKLIN, NH

Relative:
Lower

Actual:
281 ft.

ALLSITES:
Name: CURTIS RESIDENCE
Address: 46 RIVER STREET
City,State,Zip: FRANKLIN, NH
Facility ID: 201911021
Project Type: OPUF
Project Description: ON-PREMISE USE FAC. CONTAINING FUEL OIL
Project Manager: CLOSED
Expiration Date: Not reported

71
North
1/4-1/2
0.384 mi.
2027 ft.

SCOTT MARCHANT **NH ALLSITES** **S107447845**
23 GLORY DR **N/A**
FRANKLIN, NH

Relative:
Higher

Actual:
444 ft.

ALLSITES:
Name: SCOTT MARCHANT
Address: 23 GLORY DR
City,State,Zip: FRANKLIN, NH
Facility ID: 200511029

SCOTT MARCHANT (Continued) **S107447845**

Project Type: OPUF
Project Description: ON-PREMISE USE FAC. CONTAINING FUEL OIL
Project Manager: CLOSED
Expiration Date: Not reported

72
ESE
1/4-1/2
0.386 mi.
2036 ft.

PETRIGNI PROPERTY **NH ALLSITES** **S109979139**
75 ORCHARD STREET **N/A**
FRANKLIN, NH

Relative:
Higher

Actual:
457 ft.

ALLSITES:
Name: PETRIGNI PROPERTY
Address: 75 ORCHARD STREET
City,State,Zip: FRANKLIN, NH
Facility ID: 200911019
Project Type: OPUF
Project Description: ON-PREMISE USE FAC. CONTAINING FUEL OIL
Project Manager: CLOSED
Expiration Date: Not reported

73
SSE
1/4-1/2
0.388 mi.
2047 ft.

GARY DELISLE **NH ALLSITES** **S105771404**
46 VIEW STREET **N/A**
FRANKLIN, NH

Relative:
Higher

Actual:
413 ft.

ALLSITES:
Name: GARY DELISLE
Address: 46 VIEW STREET
City,State,Zip: FRANKLIN, NH
Facility ID: 199903043
Project Type: OPUF
Project Description: ON-PREMISE USE FAC. CONTAINING FUEL OIL
Project Manager: CLOSED
Expiration Date: Not reported

74
East
1/4-1/2
0.457 mi.
2412 ft.

RUSSELL COX **NH ALLSITES** **S105771414**
624 CENTRAL ST **N/A**
FRANKLIN, NH

Relative:
Higher

Actual:
425 ft.

ALLSITES:
Name: RUSSELL COX
Address: 624 CENTRAL ST
City,State,Zip: FRANKLIN, NH
Facility ID: 200109034
Project Type: OPUF
Project Description: ON-PREMISE USE FAC. CONTAINING FUEL OIL
Project Manager: CLOSED
Expiration Date: Not reported

75
North
1/4-1/2
0.476 mi.
2511 ft.

LESTER RESIDENCE
52 FREEDOM DR
FRANKLIN, NH

NH ALLSITES **S118361801**
N/A

Relative:
Higher

Actual:
465 ft.

ALLSITES:
Name: LESTER RESIDENCE
Address: 52 FREEDOM DR
City,State,Zip: FRANKLIN, NH
Facility ID: 201509034
Project Type: OPUF
Project Description: ON-PREMISE USE FAC. CONTAINING FUEL OIL
Project Manager: CLOSED
Expiration Date: Not reported

M76
WNW
1/4-1/2
0.498 mi.
2630 ft.

POLYCLAD LAMINATES INC
45 TANNERY ST
FRANKLIN, NH 03235
Site 1 of 2 in cluster M

NH LUST **S108356437**
NH BROWNFIELDS **N/A**
NH ALLSITES
NH AIRS

Relative:
Higher

Actual:
345 ft.

LUST:
Name: POLYCLAD LAMINATES INC
Address: 45 TANNERY ST
City,State,Zip: FRANKLIN, NH
Facility ID: 199902062
Project Type: LUST
Project Manager: CLOSED
Project Site Description: LEAKING UNDERGROUND STORAGE TANK PROJECT
Expired Date: Not reported

BROWNFIELDS:
Name: POLYCLAD LAMINATES INC
Address: 45 TANNERY ST
City,State,Zip: FRANKLIN, NH
Facility ID: 199902062
Site Latitude: 43.451118
Site Longitude: -71.655845
Site Total Acreage: 1.97

ALLSITES:
Name: POLYCLAD LAMINATES INC
Address: 45 TANNERY ST
City,State,Zip: FRANKLIN, NH
Facility ID: 199902062
Project Type: SITEEVALHW
Project Description: UNSOLICITED SITE ASSESSMENT REVIEWED BY HWRB
Project Manager: UNASSIGNED
Expiration Date: Not reported

AIRS:
Name: POLYCLAD LAMINATES INC
Address: 45 TANNERY ST
City,State,Zip: FRANKLIN, NH 03235
Facility Id: 3301300031
Operating Status: PERMANENTLY CLOSED
Year Of Record: 2018

POLYCLAD LAMINATES INC (Continued) **S108356437**

Latitude/Longitude: 43.450833 / -71.655833
Sic Code: 3083
Naics: 326130
Emergency Contact: RODD FINE, DIRECTOR OPER N AM
Contact Title: Not reported
Tel Emiss: Not reported
Mailing Street: Not reported
Mailing City: Not reported
Mailing State: Not reported
Mailing Zip Code: Not reported
Contact Method Type: Not reported
Company Name: Not reported

AIRS:

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: 108883
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: 68122
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: 78933
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: CO
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported

POLYCLAD LAMINATES INC (Continued) **S108356437**

Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported
Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	HAP (SPC)
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported
Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	NO2
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported
Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	PM10
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported
Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	PM2.5
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported
Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	PT
Estimated Emissions:	0

POLYCLAD LAMINATES INC (Continued) **S108356437**

Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: SO2
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: VOC
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: VOC (SPC)
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Name: POLYCLAD LAMINATES INC
Address: 45 TANNERY ST
City,State,Zip: FRANKLIN, NH 03235
Facility Id: 3301300031
Operating Status: PERMANENTLY CLOSED
Year Of Record: 2017
Latitude/Longitude: 43.450833 / -71.655833
Sic Code: 3083
Naics: 326130
Emergency Contact: RODD FINE, DIRECTOR OPER N AM
Contact Title: Not reported
Tel Emiss: Not reported
Mailing Street: Not reported

POLYCLAD LAMINATES INC (Continued) **S108356437**

Mailing City: Not reported
Mailing State: Not reported
Mailing Zip Code: Not reported
Contact Method Type: Not reported
Company Name: Not reported

AIRS:
Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: 108883
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: 68122
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: 78933
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: CO
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006

POLYCLAD LAMINATES INC (Continued) **S108356437**

Pollutant:	HAP (SPC)
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	NO2
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	PM10
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	PM2.5
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	PT
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

POLYCLAD LAMINATES INC (Continued) **S108356437**

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	SO2
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	VOC
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	VOC (SPC)
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Name:	POLYCLAD LAMINATES INC
Address:	45 TANNERY ST
City,State,Zip:	FRANKLIN, NH 03235
Facility Id:	3301300031
Operating Status:	PERMANENTLY CLOSED
Year Of Record:	Not reported
Latitude/Longitude:	43.450833 / -71.655833
Sic Code:	3083
Naics:	326130
Emergency Contact:	RODD FINE
Contact Title:	Not reported
Tel Emiss:	Not reported
Mailing Street:	Not reported
Mailing City:	Not reported
Mailing State:	Not reported
Mailing Zip Code:	Not reported
Contact Method Type:	Not reported
Company Name:	Not reported

AIRS:

Facility Id:	3301300031

POLYCLAD LAMINATES INC (Continued) **S108356437**

Operating Status:	Closed
Year Of Record:	2006
Pollutant:	108883
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	68122
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	78933
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	CO
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	HAP (SPC)
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported

POLYCLAD LAMINATES INC (Continued) **S108356437**

Report Product ID: Not reported

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: NO2
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: PM10
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: PM2.5
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: PT
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: SO2
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported

POLYCLAD LAMINATES INC (Continued) **S108356437**

Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: VOC
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: VOC (SPC)
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Name: POLYCLAD LAMINATES INC
Address: 45 TANNERY ST
City,State,Zip: FRANKLIN, NH 03235
Facility Id: 3301300031
Operating Status: PERMANENTLY CLOSED
Year Of Record: Not reported
Latitude/Longitude: 43.450833 / -71.655833
Sic Code: 3083
Naics: 326130
Emergency Contact: RYAN EMERSON
Contact Title: Not reported
Tel Emiss: Not reported
Mailing Street: 583 SOUTH MAIN ST
Mailing City: FRANKLIN
Mailing State: NH
Mailing Zip Code: 03235
Contact Method Type: Not reported
Company Name: Not reported

AIRS:
Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: 108883
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported

POLYCLAD LAMINATES INC (Continued) **S108356437**

Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: 68122
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: 78933
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: CO
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: HAP (SPC)
Estimated Emissions: 0
Estimated Emissions Units: Not reported
Emission Unit ID: Not reported
Unit Description: Not reported
Unit Proc ID: Not reported
Proc Description: Not reported
Report Product ID: Not reported

Facility Id: 3301300031
Operating Status: Closed
Year Of Record: 2006
Pollutant: NO2
Estimated Emissions: 0

POLYCLAD LAMINATES INC (Continued) **S108356437**

Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported
Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	PM10
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported
Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	PM2.5
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported
Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	PT
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported
Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	SO2
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported
Facility Id:	3301300031
Operating Status:	Closed

POLYCLAD LAMINATES INC (Continued) **S108356437**

Year Of Record:	2006
Pollutant:	VOC
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	VOC (SPC)
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Name:	POLYCLAD LAMINATES INC
Address:	45 TANNERY ST
City,State,Zip:	FRANKLIN, NH 03235
Facility Id:	3301300031
Operating Status:	PERMANENTLY CLOSED
Year Of Record:	2020
Latitude/Longitude:	43.450833 / -71.655833
Sic Code:	3083
Naics:	326130
Emergency Contact:	RODD FINE
Contact Title:	DIRECTOR OPER N AM
Tel Emiss:	Not reported
Mailing Street:	Not reported
Mailing City:	Not reported
Mailing State:	Not reported
Mailing Zip Code:	Not reported
Contact Method Type:	Not reported
Company Name:	POLYCLAD LAMINATES/TANNERY ST.

AIRS:

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	108883
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006

POLYCLAD LAMINATES INC (Continued) **S108356437**

Pollutant:	68122
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	78933
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	CO
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	HAP (SPC)
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	NO2
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

POLYCLAD LAMINATES INC (Continued) **S108356437**

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	PM10
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	PM2.5
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	PT
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	SO2
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	VOC
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported

POLYCLAD LAMINATES INC (Continued) **S108356437**

Proc Description:	Not reported
Report Product ID:	Not reported
Facility Id:	3301300031
Operating Status:	Closed
Year Of Record:	2006
Pollutant:	VOC (SPC)
Estimated Emissions:	0
Estimated Emissions Units:	Not reported
Emission Unit ID:	Not reported
Unit Description:	Not reported
Unit Proc ID:	Not reported
Proc Description:	Not reported
Report Product ID:	Not reported

M77 **POLYCLAD LAMINATES, INC.** **US BROWNFIELDS** **1014949325**
WNW **45 TANNERY STREET** **N/A**
1/4-1/2 **FRANKLIN, NH 3235**
0.498 mi.
2630 ft. **Site 2 of 2 in cluster M**

Relative:
Higher

Actual:
345 ft.

US BROWNFIELDS:

Name:	POLYCLAD LAMINATES, INC.
Address:	45 TANNERY STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	Map 116, Lot 171
Parcel size:	1.97
Latitude:	43.4500249
Longitude:	-71.6474635
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	This was an abandoned tannery property with existing concrete foundations in place. The city acquired the property and constructed a new DPW garage/facilities. Former Use: The Site is composed of a single vacant 1.97-acre parcel of land located at 45 Tannery Street in Franklin, New Hampshire, that is situated along the Pemigewasset River. The Site consists of a vacant lot with only the former building s concrete slab-on-grade foundation and a small pile of debris. The Site was first developed in 1892. By approximately 1930, the first building was constructed on the Site. The most recent building was demolished in 2008 after it collapsed due to heavy winter snow cover. Based on a prior Phase I ESA report, the Site appears to be have used for railroad purposes when the Boston & Maine and Bristol Rail Road transected the Site beginning in 1892. It is not clear when railroad activities ceased on the Site. However, records do show that the Hingston Leather Company, Inc. and Louis Verza Leather Company were using the Site for tannery activities beginning in the 1950 s until the mid to late 1970 s. Between 1979 and 1980, Polyclad Laminates, Inc. began operations on the Site. Polyclad Laminates, Inc. manufactured component materials used in multi-ed circuit boards called pre-preg . The process involved dipping fiberglass cloth in a dip tank filled with epoxy resin. Polyclad Laminates used the Site for the manufacture of pre-preg from between 1979 and 1980 until around 2006.

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

Datum:	North American Datum of 1983
Acres Property ID:	128562
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	30000
Redev. Funding Source:	Town of Franklin
Redev. Funding Entity Name:	Local Funding
Redevelopment Start Date:	10/1/2011
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	96111801
Start Date:	-
Ownership Entity:	Government
Completion Date:	-
Current Owner:	City of Franklin
Did Owner Change:	Y
Cleanup Required:	Y
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	2/18/2011
State/tribal program ID:	199902062
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	3
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	1.97
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.97
Future use industrial acreage:	-
Superfund Fed. landowner flag:	Y
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	The Site is composed of a single vacant 1.97-acre parcel of land

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

located at 45 Tannery Street in Franklin, New Hampshire, that is situated along the Pemigewasset River. The Site consists of a vacant lot with only the former building s concrete slab-on-grade foundation and a small pile of debris. The Site was first developed in 1892. By approximately 1930, the first building was constructed on the Site. The most recent building was demolished in 2008 after it collapsed due to heavy winter snow cover. Based on a prior Phase I ESA report, the Site appears to be have used for railroad purposes when the Boston & Maine and Bristol Rail Road transected the Site beginning in 1892. It is not clear when railroad activities ceased on the Site. However, records do show that the Hingston Leather Company, Inc. and Louis Verza Leather Company were using the Site for tannery activities beginning in the 1950 s until the mid to late 1970 s. Between 1979 and 1980, Polyclad Laminates, Inc. began operations on the Site. Polyclad Laminates, Inc. manufactured component materials used in multi-ed circuit boards called pre-preg . The process involved dipping fiberglass cloth in a dip tank filled with epoxy resin. Polyclad Laminates used the Site for the manufacture of pre-preg from between 1979 and 1980 until around 2006.

Below Poverty Number:	156
Below Poverty Percent:	10.16
Meidan Income:	4022
Meidan Income Number:	695
Meidan Income Percent:	45.28
Vacant Housing Number:	37
Vacant Housing Percent:	5.59
Unemployed Number:	101
Unemployed Percent:	6.58

Name:	POLYCLAD LAMINATES, INC.
Address:	45 TANNERY STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	Map 116, Lot 171
Parcel size:	1.97
Latitude:	43.4500249
Longitude:	-71.6474635
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	This was an abandoned tannery property with existing concrete foundations in place. The city acquired the property and constructed a new DPW garage/facilities. Former Use: The Site is composed of a single vacant 1.97-acre parcel of land located at 45 Tannery Street in Franklin, New Hampshire, that is situated along the Pemigewasset River. The Site consists of a vacant lot with only the former building s concrete slab-on-grade foundation and a small pile of debris. The Site was first developed in 1892. By approximately 1930, the first building was constructed on the Site. The most recent building was demolished in 2008 after it collapsed due to heavy winter snow cover. Based on a prior Phase I ESA report, the Site appears to be have used for railroad purposes when the Boston & Maine and Bristol Rail Road transected the Site beginning in 1892. It is not clear when railroad activities ceased on the Site. However, records do show that the Hingston Leather Company, Inc. and Louis Verza Leather Company were using the Site for tannery activities

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

beginning in the 1950 s until the mid to late 1970 s. Between 1979 and 1980, Polyclad Laminates, Inc. began operations on the Site. Polyclad Laminates, Inc. manufactured component materials used in multi-ed circuit boards called pre-preg . The process involved dipping fiberglass cloth in a dip tank filled with epoxy resin. Polyclad Laminates used the Site for the manufacture of pre-preg from between 1979 and 1980 until around 2006.

Datum:	North American Datum of 1983
Acres Property ID:	128562
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	4285
Assessment Funding Source:	NHDES
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	State/Tribal Funding (non-section 128(a))
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	Supplemental Assessment
Accomplishment Count:	N
Cooperative Agreement Number:	96111801
Start Date:	6/5/2017
Ownership Entity:	Government
Completion Date:	5/24/2018
Current Owner:	City of Franklin
Did Owner Change:	Y
Cleanup Required:	Y
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	2/18/2011
State/tribal program ID:	199902062
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	1.97
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.97
Future use industrial acreage:	-
Superfund Fed. landowner flag:	Y
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	The Site is composed of a single vacant 1.97-acre parcel of land located at 45 Tannery Street in Franklin, New Hampshire, that is situated along the Pemigewasset River. The Site consists of a vacant lot with only the former building s concrete slab-on-grade foundation and a small pile of debris. The Site was first developed in 1892. By approximately 1930, the first building was constructed on the Site. The most recent building was demolished in 2008 after it collapsed due to heavy winter snow cover. Based on a prior Phase I ESA report, the Site appears to be have used for railroad purposes when the Boston & Maine and Bristol Rail Road transected the Site beginning in 1892. It is not clear when railroad activities ceased on the Site. However, records do show that the Hingston Leather Company, Inc. and Louis Verza Leather Company were using the Site for tannery activities beginning in the 1950 s until the mid to late 1970 s. Between 1979 and 1980, Polyclad Laminates, Inc. began operations on the Site. Polyclad Laminates, Inc. manufactured component materials used in multi-ed circuit boards called pre-preg . The process involved dipping fiberglass cloth in a dip tank filled with epoxy resin. Polyclad Laminates used the Site for the manufacture of pre-preg from between 1979 and 1980 until around 2006.
Below Poverty Number:	156
Below Poverty Percent:	10.16
Meidan Income:	4022
Meidan Income Number:	695
Meidan Income Percent:	45.28
Vacant Housing Number:	37
Vacant Housing Percent:	5.59
Unemployed Number:	101
Unemployed Percent:	6.58

Name:	POLYCLAD LAMINATES, INC.
Address:	45 TANNERY STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	Map 116, Lot 171
Parcel size:	1.97
Latitude:	43.4500249
Longitude:	-71.6474635
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	This was an abandoned tannery property with existing concrete foundations in place. The city acquired the property and constructed a new DPW garage/facilities. Former Use: The Site is composed of a single vacant 1.97-acre parcel of land located at 45 Tannery Street in Franklin, New Hampshire, that is situated along the Pemigewasset River. The Site consists of a vacant lot with only the former building s concrete slab-on-grade foundation and a small pile of debris. The Site was first developed in 1892. By approximately 1930, the first building was constructed on the Site. The most recent

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

building was demolished in 2008 after it collapsed due to heavy winter snow cover. Based on a prior Phase I ESA report, the Site appears to be have used for railroad purposes when the Boston & Maine and Bristol Rail Road transected the Site beginning in 1892. It is not clear when railroad activities ceased on the Site. However, records do show that the Hingston Leather Company, Inc. and Louis Verza Leather Company were using the Site for tannery activities beginning in the 1950 s until the mid to late 1970 s. Between 1979 and 1980, Polyclad Laminates, Inc. began operations on the Site. Polyclad Laminates, Inc. manufactured component materials used in multi-ed circuit boards called pre-preg . The process involved dipping fiberglass cloth in a dip tank filled with epoxy resin. Polyclad Laminates used the Site for the manufacture of pre-preg from between 1979 and 1980 until around 2006.

Datum:	North American Datum of 1983
Acres Property ID:	128562
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	32024
Assessment Funding Source:	EPA
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	Phase II Environmental Assessment
Accomplishment Count:	Y
Cooperative Agreement Number:	96111801
Start Date:	6/28/2011
Ownership Entity:	Government
Completion Date:	6/24/2012
Current Owner:	City of Franklin
Did Owner Change:	Y
Cleanup Required:	Y
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	2/18/2011
State/tribal program ID:	199902062
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	1.97
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.97
Future use industrial acreage:	-
Superfund Fed. landowner flag:	Y
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	The Site is composed of a single vacant 1.97-acre parcel of land located at 45 Tannery Street in Franklin, New Hampshire, that is situated along the Pemigewasset River. The Site consists of a vacant lot with only the former building s concrete slab-on-grade foundation and a small pile of debris. The Site was first developed in 1892. By approximately 1930, the first building was constructed on the Site. The most recent building was demolished in 2008 after it collapsed due to heavy winter snow cover. Based on a prior Phase I ESA report, the Site appears to be have used for railroad purposes when the Boston & Maine and Bristol Rail Road transected the Site beginning in 1892. It is not clear when railroad activities ceased on the Site. However, records do show that the Hingston Leather Company, Inc. and Louis Verza Leather Company were using the Site for tannery activities beginning in the 1950 s until the mid to late 1970 s. Between 1979 and 1980, Polyclad Laminates, Inc. began operations on the Site. Polyclad Laminates, Inc. manufactured component materials used in multi-ed circuit boards called pre-preg . The process involved dipping fiberglass cloth in a dip tank filled with epoxy resin. Polyclad Laminates used the Site for the manufacture of pre-preg from between 1979 and 1980 until around 2006.
Below Poverty Number:	156
Below Poverty Percent:	10.16
Meidan Income:	4022
Meidan Income Number:	695
Meidan Income Percent:	45.28
Vacant Housing Number:	37
Vacant Housing Percent:	5.59
Unemployed Number:	101
Unemployed Percent:	6.58

Name:	POLYCLAD LAMINATES, INC.
Address:	45 TANNERY STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	New Hampshire Department of Environmental Services
Grant Type:	Section 128(a) State/Tribal
Property Number:	Map 116, Lot 171
Parcel size:	1.97
Latitude:	43.4500249
Longitude:	-71.6474635
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	This was an abandoned tannery property with existing concrete foundations in place. The city acquired the property and constructed

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

a new DPW garage/facilities. Former Use: The Site is composed of a single vacant 1.97-acre parcel of land located at 45 Tannery Street in Franklin, New Hampshire, that is situated along the Pemigewasset River. The Site consists of a vacant lot with only the former building s concrete slab-on-grade foundation and a small pile of debris. The Site was first developed in 1892. By approximately 1930, the first building was constructed on the Site. The most recent building was demolished in 2008 after it collapsed due to heavy winter snow cover. Based on a prior Phase I ESA report, the Site appears to be have used for railroad purposes when the Boston & Maine and Bristol Rail Road transected the Site beginning in 1892. It is not clear when railroad activities ceased on the Site. However, records do show that the Hingston Leather Company, Inc. and Louis Verza Leather Company were using the Site for tannery activities beginning in the 1950 s until the mid to late 1970 s. Between 1979 and 1980, Polyclad Laminates, Inc. began operations on the Site. Polyclad Laminates, Inc. manufactured component materials used in multi-ed circuit boards called pre-preg . The process involved dipping fiberglass cloth in a dip tank filled with epoxy resin. Polyclad Laminates used the Site for the manufacture of pre-preg from between 1979 and 1980 until around 2006.

Datum:	North American Datum of 1983
Acres Property ID:	128562
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	8733
Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	State/Tribal Funding (non-section 128(a))
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	Phase I Environmental Assessment
Accomplishment Count:	N
Cooperative Agreement Number:	96128501
Start Date:	2/18/2011
Ownership Entity:	Government
Completion Date:	4/22/2011
Current Owner:	City of Franklin
Did Owner Change:	Y
Cleanup Required:	Y
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

State/tribal program date:	2/18/2011
State/tribal program ID:	199902062
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	1.97
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.97
Future use industrial acreage:	-
Superfund Fed. landowner flag:	Y
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	The Site is composed of a single vacant 1.97-acre parcel of land located at 45 Tannery Street in Franklin, New Hampshire, that is situated along the Pemigewasset River. The Site consists of a vacant lot with only the former building s concrete slab-on-grade foundation and a small pile of debris. The Site was first developed in 1892. By approximately 1930, the first building was constructed on the Site. The most recent building was demolished in 2008 after it collapsed due to heavy winter snow cover. Based on a prior Phase I ESA report, the Site appears to be have used for railroad purposes when the Boston & Maine and Bristol Rail Road transected the Site beginning in 1892. It is not clear when railroad activities ceased on the Site. However, records do show that the Hingston Leather Company, Inc. and Louis Verza Leather Company were using the Site for tannery activities beginning in the 1950 s until the mid to late 1970 s. Between 1979 and 1980, Polyclad Laminates, Inc. began operations on the Site. Polyclad Laminates, Inc. manufactured component materials used in multi-ed circuit boards called pre-preg . The process involved dipping fiberglass cloth in a dip tank filled with epoxy resin. Polyclad Laminates used the Site for the manufacture of pre-preg from between 1979 and 1980 until around 2006.
Below Poverty Number:	156
Below Poverty Percent:	10.16
Meidan Income:	4022
Meidan Income Number:	695
Meidan Income Percent:	45.28
Vacant Housing Number:	37
Vacant Housing Percent:	5.59
Unemployed Number:	101
Unemployed Percent:	6.58

Name:	POLYCLAD LAMINATES, INC.
Address:	45 TANNERY STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	Map 116, Lot 171
Parcel size:	1.97

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

Latitude:	43.4500249
Longitude:	-71.6474635
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	This was an abandoned tannery property with existing concrete foundations in place. The city acquired the property and constructed a new DPW garage/facilities. Former Use: The Site is composed of a single vacant 1.97-acre parcel of land located at 45 Tannery Street in Franklin, New Hampshire, that is situated along the Pemigewasset River. The Site consists of a vacant lot with only the former building s concrete slab-on-grade foundation and a small pile of debris. The Site was first developed in 1892. By approximately 1930, the first building was constructed on the Site. The most recent building was demolished in 2008 after it collapsed due to heavy winter snow cover. Based on a prior Phase I ESA report, the Site appears to be have used for railroad purposes when the Boston & Maine and Bristol Rail Road transected the Site beginning in 1892. It is not clear when railroad activities ceased on the Site. However, records do show that the Hingston Leather Company, Inc. and Louis Verza Leather Company were using the Site for tannery activities beginning in the 1950 s until the mid to late 1970 s. Between 1979 and 1980, Polyclad Laminates, Inc. began operations on the Site. Polyclad Laminates, Inc. manufactured component materials used in multi-ed circuit boards called pre-preg . The process involved dipping fiberglass cloth in a dip tank filled with epoxy resin. Polyclad Laminates used the Site for the manufacture of pre-preg from between 1979 and 1980 until around 2006.
Datum:	North American Datum of 1983
Acres Property ID:	128562
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	5505
Assessment Funding Source:	NHDES
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	State/Tribal Funding (non-section 128(a))
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	Supplemental Assessment
Accomplishment Count:	N
Cooperative Agreement Number:	96111801
Start Date:	6/5/2017
Ownership Entity:	Government
Completion Date:	5/24/2018
Current Owner:	City of Franklin
Did Owner Change:	Y
Cleanup Required:	Y
Video Available:	N
Photo Available:	Y

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	2/18/2011
State/tribal program ID:	199902062
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	1.97
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.97
Future use industrial acreage:	-
Superfund Fed. landowner flag:	Y
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	The Site is composed of a single vacant 1.97-acre parcel of land located at 45 Tannery Street in Franklin, New Hampshire, that is situated along the Pemigewasset River. The Site consists of a vacant lot with only the former building s concrete slab-on-grade foundation and a small pile of debris. The Site was first developed in 1892. By approximately 1930, the first building was constructed on the Site. The most recent building was demolished in 2008 after it collapsed due to heavy winter snow cover. Based on a prior Phase I ESA report, the Site appears to be have used for railroad purposes when the Boston & Maine and Bristol Rail Road transected the Site beginning in 1892. It is not clear when railroad activities ceased on the Site. However, records do show that the Hingston Leather Company, Inc. and Louis Verza Leather Company were using the Site for tannery activities beginning in the 1950 s until the mid to late 1970 s. Between 1979 and 1980, Polyclad Laminates, Inc. began operations on the Site. Polyclad Laminates, Inc. manufactured component materials used in multi-ed circuit boards called pre-preg . The process involved dipping fiberglass cloth in a dip tank filled with epoxy resin. Polyclad Laminates used the Site for the manufacture of pre-preg from between 1979 and 1980 until around 2006.
Below Poverty Number:	156
Below Poverty Percent:	10.16
Meidan Income:	4022
Meidan Income Number:	695
Meidan Income Percent:	45.28
Vacant Housing Number:	37
Vacant Housing Percent:	5.59
Unemployed Number:	101
Unemployed Percent:	6.58

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

Name:	POLYCLAD LAMINATES, INC.
Address:	45 TANNERY STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	Map 116, Lot 171
Parcel size:	1.97
Latitude:	43.4500249
Longitude:	-71.6474635
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	This was an abandoned tannery property with existing concrete foundations in place. The city acquired the property and constructed a new DPW garage/facilities. Former Use: The Site is composed of a single vacant 1.97-acre parcel of land located at 45 Tannery Street in Franklin, New Hampshire, that is situated along the Pemigewasset River. The Site consists of a vacant lot with only the former building s concrete slab-on-grade foundation and a small pile of debris. The Site was first developed in 1892. By approximately 1930, the first building was constructed on the Site. The most recent building was demolished in 2008 after it collapsed due to heavy winter snow cover. Based on a prior Phase I ESA report, the Site appears to be have used for railroad purposes when the Boston & Maine and Bristol Rail Road transected the Site beginning in 1892. It is not clear when railroad activities ceased on the Site. However, records do show that the Hingston Leather Company, Inc. and Louis Verza Leather Company were using the Site for tannery activities beginning in the 1950 s until the mid to late 1970 s. Between 1979 and 1980, Polyclad Laminates, Inc. began operations on the Site. Polyclad Laminates, Inc. manufactured component materials used in multi-ed circuit boards called pre-preg . The process involved dipping fiberglass cloth in a dip tank filled with epoxy resin. Polyclad Laminates used the Site for the manufacture of pre-preg from between 1979 and 1980 until around 2006.
Datum:	North American Datum of 1983
Acres Property ID:	128562
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	1000
Redev. Funding Source:	Town of Franklin
Redev. Funding Entity Name:	Local Funding
Redevelopment Start Date:	10/1/2011
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	96111801
Start Date:	-

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

Ownership Entity:	Government
Completion Date:	-
Current Owner:	City of Franklin
Did Owner Change:	Y
Cleanup Required:	Y
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	2/18/2011
State/tribal program ID:	199902062
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	3
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	1.97
Future use greenspace acreage:	-
Future use residential acreage:	-

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

Future use commercial acreage:	1.97
Future use industrial acreage:	-
Superfund Fed. landowner flag:	Y
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	The Site is composed of a single vacant 1.97-acre parcel of land located at 45 Tannery Street in Franklin, New Hampshire, that is situated along the Pemigewasset River. The Site consists of a vacant lot with only the former building s concrete slab-on-grade foundation and a small pile of debris. The Site was first developed in 1892. By approximately 1930, the first building was constructed on the Site. The most recent building was demolished in 2008 after it collapsed due to heavy winter snow cover. Based on a prior Phase I ESA report, the Site appears to be have used for railroad purposes when the Boston & Maine and Bristol Rail Road transected the Site beginning in 1892. It is not clear when railroad activities ceased on the Site. However, records do show that the Hingston Leather Company, Inc. and Louis Verza Leather Company were using the Site for tannery activities beginning in the 1950 s until the mid to late 1970 s. Between 1979 and 1980, Polyclad Laminates, Inc. began operations on the Site. Polyclad Laminates, Inc. manufactured component materials used in multi-ed circuit boards called pre-preg . The process involved dipping fiberglass cloth in a dip tank filled with epoxy resin. Polyclad Laminates used the Site for the manufacture of pre-preg from between 1979 and 1980 until around 2006.
Below Poverty Number:	156
Below Poverty Percent:	10.16
Meidan Income:	4022

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

Meidan Income Number:	695
Meidan Income Percent:	45.28
Vacant Housing Number:	37
Vacant Housing Percent:	5.59
Unemployed Number:	101
Unemployed Percent:	6.58
Name:	POLYCLAD LAMINATES, INC.
Address:	45 TANNERY STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	Map 116, Lot 171
Parcel size:	1.97
Latitude:	43.4500249
Longitude:	-71.6474635
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	This was an abandoned tannery property with existing concrete foundations in place. The city acquired the property and constructed a new DPW garage/facilities. Former Use: The Site is composed of a single vacant 1.97-acre parcel of land located at 45 Tannery Street in Franklin, New Hampshire, that is situated along the Pemigewasset River. The Site consists of a vacant lot with only the former building s concrete slab-on-grade foundation and a small pile of debris. The Site was first developed in 1892. By approximately 1930, the first building was constructed on the Site. The most recent building was demolished in 2008 after it collapsed due to heavy winter snow cover. Based on a prior Phase I ESA report, the Site appears to be have used for railroad purposes when the Boston & Maine and Bristol Rail Road transected the Site beginning in 1892. It is not clear when railroad activities ceased on the Site. However, records do show that the Hingston Leather Company, Inc. and Louis Verza Leather Company were using the Site for tannery activities beginning in the 1950 s until the mid to late 1970 s. Between 1979 and 1980, Polyclad Laminates, Inc. began operations on the Site. Polyclad Laminates, Inc. manufactured component materials used in multi-ed circuit boards called pre-preg . The process involved dipping fiberglass cloth in a dip tank filled with epoxy resin. Polyclad Laminates used the Site for the manufacture of pre-preg from between 1979 and 1980 until around 2006.
Datum:	North American Datum of 1983
Acres Property ID:	128562
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	96111801
Start Date:	-
Ownership Entity:	Government
Completion Date:	-
Current Owner:	City of Franklin
Did Owner Change:	Y
Cleanup Required:	Y
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	2/18/2011
State/tribal program ID:	199902062
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	1.97
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.97
Future use industrial acreage:	-
Superfund Fed. landowner flag:	Y
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	The Site is composed of a single vacant 1.97-acre parcel of land located at 45 Tannery Street in Franklin, New Hampshire, that is situated along the Pemigewasset River. The Site consists of a vacant lot with only the former building s concrete slab-on-grade foundation and a small pile of debris. The Site was first developed in 1892. By approximately 1930, the first building was constructed on the Site. The most recent building was demolished in 2008 after it collapsed due to heavy winter snow cover. Based on a prior Phase I ESA report, the Site appears to be have used for railroad purposes when the Boston & Maine and Bristol Rail Road transected the Site beginning in 1892. It is not clear when railroad activities ceased on the Site. However, records do show that the Hingston Leather Company, Inc. and Louis Verza Leather Company were using the Site for tannery activities beginning in the 1950 s until the mid to late 1970 s. Between 1979 and 1980, Polyclad Laminates, Inc. began operations on the Site. Polyclad Laminates, Inc. manufactured component materials used in multi-ed

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

circuit boards called pre-preg . The process involved dipping fiberglass cloth in a dip tank filled with epoxy resin. Polyclad Laminates used the Site for the manufacture of pre-preg from between 1979 and 1980 until around 2006.

Below Poverty Number:	156
Below Poverty Percent:	10.16
Meidan Income:	4022
Meidan Income Number:	695
Meidan Income Percent:	45.28
Vacant Housing Number:	37
Vacant Housing Percent:	5.59
Unemployed Number:	101
Unemployed Percent:	6.58

Name:	POLYCLAD LAMINATES, INC.
Address:	45 TANNERY STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	Map 116, Lot 171
Parcel size:	1.97
Latitude:	43.4500249
Longitude:	-71.6474635
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	This was an abandoned tannery property with existing concrete foundations in place. The city acquired the property and constructed a new DPW garage/facilities. Former Use: The Site is composed of a single vacant 1.97-acre parcel of land located at 45 Tannery Street in Franklin, New Hampshire, that is situated along the Pemigewasset River. The Site consists of a vacant lot with only the former building s concrete slab-on-grade foundation and a small pile of debris. The Site was first developed in 1892. By approximately 1930, the first building was constructed on the Site. The most recent building was demolished in 2008 after it collapsed due to heavy winter snow cover. Based on a prior Phase I ESA report, the Site appears to be have used for railroad purposes when the Boston & Maine and Bristol Rail Road transected the Site beginning in 1892. It is not clear when railroad activities ceased on the Site. However, records do show that the Hingston Leather Company, Inc. and Louis Verza Leather Company were using the Site for tannery activities beginning in the 1950 s until the mid to late 1970 s. Between 1979 and 1980, Polyclad Laminates, Inc. began operations on the Site. Polyclad Laminates, Inc. manufactured component materials used in multi-ed circuit boards called pre-preg . The process involved dipping fiberglass cloth in a dip tank filled with epoxy resin. Polyclad Laminates used the Site for the manufacture of pre-preg from between 1979 and 1980 until around 2006.
Datum:	North American Datum of 1983
Acres Property ID:	128562
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	96111801
Start Date:	-
Ownership Entity:	Government
Completion Date:	-
Current Owner:	City of Franklin
Did Owner Change:	Y
Cleanup Required:	Y
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	2/18/2011
State/tribal program ID:	199902062
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	1.97
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.97
Future use industrial acreage:	-
Superfund Fed. landowner flag:	Y
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	The Site is composed of a single vacant 1.97-acre parcel of land located at 45 Tannery Street in Franklin, New Hampshire, that is situated along the Pemigewasset River. The Site consists of a vacant lot with only the former building s concrete slab-on-grade foundation and a small pile of debris. The Site was first developed in 1892. By approximately 1930, the first building was constructed on the Site. The most recent building was demolished in 2008 after it collapsed due to heavy winter snow cover. Based on a prior Phase I ESA report, the Site appears to be have used for railroad purposes when the Boston &

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

Maine and Bristol Rail Road transected the Site beginning in 1892. It is not clear when railroad activities ceased on the Site. However, records do show that the Hingston Leather Company, Inc. and Louis Verza Leather Company were using the Site for tannery activities beginning in the 1950 s until the mid to late 1970 s. Between 1979 and 1980, Polyclad Laminates, Inc. began operations on the Site. Polyclad Laminates, Inc. manufactured component materials used in multi-ed circuit boards called pre-preg . The process involved dipping fiberglass cloth in a dip tank filled with epoxy resin. Polyclad Laminates used the Site for the manufacture of pre-preg from between 1979 and 1980 until around 2006.

Below Poverty Number:	156
Below Poverty Percent:	10.16
Meidan Income:	4022
Meidan Income Number:	695
Meidan Income Percent:	45.28
Vacant Housing Number:	37
Vacant Housing Percent:	5.59
Unemployed Number:	101
Unemployed Percent:	6.58

Name:	POLYCLAD LAMINATES, INC.
Address:	45 TANNERY STREET
City,State,Zip:	FRANKLIN, NH 3235
Recipient Name:	Lakes Region Planning Commission
Grant Type:	Assessment
Property Number:	Map 116, Lot 171
Parcel size:	1.97
Latitude:	43.4500249
Longitude:	-71.6474635
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	This was an abandoned tannery property with existing concrete foundations in place. The city acquired the property and constructed a new DPW garage/facilities. Former Use: The Site is composed of a single vacant 1.97-acre parcel of land located at 45 Tannery Street in Franklin, New Hampshire, that is situated along the Pemigewasset River. The Site consists of a vacant lot with only the former building s concrete slab-on-grade foundation and a small pile of debris. The Site was first developed in 1892. By approximately 1930, the first building was constructed on the Site. The most recent building was demolished in 2008 after it collapsed due to heavy winter snow cover. Based on a prior Phase I ESA report, the Site appears to be have used for railroad purposes when the Boston & Maine and Bristol Rail Road transected the Site beginning in 1892. It is not clear when railroad activities ceased on the Site. However, records do show that the Hingston Leather Company, Inc. and Louis Verza Leather Company were using the Site for tannery activities beginning in the 1950 s until the mid to late 1970 s. Between 1979 and 1980, Polyclad Laminates, Inc. began operations on the Site. Polyclad Laminates, Inc. manufactured component materials used in multi-ed circuit boards called pre-preg . The process involved dipping fiberglass cloth in a dip tank filled with epoxy resin. Polyclad Laminates used the Site for the manufacture of pre-preg from between 1979 and 1980 until around 2006.
Datum:	North American Datum of 1983

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

Acres Property ID:	128562
IC Data Access:	-
Start Date:	-
Redev Completition Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	251000
Redev. Funding Source:	Town of Franklin
Redev. Funding Entity Name:	Local Funding
Redevelopment Start Date:	10/1/2011
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	96111801
Start Date:	-
Ownership Entity:	Government
Completion Date:	-
Current Owner:	City of Franklin
Did Owner Change:	Y
Cleanup Required:	Y
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	2/18/2011
State/tribal program ID:	199902062
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controled substance found:	-
Controled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	3
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	1.97
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.97
Future use industrial acreage:	-
Superfund Fed. landowner flag:	Y
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	The Site is composed of a single vacant 1.97-acre parcel of land located at 45 Tannery Street in Franklin, New Hampshire, that is

POLYCLAD LAMINATES, INC. (Continued) **1014949325**

situated along the Pemigewasset River. The Site consists of a vacant lot with only the former building s concrete slab-on-grade foundation and a small pile of debris. The Site was first developed in 1892. By approximately 1930, the first building was constructed on the Site. The most recent building was demolished in 2008 after it collapsed due to heavy winter snow cover. Based on a prior Phase I ESA report, the Site appears to be have used for railroad purposes when the Boston & Maine and Bristol Rail Road transected the Site beginning in 1892. It is not clear when railroad activities ceased on the Site. However, records do show that the Hingston Leather Company, Inc. and Louis Verza Leather Company were using the Site for tannery activities beginning in the 1950 s until the mid to late 1970 s. Between 1979 and 1980, Polyclad Laminates, Inc. began operations on the Site. Polyclad Laminates, Inc. manufactured component materials used in multi-ed circuit boards called pre-preg . The process involved dipping fiberglass cloth in a dip tank filled with epoxy resin. Polyclad Laminates used the Site for the manufacture of pre-preg from between 1979 and 1980 until around 2006.

Below Poverty Number:	156
Below Poverty Percent:	10.16
Meidan Income:	4022
Meidan Income Number:	695
Meidan Income Percent:	45.28
Vacant Housing Number:	37
Vacant Housing Percent:	5.59
Unemployed Number:	101
Unemployed Percent:	6.58

---

78 **QUICK TURN FLEX CIRCUITS LLC** **NH SHWS** **1000692675**
WSW **174 N MAIN ST** **NH UST** **NHD986472249**
1/2-1 **FRANKLIN, NH 03235** **RCRA NonGen / NLR**
0.617 mi. **RI MANIFEST**
3256 ft. **NH NPDES**

Relative: Higher

Actual: 318 ft.

SHWS:

Name:	ADVANCE CIRCUIT SYSTEMS INC
Address:	174 N MAIN ST
City,State,Zip:	FRANKLIN, NH
Facility ID:	199207032
Proj Type:	HAZWASTE
Project Manager:	**CLOSED**
Project Site Description:	**HAZARDOUS WASTE DISCHARGE PROJECT**
Expired Date:	**Not reported**

UST:

Name:	ADVANCE CIRCUIT SYSTEMS INC
Address:	174 N MAIN ST
City:	FRANKLIN
Facility ID:	112548
Facility Type:	INDUSTRIAL
Site Number:	199207032
Owner Name:	ADVANCE CIRCUIT SYSTEMS INC
Owner Type:	COMMERCIAL/RESIDENTIAL
Owner Title:	PAUL D. MORRISSETTE, JR.
Owner Address:	75 N MAIN ST
Owner Address2:	Not reported
Owner City,St,Zip:	FRANKLIN, NH 03235

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Manager Name:	AL BROWN
Manager Title:	ENV. COOR.
Tank ID:	1
Status:	INACTIVE
Capacity (gal):	8000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	Not reported
Install Date:	01/01/1974
Last Test:	06/15/1991
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	10/08/1997
Tank Material:	STEEL - BARE/GALV
Closure Date:	10/21/1997
Tank Secondary:	NO
Product Stored:	#2 HEATING OIL
Overfill Type:	Not reported

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Pipe Secondary:	NO
Pipe Material:	COPPER
Pipe System:	SUCTION: OLD CODE

Tank ID:	2
Status:	INACTIVE
Capacity (gal):	5700
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	NO
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	PASS
Piping Tightness Test Date:	06/04/1991
Piping Tightness Test Pass Fail:	PASS
Piping Material Comments:	Not reported
Install Date:	01/01/1970
Last Test:	06/04/1991
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	10/08/1997
Tank Material:	STEEL - BARE/GALV
Closure Date:	10/21/1997
Tank Secondary:	NO

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Product Stored:	#2 HEATING OIL
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	COPPER
Pipe System:	SUCTION: OLD CODE

Tank ID:	3
Status:	INACTIVE
Capacity (gal):	1000
Temporary Closed Date:	01/01/1974
Tank Filled Removed:	Not reported
Compartment:	Not reported
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	NONE
Install Date:	01/01/1971
Last Test:	Not reported
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	11/11/1911
Tank Material:	STEEL - BARE/GALV

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Closure Date:	Not reported
Tank Secondary:	NO
Product Stored:	UNKNOWN SUBSTANCE
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	Not reported
Pipe System:	Not reported

Tank ID:	4
Status:	INACTIVE
Capacity (gal):	1000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	Not reported
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	NONE
Install Date:	01/01/1971
Last Test:	Not reported
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Permanent Closure:	11/11/1911
Tank Material:	STEEL - BARE/GALV
Closure Date:	Not reported
Tank Secondary:	NO
Product Stored:	EMPTY
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	Not reported
Pipe System:	Not reported

Tank ID:	5
Status:	INACTIVE
Capacity (gal):	1000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	Not reported
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	NONE
Install Date:	01/01/1971
Last Test:	Not reported
Spill Installed:	Not reported

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	11/11/1911
Tank Material:	STEEL - BARE/GALV
Closure Date:	Not reported
Tank Secondary:	NO
Product Stored:	EMPTY
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	Not reported
Pipe System:	Not reported

Tank ID:	6
Status:	INACTIVE
Capacity (gal):	1000
Temporary Closed Date:	Not reported
Tank Filled Removed:	Not reported
Compartment:	Not reported
Tank Diameter In Inches:	Not reported
Construction Material Comments:	Not reported
Meets Dec 22 2015 Deadline:	Not reported
Leak Line Detection:	Not reported
Leak Line Detection Installed Date:	Not reported
Leak Line Detection Test Pass Fail:	Not reported
Drop Tube Pass Fail:	Not reported
Drain Valve Replaced Date:	Not reported
Dry Beak Installed Date:	Not reported
Inv Monitor Review Date:	Not reported
Dispenser Pan:	Not reported
Overfill Length In Inches:	Not reported
Release Detection (RD) Tank Type:	NONE LISTED
RD Tank Type Installed Date:	Not reported
RD Tank Type Tested Date:	Not reported
RD Tank Type Test Pass Fail:	Not reported
RD Piping Type:	NONE
RD Piping Installed Date:	Not reported
RD Piping Tested Date:	Not reported
RD Piping Test Pass Fail:	Not reported
Corrosion Protection (CP) Tank:	Not reported
CP Tank Installed Date:	Not reported
CP Tank Tested Date:	Not reported
CP Tank Test Pass Fail:	Not reported
CP Piping:	Not reported
CP Piping Installed Date:	Not reported
CP Piping Tested Date:	Not reported
CP Piping Test Pass Fail:	Not reported
CP Fitting:	Not reported
CP Fitting Installed Date:	Not reported
CP Fitting Tested Date:	Not reported
CP Fitting Test Pass Fail:	Not reported
CP Log Date:	Not reported
Tank Tightness Test Pass Fail:	Not reported
Piping Tightness Test Date:	Not reported
Piping Tightness Test Pass Fail:	Not reported
Piping Material Comments:	NONE
Install Date:	01/01/1971

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Last Test:	Not reported
Spill Installed:	Not reported
Overfill:	Not reported
Line Leak Detection:	Not reported
Permanent Closure:	11/11/1911
Tank Material:	STEEL - BARE/GALV
Closure Date:	Not reported
Tank Secondary:	NO
Product Stored:	EMPTY
Overfill Type:	Not reported
Pipe Secondary:	NO
Pipe Material:	Not reported
Pipe System:	Not reported

RCRA NonGen / NLR:

Date Form Received by Agency:		20060724
Handler Name:	QUICK TURN FLEX CIRCUITS LLC	
Handler Address:		174 N MAIN ST
Handler City,State,Zip:		FRANKLIN, NH 03235
EPA ID:		NHD986472249
Contact Name:		RICHARD KLOZA
Contact Address:		174 N MAIN ST
Contact City,State,Zip:		FRANKLIN, NH 03235
Contact Telephone:		603-930-7244
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		01
Land Type:		Private
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		174 N MAIN ST
Mailing City,State,Zip:		FRANKLIN, NH 03235
Owner Name:	RICHARD KLOZA	
Owner Type:		Other
Operator Name:	RICHARD KLOZA	
Operator Type:		Other
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20060906
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Biennial: List of Years
Year: 2003

Click Here for Biennial Reporting System Data:
Year: 2001

Click Here for Biennial Reporting System Data:

Hazardous Waste Summary:
Waste Code: D001
Waste Description: IGNITABLE WASTE

Waste Code: D008
Waste Description: LEAD

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Waste Code: F006
Waste Description: WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS, EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC, AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name: FLEXIBLE CIRCUITS INC	
Legal Status:	Private
Date Became Current:	20001001
Date Ended Current:	Not reported
Owner/Operator Address:	174 N MAIN ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name: RICHARD KLOZA	
Legal Status:	Other
Date Became Current:	20031201
Date Ended Current:	Not reported
Owner/Operator Address:	334 BROAD ST
Owner/Operator City,State,Zip:	HOLLIS, NH 03049
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: FRANKLIN FALLS MILL LLC	
Legal Status:	Private
Date Became Current:	20011130
Date Ended Current:	Not reported
Owner/Operator Address:	349 CENTRAL ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: FLEXIBLE CIRCUITS INC	
Legal Status:	Private
Date Became Current:	20020402
Date Ended Current:	Not reported
Owner/Operator Address:	174 N MAIN ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-2267
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Owner/Operator Indicator:	Operator
Owner/Operator Name: RICHARD KLOZA	
Legal Status:	Other
Date Became Current:	20031201
Date Ended Current:	Not reported
Owner/Operator Address:	334 BROAD ST
Owner/Operator City,State,Zip:	HOLLIS, NH 03049
Owner/Operator Telephone:	603-594-9444
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: RALPH MECHEAU	
Legal Status:	Private
Date Became Current:	20010102
Date Ended Current:	Not reported
Owner/Operator Address:	174 N MAST ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-2311
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: RICHARD KLOZA	
Legal Status:	Other
Date Became Current:	20031201
Date Ended Current:	Not reported
Owner/Operator Address:	334 BROAD ST
Owner/Operator City,State,Zip:	HOLLIS, NH 03049
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name: RICHARD KLOZA	
Legal Status:	Other
Date Became Current:	20031201
Date Ended Current:	Not reported
Owner/Operator Address:	334 BROAD ST
Owner/Operator City,State,Zip:	HOLLIS, NH 03049
Owner/Operator Telephone:	603-594-9444
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: FLEXIBLE CIRCUITS INC	
Legal Status:	Private
Date Became Current:	20020402
Date Ended Current:	Not reported
Owner/Operator Address:	174 N MAIN ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	603-934-2267
Owner/Operator Telephone Ext:	Not reported

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name: RICHARD KLOZA	
Legal Status:	Other
Date Became Current:	20031201
Date Ended Current:	Not reported
Owner/Operator Address:	334 BROAD ST
Owner/Operator City,State,Zip:	HOLLIS, NH 03049
Owner/Operator Telephone:	603-594-9444
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name: FRANKLIN FALLS MILL LLC	
Legal Status:	Private
Date Became Current:	20011130
Date Ended Current:	Not reported
Owner/Operator Address:	349 CENTRAL ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name: RICHARD KLOZA	
Legal Status:	Other
Date Became Current:	20031201
Date Ended Current:	Not reported
Owner/Operator Address:	334 BROAD ST
Owner/Operator City,State,Zip:	HOLLIS, NH 03049
Owner/Operator Telephone:	603-594-9444
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name: FRANKLIN FALLS MILL LLC	
Legal Status:	Private
Date Became Current:	20011130
Date Ended Current:	Not reported
Owner/Operator Address:	349 CENTRAL ST
Owner/Operator City,State,Zip:	FRANKLIN, NH 03235
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name: FRANKLIN FALLS MILL LLC	
Legal Status:	Private
Date Became Current:	20011130
Date Ended Current:	Not reported
Owner/Operator Address:	349 CENTRAL ST

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Owner/Operator City,State,Zip: FRANKLIN, NH 03235
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: RICHARD KLOZA
Legal Status: Private
Date Became Current: 20031201
Date Ended Current: Not reported
Owner/Operator Address: 334 BROAD ST
Owner/Operator City,State,Zip: HOLLIS, NH 03049
Owner/Operator Telephone: 603-594-9444
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: RALPH MECHEAU
Legal Status: Private
Date Became Current: 20010102
Date Ended Current: Not reported
Owner/Operator Address: 174 N MAST ST
Owner/Operator City,State,Zip: FRANKLIN, NH 03235
Owner/Operator Telephone: 603-934-2311
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: RICHARD KLOZA
Legal Status: Private
Date Became Current: 20031201
Date Ended Current: Not reported
Owner/Operator Address: 334 BROAD ST
Owner/Operator City,State,Zip: HOLLIS, NH 03049
Owner/Operator Telephone: 603-594-9444
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 20011126
Handler Name: FLEXIBLE CIRCUITS INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20040101

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Handler Name: QUICK TURN FLEX CIRCUITS LLC
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20031121
Handler Name: QUICK TURN FLEX CIRCUITS LLC
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060724
Handler Name: QUICK TURN FLEX CIRCUITS LLC
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19910823
Handler Name: FLEXIBLE CIRCUITS INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20020212
Handler Name: FLEXIBLE CIRCUITS INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20031120
Handler Name: FLEXIBLE CIRCUITS INC
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: Yes
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19920317
Handler Name: ADVANCE CIRCUIT SYSTEMS INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19940321
Handler Name: ADVANCE CIRCUIT SYSTEMS, INC.
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19960329
Handler Name: ADVANCE CIRCUIT SYSTEMS INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Electronic Manifest Broker: Not reported

Receive Date: 19980316
Handler Name: ADVANCE CIRCUIT SYSTEMS INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20000412
Handler Name: ADVANCE CIRCUIT SYSTEMS INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Code: 334412
NAICS Description: BARE PRINTED CIRCUIT BOARD MANUFACTURING

NAICS Code: 334413
NAICS Description: SEMICONDUCTOR AND RELATED DEVICE MANUFACTURING

NAICS Code: 334418
NAICS Description: PRINTED CIRCUIT ASSEMBLY (ELECTRONIC ASSEMBLY) MANUFACTURING

NAICS Code: 334515
NAICS Description: INSTRUMENT MANUFACTURING FOR MEASURING AND TESTING ELECTRICITY AND ELECTRICAL SIGNALS

Facility Has Received Notices of Violation:
Found Violation: Yes
Agency Which Determined Violation: EPA
Violation Short Description: Generators - General
Date Violation was Determined: 20010410
Actual Return to Compliance Date: 20021101
Return to Compliance Qualifier: Documented
Violation Responsible Agency: EPA
Scheduled Compliance Date: Not reported
Enforcement Identifier: 001
Date of Enforcement Action: 20021101
Enforcement Responsible Agency: EPA
Enforcement Docket Number: RCRA1-2002-0032
Enforcement Attorney: BCHIN

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	AGM01
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported

Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	Generators - Pre-transport
Date Violation was Determined:	20010410
Actual Return to Compliance Date:	20021101
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20021101
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	RCRA1-2002-0032
Enforcement Attorney:	BCHIN
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	AGM01
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Generators - Pre-transport
Date Violation was Determined:	20050121
Actual Return to Compliance Date:	20050215
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20050215
Enforcement Responsible Agency:	State
Enforcement Docket Number:	NOPV
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INFORMAL WRITTEN NOTIFICATION
Enforcement Responsible Person:	RBBNH
Enforcement Responsible Sub-Organization:	RC
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	Generators - Pre-transport
Date Violation was Determined:	20010410
Actual Return to Compliance Date:	20021101
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20021101
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	RCRA1-2002-0032
Enforcement Attorney:	BCHIN

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	AGM01
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported

Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	Generators - General
Date Violation was Determined:	20010410
Actual Return to Compliance Date:	20021101
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20021101
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	RCRA1-2002-0032
Enforcement Attorney:	BCHIN
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	AGM01
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Generators - General
Date Violation was Determined:	20050121
Actual Return to Compliance Date:	20050215
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20050215
Enforcement Responsible Agency:	State
Enforcement Docket Number:	NOPV
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INFORMAL WRITTEN NOTIFICATION
Enforcement Responsible Person:	RBBNH
Enforcement Responsible Sub-Organization:	RC
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Generators - Pre-transport
Date Violation was Determined:	20050121
Actual Return to Compliance Date:	20050215
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20050215
Enforcement Responsible Agency:	State
Enforcement Docket Number:	NOPV
Enforcement Attorney:	Not reported

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INFORMAL WRITTEN NOTIFICATION
Enforcement Responsible Person:	RBBNH
Enforcement Responsible Sub-Organization:	RC
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported

Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	Generators - Records/Reporting
Date Violation was Determined:	20010410
Actual Return to Compliance Date:	20021101
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20021101
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	RCRA1-2002-0032
Enforcement Attorney:	BCHIN
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	AGM01
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Generators - Pre-transport
Date Violation was Determined:	20050121
Actual Return to Compliance Date:	20050215
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20050215
Enforcement Responsible Agency:	State
Enforcement Docket Number:	NOPV
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INFORMAL WRITTEN NOTIFICATION
Enforcement Responsible Person:	RBBNH
Enforcement Responsible Sub-Organization:	RC
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	Generators - Pre-transport
Date Violation was Determined:	20010410
Actual Return to Compliance Date:	20021101
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20021101
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	RCRA1-2002-0032
Enforcement Attorney:	BCHIN

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	AGM01
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported

Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Universal Waste - General
Date Violation was Determined:	20050121
Actual Return to Compliance Date:	20050215
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20050215
Enforcement Responsible Agency:	State
Enforcement Docket Number:	NOPV
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INFORMAL WRITTEN NOTIFICATION
Enforcement Responsible Person:	RBBNH
Enforcement Responsible Sub-Organization:	RC
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	Generators - Pre-transport
Date Violation was Determined:	20010410
Actual Return to Compliance Date:	20021101
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20021101
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	RCRA1-2002-0032
Enforcement Attorney:	BCHIN

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	AGM01
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported

Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	Generators - Pre-transport
Date Violation was Determined:	20010410
Actual Return to Compliance Date:	20021101
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20021101
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	RCRA1-2002-0032
Enforcement Attorney:	BCHIN
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	AGM01
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	Generators - Pre-transport
Date Violation was Determined:	20010410
Actual Return to Compliance Date:	20021101
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20021101
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	RCRA1-2002-0032
Enforcement Attorney:	BCHIN

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	AGM01
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported

Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	Generators - Pre-transport
Date Violation was Determined:	20010410
Actual Return to Compliance Date:	20021101
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20021101
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	RCRA1-2002-0032
Enforcement Attorney:	BCHIN
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	AGM01
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported

Evaluation Action Summary:

Evaluation Date:	20010410
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	JVG01
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	20021101
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Evaluation Date:	20010410
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	JVG01
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	20021101
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Evaluation Date:	20050121
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	RBBNH
Evaluation Responsible Sub-Organization:	RC
Actual Return to Compliance Date:	20050215
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Evaluation Date:	20010410
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	JVG01
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	20021101
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Former Citation:	Not reported
Evaluation Date:	20010410
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	JVG01
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	20021101
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20050121
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	RBBNH
Evaluation Responsible Sub-Organization:	RC
Actual Return to Compliance Date:	20050215
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20050121
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	RBBNH
Evaluation Responsible Sub-Organization:	RC
Actual Return to Compliance Date:	20050215
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20010410
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	JVG01
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	20021101
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20050121
Evaluation Responsible Agency:	State
Found Violation:	Yes

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	RBBNH
Evaluation Responsible Sub-Organization:	RC
Actual Return to Compliance Date:	20050215
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Evaluation Date:	20010410
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	JVG01
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	20021101
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Evaluation Date:	20021101
Evaluation Responsible Agency:	EPA
Found Violation:	No
Evaluation Type Description:	NOT A SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	AGM01
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Evaluation Date:	20050121
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	RBBNH
Evaluation Responsible Sub-Organization:	RC
Actual Return to Compliance Date:	20050215
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Evaluation Date:	20010410
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	JVG01
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	20021101
Scheduled Compliance Date:	Not reported

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20010410
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	JVG01
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	20021101
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20020627
Evaluation Responsible Agency:	EPA
Found Violation:	No
Evaluation Type Description:	SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	AGM01
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20010410
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	JVG01
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	20021101
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20010410
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	JVG01
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	20021101
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

RI MANIFEST:

Name:	ADV CIRC
Address:	174 N MAIN ST
City,State,Zip:	FRANKLIN, NH 03235
EPA Id:	NHD986472249
GEN Cert Date:	5/8/1992
Manifest Document Number:	RIB0018982
Waste Description:	MET HYD
TSDF Id:	RID040098352
TSDF Name:	NORTHLAND
Qty:	2
WT/Vol Units:	Y
TSDF Date:	Not reported
Transporter 2 Id:	Not reported
Item Number:	1
Transporter 2 Name:	Not reported
Transporter Name 2:	JEFFREY
Transporter EPAID:	MAD080030356
Transporter Receipt Date:	Not reported
Number Of Containers:	0
Container Type:	Not reported
Waste Code1:	F006
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Fee Exempt Code:	Not reported
Comment:	Not reported
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
Quarter:	Not reported
Transporter Contact Name:	Not reported
Transporter Contact Email:	Not reported
Filing Date:	Not reported
Total Fee:	Not reported
Billing Name:	Not reported
Paid Date:	Not reported
Paid Time:	Not reported
Facility Receipt Date:	Not reported
Fee:	Not reported
Manifest Created Date:	Not reported
Manifest Updated Date:	Not reported

RI MANIFEST:

Transporter Receipt Date:	Not reported
Number Of Containers:	0
Container Type:	Not reported
Waste Code1:	F006
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

TSDF Name:	NORTHLAND
TSDF Id:	RID040098352
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD986472249
Manifest Docket Number:	NHF0011016
Quarter:	Not reported
Waste Description:	MET HYD
Transporter Contact Name:	Not reported
Quantity:	3000
Transporter Contact Email:	Not reported
WT/Vol Units:	P
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	1
Transporter Name:	JEFFREY
Billing Name:	Not reported
Transporter EPA ID:	MAD080030356
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	3/3/1993
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	Not reported
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	Not reported
Number Of Containers:	0
Container Type:	Not reported
Waste Code1:	F006
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	NORTHLAND
TSDF Id:	RID040098352
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD986472249
Manifest Docket Number:	NHF0011016
Quarter:	Not reported
Waste Description:	MET HYD
Transporter Contact Name:	Not reported
Quantity:	3000
Transporter Contact Email:	Not reported
WT/Vol Units:	P
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	1

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Transporter Name:	JEFFREY
Billing Name:	Not reported
Transporter EPA ID:	MAD080030356
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	3/3/1993
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	Not reported
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	Not reported
Number Of Containers:	0
Container Type:	Not reported
Waste Code1:	F006
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	NORTHLAND
TSDF Id:	RID040098352
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD986472249
Manifest Docket Number:	RIB0018971
Quarter:	Not reported
Waste Description:	MET HYDROX SLUDGE
Transporter Contact Name:	Not reported
Quantity:	2
Transporter Contact Email:	Not reported
WT/Vol Units:	Y
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	1
Transporter Name:	JEFFREY
Billing Name:	Not reported
Transporter EPA ID:	MAD080030356
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	3/12/1992
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	Not reported
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	Not reported
Number Of Containers:	0

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Container Type:	Not reported
Waste Code1:	F006
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	NORTHLAND
TSDF Id:	RID040098352
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD986472249
Manifest Docket Number:	RIB0018971
Quarter:	Not reported
Waste Description:	MET HYDROX SLUDGE
Transporter Contact Name:	Not reported
Quantity:	2
Transporter Contact Email:	Not reported
WT/Vol Units:	Y
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	1
Transporter Name:	JEFFREY
Billing Name:	Not reported
Transporter EPA ID:	MAD080030356
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	3/12/1992
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	Not reported
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	Not reported
Number Of Containers:	0
Container Type:	Not reported
Waste Code1:	F006
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	NORTHLAND
TSDF Id:	RID040098352
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD986472249
Manifest Docket Number:	RIC0023737

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Quarter:	Not reported
Waste Description:	MET HYD
Transporter Contact Name:	Not reported
Quantity:	3000
Transporter Contact Email:	Not reported
WT/Vol Units:	P
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	1
Transporter Name:	JEFFREY
Billing Name:	Not reported
Transporter EPA ID:	MAD080030356
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	9/18/1992
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	Not reported
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	Not reported
Number Of Containers:	0
Container Type:	Not reported
Waste Code1:	F006
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	NORTHLAND
TSDF Id:	RID040098352
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD986472249
Manifest Docket Number:	RIB0020780
Quarter:	Not reported
Waste Description:	MET HYD
Transporter Contact Name:	Not reported
Quantity:	2
Transporter Contact Email:	Not reported
WT/Vol Units:	Y
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	1
Transporter Name:	JEFFREY
Billing Name:	Not reported
Transporter EPA ID:	MAD080030356
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	7/16/1992
Facility Receipt Date:	Not reported

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	Not reported
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	Not reported
Number Of Containers:	0
Container Type:	Not reported
Waste Code1:	F006
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	NORTHLAND
TSDF Id:	RID040098352
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD986472249
Manifest Docket Number:	RIB0020780
Quarter:	Not reported
Waste Description:	MET HYD
Transporter Contact Name:	Not reported
Quantity:	2
Transporter Contact Email:	Not reported
WT/Vol Units:	Y
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	1
Transporter Name:	JEFFREY
Billing Name:	Not reported
Transporter EPA ID:	MAD080030356
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	7/16/1992
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	Not reported
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	Not reported
Number Of Containers:	0
Container Type:	Not reported
Waste Code1:	F006
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	NORTHLAND
TSDF Id:	RID040098352
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD986472249
Manifest Docket Number:	RIB0018982
Quarter:	Not reported
Waste Description:	MET HYD
Transporter Contact Name:	Not reported
Quantity:	2
Transporter Contact Email:	Not reported
WT/Vol Units:	Y
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	1
Transporter Name:	JEFFREY
Billing Name:	Not reported
Transporter EPA ID:	MAD080030356
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	5/8/1992
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	Not reported
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	Not reported
Number Of Containers:	0
Container Type:	Not reported
Waste Code1:	F006
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	NORTHLAND
TSDF Id:	RID040098352
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD986472249
Manifest Docket Number:	RIB0018982
Quarter:	Not reported
Waste Description:	MET HYD
Transporter Contact Name:	Not reported
Quantity:	2
Transporter Contact Email:	Not reported
WT/Vol Units:	Y
Filing Date:	Not reported

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Total Fee:	Not reported
Item Number:	1
Transporter Name:	JEFFREY
Billing Name:	Not reported
Transporter EPA ID:	MAD080030356
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	5/8/1992
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	Not reported
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	Not reported
Number Of Containers:	0
Container Type:	Not reported
Waste Code1:	F006
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	NORTHLAND
TSDF Id:	RID040098352
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	NHD986472249
Manifest Docket Number:	RIC0023737
Quarter:	Not reported
Waste Description:	MET HYD
Transporter Contact Name:	Not reported
Quantity:	3000
Transporter Contact Email:	Not reported
WT/Vol Units:	P
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	1
Transporter Name:	JEFFREY
Billing Name:	Not reported
Transporter EPA ID:	MAD080030356
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	9/18/1992
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDF Receipt Date:	Not reported
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported

QUICK TURN FLEX CIRCUITS LLC (Continued) **1000692675**

Click this hyperlink while viewing on your computer to access additional RI_MANIFEST: detail in the EDR Site Report.

NPDES:

Name:	ADVANCE CIRCUIT SYSTEMS, INC.
Address:	174 N. MAIN STREET
City,State,Zip:	FRANKLIN, NH
Permit Number:	NH0022748
Mailing Address Line 1:	174 North Main Street
Mailing Address Line 2:	Not reported
Mailing Address Line 3:	Not reported
Mailing Address City,St,Zip:	Franklin, NH 03235
Contact Name:	Al Brown
Contact Title:	Chemical Engineer
Contact Phone:	934-2311
Issuance Date:	Not reported
Expire Date:	Not reported
Facility Status:	Inactive
Facility Type:	Not reported
Receiving Strem:	Chance Pond Brook
Responsible Official:	Ronal Brooks
Responsible Official Title:	President
Responsible Official Title 2:	Not reported
Responsible Official Address:	174 N. Main Street
Responsible Official Address 2:	Not reported
Responsible Official Address 3:	Not reported
Responsible Official City:	Franklin
Responsible Official State:	NH
Responsible Official Zip:	03235
Responsible Official Phone:	934-2311
Responsible Official Phone 2:	Not reported
Responsible Official Fax:	Not reported
Responsible Official Email:	Not reported
expr1023:	Not reported

---

79 **CROWLEY TRUCKING** **NH SHWS** **S102991142**
East **4 GREEN STREET** **NH INST CONTROL** **N/A**
1/2-1 **FRANKLIN, NH**
0.775 mi.
4090 ft.

Relative:
Higher

Actual:
477 ft.

SHWS:

Name:	CROWLEY TRUCKING
Address:	4 GREEN STREET
City,State,Zip:	FRANKLIN, NH
Facility ID:	199802084
Proj Type:	HAZWASTE
Project Manager:	**CLOSED-AUR**
Project Site Description:	**HAZARDOUS WASTE DISCHARGE PROJECT**
Expired Date:	**Not reported**

Inst Control:

Name:	CROWLEY TRUCKING
Address:	4 GREEN STREET
City,State,Zip:	FRANKLIN, NH
Facility ID:	199802084

CROWLEY TRUCKING (Continued) **S102991142**

Action Date: 11/26/2001
Action Description: AUR ACCEPTED AS RECORDED SEP-20-2001
Project Type: HAZWASTE
Project Management: CLOSED-AUR

Name: CROWLEY TRUCKING
Address: 4 GREEN STREET
City,State,Zip: FRANKLIN, NH
Facility ID: 199802084
Action Date: 02/26/2001
Action Description: COPY OF RECORDED AUR ACCEPTED FOR PSNH PORTION
Project Type: HAZWASTE
Project Management: CLOSED-AUR

---

80 **FRANKLIN NON-FERROUS FOUNDRY INC** **NH SHWS** **S123698562**
NE **293 SANBORN STREET** **NH ALLSITES** **N/A**
1/2-1 **FRANKLIN, NH**
0.889 mi.
4692 ft.

Relative:
Higher

Actual:
580 ft.

SHWS:
Name: FRANKLIN NON-FERROUS FOUNDRY INC
Address: 293 SANBORN STREET
City,State,Zip: FRANKLIN, NH
Facility ID: 198709004
Proj Type: HAZWASTE
Project Manager: **SWIONTEK**
Project Site Description: **HAZARDOUS WASTE DISCHARGE PROJECT**
Expired Date: **Not reported**

ALLSITES:
Name: FRANKLIN NON-FERROUS FOUNDRY INC
Address: 293 SANBORN STREET
City,State,Zip: FRANKLIN, NH
Facility ID: 198709004
Project Type: UIC
Project Description: UNDERGROUND INJECTION CONTROL
Project Manager: REGISTRATION
Expiration Date: Not reported

Count: 5 records.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
FRANKLIN	S103093992	GHI ASSOCIATES, INC.	EAST BOW STREET		NH SHWS
FRANKLIN	1003862525	FRANKLIN RIVER ROAD LANDFILL	FRANKLIN RIVER ROAD	03235	SEMS-ARCHIVE
FRANKLIN	S115302642	STANLEY MILL	MEMORIAL ST		NH RGA LUST
FRANKLIN	S102828341	FRANKLIN FALLS DAM	P O BOX 340-FRANKLIN FALLS DAM		NH LUST
FRANKLIN	S105426281	FRANKLIN MUNICIPAL LANDFILL	RIVER RD		NH SWF/LF

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

STANDARD ENVIRONMENTAL RECORDS

Lists of Federal NPL (Superfund) sites

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 07/26/2022
Date Data Arrived at EDR: 08/02/2022
Date Made Active in Reports: 08/22/2022
Number of Days to Update: 20

Source: EPA
Telephone: N/A
Last EDR Contact: 09/01/2022
Next Scheduled EDR Contact: 10/10/2022
Data Release Frequency: Quarterly

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)
Telephone: 202-564-7333

EPA Region 1
Telephone 617-918-1143

EPA Region 6
Telephone: 214-655-6659

EPA Region 3
Telephone 215-814-5418

EPA Region 7
Telephone: 913-551-7247

EPA Region 4
Telephone 404-562-8033

EPA Region 8
Telephone: 303-312-6774

EPA Region 5
Telephone 312-886-6686

EPA Region 9
Telephone: 415-947-4246

EPA Region 10
Telephone 206-553-8665

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 07/26/2022
Date Data Arrived at EDR: 08/02/2022
Date Made Active in Reports: 08/22/2022
Number of Days to Update: 20

Source: EPA
Telephone: N/A
Last EDR Contact: 09/01/2022
Next Scheduled EDR Contact: 10/10/2022
Data Release Frequency: Quarterly

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Date of Government Version: 10/15/1991
Date Data Arrived at EDR: 02/02/1994
Date Made Active in Reports: 03/30/1994
Number of Days to Update: 56

Source: EPA
Telephone: 202-564-4267
Last EDR Contact: 08/15/2011
Next Scheduled EDR Contact: 11/28/2011
Data Release Frequency: No Update Planned

Lists of Federal Delisted NPL sites

Delisted NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 07/26/2022
Date Data Arrived at EDR: 08/02/2022
Date Made Active in Reports: 08/22/2022
Number of Days to Update: 20

Source: EPA
Telephone: N/A
Last EDR Contact: 09/01/2022
Next Scheduled EDR Contact: 10/10/2022
Data Release Frequency: Quarterly

Lists of Federal sites subject to CERCLA removals and CERCLA orders

FEDERAL FACILITY: Federal Facility Site Information listing

A listing of National Priority List (NPL) and Base Realignment and Closure (BRAC) sites found in the Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Database where EPA Federal Facilities Restoration and Reuse Office is involved in cleanup activities.

Date of Government Version: 05/25/2021
Date Data Arrived at EDR: 06/24/2021
Date Made Active in Reports: 09/20/2021
Number of Days to Update: 88

Source: Environmental Protection Agency
Telephone: 703-603-8704
Last EDR Contact: 09/06/2022
Next Scheduled EDR Contact: 10/10/2022
Data Release Frequency: Varies

SEMS: Superfund Enterprise Management System

SEMS (Superfund Enterprise Management System) tracks hazardous waste sites, potentially hazardous waste sites, and remedial activities performed in support of EPA's Superfund Program across the United States. The list was formerly know as CERCLIS, renamed to SEMS by the EPA in 2015. The list contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). This dataset also contains sites which are either proposed to or on the National Priorities List (NPL) and the sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 07/26/2022
Date Data Arrived at EDR: 08/02/2022
Date Made Active in Reports: 08/22/2022
Number of Days to Update: 20

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 09/01/2022
Next Scheduled EDR Contact: 10/24/2022
Data Release Frequency: Quarterly

Lists of Federal CERCLA sites with NFRAP

SEMS-ARCHIVE: Superfund Enterprise Management System Archive

SEMS-ARCHIVE (Superfund Enterprise Management System Archive) tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS-NFRAP, renamed to SEMS ARCHIVE by the EPA in 2015. EPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list the site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that. based upon available information, the location is not judged to be potential NPL site.

Date of Government Version: 07/26/2022
Date Data Arrived at EDR: 08/02/2022
Date Made Active in Reports: 08/22/2022
Number of Days to Update: 20

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 09/01/2022
Next Scheduled EDR Contact: 10/24/2022
Data Release Frequency: Quarterly

Lists of Federal RCRA facilities undergoing Corrective Action

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 06/20/2022
Date Data Arrived at EDR: 06/21/2022
Date Made Active in Reports: 06/28/2022
Number of Days to Update: 7

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 09/19/2022
Next Scheduled EDR Contact: 01/02/2023
Data Release Frequency: Quarterly

Lists of Federal RCRA TSD facilities

RCRA-TSDF: RCRA - Treatment, Storage and Disposal

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 06/20/2022
Date Data Arrived at EDR: 06/21/2022
Date Made Active in Reports: 06/28/2022
Number of Days to Update: 7

Source: Environmental Protection Agency
Telephone: (888) 372-7341
Last EDR Contact: 09/19/2022
Next Scheduled EDR Contact: 01/02/2023
Data Release Frequency: Quarterly

Lists of Federal RCRA generators

RCRA-LQG: RCRA - Large Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

Date of Government Version: 06/20/2022
Date Data Arrived at EDR: 06/21/2022
Date Made Active in Reports: 06/28/2022
Number of Days to Update: 7

Source: Environmental Protection Agency
Telephone: (888) 372-7341
Last EDR Contact: 09/19/2022
Next Scheduled EDR Contact: 01/02/2023
Data Release Frequency: Quarterly

RCRA-SQG: RCRA - Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

Date of Government Version: 06/20/2022
Date Data Arrived at EDR: 06/21/2022
Date Made Active in Reports: 06/28/2022
Number of Days to Update: 7

Source: Environmental Protection Agency
Telephone: (888) 372-7341
Last EDR Contact: 09/19/2022
Next Scheduled EDR Contact: 01/02/2023
Data Release Frequency: Quarterly

RCRA-VSQG: RCRA - Very Small Quantity Generators (Formerly Conditionally Exempt Small Quantity Generators)

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Very small quantity generators (VSQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Date of Government Version: 06/20/2022
Date Data Arrived at EDR: 06/21/2022
Date Made Active in Reports: 06/28/2022
Number of Days to Update: 7

Source: Environmental Protection Agency
Telephone: (888) 372-7341
Last EDR Contact: 09/19/2022
Next Scheduled EDR Contact: 01/02/2023
Data Release Frequency: Quarterly

Federal institutional controls / engineering controls registries

LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 05/16/2022
Date Data Arrived at EDR: 05/19/2022
Date Made Active in Reports: 07/29/2022
Number of Days to Update: 71

Source: Department of the Navy
Telephone: 843-820-7326
Last EDR Contact: 08/03/2022
Next Scheduled EDR Contact: 11/21/2022
Data Release Frequency: Varies

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 05/16/2022
Date Data Arrived at EDR: 05/24/2022
Date Made Active in Reports: 07/29/2022
Number of Days to Update: 66

Source: Environmental Protection Agency
Telephone: 703-603-0695
Last EDR Contact: 08/17/2022
Next Scheduled EDR Contact: 12/05/2022
Data Release Frequency: Varies

US INST CONTROLS: Institutional Controls Sites List

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 05/16/2022
Date Data Arrived at EDR: 05/24/2022
Date Made Active in Reports: 07/29/2022
Number of Days to Update: 66

Source: Environmental Protection Agency
Telephone: 703-603-0695
Last EDR Contact: 08/17/2022
Next Scheduled EDR Contact: 12/05/2022
Data Release Frequency: Varies

Federal ERNS list

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 06/14/2022
Date Data Arrived at EDR: 06/15/2022
Date Made Active in Reports: 06/21/2022
Number of Days to Update: 6

Source: National Response Center, United States Coast Guard
Telephone: 202-267-2180
Last EDR Contact: 09/20/2022
Next Scheduled EDR Contact: 01/02/2023
Data Release Frequency: Quarterly

Lists of state- and tribal hazardous waste facilities

SHWS: Listing of All Sites

State Hazardous Waste Sites. State hazardous waste site records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. Available information varies by state.

Date of Government Version: 05/02/2022
Date Data Arrived at EDR: 05/04/2022
Date Made Active in Reports: 07/26/2022
Number of Days to Update: 83

Source: Department of Environmental Services
Telephone: 603-271-2919
Last EDR Contact: 07/29/2022
Next Scheduled EDR Contact: 11/14/2022
Data Release Frequency: Quarterly

Lists of state and tribal landfills and solid waste disposal facilities

SWF/LF: Solid Waste Facility Information

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 04/12/2022
Date Data Arrived at EDR: 04/13/2022
Date Made Active in Reports: 07/11/2022
Number of Days to Update: 89

Source: Department of Environmental Services
Telephone: 603-271-5380
Last EDR Contact: 07/07/2022
Next Scheduled EDR Contact: 10/24/2022
Data Release Frequency: Annually

Lists of state and tribal leaking storage tanks

LUST: Listing of All Sites

Leaking Underground Storage Tank Incident Reports. LUST records contain an inventory of reported leaking underground storage tank incidents. Not all states maintain these records, and the information stored varies by state.

Date of Government Version: 05/02/2022
Date Data Arrived at EDR: 05/04/2022
Date Made Active in Reports: 07/26/2022
Number of Days to Update: 83

Source: Department of Environmental Services
Telephone: 603-271-2975
Last EDR Contact: 07/29/2022
Next Scheduled EDR Contact: 11/14/2022
Data Release Frequency: Quarterly

LAST: Listing of All Sites

Leaking Aboveground Storage Tank Incident Reports.

Date of Government Version: 05/02/2022
Date Data Arrived at EDR: 05/04/2022
Date Made Active in Reports: 07/26/2022
Number of Days to Update: 83

Source: Department of Environmental Services
Telephone: 603-271-2975
Last EDR Contact: 07/29/2022
Next Scheduled EDR Contact: 11/14/2022
Data Release Frequency: Quarterly

INDIAN LUST R5: Leaking Underground Storage Tanks on Indian Land
Leaking underground storage tanks located on Indian Land in Michigan, Minnesota and Wisconsin.

Date of Government Version: 04/11/2022
Date Data Arrived at EDR: 06/13/2022
Date Made Active in Reports: 08/16/2022
Number of Days to Update: 64
Source: EPA, Region 5
Telephone: 312-886-7439
Last EDR Contact: 06/13/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 04/28/2022
Date Data Arrived at EDR: 06/13/2022
Date Made Active in Reports: 08/16/2022
Number of Days to Update: 64
Source: EPA Region 6
Telephone: 214-665-6597
Last EDR Contact: 06/13/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 04/08/2022
Date Data Arrived at EDR: 06/13/2022
Date Made Active in Reports: 08/16/2022
Number of Days to Update: 64
Source: Environmental Protection Agency
Telephone: 415-972-3372
Last EDR Contact: 06/13/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 04/20/2022
Date Data Arrived at EDR: 06/13/2022
Date Made Active in Reports: 08/16/2022
Number of Days to Update: 64
Source: EPA Region 8
Telephone: 303-312-6271
Last EDR Contact: 06/13/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Florida, Mississippi and North Carolina.

Date of Government Version: 06/02/2022
Date Data Arrived at EDR: 06/13/2022
Date Made Active in Reports: 08/31/2022
Number of Days to Update: 79
Source: EPA Region 4
Telephone: 404-562-8677
Last EDR Contact: 06/13/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 04/20/2022
Date Data Arrived at EDR: 06/13/2022
Date Made Active in Reports: 08/16/2022
Number of Days to Update: 64
Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 06/13/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land
A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 04/28/2021
Date Data Arrived at EDR: 06/11/2021
Date Made Active in Reports: 09/07/2021
Number of Days to Update: 88
Source: EPA Region 1
Telephone: 617-918-1313
Last EDR Contact: 06/13/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 04/14/2022
Date Data Arrived at EDR: 06/13/2022
Date Made Active in Reports: 08/16/2022
Number of Days to Update: 64

Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 06/13/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

Lists of state and tribal registered storage tanks

FEMA UST: Underground Storage Tank Listing
A listing of all FEMA owned underground storage tanks.

Date of Government Version: 10/14/2021
Date Data Arrived at EDR: 11/05/2021
Date Made Active in Reports: 02/01/2022
Number of Days to Update: 88

Source: FEMA
Telephone: 202-646-5797
Last EDR Contact: 06/29/2022
Next Scheduled EDR Contact: 10/17/2022
Data Release Frequency: Varies

UST: Underground Storage Tank Registration Data
Registered Underground Storage Tanks. UST's are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA) and must be registered with the state department responsible for administering the UST program. Available information varies by state program.

Date of Government Version: 05/02/2022
Date Data Arrived at EDR: 05/04/2022
Date Made Active in Reports: 07/26/2022
Number of Days to Update: 83

Source: Department of Environmental Services
Telephone: 603-271-2975
Last EDR Contact: 07/29/2022
Next Scheduled EDR Contact: 11/14/2022
Data Release Frequency: Quarterly

AST: Registered Aboveground Petroleum Storage Tank Database
Registered Aboveground Storage Tanks.

Date of Government Version: 05/02/2022
Date Data Arrived at EDR: 05/04/2022
Date Made Active in Reports: 07/26/2022
Number of Days to Update: 83

Source: Department of Environmental Services
Telephone: 603-271-6058
Last EDR Contact: 07/29/2022
Next Scheduled EDR Contact: 11/14/2022
Data Release Frequency: Quarterly

INDIAN UST R4: Underground Storage Tanks on Indian Land
The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 4 (Alabama, Florida, Georgia, Kentucky, Mississippi, North Carolina, South Carolina, Tennessee and Tribal Nations)

Date of Government Version: 06/02/2022
Date Data Arrived at EDR: 06/13/2022
Date Made Active in Reports: 08/31/2022
Number of Days to Update: 79

Source: EPA Region 4
Telephone: 404-562-9424
Last EDR Contact: 06/13/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

INDIAN UST R9: Underground Storage Tanks on Indian Land
The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 9 (Arizona, California, Hawaii, Nevada, the Pacific Islands, and Tribal Nations).

Date of Government Version: 04/08/2022
Date Data Arrived at EDR: 06/13/2022
Date Made Active in Reports: 08/16/2022
Number of Days to Update: 64

Source: EPA Region 9
Telephone: 415-972-3368
Last EDR Contact: 06/13/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

INDIAN UST R7: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 7 (Iowa, Kansas, Missouri, Nebraska, and 9 Tribal Nations).

Date of Government Version: 04/14/2022
Date Data Arrived at EDR: 06/13/2022
Date Made Active in Reports: 08/16/2022
Number of Days to Update: 64

Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 06/13/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

INDIAN UST R10: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 10 (Alaska, Idaho, Oregon, Washington, and Tribal Nations).

Date of Government Version: 04/20/2022
Date Data Arrived at EDR: 06/13/2022
Date Made Active in Reports: 08/16/2022
Number of Days to Update: 64

Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 06/13/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

INDIAN UST R1: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 1 (Connecticut, Maine, Massachusetts, New Hampshire, Rhode Island, Vermont and ten Tribal Nations).

Date of Government Version: 04/07/2022
Date Data Arrived at EDR: 06/13/2022
Date Made Active in Reports: 08/16/2022
Number of Days to Update: 64

Source: EPA, Region 1
Telephone: 617-918-1313
Last EDR Contact: 06/13/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

INDIAN UST R5: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 5 (Michigan, Minnesota and Wisconsin and Tribal Nations).

Date of Government Version: 04/11/2022
Date Data Arrived at EDR: 06/13/2022
Date Made Active in Reports: 08/16/2022
Number of Days to Update: 64

Source: EPA Region 5
Telephone: 312-886-6136
Last EDR Contact: 06/13/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

INDIAN UST R6: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 6 (Louisiana, Arkansas, Oklahoma, New Mexico, Texas and 65 Tribes).

Date of Government Version: 04/28/2022
Date Data Arrived at EDR: 06/13/2022
Date Made Active in Reports: 08/16/2022
Number of Days to Update: 64

Source: EPA Region 6
Telephone: 214-665-7591
Last EDR Contact: 06/13/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

INDIAN UST R8: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 8 (Colorado, Montana, North Dakota, South Dakota, Utah, Wyoming and 27 Tribal Nations).

Date of Government Version: 04/20/2022
Date Data Arrived at EDR: 06/13/2022
Date Made Active in Reports: 08/16/2022
Number of Days to Update: 64

Source: EPA Region 8
Telephone: 303-312-6137
Last EDR Contact: 06/13/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

State and tribal institutional control / engineering control registries

Inst Control: Activity and Use Restrictions
An inventory of sites where Activity and Use Restrictions have been utilized.

Date of Government Version: 06/13/2022
Date Data Arrived at EDR: 06/14/2022
Date Made Active in Reports: 08/31/2022
Number of Days to Update: 78
Source: Department of Environmental Services
Telephone: 603-271-2659
Last EDR Contact: 09/12/2022
Next Scheduled EDR Contact: 12/26/2022
Data Release Frequency: Semi-Annually

Lists of state and tribal voluntary cleanup sites

INDIAN VCP R1: Voluntary Cleanup Priority Listing
A listing of voluntary cleanup priority sites located on Indian Land located in Region 1.

Date of Government Version: 07/27/2015
Date Data Arrived at EDR: 09/29/2015
Date Made Active in Reports: 02/18/2016
Number of Days to Update: 142
Source: EPA, Region 1
Telephone: 617-918-1102
Last EDR Contact: 09/13/2022
Next Scheduled EDR Contact: 01/02/2023
Data Release Frequency: Varies

VCP: Voluntary Cleanup Program Sites
The program provides comprehensive liability protections to eligible persons who voluntarily assume responsibility for the cleanup of contaminated properties. The sites on the list are ones where persons have applied to participate in the program and in most cases have been deemed eligible.

Date of Government Version: 01/04/2022
Date Data Arrived at EDR: 01/11/2022
Date Made Active in Reports: 04/04/2022
Number of Days to Update: 83
Source: Department of Environmental Services
Telephone: 603-271-2183
Last EDR Contact: 07/14/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

INDIAN VCP R7: Voluntary Cleanup Priority Lisitng
A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008
Date Data Arrived at EDR: 04/22/2008
Date Made Active in Reports: 05/19/2008
Number of Days to Update: 27
Source: EPA, Region 7
Telephone: 913-551-7365
Last EDR Contact: 07/08/2021
Next Scheduled EDR Contact: 07/20/2009
Data Release Frequency: Varies

Lists of state and tribal brownfield sites

BROWNFIELDS: Brownfields Sites
Sites that have benefited from one or more brownfields initiative.

Date of Government Version: 05/02/2022
Date Data Arrived at EDR: 05/04/2022
Date Made Active in Reports: 07/26/2022
Number of Days to Update: 83
Source: Department of Environmental Services
Telephone: 603-271-6422
Last EDR Contact: 08/02/2022
Next Scheduled EDR Contact: 11/14/2022
Data Release Frequency: Varies

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: A Listing of Brownfields Sites
Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on brownfields properties assessed or cleaned up with grant funding as well as information on Targeted Brownfields Assessments performed by EPA Regions. A listing of ACRES Brownfield sites is obtained from Cleanups in My Community. Cleanups in My Community provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

Date of Government Version: 02/23/2022
Date Data Arrived at EDR: 03/10/2022
Date Made Active in Reports: 03/10/2022
Number of Days to Update: 0

Source: Environmental Protection Agency
Telephone: 202-566-2777
Last EDR Contact: 09/09/2022
Next Scheduled EDR Contact: 12/26/2022
Data Release Frequency: Semi-Annually

Local Lists of Landfill / Solid Waste Disposal Sites

SWRCY: Recycling Centers
A listing of recycling center locations in the state of New Hampshire.

Date of Government Version: 03/31/2022
Date Data Arrived at EDR: 03/31/2022
Date Made Active in Reports: 04/04/2022
Number of Days to Update: 4

Source: Department of Environmental Services
Telephone: 603-271-0675
Last EDR Contact: 07/11/2022
Next Scheduled EDR Contact: 10/24/2022
Data Release Frequency: Varies

INDIAN ODI: Report on the Status of Open Dumps on Indian Lands
Location of open dumps on Indian land.

Date of Government Version: 12/31/1998
Date Data Arrived at EDR: 12/03/2007
Date Made Active in Reports: 01/24/2008
Number of Days to Update: 52

Source: Environmental Protection Agency
Telephone: 703-308-8245
Last EDR Contact: 07/21/2022
Next Scheduled EDR Contact: 11/07/2022
Data Release Frequency: Varies

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations
A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 01/12/2009
Date Data Arrived at EDR: 05/07/2009
Date Made Active in Reports: 09/21/2009
Number of Days to Update: 137

Source: EPA, Region 9
Telephone: 415-947-4219
Last EDR Contact: 07/12/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: No Update Planned

ODI: Open Dump Inventory
An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Date of Government Version: 06/30/1985
Date Data Arrived at EDR: 08/09/2004
Date Made Active in Reports: 09/17/2004
Number of Days to Update: 39

Source: Environmental Protection Agency
Telephone: 800-424-9346
Last EDR Contact: 06/09/2004
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

IHS OPEN DUMPS: Open Dumps on Indian Land
A listing of all open dumps located on Indian Land in the United States.

Date of Government Version: 04/01/2014
Date Data Arrived at EDR: 08/06/2014
Date Made Active in Reports: 01/29/2015
Number of Days to Update: 176

Source: Department of Health & Human Serivces, Indian Health Service
Telephone: 301-443-1452
Last EDR Contact: 07/21/2022
Next Scheduled EDR Contact: 11/07/2022
Data Release Frequency: Varies

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL: National Clandestine Laboratory Register
A listing of clandestine drug lab locations that have been removed from the DEAs National Clandestine Laboratory Register.

Date of Government Version: 04/30/2022
Date Data Arrived at EDR: 05/24/2022
Date Made Active in Reports: 07/29/2022
Number of Days to Update: 66

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 08/18/2022
Next Scheduled EDR Contact: 12/05/2022
Data Release Frequency: No Update Planned

ALLSITES: Site Remediation & Groundwater Hazard Inventory Listing of All Sites

Provides information on sites in New Hampshire, with activities that either have resulted in groundwater contamination or pose a potential hazard to groundwater supplies. The regulated activities and groundwater hazards include: confirmed releases of oil or hazardous materials to the soil and/or groundwater as a result of discharges, spills, and removal of underground storage tanks; underground injection wells such as floor drains, leaching galleries, and septic systems anything other than domestic wastewater; large discharges of wastewater such as domestic wastewater septic systems which are designed to discharge more than 20,000 gpd, land application of wastewater treatment facility effluent (spray irrigation, rapid infiltration basins, etc.) and unlined septage and wastewater lagoons; unpermitted hazardous waste storage facilities; landfills and other waste repositories in which groundwater quality is at risk.

Date of Government Version: 05/02/2022
Date Data Arrived at EDR: 05/04/2022
Date Made Active in Reports: 07/26/2022
Number of Days to Update: 83

Source: Department of Environmental Services
Telephone: 603-271-3503
Last EDR Contact: 07/29/2022
Next Scheduled EDR Contact: 11/14/2022
Data Release Frequency: Quarterly

CDL: Clandestine Drug Lab Listing

A listing of clandestine drug lab site locations included in the Site Remediation and Groundwater Hazard Inventory.

Date of Government Version: 05/02/2022
Date Data Arrived at EDR: 05/04/2022
Date Made Active in Reports: 07/26/2022
Number of Days to Update: 83

Source: Department of Environmental Services
Telephone: 603-271-0650
Last EDR Contact: 07/29/2022
Next Scheduled EDR Contact: 11/14/2022
Data Release Frequency: Every 4 Years

US CDL: Clandestine Drug Labs

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 04/30/2022
Date Data Arrived at EDR: 05/24/2022
Date Made Active in Reports: 07/29/2022
Number of Days to Update: 66

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 08/18/2022
Next Scheduled EDR Contact: 12/05/2022
Data Release Frequency: Quarterly

PFAS: PFAS Contamination Site Location Listing

a listing (current as of today) of the Waste Management Division Remediation Programa??s sites where PFAS has been detected to date.

Date of Government Version: 12/29/2021
Date Data Arrived at EDR: 05/18/2022
Date Made Active in Reports: 08/09/2022
Number of Days to Update: 83

Source: Department of Environmental Services
Telephone: 603-271-3744
Last EDR Contact: 08/10/2022
Next Scheduled EDR Contact: 11/28/2022
Data Release Frequency: Varies

AQUEOUS FOAM: Aqueous Film Forming Foam Release Investigations Listing

A listing of sites included in the New Hampshire Department of Environmental Services (DES) OneStop database where the project type is Class B Foam / AFF - Fire Fighting Use Area.

Date of Government Version: 02/01/2022
Date Data Arrived at EDR: 03/11/2022
Date Made Active in Reports: 03/25/2022
Number of Days to Update: 14

Source: Department of Environmental Services
Telephone: 603-271-3744
Last EDR Contact: 07/26/2022
Next Scheduled EDR Contact: 11/14/2022
Data Release Frequency: Quarterly

Local Land Records

LIENS: Environmental Liens Information Listing

An Environmental Lien is a charge, security, or encumbrance upon title to a property to secure the payment of a cost, damage, debt, obligation, or duty arising out of response actions, cleanup, or other remediation of hazardous substances or petroleum products upon a property, including (but not limited to) liens imposed pursuant to CERCLA 42 USC 9607(1) and similar state or local laws. In other words: a lien placed upon a propertys title due to an environmental condition

Date of Government Version: 04/18/2022
Date Data Arrived at EDR: 04/19/2022
Date Made Active in Reports: 07/13/2022
Number of Days to Update: 85

Source: Department of Environmental Services
Telephone: 603-271-8808
Last EDR Contact: 07/14/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: No Update Planned

LIENS 2: CERCLA Lien Information

A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 07/26/2022
Date Data Arrived at EDR: 08/02/2022
Date Made Active in Reports: 08/22/2022
Number of Days to Update: 20

Source: Environmental Protection Agency
Telephone: 202-564-6023
Last EDR Contact: 09/01/2022
Next Scheduled EDR Contact: 10/10/2022
Data Release Frequency: Semi-Annually

Records of Emergency Release Reports

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 03/21/2022
Date Data Arrived at EDR: 03/21/2022
Date Made Active in Reports: 06/14/2022
Number of Days to Update: 85

Source: U.S. Department of Transportation
Telephone: 202-366-4555
Last EDR Contact: 09/19/2022
Next Scheduled EDR Contact: 01/02/2023
Data Release Frequency: Quarterly

NH SPILLS: Listing of All Sites

Spills reported to the Emergency Response section that are included in the All Sites database.

Date of Government Version: 05/02/2022
Date Data Arrived at EDR: 05/04/2022
Date Made Active in Reports: 07/26/2022
Number of Days to Update: 83

Source: Department of Environmental Services
Telephone: 603-271-2975
Last EDR Contact: 07/29/2022
Next Scheduled EDR Contact: 11/14/2022
Data Release Frequency: Quarterly

SPILLS 90: SPILLS90 data from FirstSearch

Spills 90 includes those spill and release records available exclusively from FirstSearch databases. Typically, they may include chemical, oil and/or hazardous substance spills recorded after 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 90.

Date of Government Version: 12/18/2012
Date Data Arrived at EDR: 01/03/2013
Date Made Active in Reports: 02/28/2013
Number of Days to Update: 56

Source: FirstSearch
Telephone: N/A
Last EDR Contact: 01/03/2013
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

Other Ascertainable Records

RCRA NonGen / NLR: RCRA - Non Generators / No Longer Regulated

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

Date of Government Version: 06/20/2022
Date Data Arrived at EDR: 06/21/2022
Date Made Active in Reports: 06/28/2022
Number of Days to Update: 7

Source: Environmental Protection Agency
Telephone: (888) 372-7341
Last EDR Contact: 09/19/2022
Next Scheduled EDR Contact: 01/02/2023
Data Release Frequency: Quarterly

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 05/11/2022
Date Data Arrived at EDR: 05/17/2022
Date Made Active in Reports: 07/29/2022
Number of Days to Update: 73

Source: U.S. Army Corps of Engineers
Telephone: 202-528-4285
Last EDR Contact: 08/11/2022
Next Scheduled EDR Contact: 11/28/2022
Data Release Frequency: Varies

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 06/07/2021
Date Data Arrived at EDR: 07/13/2021
Date Made Active in Reports: 03/09/2022
Number of Days to Update: 239

Source: USGS
Telephone: 888-275-8747
Last EDR Contact: 07/13/2022
Next Scheduled EDR Contact: 10/24/2022
Data Release Frequency: Varies

FEDLAND: Federal and Indian Lands

Federally and Indian administrated lands of the United States. Lands included are administrated by: Army Corps of Engineers, Bureau of Reclamation, National Wild and Scenic River, National Wildlife Refuge, Public Domain Land, Wilderness, Wilderness Study Area, Wildlife Management Area, Bureau of Indian Affairs, Bureau of Land Management, Department of Justice, Forest Service, Fish and Wildlife Service, National Park Service.

Date of Government Version: 04/02/2018
Date Data Arrived at EDR: 04/11/2018
Date Made Active in Reports: 11/06/2019
Number of Days to Update: 574

Source: U.S. Geological Survey
Telephone: 888-275-8747
Last EDR Contact: 07/08/2022
Next Scheduled EDR Contact: 10/17/2022
Data Release Frequency: N/A

SCRD DRYCLEANERS: State Coalition for Remediation of Drycleaners Listing

The State Coalition for Remediation of Drycleaners was established in 1998, with support from the U.S. EPA Office of Superfund Remediation and Technology Innovation. It is comprised of representatives of states with established drycleaner remediation programs. Currently the member states are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin.

Date of Government Version: 01/01/2017
Date Data Arrived at EDR: 02/03/2017
Date Made Active in Reports: 04/07/2017
Number of Days to Update: 63

Source: Environmental Protection Agency
Telephone: 615-532-8599
Last EDR Contact: 08/03/2022
Next Scheduled EDR Contact: 11/21/2022
Data Release Frequency: Varies

US FIN ASSUR: Financial Assurance Information

All owners and operators of facilities that treat, store, or dispose of hazardous waste are required to provide proof that they will have sufficient funds to pay for the clean up, closure, and post-closure care of their facilities.

Date of Government Version: 06/20/2022
Date Data Arrived at EDR: 06/21/2022
Date Made Active in Reports: 08/31/2022
Number of Days to Update: 71

Source: Environmental Protection Agency
Telephone: 202-566-1917
Last EDR Contact: 09/20/2022
Next Scheduled EDR Contact: 01/02/2023
Data Release Frequency: Quarterly

EPA WATCH LIST: EPA WATCH LIST

EPA maintains a "Watch List" to facilitate dialogue between EPA, state and local environmental agencies on enforcement matters relating to facilities with alleged violations identified as either significant or high priority. Being on the Watch List does not mean that the facility has actually violated the law only that an investigation by EPA or a state or local environmental agency has led those organizations to allege that an unproven violation has in fact occurred. Being on the Watch List does not represent a higher level of concern regarding the alleged violations that were detected, but instead indicates cases requiring additional dialogue between EPA, state and local agencies - primarily because of the length of time the alleged violation has gone unaddressed or unresolved.

Date of Government Version: 08/30/2013
Date Data Arrived at EDR: 03/21/2014
Date Made Active in Reports: 06/17/2014
Number of Days to Update: 88

Source: Environmental Protection Agency
Telephone: 617-520-3000
Last EDR Contact: 07/29/2022
Next Scheduled EDR Contact: 11/14/2022
Data Release Frequency: Quarterly

2020 COR ACTION: 2020 Corrective Action Program List

The EPA has set ambitious goals for the RCRA Corrective Action program by creating the 2020 Corrective Action Universe. This RCRA cleanup baseline includes facilities expected to need corrective action. The 2020 universe contains a wide variety of sites. Some properties are heavily contaminated while others were contaminated but have since been cleaned up. Still others have not been fully investigated yet, and may require little or no remediation. Inclusion in the 2020 Universe does not necessarily imply failure on the part of a facility to meet its RCRA obligations.

Date of Government Version: 09/30/2017
Date Data Arrived at EDR: 05/08/2018
Date Made Active in Reports: 07/20/2018
Number of Days to Update: 73

Source: Environmental Protection Agency
Telephone: 703-308-4044
Last EDR Contact: 08/04/2022
Next Scheduled EDR Contact: 11/14/2022
Data Release Frequency: Varies

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2016
Date Data Arrived at EDR: 06/17/2020
Date Made Active in Reports: 09/10/2020
Number of Days to Update: 85

Source: EPA
Telephone: 202-260-5521
Last EDR Contact: 09/12/2022
Next Scheduled EDR Contact: 12/26/2022
Data Release Frequency: Every 4 Years

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/2018
Date Data Arrived at EDR: 08/14/2020
Date Made Active in Reports: 11/04/2020
Number of Days to Update: 82

Source: EPA
Telephone: 202-566-0250
Last EDR Contact: 08/11/2022
Next Scheduled EDR Contact: 11/28/2022
Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 07/18/2022
Date Data Arrived at EDR: 07/18/2022
Date Made Active in Reports: 07/29/2022
Number of Days to Update: 11

Source: EPA
Telephone: 202-564-4203
Last EDR Contact: 07/18/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Annually

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 07/26/2022
Date Data Arrived at EDR: 08/02/2022
Date Made Active in Reports: 08/22/2022
Number of Days to Update: 20

Source: EPA
Telephone: 703-416-0223
Last EDR Contact: 09/01/2022
Next Scheduled EDR Contact: 12/12/2022
Data Release Frequency: Annually

RMP: Risk Management Plans

When Congress passed the Clean Air Act Amendments of 1990, it required EPA to publish regulations and guidance for chemical accident prevention at facilities using extremely hazardous substances. The Risk Management Program Rule (RMP Rule) was written to implement Section 112(r) of these amendments. The rule, which built upon existing industry codes and standards, requires companies of all sizes that use certain flammable and toxic substances to develop a Risk Management Program, which includes a(n): Hazard assessment that details the potential effects of an accidental release, an accident history of the last five years, and an evaluation of worst-case and alternative accidental releases; Prevention program that includes safety precautions and maintenance, monitoring, and employee training measures; and Emergency response program that spells out emergency health care, employee training measures and procedures for informing the public and response agencies (e.g the fire department) should an accident occur.

Date of Government Version: 04/27/2022
Date Data Arrived at EDR: 05/04/2022
Date Made Active in Reports: 05/10/2022
Number of Days to Update: 6

Source: Environmental Protection Agency
Telephone: 202-564-8600
Last EDR Contact: 07/14/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995
Date Data Arrived at EDR: 07/03/1995
Date Made Active in Reports: 08/07/1995
Number of Days to Update: 35

Source: EPA
Telephone: 202-564-4104
Last EDR Contact: 06/02/2008
Next Scheduled EDR Contact: 09/01/2008
Data Release Frequency: No Update Planned

PRP: Potentially Responsible Parties

A listing of verified Potentially Responsible Parties

Date of Government Version: 07/26/2022
Date Data Arrived at EDR: 08/02/2022
Date Made Active in Reports: 08/31/2022
Number of Days to Update: 29

Source: EPA
Telephone: 202-564-6023
Last EDR Contact: 09/01/2022
Next Scheduled EDR Contact: 11/14/2022
Data Release Frequency: Quarterly

PADS: PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 01/20/2022
Date Data Arrived at EDR: 01/20/2022
Date Made Active in Reports: 03/25/2022
Number of Days to Update: 64

Source: EPA
Telephone: 202-566-0500
Last EDR Contact: 07/08/2022
Next Scheduled EDR Contact: 10/17/2022
Data Release Frequency: Annually

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 11/18/2016
Date Data Arrived at EDR: 11/23/2016
Date Made Active in Reports: 02/10/2017
Number of Days to Update: 79

Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 06/28/2022
Next Scheduled EDR Contact: 10/17/2022
Data Release Frequency: Quarterly

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/09/2009
Date Data Arrived at EDR: 04/16/2009
Date Made Active in Reports: 05/11/2009
Number of Days to Update: 25

Source: EPA/Office of Prevention, Pesticides and Toxic Substances
Telephone: 202-566-1667
Last EDR Contact: 08/18/2017
Next Scheduled EDR Contact: 12/04/2017
Data Release Frequency: No Update Planned

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

A listing of FIFRA/TSCA Tracking System (FTTS) inspections and enforcements.

Date of Government Version: 04/09/2009
Date Data Arrived at EDR: 04/16/2009
Date Made Active in Reports: 05/11/2009
Number of Days to Update: 25

Source: EPA
Telephone: 202-566-1667
Last EDR Contact: 08/18/2017
Next Scheduled EDR Contact: 12/04/2017
Data Release Frequency: No Update Planned

MLTS: Material Licensing Tracking System

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 06/10/2022
Date Data Arrived at EDR: 06/14/2022
Date Made Active in Reports: 08/22/2022
Number of Days to Update: 69

Source: Nuclear Regulatory Commission
Telephone: 301-415-7169
Last EDR Contact: 07/13/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Quarterly

COAL ASH DOE: Steam-Electric Plant Operation Data

A listing of power plants that store ash in surface ponds.

Date of Government Version: 12/31/2020
Date Data Arrived at EDR: 11/30/2021
Date Made Active in Reports: 02/22/2022
Number of Days to Update: 84

Source: Department of Energy
Telephone: 202-586-8719
Last EDR Contact: 08/25/2022
Next Scheduled EDR Contact: 12/12/2022
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

COAL ASH EPA: Coal Combustion Residues Surface Impoundments List
A listing of coal combustion residues surface impoundments with high hazard potential ratings.

Date of Government Version: 01/12/2017
Date Data Arrived at EDR: 03/05/2019
Date Made Active in Reports: 11/11/2019
Number of Days to Update: 251
Source: Environmental Protection Agency
Telephone: N/A
Last EDR Contact: 08/25/2022
Next Scheduled EDR Contact: 12/12/2022
Data Release Frequency: Varies

PCB TRANSFORMER: PCB Transformer Registration Database
The database of PCB transformer registrations that includes all PCB registration submittals.

Date of Government Version: 09/13/2019
Date Data Arrived at EDR: 11/06/2019
Date Made Active in Reports: 02/10/2020
Number of Days to Update: 96
Source: Environmental Protection Agency
Telephone: 202-566-0517
Last EDR Contact: 08/04/2022
Next Scheduled EDR Contact: 11/14/2022
Data Release Frequency: Varies

RADINFO: Radiation Information Database
The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

Date of Government Version: 07/01/2019
Date Data Arrived at EDR: 07/01/2019
Date Made Active in Reports: 09/23/2019
Number of Days to Update: 84
Source: Environmental Protection Agency
Telephone: 202-343-9775
Last EDR Contact: 06/23/2022
Next Scheduled EDR Contact: 10/10/2022
Data Release Frequency: Quarterly

HIST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing
A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40
Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2007
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

HIST FTTS INSP: FIFRA/TSCA Tracking System Inspection & Enforcement Case Listing
A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40
Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2008
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

DOT OPS: Incident and Accident Data
Department of Transporation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 01/02/2020
Date Data Arrived at EDR: 01/28/2020
Date Made Active in Reports: 04/17/2020
Number of Days to Update: 80

Source: Department of Transporation, Office of Pipeline Safety
Telephone: 202-366-4595
Last EDR Contact: 07/21/2022
Next Scheduled EDR Contact: 11/07/2022
Data Release Frequency: Quarterly

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 03/31/2022
Date Data Arrived at EDR: 04/14/2022
Date Made Active in Reports: 07/12/2022
Number of Days to Update: 89

Source: Department of Justice, Consent Decree Library
Telephone: Varies
Last EDR Contact: 06/29/2022
Next Scheduled EDR Contact: 10/17/2022
Data Release Frequency: Varies

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2019
Date Data Arrived at EDR: 03/02/2022
Date Made Active in Reports: 03/25/2022
Number of Days to Update: 23

Source: EPA/NTIS
Telephone: 800-424-9346
Last EDR Contact: 09/19/2022
Next Scheduled EDR Contact: 01/02/2023
Data Release Frequency: Biennially

INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2014
Date Data Arrived at EDR: 07/14/2015
Date Made Active in Reports: 01/10/2017
Number of Days to Update: 546

Source: USGS
Telephone: 202-208-3710
Last EDR Contact: 07/08/2022
Next Scheduled EDR Contact: 10/17/2022
Data Release Frequency: Semi-Annually

FUSRAP: Formerly Utilized Sites Remedial Action Program

DOE established the Formerly Utilized Sites Remedial Action Program (FUSRAP) in 1974 to remediate sites where radioactive contamination remained from Manhattan Project and early U.S. Atomic Energy Commission (AEC) operations.

Date of Government Version: 07/26/2021
Date Data Arrived at EDR: 07/27/2021
Date Made Active in Reports: 10/22/2021
Number of Days to Update: 87

Source: Department of Energy
Telephone: 202-586-3559
Last EDR Contact: 07/26/2022
Next Scheduled EDR Contact: 11/14/2022
Data Release Frequency: Varies

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 08/30/2019
Date Data Arrived at EDR: 11/15/2019
Date Made Active in Reports: 01/28/2020
Number of Days to Update: 74

Source: Department of Energy
Telephone: 505-845-0011
Last EDR Contact: 08/24/2022
Next Scheduled EDR Contact: 11/28/2022
Data Release Frequency: Varies

LEAD SMELTER 1: Lead Smelter Sites
A listing of former lead smelter site locations.

Date of Government Version: 07/26/2022
Date Data Arrived at EDR: 08/02/2022
Date Made Active in Reports: 08/22/2022
Number of Days to Update: 20
Source: Environmental Protection Agency
Telephone: 703-603-8787
Last EDR Contact: 09/01/2022
Next Scheduled EDR Contact: 10/10/2022
Data Release Frequency: Varies

LEAD SMELTER 2: Lead Smelter Sites
A list of several hundred sites in the U.S. where secondary lead smelting was done from 1931and 1964. These sites may pose a threat to public health through ingestion or inhalation of contaminated soil or dust

Date of Government Version: 04/05/2001
Date Data Arrived at EDR: 10/27/2010
Date Made Active in Reports: 12/02/2010
Number of Days to Update: 36
Source: American Journal of Public Health
Telephone: 703-305-6451
Last EDR Contact: 12/02/2009
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

US AIRS (AFS): Aerometric Information Retrieval System Facility Subsystem (AFS)
The database is a sub-system of Aerometric Information Retrieval System (AIRS). AFS contains compliance data on air pollution point sources regulated by the U.S. EPA and/or state and local air regulatory agencies. This information comes from source reports by various stationary sources of air pollution, such as electric power plants, steel mills, factories, and universities, and provides information about the air pollutants they produce. Action, air program, air program pollutant, and general level plant data. It is used to track emissions and compliance data from industrial plants.

Date of Government Version: 10/12/2016
Date Data Arrived at EDR: 10/26/2016
Date Made Active in Reports: 02/03/2017
Number of Days to Update: 100
Source: EPA
Telephone: 202-564-2496
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Annually

US AIRS MINOR: Air Facility System Data
A listing of minor source facilities.

Date of Government Version: 10/12/2016
Date Data Arrived at EDR: 10/26/2016
Date Made Active in Reports: 02/03/2017
Number of Days to Update: 100
Source: EPA
Telephone: 202-564-2496
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Annually

US MINES: Mines Master Index File
Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 08/03/2022
Date Data Arrived at EDR: 08/17/2022
Date Made Active in Reports: 08/31/2022
Number of Days to Update: 14
Source: Department of Labor, Mine Safety and Health Administration
Telephone: 303-231-5959
Last EDR Contact: 08/17/2022
Next Scheduled EDR Contact: 12/05/2022
Data Release Frequency: Semi-Annually

MINES VIOLATIONS: MSHA Violation Assessment Data
Mines violation and assessment information. Department of Labor, Mine Safety & Health Administration.

Date of Government Version: 03/21/2022
Date Data Arrived at EDR: 03/22/2022
Date Made Active in Reports: 03/25/2022
Number of Days to Update: 3
Source: DOL, Mine Safety & Health Admi
Telephone: 202-693-9424
Last EDR Contact: 08/02/2022
Next Scheduled EDR Contact: 12/12/2022
Data Release Frequency: Quarterly

US MINES 2: Ferrous and Nonferrous Metal Mines Database Listing

This map layer includes ferrous (ferrous metal mines are facilities that extract ferrous metals, such as iron ore or molybdenum) and nonferrous (Nonferrous metal mines are facilities that extract nonferrous metals, such as gold, silver, copper, zinc, and lead) metal mines in the United States.

Date of Government Version: 05/06/2020
Date Data Arrived at EDR: 05/27/2020
Date Made Active in Reports: 08/13/2020
Number of Days to Update: 78

Source: USGS
Telephone: 703-648-7709
Last EDR Contact: 08/17/2022
Next Scheduled EDR Contact: 12/05/2022
Data Release Frequency: Varies

US MINES 3: Active Mines & Mineral Plants Database Listing

Active Mines and Mineral Processing Plant operations for commodities monitored by the Minerals Information Team of the USGS.

Date of Government Version: 04/14/2011
Date Data Arrived at EDR: 06/08/2011
Date Made Active in Reports: 09/13/2011
Number of Days to Update: 97

Source: USGS
Telephone: 703-648-7709
Last EDR Contact: 08/17/2022
Next Scheduled EDR Contact: 12/05/2022
Data Release Frequency: Varies

ABANDONED MINES: Abandoned Mines

An inventory of land and water impacted by past mining (primarily coal mining) is maintained by OSMRE to provide information needed to implement the Surface Mining Control and Reclamation Act of 1977 (SMCRA). The inventory contains information on the location, type, and extent of AML impacts, as well as, information on the cost associated with the reclamation of those problems. The inventory is based upon field surveys by State, Tribal, and OSMRE program officials. It is dynamic to the extent that it is modified as new problems are identified and existing problems are reclaimed.

Date of Government Version: 06/14/2022
Date Data Arrived at EDR: 06/15/2022
Date Made Active in Reports: 08/22/2022
Number of Days to Update: 68

Source: Department of Interior
Telephone: 202-208-2609
Last EDR Contact: 09/13/2022
Next Scheduled EDR Contact: 12/19/2022
Data Release Frequency: Quarterly

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 05/13/2022
Date Data Arrived at EDR: 05/18/2022
Date Made Active in Reports: 05/31/2022
Number of Days to Update: 13

Source: EPA
Telephone: (617) 918-1111
Last EDR Contact: 08/25/2022
Next Scheduled EDR Contact: 12/12/2022
Data Release Frequency: Quarterly

DOCKET HWC: Hazardous Waste Compliance Docket Listing

A complete list of the Federal Agency Hazardous Waste Compliance Docket Facilities.

Date of Government Version: 05/06/2021
Date Data Arrived at EDR: 05/21/2021
Date Made Active in Reports: 08/11/2021
Number of Days to Update: 82

Source: Environmental Protection Agency
Telephone: 202-564-0527
Last EDR Contact: 08/22/2022
Next Scheduled EDR Contact: 12/05/2022
Data Release Frequency: Varies

ECHO: Enforcement & Compliance History Information

ECHO provides integrated compliance and enforcement information for about 800,000 regulated facilities nationwide.

Date of Government Version: 04/02/2022
Date Data Arrived at EDR: 04/05/2022
Date Made Active in Reports: 06/28/2022
Number of Days to Update: 84

Source: Environmental Protection Agency
Telephone: 202-564-2280
Last EDR Contact: 07/01/2022
Next Scheduled EDR Contact: 10/17/2022
Data Release Frequency: Quarterly

UXO: Unexploded Ordnance Sites

A listing of unexploded ordnance site locations

Date of Government Version: 12/31/2020
Date Data Arrived at EDR: 01/11/2022
Date Made Active in Reports: 02/14/2022
Number of Days to Update: 34

Source: Department of Defense
Telephone: 703-704-1564
Last EDR Contact: 07/07/2022
Next Scheduled EDR Contact: 10/24/2022
Data Release Frequency: Varies

FUELS PROGRAM: EPA Fuels Program Registered Listing

This listing includes facilities that are registered under the Part 80 (Code of Federal Regulations) EPA Fuels Programs. All companies now are required to submit new and updated registrations.

Date of Government Version: 05/16/2022
Date Data Arrived at EDR: 05/17/2022
Date Made Active in Reports: 07/29/2022
Number of Days to Update: 73

Source: EPA
Telephone: 800-385-6164
Last EDR Contact: 08/11/2022
Next Scheduled EDR Contact: 11/28/2022
Data Release Frequency: Quarterly

AIRS: Permitted Airs Facility Listing

A listing of permitted Airs facility locations in New Hampshire.

Date of Government Version: 05/28/2022
Date Data Arrived at EDR: 06/01/2022
Date Made Active in Reports: 08/23/2022
Number of Days to Update: 83

Source: Department of Environmental Services
Telephone: 603-271-6283
Last EDR Contact: 08/23/2022
Next Scheduled EDR Contact: 12/12/2022
Data Release Frequency: Varies

ASBESTOS: Asbestos Notification Listing

Asbestos notification sites

Date of Government Version: 08/10/2022
Date Data Arrived at EDR: 08/11/2022
Date Made Active in Reports: 08/23/2022
Number of Days to Update: 12

Source: Department of Environmental Services
Telephone: 603-271-1373
Last EDR Contact: 08/10/2022
Next Scheduled EDR Contact: 11/28/2022
Data Release Frequency: Varies

DRYCLEANERS: Listing of Drycleaners

A listing of drycleaner locations in New Hampshire.

Date of Government Version: 06/13/2022
Date Data Arrived at EDR: 06/14/2022
Date Made Active in Reports: 08/30/2022
Number of Days to Update: 77

Source: Department of Environmental Services
Telephone: 603-271-2937
Last EDR Contact: 09/12/2022
Next Scheduled EDR Contact: 12/26/2022
Data Release Frequency: Quarterly

Financial Assurance 1: Financial Assurance Information Listing

Financial assurance is intended to ensure that resources are available to pay for the cost of closure, post-closure care, and corrective measures if the owner or operator of a regulated facility is unable or unwilling to pay

Date of Government Version: 04/12/2022
Date Data Arrived at EDR: 04/13/2022
Date Made Active in Reports: 07/11/2022
Number of Days to Update: 89

Source: Department of Environmental Services
Telephone: 602-271-0675
Last EDR Contact: 08/16/2022
Next Scheduled EDR Contact: 10/24/2022
Data Release Frequency: Quarterly

Financial Assurance 2: Financial Assurance Information listing

A listing of financial assurance information for hazardous waste facilities. Financial assurance is intended to ensure that resources are available to pay for the cost of closure, post-closure care, and corrective measures if the owner or operator of a regulated facility is unable or unwilling to pay.

Date of Government Version: 04/11/2022
Date Data Arrived at EDR: 04/13/2022
Date Made Active in Reports: 07/11/2022
Number of Days to Update: 89

Source: Department of Environmental Services
Telephone: 603-271-5328
Last EDR Contact: 07/07/2022
Next Scheduled EDR Contact: 10/24/2022
Data Release Frequency: Varies

LEAD: Lead Inspection Database

The Childhood Lead Poisoning Prevention Program data of lead inspection for the state.

Date of Government Version: 10/16/2007
Date Data Arrived at EDR: 10/18/2007
Date Made Active in Reports: 11/13/2007
Number of Days to Update: 26

Source: Department of Health & Human Services, Childhood Lead Poisoning Prevention Progr
Telephone: 603-271-3854
Last EDR Contact: 09/08/2022
Next Scheduled EDR Contact: 11/14/2022
Data Release Frequency: Varies

NPDES: NPDES Permit Listing

General information regarding NPDES (National Pollutant Discharge Elimination System) permits.

Date of Government Version: 05/20/2022
Date Data Arrived at EDR: 05/20/2022
Date Made Active in Reports: 06/07/2022
Number of Days to Update: 18

Source: Department of Environmental Services
Telephone: 603-271-0671
Last EDR Contact: 08/16/2022
Next Scheduled EDR Contact: 12/05/2022
Data Release Frequency: Semi-Annually

MINES MRDS: Mineral Resources Data System

Mineral Resources Data System

Date of Government Version: 04/06/2018
Date Data Arrived at EDR: 10/21/2019
Date Made Active in Reports: 10/24/2019
Number of Days to Update: 3

Source: USGS
Telephone: 703-648-6533
Last EDR Contact: 08/17/2022
Next Scheduled EDR Contact: 12/05/2022
Data Release Frequency: Varies

MANIFEST: Hazardous Waste Manifest Information Listing

Hazardous waste manifest information for the state of New Hampshire.

Date of Government Version: 06/30/2019
Date Data Arrived at EDR: 07/23/2019
Date Made Active in Reports: 02/03/2020
Number of Days to Update: 195

Source: Department of Environmental Services
Telephone: 603-271-3203
Last EDR Contact: 07/12/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Annually

PCS: Permit Compliance System

PCS is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

Date of Government Version: 07/14/2011
Date Data Arrived at EDR: 08/05/2011
Date Made Active in Reports: 09/29/2011
Number of Days to Update: 55

Source: EPA, Office of Water
Telephone: 202-564-2496
Last EDR Contact: 06/28/2022
Next Scheduled EDR Contact: 10/17/2022
Data Release Frequency: Semi-Annually

PCS ENF: Enforcement data

No description is available for this data

Date of Government Version: 12/31/2014
Date Data Arrived at EDR: 02/05/2015
Date Made Active in Reports: 03/06/2015
Number of Days to Update: 29

Source: EPA
Telephone: 202-564-2497
Last EDR Contact: 06/28/2022
Next Scheduled EDR Contact: 10/17/2022
Data Release Frequency: Varies

PCS INACTIVE: Listing of Inactive PCS Permits
An inactive permit is a facility that has shut down or is no longer discharging.

Date of Government Version: 11/05/2014
Date Data Arrived at EDR: 01/06/2015
Date Made Active in Reports: 05/06/2015
Number of Days to Update: 120

Source: EPA
Telephone: 202-564-2496
Last EDR Contact: 06/28/2022
Next Scheduled EDR Contact: 10/17/2022
Data Release Frequency: Semi-Annually

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP: EDR Proprietary Manufactured Gas Plants
The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

EDR Hist Auto: EDR Exclusive Historical Auto Stations
EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR Hist Cleaner: EDR Exclusive Historical Cleaners
EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA HWS: Recovered Government Archive State Hazardous Waste Facilities List

The EDR Recovered Government Archive State Hazardous Waste database provides a list of SHWS incidents derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Environmental Services in New Hampshire.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 01/08/2014
Number of Days to Update: 191

Source: Department of Environmental Services
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

RGA LF: Recovered Government Archive Solid Waste Facilities List

The EDR Recovered Government Archive Landfill database provides a list of landfills derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Environmental Services in New Hampshire.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 01/17/2014
Number of Days to Update: 200

Source: Department of Environmental Services
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

RGA LUST: Recovered Government Archive Leaking Underground Storage Tank

The EDR Recovered Government Archive Leaking Underground Storage Tank database provides a list of LUST incidents derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Environmental Services in New Hampshire.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 01/03/2014
Number of Days to Update: 186

Source: Department of Environmental Services
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data

Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 05/08/2022
Date Data Arrived at EDR: 05/09/2022
Date Made Active in Reports: 07/28/2022
Number of Days to Update: 80

Source: Department of Energy & Environmental Protection
Telephone: 860-424-3375
Last EDR Contact: 08/08/2022
Next Scheduled EDR Contact: 11/21/2022
Data Release Frequency: No Update Planned

NJ MANIFEST: Manifest Information
Hazardous waste manifest information.

Date of Government Version: 12/31/2018
Date Data Arrived at EDR: 04/10/2019
Date Made Active in Reports: 05/16/2019
Number of Days to Update: 36

Source: Department of Environmental Protection
Telephone: N/A
Last EDR Contact: 06/28/2022
Next Scheduled EDR Contact: 10/17/2022
Data Release Frequency: Annually

NY MANIFEST: Facility and Manifest Data
Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 01/01/2019
Date Data Arrived at EDR: 10/29/2021
Date Made Active in Reports: 01/19/2022
Number of Days to Update: 82

Source: Department of Environmental Conservation
Telephone: 518-402-8651
Last EDR Contact: 07/29/2022
Next Scheduled EDR Contact: 11/07/2022
Data Release Frequency: Quarterly

PA MANIFEST: Manifest Information
Hazardous waste manifest information.

Date of Government Version: 06/30/2018
Date Data Arrived at EDR: 07/19/2019
Date Made Active in Reports: 09/10/2019
Number of Days to Update: 53

Source: Department of Environmental Protection
Telephone: 717-783-8990
Last EDR Contact: 07/06/2022
Next Scheduled EDR Contact: 10/24/2022
Data Release Frequency: Annually

RI MANIFEST: Manifest information
Hazardous waste manifest information

Date of Government Version: 12/31/2020
Date Data Arrived at EDR: 11/30/2021
Date Made Active in Reports: 02/18/2022
Number of Days to Update: 80

Source: Department of Environmental Management
Telephone: 401-222-2797
Last EDR Contact: 08/10/2022
Next Scheduled EDR Contact: 11/28/2022
Data Release Frequency: Annually

VT MANIFEST: Hazardous Waste Manifest Data
Hazardous waste manifest information.

Date of Government Version: 10/28/2019
Date Data Arrived at EDR: 10/29/2019
Date Made Active in Reports: 01/09/2020
Number of Days to Update: 72

Source: Department of Environmental Conservation
Telephone: 802-241-3443
Last EDR Contact: 07/12/2022
Next Scheduled EDR Contact: 10/24/2022
Data Release Frequency: Annually

WI MANIFEST: Manifest Information
Hazardous waste manifest information.

Date of Government Version: 05/31/2018
Date Data Arrived at EDR: 06/19/2019
Date Made Active in Reports: 09/03/2019
Number of Days to Update: 76

Source: Department of Natural Resources
Telephone: N/A
Last EDR Contact: 08/29/2022
Next Scheduled EDR Contact: 12/19/2022
Data Release Frequency: Annually

Oil/Gas Pipelines
Source: Endeavor Business Media
Petroleum Bundle (Crude Oil, Refined Products, Petrochemicals, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)) N = Natural Gas Bundle (Natural Gas, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)). This map includes information copyrighted by Endeavor Business Media. This information is provided on a best effort basis and Endeavor Business Media does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of Endeavor Business Media.

Electric Power Transmission Line Data
Source: Endeavor Business Media
This map includes information copyrighted by Endeavor Business Media. This information is provided on a best effort basis and Endeavor Business Media does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of Endeavor Business Media.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:
Source: American Hospital Association, Inc.
Telephone: 312-280-5991
The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing
Source: Centers for Medicare & Medicaid Services
Telephone: 410-786-3000
A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes
Source: National Institutes of Health
Telephone: 301-594-6248
Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools
Source: National Center for Education Statistics
Telephone: 202-502-7300
The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Private Schools
Source: National Center for Education Statistics
Telephone: 202-502-7300
The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Child Care Facility List
Source: Department of Health & Human Services
Telephone: 603-271-4624

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.
Source: FEMA
Telephone: 877-336-2627
Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005 and 2010 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Wetland Inventory
Source: US Fish & Wildlife Service
Telephone: 703-358-2171

Current USGS 7.5 Minute Topographic Map
Source: U.S. Geological Survey

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

STREET AND ADDRESS INFORMATION

Â© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

GEOCHECK ®- PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

STANLEY MILL
93 MEMORIAL STREET
FRANKLIN, NH 03235

TARGET PROPERTY COORDINATES

Latitude (North):	43.446209 - 43ˆ 26’ 46.35’’
Longitude (West):	71.647921 - 71ˆ 38’ 52.52’’
Universal Tranverse Mercator:	Zone 19
UTM X (Meters):	285730.3
UTM Y (Meters):	4813558.0
Elevation:	300 ft. above sea level

USGS TOPOGRAPHIC MAP

Target Property Map:	11743457 FRANKLIN, NH
Version Date:	2018

EDR’s GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principle investigative components:

1. Groundwater flow direction, and
2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).

TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General SSW

SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

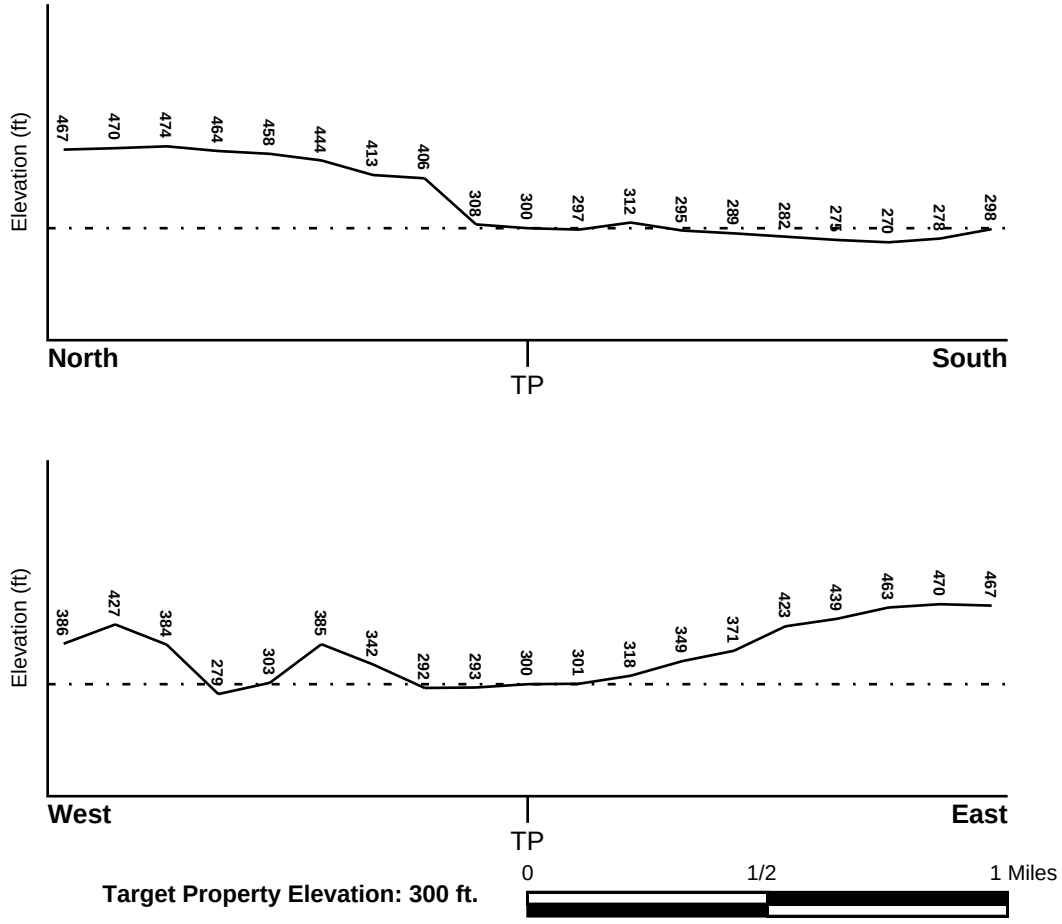

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

Flood Plain Panel at Target Property	FEMA Source Type
33013C0159E	FEMA FIRM Flood data

Additional Panels in search area:	FEMA Source Type
33013C0158E	FEMA FIRM Flood data
33013C0166E	FEMA FIRM Flood data
33013C0167E	FEMA FIRM Flood data

NATIONAL WETLAND INVENTORY

NWI Quad at Target Property	NWI Electronic Data Coverage
FRANKLIN	YES - refer to the Overview Map and Detail Map

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

AQUIFLOW®

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

MAP ID	LOCATION FROM TP	GENERAL DIRECTION GROUNDWATER FLOW
Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT

Era:	Paleozoic
System:	Devonian
Series:	Devonian
Code:	De *(decoded above as Era, System & Series)*

GEOLOGIC AGE IDENTIFICATION

Category: Eugeosynclinal Deposits

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps. The following information is based on Soil Conservation Service STATSGO data.

Soil Component Name:	PAXTON
Soil Surface Texture:	very stony - fine sandy loam
Hydrologic Group:	Class C - Slow infiltration rates. Soils with layers impeding downward movement of water, or soils with moderately fine or fine textures.
Soil Drainage Class:	Well drained. Soils have intermediate water holding capacity. Depth to water table is more than 6 feet.

Hydric Status: Soil does not meet the requirements for a hydric soil.

Corrosion Potential - Uncoated Steel: LOW

Depth to Bedrock Min: > 60 inches

Depth to Bedrock Max: > 60 inches

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
	Boundary			Classification			
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil	Permeability Rate (in/hr)	Soil Reaction (pH)
1	0 inches	2 inches	very stony - fine sandy loam	Granular materials (35 pct. or less passing No. 200), Silty, or Clayey Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 2.00 Min: 0.60	Max: 6.00 Min: 4.50
2	2 inches	26 inches	fine sandy loam	Granular materials (35 pct. or less passing No. 200), Silty, or Clayey Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 2.00 Min: 0.60	Max: 6.00 Min: 4.50
3	26 inches	65 inches	fine sandy loam	Granular materials (35 pct. or less passing No. 200), Stone Fragments, Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 0.20 Min: 0.00	Max: 6.00 Min: 4.50

OTHER SOIL TYPES IN AREA

Based on Soil Conservation Service STATSGO data, the following additional subordinant soil types may appear within the general area of target property.

Soil Surface Textures: fine sandy loam
unweathered bedrock

Surficial Soil Types: fine sandy loam
unweathered bedrock

Shallow Soil Types: No Other Soil Types

Deeper Soil Types: unweathered bedrock
gravelly - loamy sand
sandy loam
loamy sand

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

WELL SEARCH DISTANCE INFORMATION

DATABASE	SEARCH DISTANCE (miles)
Federal USGS	1.000
Federal FRDS PWS	Nearest PWS within 1 mile
State Database	1.000

FEDERAL USGS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
A2	USGS40000798197	1/8 - 1/4 Mile South
A3	USGS40000798196	1/8 - 1/4 Mile South
A4	USGS40000798195	1/8 - 1/4 Mile South
A5	USGS40000798198	1/8 - 1/4 Mile South
A6	USGS40000798201	1/8 - 1/4 Mile South
A7	USGS40000798200	1/8 - 1/4 Mile South
A8	USGS40000798199	1/8 - 1/4 Mile South
B9	USGS40000798177	1/8 - 1/4 Mile South
B10	USGS40000798178	1/8 - 1/4 Mile South
B11	USGS40000798179	1/8 - 1/4 Mile South
B12	USGS40000798176	1/8 - 1/4 Mile South
B13	USGS40000798175	1/8 - 1/4 Mile South
B14	USGS40000798180	1/8 - 1/4 Mile SSW
B15	USGS40000798162	1/8 - 1/4 Mile South
B16	USGS40000798161	1/8 - 1/4 Mile South
B17	USGS40000798163	1/8 - 1/4 Mile South
B18	USGS40000798165	1/8 - 1/4 Mile South
B19	USGS40000798164	1/8 - 1/4 Mile South
B20	USGS40000798166	1/8 - 1/4 Mile SSW
B21	USGS40000798167	1/8 - 1/4 Mile SSW
B22	USGS40000798150	1/4 - 1/2 Mile South
B23	USGS40000798151	1/4 - 1/2 Mile South
B24	USGS40000798142	1/4 - 1/2 Mile South
B25	USGS40000798143	1/4 - 1/2 Mile South
26	USGS40000798134	1/4 - 1/2 Mile South
29	USGS40000798111	1/4 - 1/2 Mile SSW
30	USGS40000798100	1/2 - 1 Mile SSW
31	USGS40000798329	1/2 - 1 Mile ENE
C32	USGS40000798332	1/2 - 1 Mile ENE
C36	USGS40000798341	1/2 - 1 Mile ENE
D37	USGS40000798284	1/2 - 1 Mile West

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
A1	NH2077080	1/8 - 1/4 Mile SSE

Note: PWS System location is not always the same as well location.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
27	NHINV0000048785	1/4 - 1/2 Mile SSE
28	NHINV0000044227	1/4 - 1/2 Mile WNW
C33	NHINV0000041179	1/2 - 1 Mile ENE
C34	NHINV0000052309	1/2 - 1 Mile ENE
D35	NHINV0000009475	1/2 - 1 Mile WNW
38	NHINV0000033255	1/2 - 1 Mile WSW
39	NHINV0000060170	1/2 - 1 Mile SSW

PHYSICAL SETTING SOURCE MAP - 7125568.2s

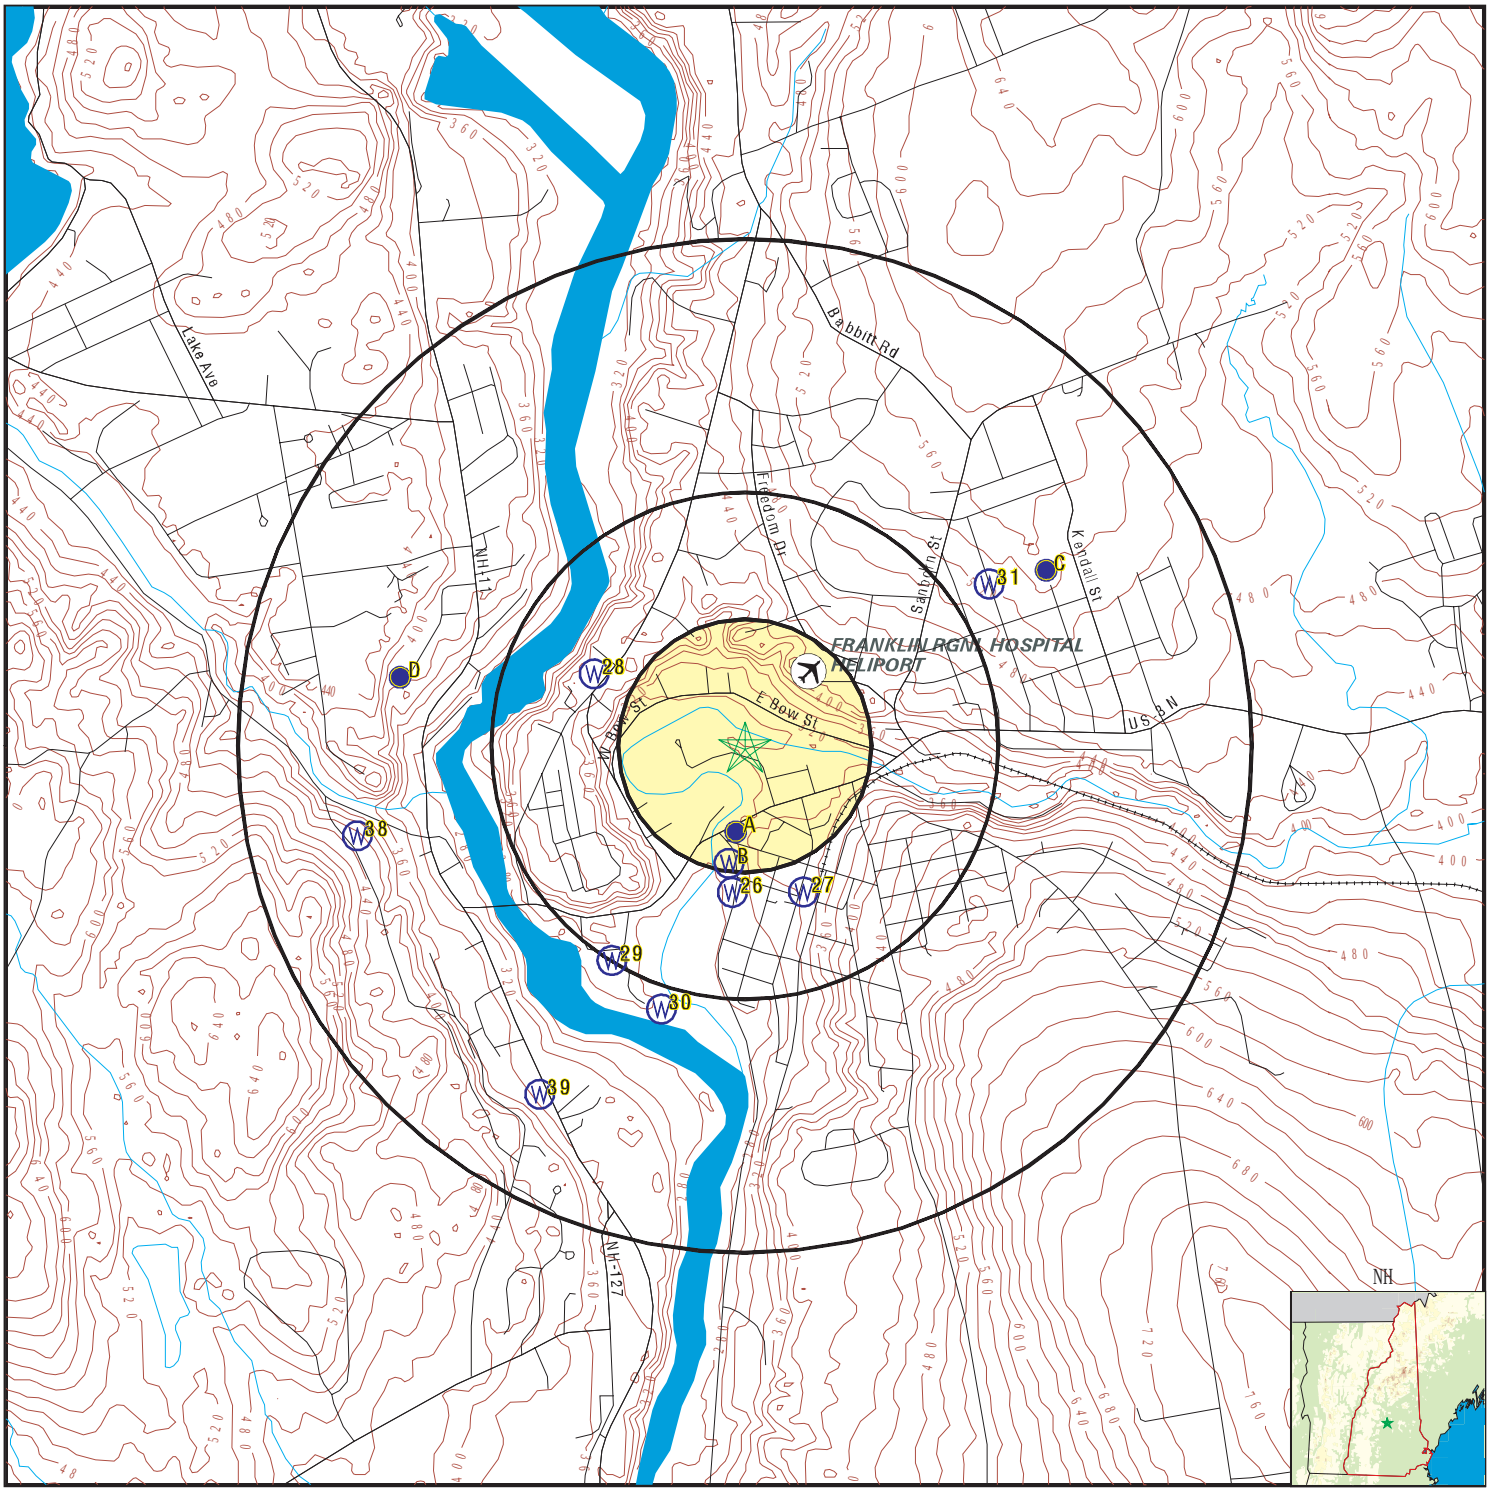

- County Boundary
- Major Roads
- Contour Lines
- Airports
- Earthquake epicenter, Richter 5 or greater
- Water Wells
- Public Water Supply Wells
- Cluster of Multiple Icons
- Groundwater Flow Direction
- GI Indeterminate Groundwater Flow at Location
- GV Groundwater Flow Varies at Location

SITE NAME:	Stanley Mill	CLIENT:	Nobis Group
ADDRESS:	93 Memorial Street Franklin NH 03235	CONTACT:	Karina Zawilinski
		INQUIRY #:	7125568.2s
LAT/LONG:	43.446209 / 71.647921	DATE:	September 21, 2022 4:53 pm

Copyright © 2022 EDR, Inc. © 2015 TomTom Rel. 2015.

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

A1
SSE
1/8 - 1/4 Mile
Higher

FRDS PWS **NH2077080**

Epa region:	01	State:	NH
Pwsid:	NH2077080	Pwsname:	OSBORNE COTTAGES
Cityserved:	Not Reported	Stateserved:	NH
Zipserved:	Not Reported	Fipscounty:	33001
Status:	Active	Retpopsrvd:	45
Pwssvcconn:	18	Psource longname:	Groundwater
Pwstype:	TNCWS	Owner:	Private
Contact:	THOMAS DOYLE	Contactorgname:	OSBORNE COTTAGES LLC
Contactphone:	Not Reported	Contactaddress1:	22 HICKORY LN
Contactaddress2:	Not Reported	Contactcity:	DANVILLE
Contactstate:	NH	Contactzip:	03819
Pwsactivitycode:	A		

A2
South
1/8 - 1/4 Mile
Lower

FED USGS **USGS40000798197**

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 82	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900207
Well Depth:	13.3	Well Depth Units:	ft
Well Hole Depth:	17	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-02-07
Feet below surface:	5.52	Feet to sea level:	Not Reported
Note:	Not Reported		

A3
South
1/8 - 1/4 Mile
Lower

FED USGS **USGS40000798196**

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 80	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900206
Well Depth:	13.95	Well Depth Units:	ft
Well Hole Depth:	17	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-02-06
Feet below surface:	5.74	Feet to sea level:	Not Reported
Note:	Not Reported		

A4
South
1/8 - 1/4 Mile
Lower

FED USGS **USGS40000798195**

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 79	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900206
Well Depth:	10.91	Well Depth Units:	ft
Well Hole Depth:	15	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-02-06
Feet below surface:	5.15	Feet to sea level:	Not Reported
Note:	Not Reported		

A5
South
1/8 - 1/4 Mile
Lower

FED USGS **USGS40000798198**

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 83	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900207
Well Depth:	13.86	Well Depth Units:	ft
Well Hole Depth:	17	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-02-07
Feet below surface:	7.57	Feet to sea level:	Not Reported
Note:	Not Reported		

A6
South
1/8 - 1/4 Mile
Lower

FED USGS **USGS40000798201**

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 86	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported

Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900326
Well Depth:	11	Well Depth Units:	ft
Well Hole Depth:	13	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-03-28
Feet below surface:	5.08	Feet to sea level:	Not Reported
Note:	Not Reported		

A7
South **FED USGS** **USGS40000798200**
1/8 - 1/4 Mile
Lower

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 85	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900326
Well Depth:	13.3	Well Depth Units:	ft
Well Hole Depth:	13.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-03-28
Feet below surface:	5.53	Feet to sea level:	Not Reported
Note:	Not Reported		

A8
South **FED USGS** **USGS40000798199**
1/8 - 1/4 Mile
Lower

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 84	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900326
Well Depth:	13.31	Well Depth Units:	ft
Well Hole Depth:	13.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-03-28
Feet below surface:	6.80	Feet to sea level:	Not Reported
Note:	Not Reported		

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

B9
South
1/8 - 1/4 Mile
Lower

FED USGS **USGS40000798177**

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 88	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900326
Well Depth:	13.37	Well Depth Units:	ft
Well Hole Depth:	13.4	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-03-28
Feet below surface:	7.03	Feet to sea level:	Not Reported
Note:	Not Reported		

B10
South
1/8 - 1/4 Mile
Lower

FED USGS **USGS40000798178**

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 93	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900717
Well Depth:	12.48	Well Depth Units:	ft
Well Hole Depth:	12.9	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-07-17
Feet below surface:	7.58	Feet to sea level:	Not Reported
Note:	Not Reported		

B11
South
1/8 - 1/4 Mile
Lower

FED USGS **USGS40000798179**

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 97	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900927

Well Depth:	14.61	Well Depth Units:	ft
Well Hole Depth:	16.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-10-01
Feet below surface:	7.35	Feet to sea level:	Not Reported
Note:	Not Reported		

B12
South **FED USGS** **USGS40000798176**
1/8 - 1/4 Mile
Lower

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 87	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900326
Well Depth:	12.82	Well Depth Units:	ft
Well Hole Depth:	12.85	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-03-28
Feet below surface:	6.38	Feet to sea level:	Not Reported
Note:	Not Reported		

B13
South **FED USGS** **USGS40000798175**
1/8 - 1/4 Mile
Lower

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 81	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900206
Well Depth:	11.9	Well Depth Units:	ft
Well Hole Depth:	12	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-02-06
Feet below surface:	5.34	Feet to sea level:	Not Reported
Note:	Not Reported		

B14
SSW **FED USGS** **USGS40000798180**
1/8 - 1/4 Mile
Lower

Organization ID:	USGS-NH
Organization Name:	USGS New Hampshire Water Science Center

Monitor Location:	NH-FKW 94	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900717
Well Depth:	7.22	Well Depth Units:	ft
Well Hole Depth:	7.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-07-17
Feet below surface:	3.08	Feet to sea level:	Not Reported
Note:	Not Reported		

B15
South **FED USGS** **USGS40000798162**
1/8 - 1/4 Mile
Lower

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 92	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900717
Well Depth:	12.88	Well Depth Units:	ft
Well Hole Depth:	15.8	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-07-17
Feet below surface:	8.09	Feet to sea level:	Not Reported
Note:	Not Reported		

B16
South **FED USGS** **USGS40000798161**
1/8 - 1/4 Mile
Lower

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 91	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900717
Well Depth:	14.48	Well Depth Units:	ft
Well Hole Depth:	16.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-07-17
Feet below surface:	8.08	Feet to sea level:	Not Reported
Note:	Not Reported		

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

B17
South
1/8 - 1/4 Mile
Lower

FED USGS **USGS40000798163**

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 98	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900927
Well Depth:	18.47	Well Depth Units:	ft
Well Hole Depth:	18.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-10-01
Feet below surface:	8.43	Feet to sea level:	Not Reported
Note:	Not Reported		

B18
South
1/8 - 1/4 Mile
Lower

FED USGS **USGS40000798165**

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 103	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900928
Well Depth:	15.15	Well Depth Units:	ft
Well Hole Depth:	16	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-10-01
Feet below surface:	10.15	Feet to sea level:	Not Reported
Note:	Not Reported		

B19
South
1/8 - 1/4 Mile
Lower

FED USGS **USGS40000798164**

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 100	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900927

Well Depth:	17	Well Depth Units:	ft
Well Hole Depth:	17	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-10-01
Feet below surface:	9.85	Feet to sea level:	Not Reported
Note:	Not Reported		

B20
SSW **FED USGS** **USGS40000798166**
1/8 - 1/4 Mile
Lower

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 101	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900928
Well Depth:	15.85	Well Depth Units:	ft
Well Hole Depth:	17	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-10-01
Feet below surface:	9.79	Feet to sea level:	Not Reported
Note:	Not Reported		

B21
SSW **FED USGS** **USGS40000798167**
1/8 - 1/4 Mile
Lower

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 102	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900928
Well Depth:	16.75	Well Depth Units:	ft
Well Hole Depth:	18.8	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-10-01
Feet below surface:	11.53	Feet to sea level:	Not Reported
Note:	Not Reported		

B22
South **FED USGS** **USGS40000798150**
1/4 - 1/2 Mile
Lower

Organization ID:	USGS-NH
Organization Name:	USGS New Hampshire Water Science Center

Monitor Location:	NH-FKW 90	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900717
Well Depth:	14.11	Well Depth Units:	ft
Well Hole Depth:	15.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-07-17
Feet below surface:	8.71	Feet to sea level:	Not Reported
Note:	Not Reported		

B23
South **FED USGS** **USGS40000798151**
1/4 - 1/2 Mile
Lower

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 96	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	19.48	Well Depth Units:	ft
Well Hole Depth:	19.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-10-01
Feet below surface:	7.9	Feet to sea level:	Not Reported
Note:	Not Reported		

B24
South **FED USGS** **USGS40000798142**
1/4 - 1/2 Mile
Lower

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 89	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900717
Well Depth:	8.34	Well Depth Units:	ft
Well Hole Depth:	8.5	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-08-14
Feet below surface:	7.03	Feet to sea level:	Not Reported
Note:	Not Reported		

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

B25
South
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000798143**

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 99	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900927
Well Depth:	18	Well Depth Units:	ft
Well Hole Depth:	18	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-10-01
Feet below surface:	9	Feet to sea level:	Not Reported
Note:	Not Reported		

26
South
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000798134**

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 95	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Sand and gravel aquifers (glaciated regions)		
Formation Type:	Stratified Deposits, Undifferentiated		
Aquifer Type:	Not Reported	Construction Date:	19900927
Well Depth:	17.62	Well Depth Units:	ft
Well Hole Depth:	18	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	1	Level reading date:	1990-10-01
Feet below surface:	8.70	Feet to sea level:	Not Reported
Note:	Not Reported		

27
SSE
1/4 - 1/2 Mile
Higher

NH WELLS **NHINV0000048785**

Database:	Well Locations	Driller #:	48786
Well #:	Not Reported	WRB ID:	087.0275
Elevation:	0	Well Owner:	STOVE SR
Date Completed:	2011 323	Well Use:	Test/Exploration
Well Need:	Monitoring (water level or quality)		
Well Type:	Drilled in Gravel	Well Depth:	15
Bedrock Depth:	0	Casing Length:	5
Yield Test Method:	Not Reported	Duration:	0
Discharge (GPM):	0	Static Water Level:	6

Date Measured:	2011 323	Water Quality Checked:	Not Reported

28
WNW **NH WELLS** **NHINV0000044227**
1/4 - 1/2 Mile
Higher

Database:	Well Locations	Driller #:	44228
Well #:	MW-5	WRB ID:	087.0247
Elevation:	384	Well Owner:	POLY CLAD LAMINATES
Date Completed:	2007 413	Well Use:	Test/Exploration
Well Need:	Monitoring (water level or quality)		
Well Type:	Not Reported	Well Depth:	36
Bedrock Depth:	0	Casing Length:	36
Yield Test Method:	Not Reported	Duration:	0
Discharge (GPM):	0	Static Water Level:	28
Date Measured:	2007 913	Water Quality Checked:	Not Reported

29
SSW **FED USGS** **USGS40000798111**
1/4 - 1/2 Mile
Lower

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 106	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19460918
Well Depth:	27	Well Depth Units:	ft
Well Hole Depth:	27	Well Hole Depth Units:	ft

30
SSW **FED USGS** **USGS40000798100**
1/2 - 1 Mile
Lower

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 105	Type:	Well
Description:	Not Reported	HUC:	01070002
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19460918
Well Depth:	35	Well Depth Units:	ft
Well Hole Depth:	35	Well Hole Depth Units:	ft

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database	EDR ID Number

31
ENE
1/2 - 1 Mile
Higher

FED USGS **USGS40000798329**

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 127	Type:	Well
Description:	Field location by Water well contractor		
HUC:	Not Reported	Drainage Area:	Not Reported
Drainage Area Units:	Not Reported	Contrib Drainage Area:	Not Reported
Contrib Drainage Area Unts:	Not Reported	Aquifer:	Not Reported
Formation Type:	Bedrock	Aquifer Type:	Not Reported
Construction Date:	20030820	Well Depth:	140
Well Depth Units:	ft	Well Hole Depth:	Not Reported
Well Hole Depth Units:	Not Reported		

C32
ENE
1/2 - 1 Mile
Higher

FED USGS **USGS40000798332**

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 110	Type:	Well
Description:	Field location by Water well contractor		
HUC:	Not Reported	Drainage Area:	Not Reported
Drainage Area Units:	Not Reported	Contrib Drainage Area:	Not Reported
Contrib Drainage Area Unts:	Not Reported	Aquifer:	Not Reported
Formation Type:	Bedrock	Aquifer Type:	Not Reported
Construction Date:	20030417	Well Depth:	425
Well Depth Units:	ft	Well Hole Depth:	Not Reported
Well Hole Depth Units:	Not Reported		

C33
ENE
1/2 - 1 Mile
Higher

NH WELLS **NHINV0000041179**

Database:	Well Locations	Driller #:	41180
Well #:	7222	WRB ID:	087.0157
Elevation:	0	Well Owner:	JEFF MARCEAU
Date Completed:	2003 417	Well Use:	Domestic
Well Need:	New	Well Type:	Drilled in Bedrock
Well Depth:	425	Bedrock Depth:	20
Casing Length:	60	Yield Test Method:	Compressed Air
Duration:	.5	Discharge (GPM):	15
Static Water Level:	20	Date Measured:	2003 417
Water Quality Checked:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

C34
ENE
1/2 - 1 Mile
Higher

NH WELLS **NHINV0000052309**

Database:	Well Locations	Driller #:	52310
Well #:	7475	WRB ID:	087.0175
Elevation:	0	Well Owner:	LAKEVIEW CONSTRUCTION
Date Completed:	20031022	Well Use:	Domestic
Well Need:	New	Well Type:	Drilled in Bedrock
Well Depth:	145	Bedrock Depth:	20
Casing Length:	40	Yield Test Method:	Compressed Air
Duration:	.5	Discharge (GPM):	15
Static Water Level:	20	Date Measured:	20031022
Water Quality Checked:	Not Reported		

D35
WNW
1/2 - 1 Mile
Higher

NH WELLS **NHINV0000009475**

Database:	Well Locations	Driller #:	9476
Well #:	Not Reported	WRB ID:	087.0026
Elevation:	380	Well Owner:	BECKFORD
Date Completed:	0	Well Use:	Domestic
Well Need:	New	Well Type:	Drilled in Bedrock
Well Depth:	280	Bedrock Depth:	90
Casing Length:	100	Yield Test Method:	Compressed Air
Duration:	.5	Discharge (GPM):	9
Static Water Level:	0	Date Measured:	0
Water Quality Checked:	Not Reported		

C36
ENE
1/2 - 1 Mile
Higher

FED USGS **USGS40000798341**

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 123	Type:	Well
Description:	Field location by Water well contractor		
HUC:	Not Reported	Drainage Area:	Not Reported
Drainage Area Units:	Not Reported	Contrib Drainage Area:	Not Reported
Contrib Drainage Area Unts:	Not Reported	Aquifer:	Not Reported
Formation Type:	Bedrock	Aquifer Type:	Not Reported
Construction Date:	20031022	Well Depth:	145
Well Depth Units:	ft	Well Hole Depth:	Not Reported
Well Hole Depth Units:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

D37
West
1/2 - 1 Mile
Higher | **FED USGS** | **USGS40000798284**

Organization ID:	USGS-NH		
Organization Name:	USGS New Hampshire Water Science Center		
Monitor Location:	NH-FKW 48	Type:	Well
Description:	Not Reported	HUC:	01070001
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Bedrock
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	280	Well Depth Units:	ft
Well Hole Depth:	Not Reported	Well Hole Depth Units:	Not Reported

---

38
WSW
1/2 - 1 Mile
Higher | **NH WELLS** | **NHINV0000033255**

Database:	Well Locations	Driller #:	33256
Well #:	591	WRB ID:	087.0127
Elevation:	410	Well Owner:	MARCOUX
Date Completed:	20011023	Well Use:	Domestic
Well Need:	New	Well Type:	Drilled in Bedrock
Well Depth:	480	Bedrock Depth:	40
Casing Length:	60	Yield Test Method:	Compressed Air
Duration:	1	Discharge (GPM):	6
Static Water Level:	23	Date Measured:	20011023
Water Quality Checked:	Not Reported		

39
SSW
1/2 - 1 Mile
Higher | **NH WELLS** | **NHINV0000060170**

Database:	Well Locations	Driller #:	60171
Well #:	54398	WRB ID:	087.0214
Elevation:	333	Well Owner:	IRVING OIL CO
Date Completed:	2005 420	Well Use:	Test/Exploration
Well Need:	Monitoring (water level or quality)		
Well Type:	Drilled in Gravel	Well Depth:	11
Bedrock Depth:	0	Casing Length:	10
Yield Test Method:	Not Reported	Duration:	0
Discharge (GPM):	0	Static Water Level:	.5
Date Measured:	2005 420	Water Quality Checked:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS
RADON

AREA RADON INFORMATION

State Database: NH Radon

Radon Test Results

County	Town	Num Tests	Avg Result	Max Result	Min Result
MERRIMACK	ALLENSTOWN	63	5.3	34.7	0.3
MERRIMACK	ANDOVER	84	2.3	13.2	0.3
MERRIMACK	BOSCAWEN	61	1.5	6.3	0.3
MERRIMACK	BOW	180	10.4	137.2	0.3
MERRIMACK	BRADFORD	87	1.6	14.2	0.3
MERRIMACK	CANTERBURY	227	3.0	52.6	0.3
MERRIMACK	CHICHESTER	169	8.7	152.8	0.3
MERRIMACK	CONCORD	326	2.5	71.3	0.3
MERRIMACK	CONTOOCOOK	42	1.0	3.5	0.3
MERRIMACK	DANBURY	74	2.8	13.0	0.3
MERRIMACK	EPSOM	245	4.1	25.3	0.3
MERRIMACK	FRANKLIN	182	2.3	19.8	0.3
MERRIMACK	HENNIKER	161	1.3	21.6	0.3
MERRIMACK	HOOKSETT	270	6.2	60.8	0.3
MERRIMACK	LOUDON	315	3.8	36.8	0.3
MERRIMACK	NEWBURY	106	3.2	17.0	0.3
MERRIMACK	PEMBROKE	257	6.5	140.1	0.3
MERRIMACK	PITTSFIELD	110	3.5	75.4	0.3
MERRIMACK	SALISBURY	48	1.3	4.2	0.3
MERRIMACK	SUTTON	54	1.4	3.9	0.3
MERRIMACK	WEBSTER	63	1.6	4.7	0.3
MERRIMACK	WILMOT	20	4.7	29.2	0.3
MERRIMACK	HILL	56	1.7	4.9	0.3
MERRIMACK	HOPKINTON	269	1.9	15.1	0.3
MERRIMACK	NEW LONDON	195	5.4	143.8	0.3
MERRIMACK	WARNER	152	2.2	20.7	0.3

Federal EPA Radon Zone for MERRIMACK County: 2

Note: Zone 1 indoor average level > 4 pCi/L.
: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.
: Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for MERRIMACK COUNTY, NH

Number of sites tested: 199

Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L
Living Area	1.320 pCi/L	81%	16%	3%
Basement	2.560 pCi/L	72%	26%	3%

PHYSICAL SETTING SOURCE RECORDS SEARCHED

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)
Source: United States Geologic Survey
EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Current USGS 7.5 Minute Topographic Map
Source: U.S. Geological Survey

HYDROLOGIC INFORMATION

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.
Source: FEMA
Telephone: 877-336-2627
Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005 and 2010 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Wetland Inventory
Source: US Fish & Wildlife Service
Telephone: 703-358-2171

HYDROGEOLOGIC INFORMATION

AQUIFLOW^{R} Information System
Source: EDR proprietary database of groundwater flow information
EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit
Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database
Source: Department of Agriculture, Natural Resources Conservation Service (NRCS)
The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database
Source: Department of Agriculture, Natural Resources Conservation Service (NRCS)
Telephone: 800-672-5559
SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Service, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems
Source: EPA/Office of Drinking Water
Telephone: 202-564-3750
Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data
Source: EPA/Office of Drinking Water
Telephone: 202-564-3750
Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)
This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

Public Water Supply Sources
Source: Department of Environmental Services
Telephone: 603-271-3503

Well Locations
Source: University of New Hampshire, GRANIT
Telephone: 603-862-1792

OTHER STATE DATABASE INFORMATION

RADON

State Database: NH Radon
Source: Department of Health and Human Services
Telephone: 603-271-4610
Summary Table of Short-term Radon Test Results

Area Radon Information
Source: USGS
Telephone: 703-356-4020
The National Radon Database has been developed by the U.S. Environmental Protection Agency (USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

EPA Radon Zones
Source: EPA
Telephone: 703-356-4020
Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor radon levels.

OTHER

Airport Landing Facilities: Private and public use landing facilities
Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater
Source: Department of Commerce, National Oceanic and Atmospheric Administration

Earthquake Fault Lines: The fault lines displayed on EDR's Topographic map are digitized quaternary faultlines, prepared in 1975 by the United State Geological Survey

PHYSICAL SETTING SOURCE RECORDS SEARCHED

STREET AND ADDRESS INFORMATION

Â© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

Stanley Mill
93 Memorial Street
Franklin, NH 03235

Inquiry Number: 7125568.4
September 21, 2022

EDR Historical Topo Map Report

with QuadMatch™

6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

EDR Historical Topo Map Report

09/21/22

Site Name:

Stanley Mill
93 Memorial Street
Franklin, NH 03235
EDR Inquiry # 7125568.4

Client Name:

Nobis Group
18 Chenell Drive
Concord, NH 03301
Contact: Karina Zawilinski

EDR Topographic Map Library has been searched by EDR and maps covering the target property location as provided by Nobis Group were identified for the years listed below. EDR's Historical Topo Map Report is designed to assist professionals in evaluating potential liability on a target property resulting from past activities. EDRs Historical Topo Map Report includes a search of a collection of public and private color historical topographic maps, dating back to the late 1800s.

Search Results:

P.O.# 100400.000
Project: Stanley Mill

Coordinates:

Latitude:	43.446209 43° 26' 46" North
Longitude:	-71.647921 -71° 38' 53" West
UTM Zone:	Zone 19 North
UTM X Meters:	285736.40
UTM Y Meters:	4813773.47
Elevation:	300.00' above sea level

Maps Provided:

2018
2015
2012
2000
1987
1956
1927

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2022 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Topo Sheet Key

This EDR Topo Map Report is based upon the following USGS topographic map sheets.

2018 Source Sheets

Franklin
2018
7.5-minute, 24000

Northfield
2018
7.5-minute, 24000

2015 Source Sheets

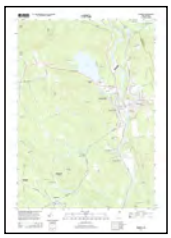

Franklin
2015
7.5-minute, 24000

Northfield
2015
7.5-minute, 24000

2012 Source Sheets

Franklin
2012
7.5-minute, 24000

Northfield
2012
7.5-minute, 24000

2000 Source Sheets

Franklin
2000
7.5-minute, 24000
Aerial Photo Revised 2000

Topo Sheet Key

This EDR Topo Map Report is based upon the following USGS topographic map sheets.

1987 Source Sheets

Franklin
1987
7.5-minute, 24000
Aerial Photo Revised 1981

Northfield
1987
7.5-minute, 24000
Aerial Photo Revised 1981

1956 Source Sheets

Penacook
1956
15-minute, 62500

1927 Source Sheets

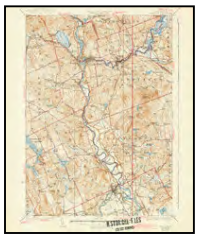

Penacook
1927
15-minute, 62500

Historical Topo Map

2018

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

NW N NE
W E
SW S SE

TP, Franklin, 2018, 7.5-minute
E, Northfield, 2018, 7.5-minute

SITE NAME: Stanley Mill
ADDRESS: 93 Memorial Street
Franklin, NH 03235
CLIENT: Nobis Group

N

Historical Topo Map

2015

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

NW N NE
W E
SW S SE

TP, Franklin, 2015, 7.5-minute
E, Northfield, 2015, 7.5-minute

SITE NAME: Stanley Mill
ADDRESS: 93 Memorial Street
Franklin, NH 03235
CLIENT: Nobis Group

N

Historical Topo Map

2012

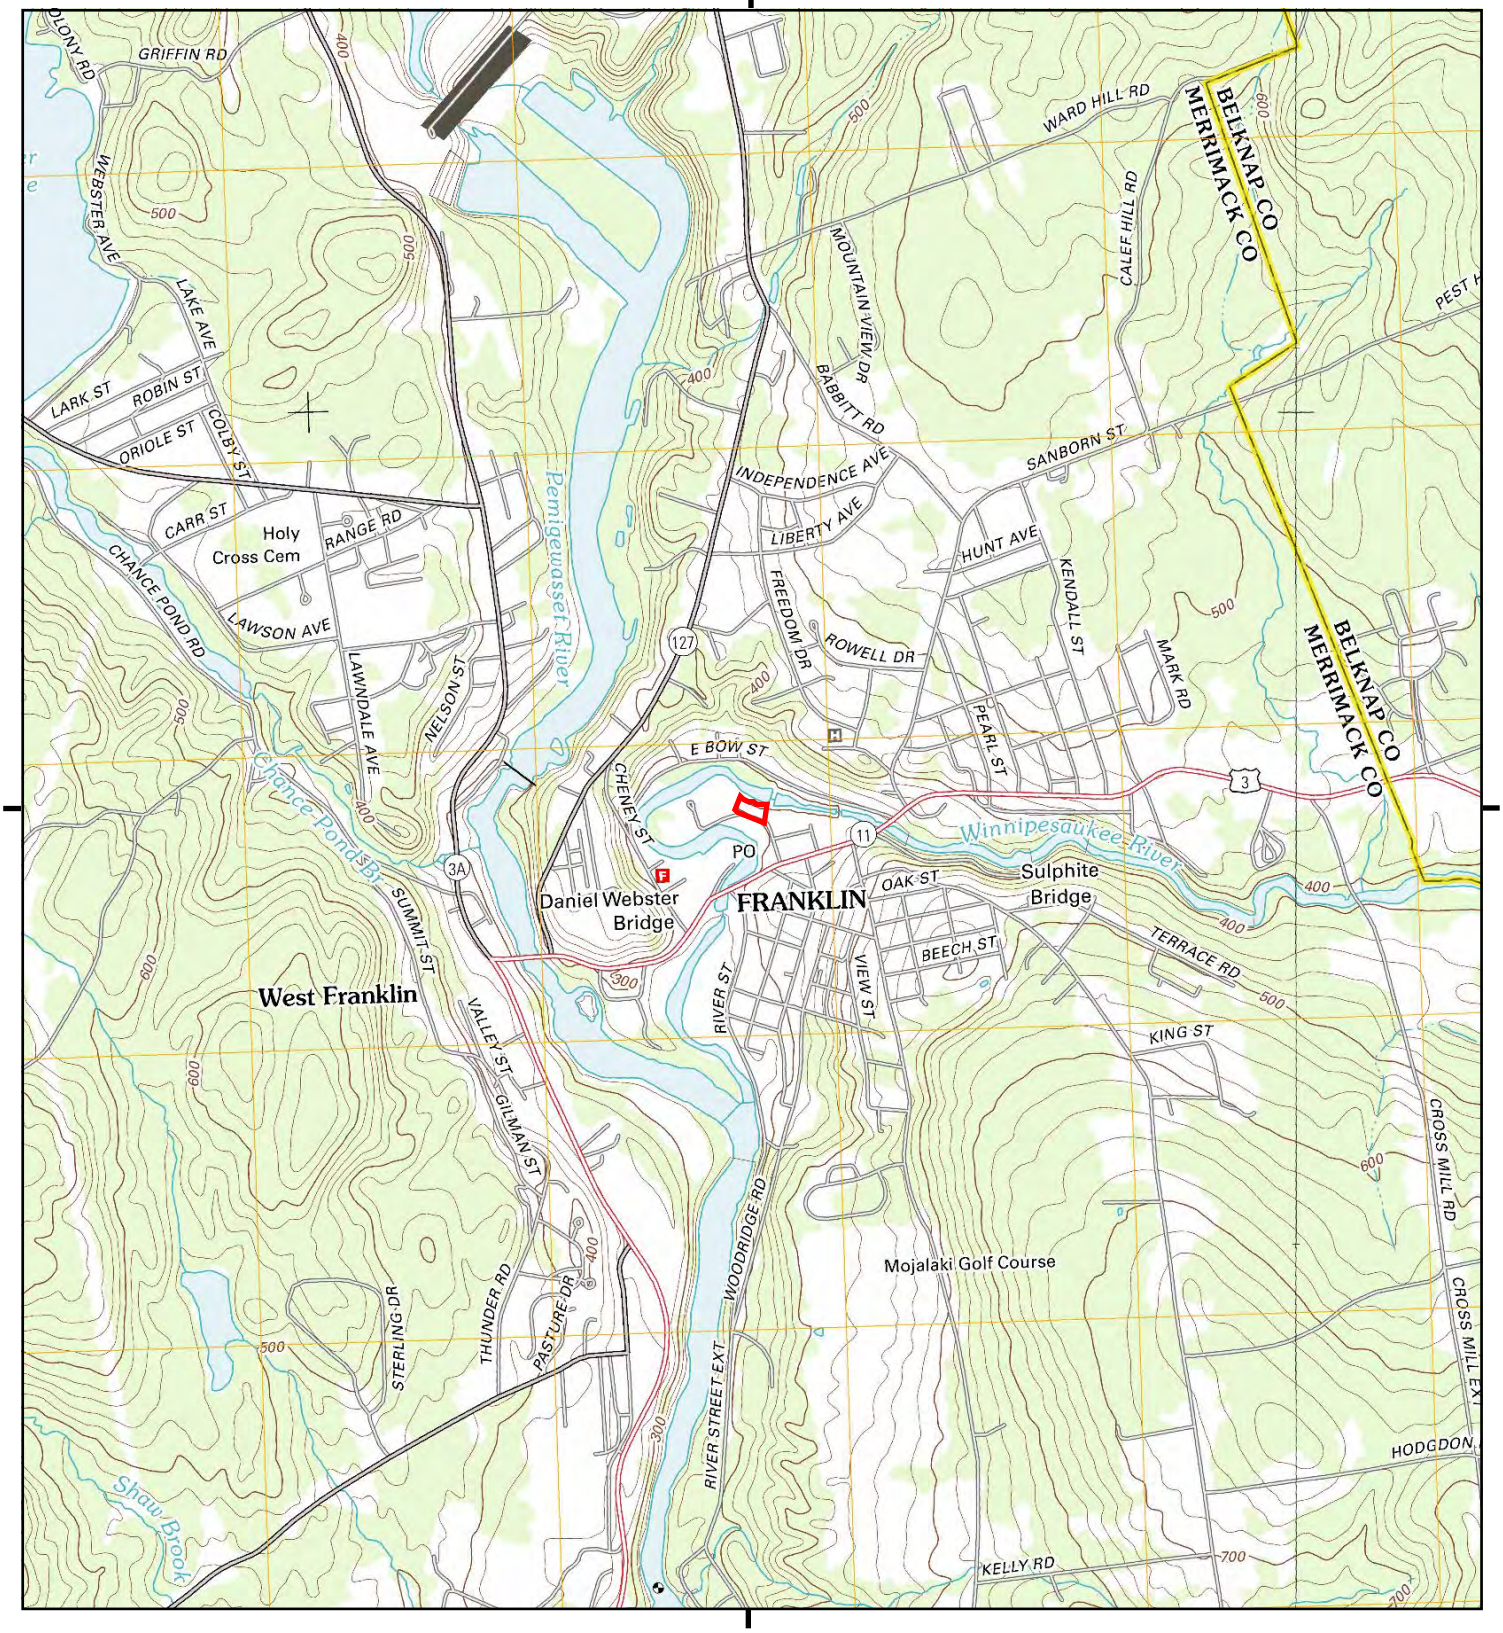

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

NW N NE
W E
SW S SE

TP, Franklin, 2012, 7.5-minute
E, Northfield, 2012, 7.5-minute

SITE NAME: Stanley Mill
ADDRESS: 93 Memorial Street
Franklin, NH 03235
CLIENT: Nobis Group

N

Historical Topo Map

2000

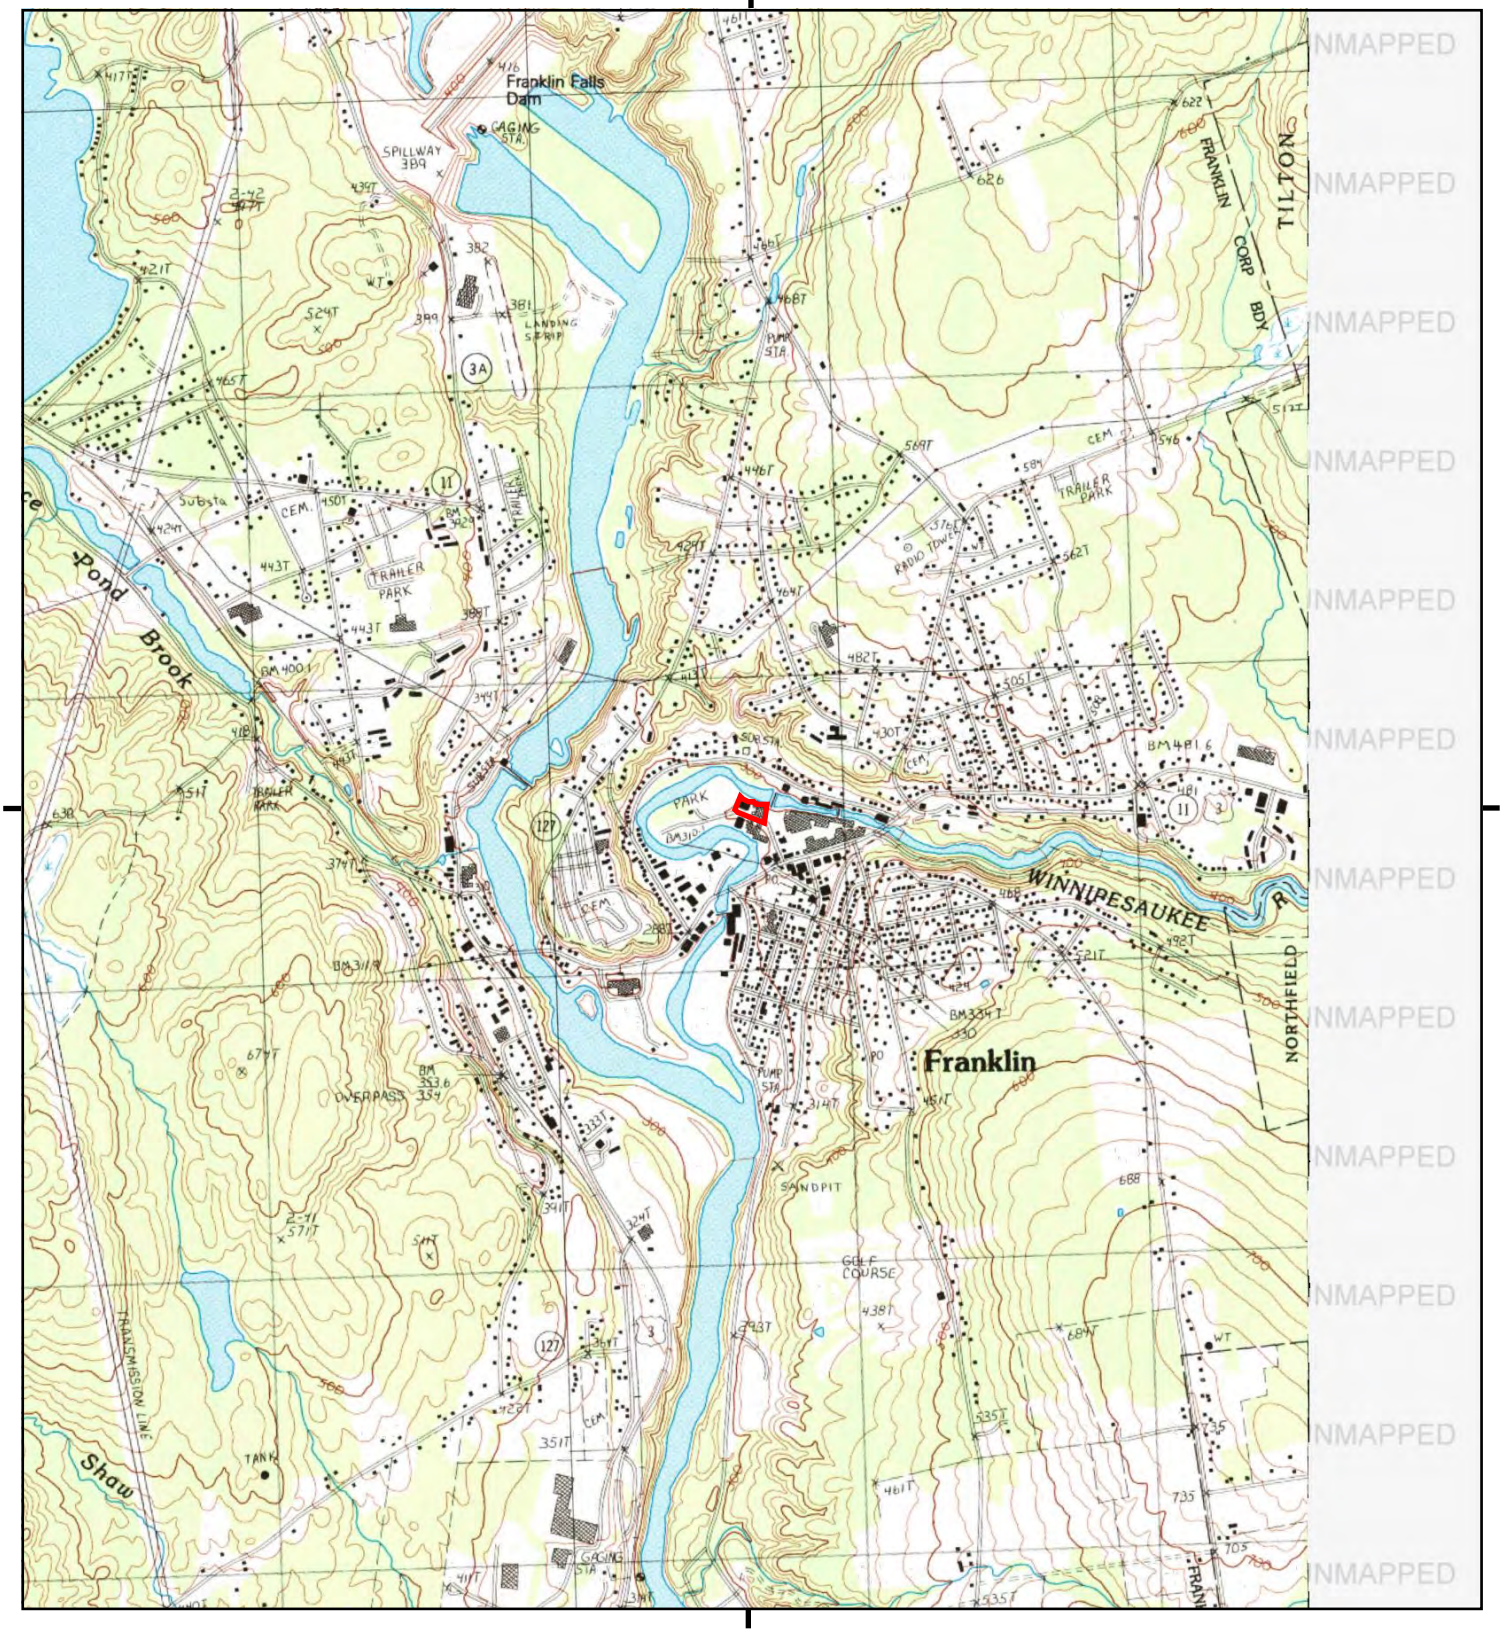

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

NW N NE
W E
SW S SE

TP, Franklin, 2000, 7.5-minute

SITE NAME: Stanley Mill
ADDRESS: 93 Memorial Street
Franklin, NH 03235
CLIENT: Nobis Group

N

Historical Topo Map

1987

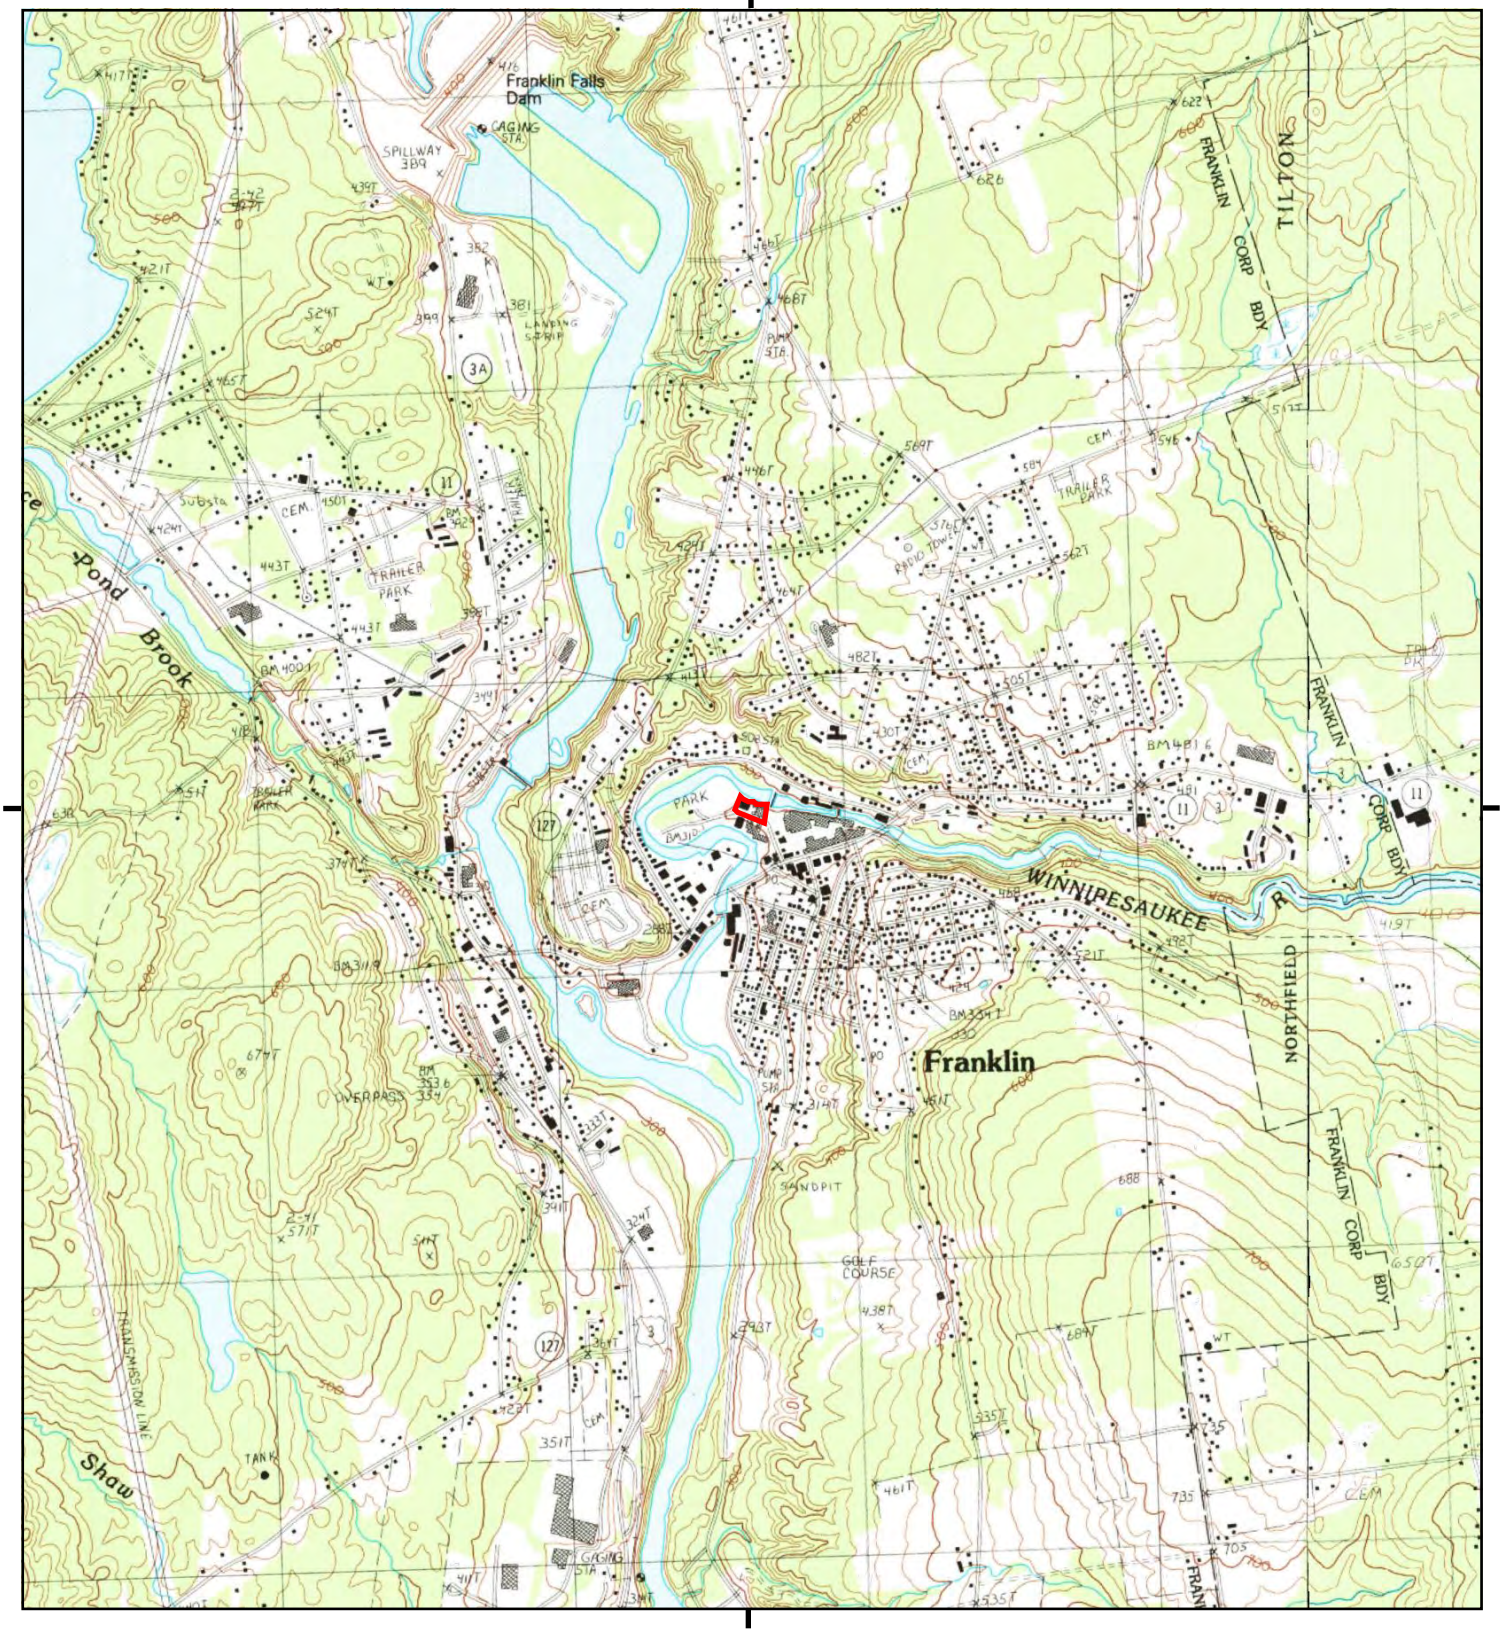

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

NW N NE
W E
SW S SE

TP, Franklin, 1987, 7.5-minute
E, Northfield, 1987, 7.5-minute

SITE NAME: Stanley Mill
ADDRESS: 93 Memorial Street
Franklin, NH 03235
CLIENT: Nobis Group

N

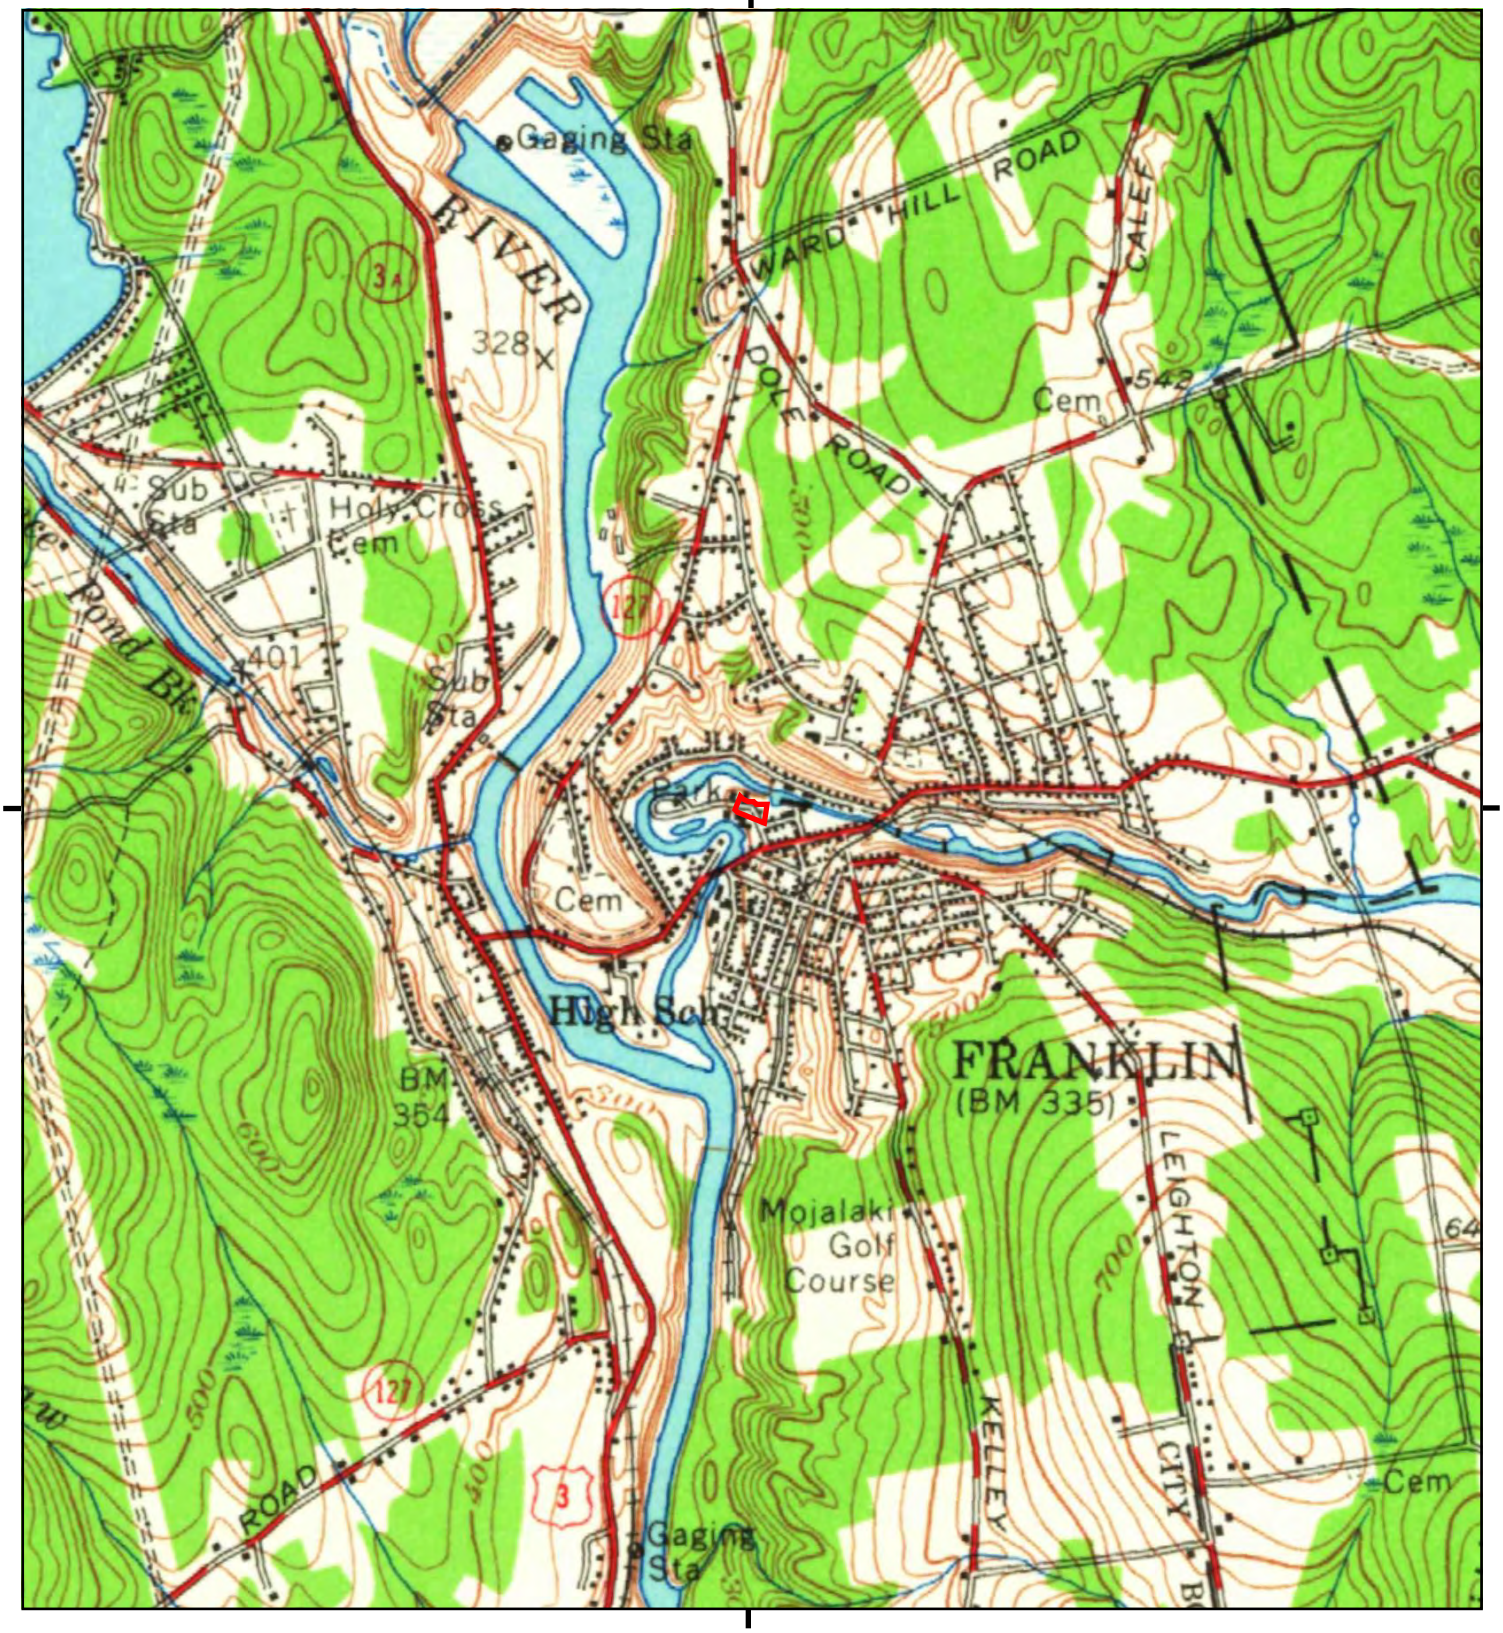

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

NW N NE
W E
SW S SE

TP, Penacook, 1956, 15-minute

SITE NAME: Stanley Mill
ADDRESS: 93 Memorial Street
Franklin, NH 03235
CLIENT: Nobis Group

N

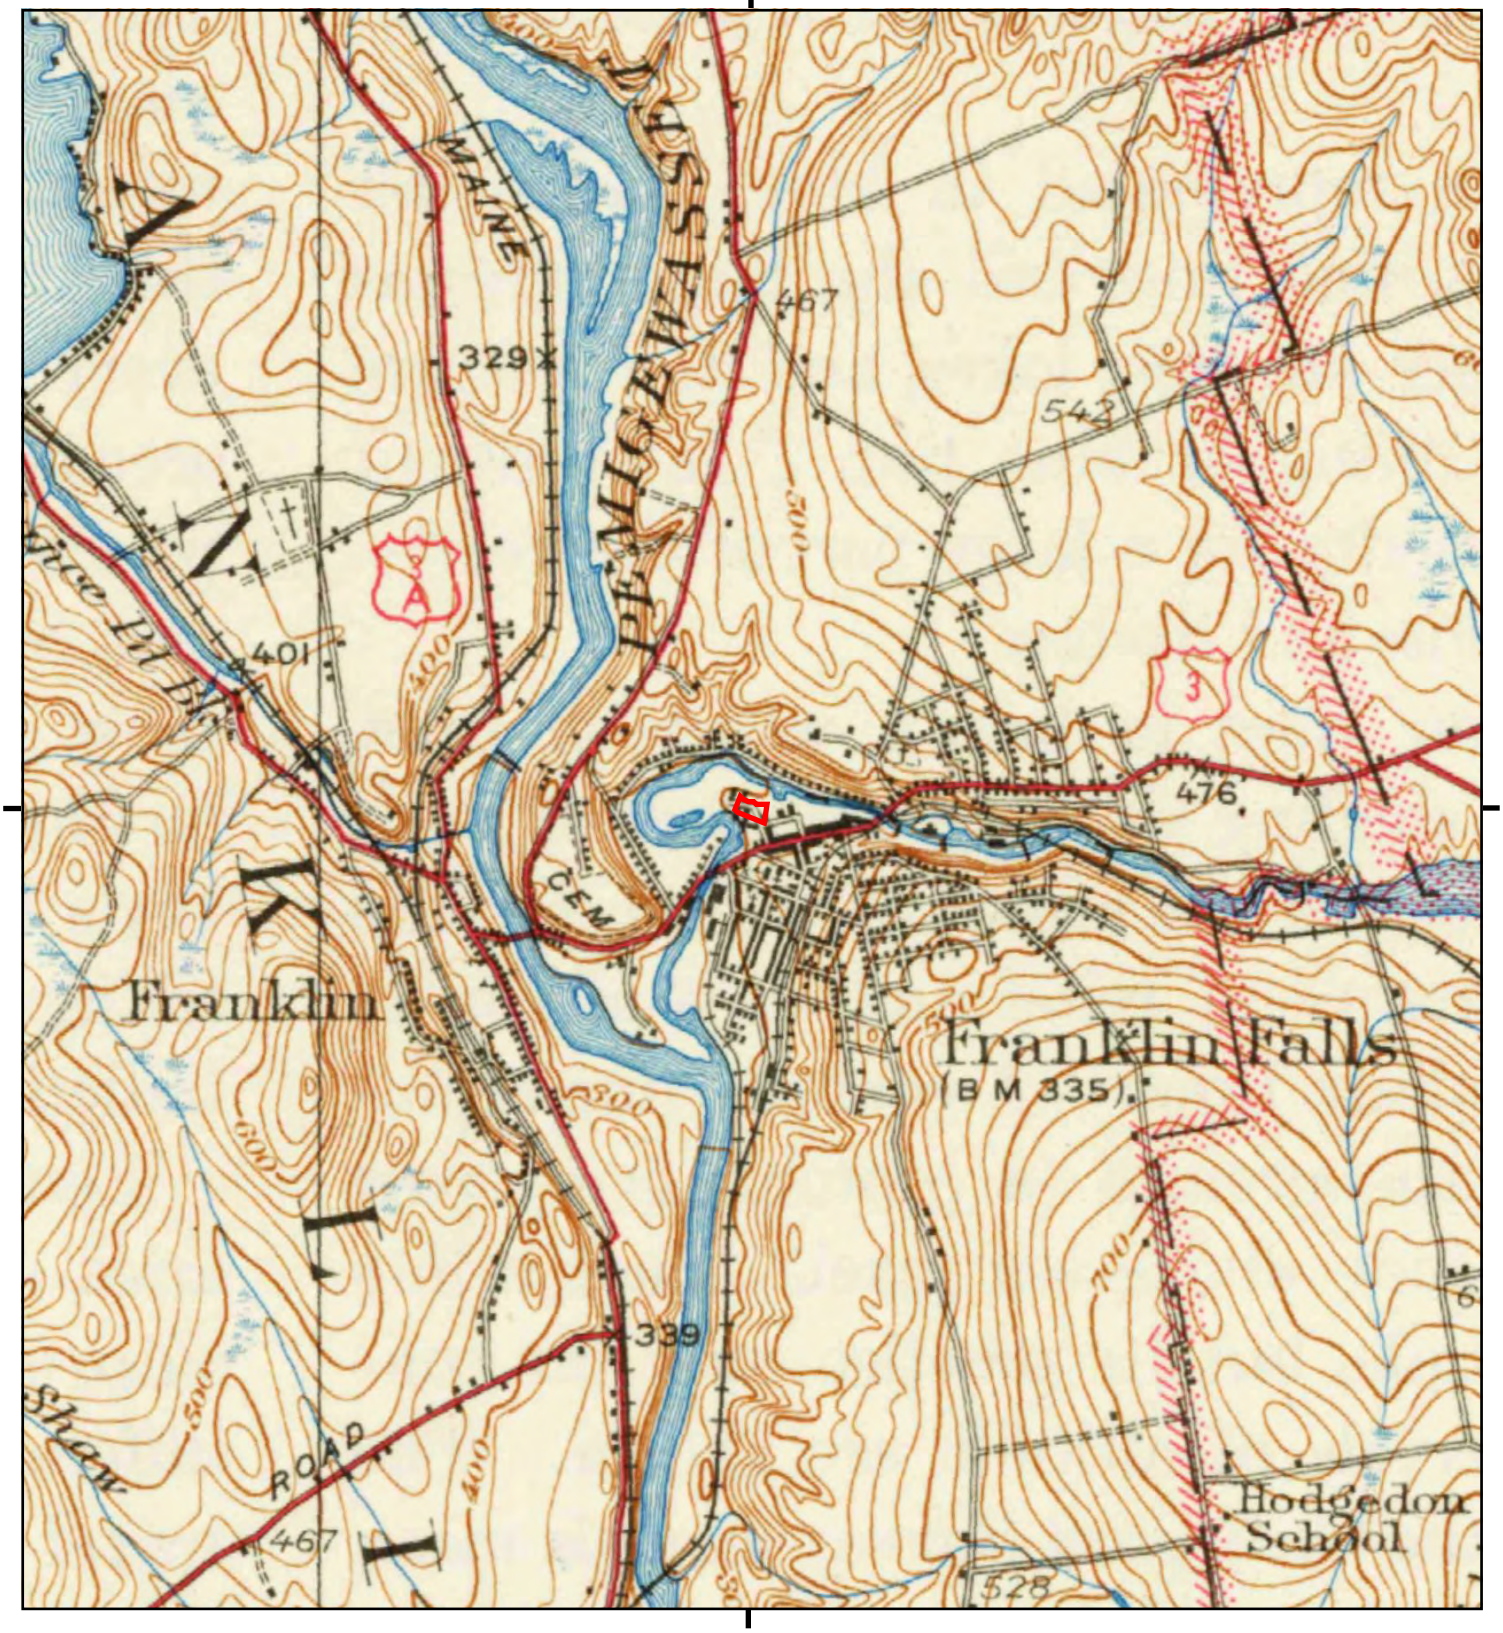

This report includes information from the following map sheet(s).

0 Miles 0.25 0.5 1 1.5

NW N NE
W E
SW S SE

TP, Penacook, 1927, 15-minute

SITE NAME: Stanley Mill
ADDRESS: 93 Memorial Street
Franklin, NH 03235
CLIENT: Nobis Group

N

Stanley Mill
93 Memorial Street
Franklin, NH 03235

Inquiry Number: 7125568.3
September 22, 2022

Certified Sanborn® Map Report

6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

09/22/22

Site Name:

Stanley Mill
93 Memorial Street
Franklin, NH 03235
EDR Inquiry # 7125568.3

Client Name:

Nobis Group
18 Chenell Drive
Concord, NH 03301
Contact: Karina Zawilinski

The Sanborn Library has been searched by EDR and maps covering the target property location as provided by Nobis Group were identified for the years listed below. The Sanborn Library is the largest, most complete collection of fire insurance maps. The collection includes maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow, and others. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by the Sanborn Library LLC, the copyright holder for the collection. Results can be authenticated by visiting www.edrnet.com/sanborn.

The Sanborn Library is continually enhanced with newly identified map archives. This report accesses all maps in the collection as of the day this report was generated.

Certified Sanborn Results:

Certification # 6FDC-4988-BF2E

PO # 100400.000

Project Stanley Mill

Maps Provided:

1964
1948
1929
1923
1911
1902
1897
1892
1884

Sanborn® Library search results

Certification #: 6FDC-4988-BF2E

The Sanborn Library includes more than 1.2 million fire insurance maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow and others which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- ☑ Library of Congress
- ☑ University Publications of America
- ☑ EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

Nobis Group (the client) is permitted to make up to FIVE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2022 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.

1964 Source Sheets

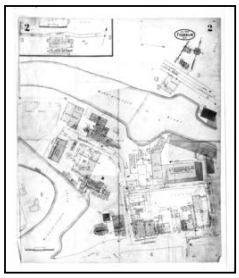

Volume 1, Sheet 2
1964

Volume 1, Sheet 13
1964

1948 Source Sheets

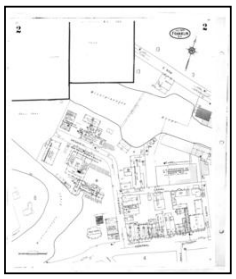

Volume 1, Sheet 2
1948

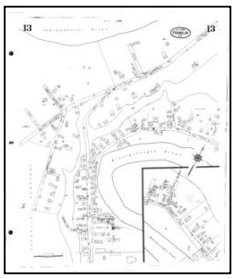

Volume 1, Sheet 13
1948

1929 Source Sheets

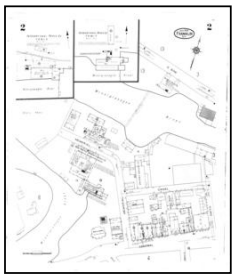

Volume 1, Sheet 2
1929

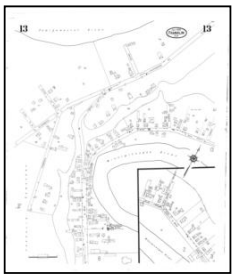

Volume 1, Sheet 13
1929

1923 Source Sheets

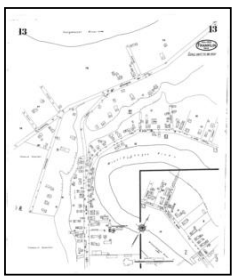

Volume 1, Sheet 13
1923

Volume 1, Sheet 2
1923

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.

1911 Source Sheets

Volume 1, Sheet 4
1911

1902 Source Sheets

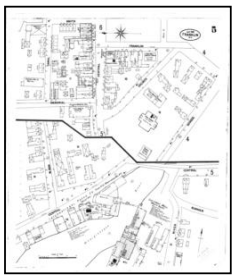

Volume 1, Sheet 5
1902

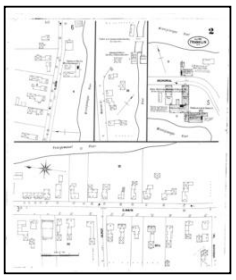

Volume 1, Sheet 2
1902

1897 Source Sheets

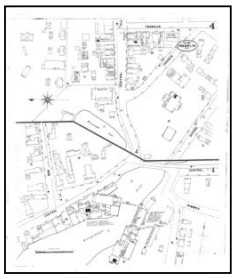

Volume 1, Sheet 4
1897

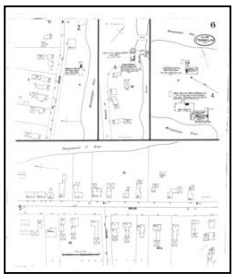

Volume 1, Sheet 6
1897

1892 Source Sheets

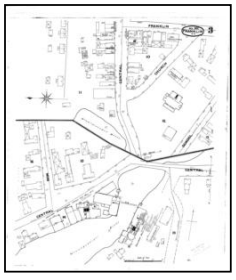

Volume 1, Sheet 3
1892

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.

1884 Source Sheets

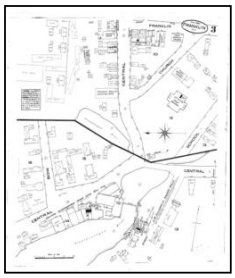

Volume 1, Sheet 3
1884

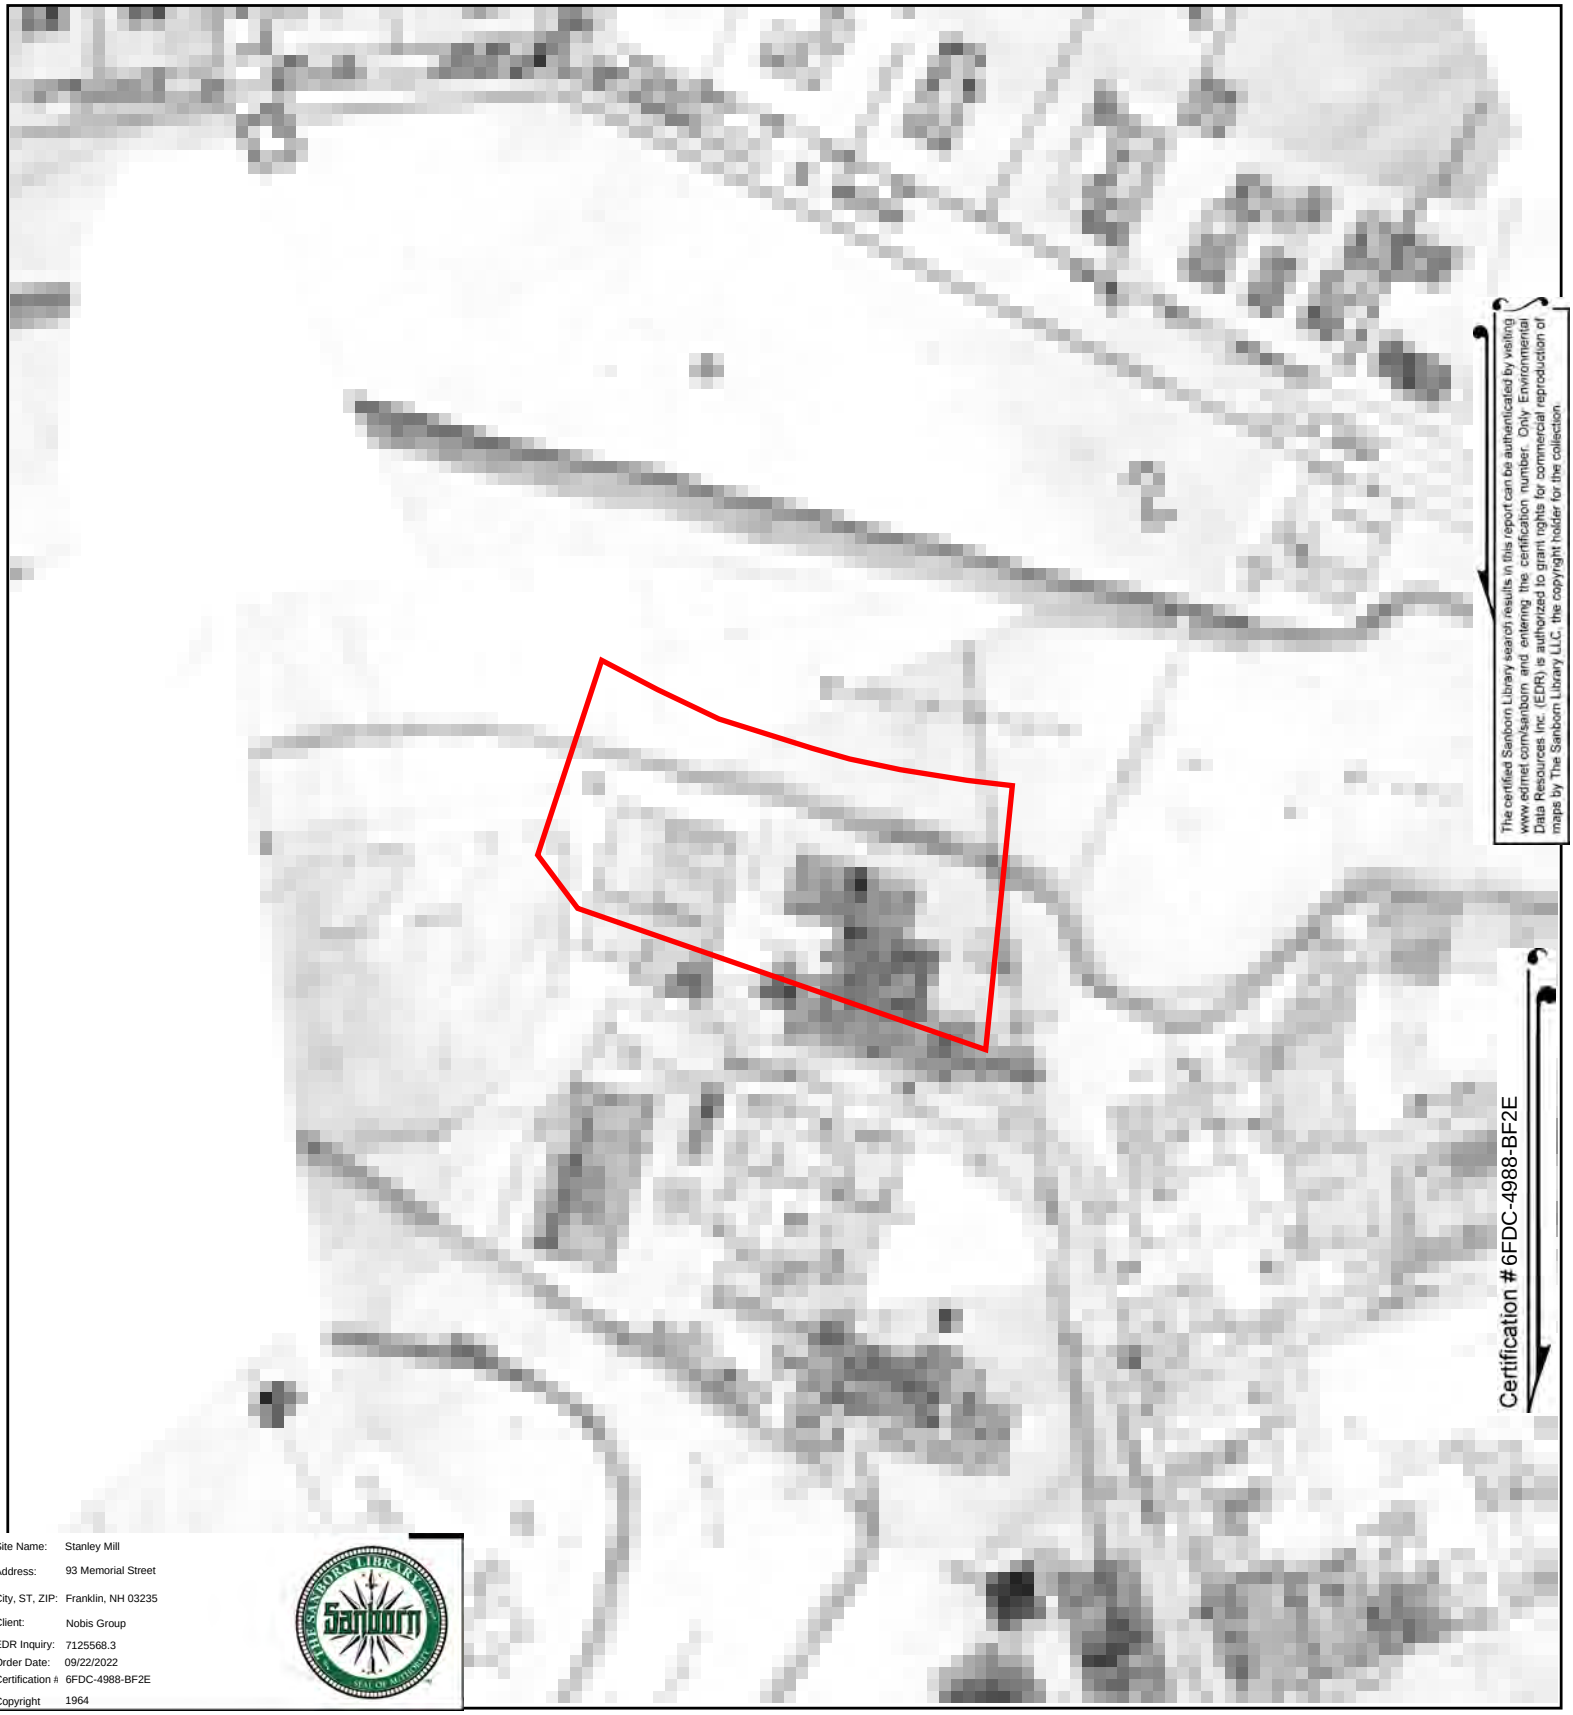

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #6FDC-4988-BF2E

Site Name:	Stanley Mill
Address:	93 Memorial Street
City, ST, ZIP:	Franklin, NH 03235
Client:	Nobis Group
EDR Inquiry:	7125568.3
Order Date:	09/22/2022
Certification #	6FDC-4988-BF2E
Copyright	1964

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 150 300 600

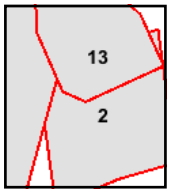

Volume 1, Sheet 13
Volume 1, Sheet 2

N

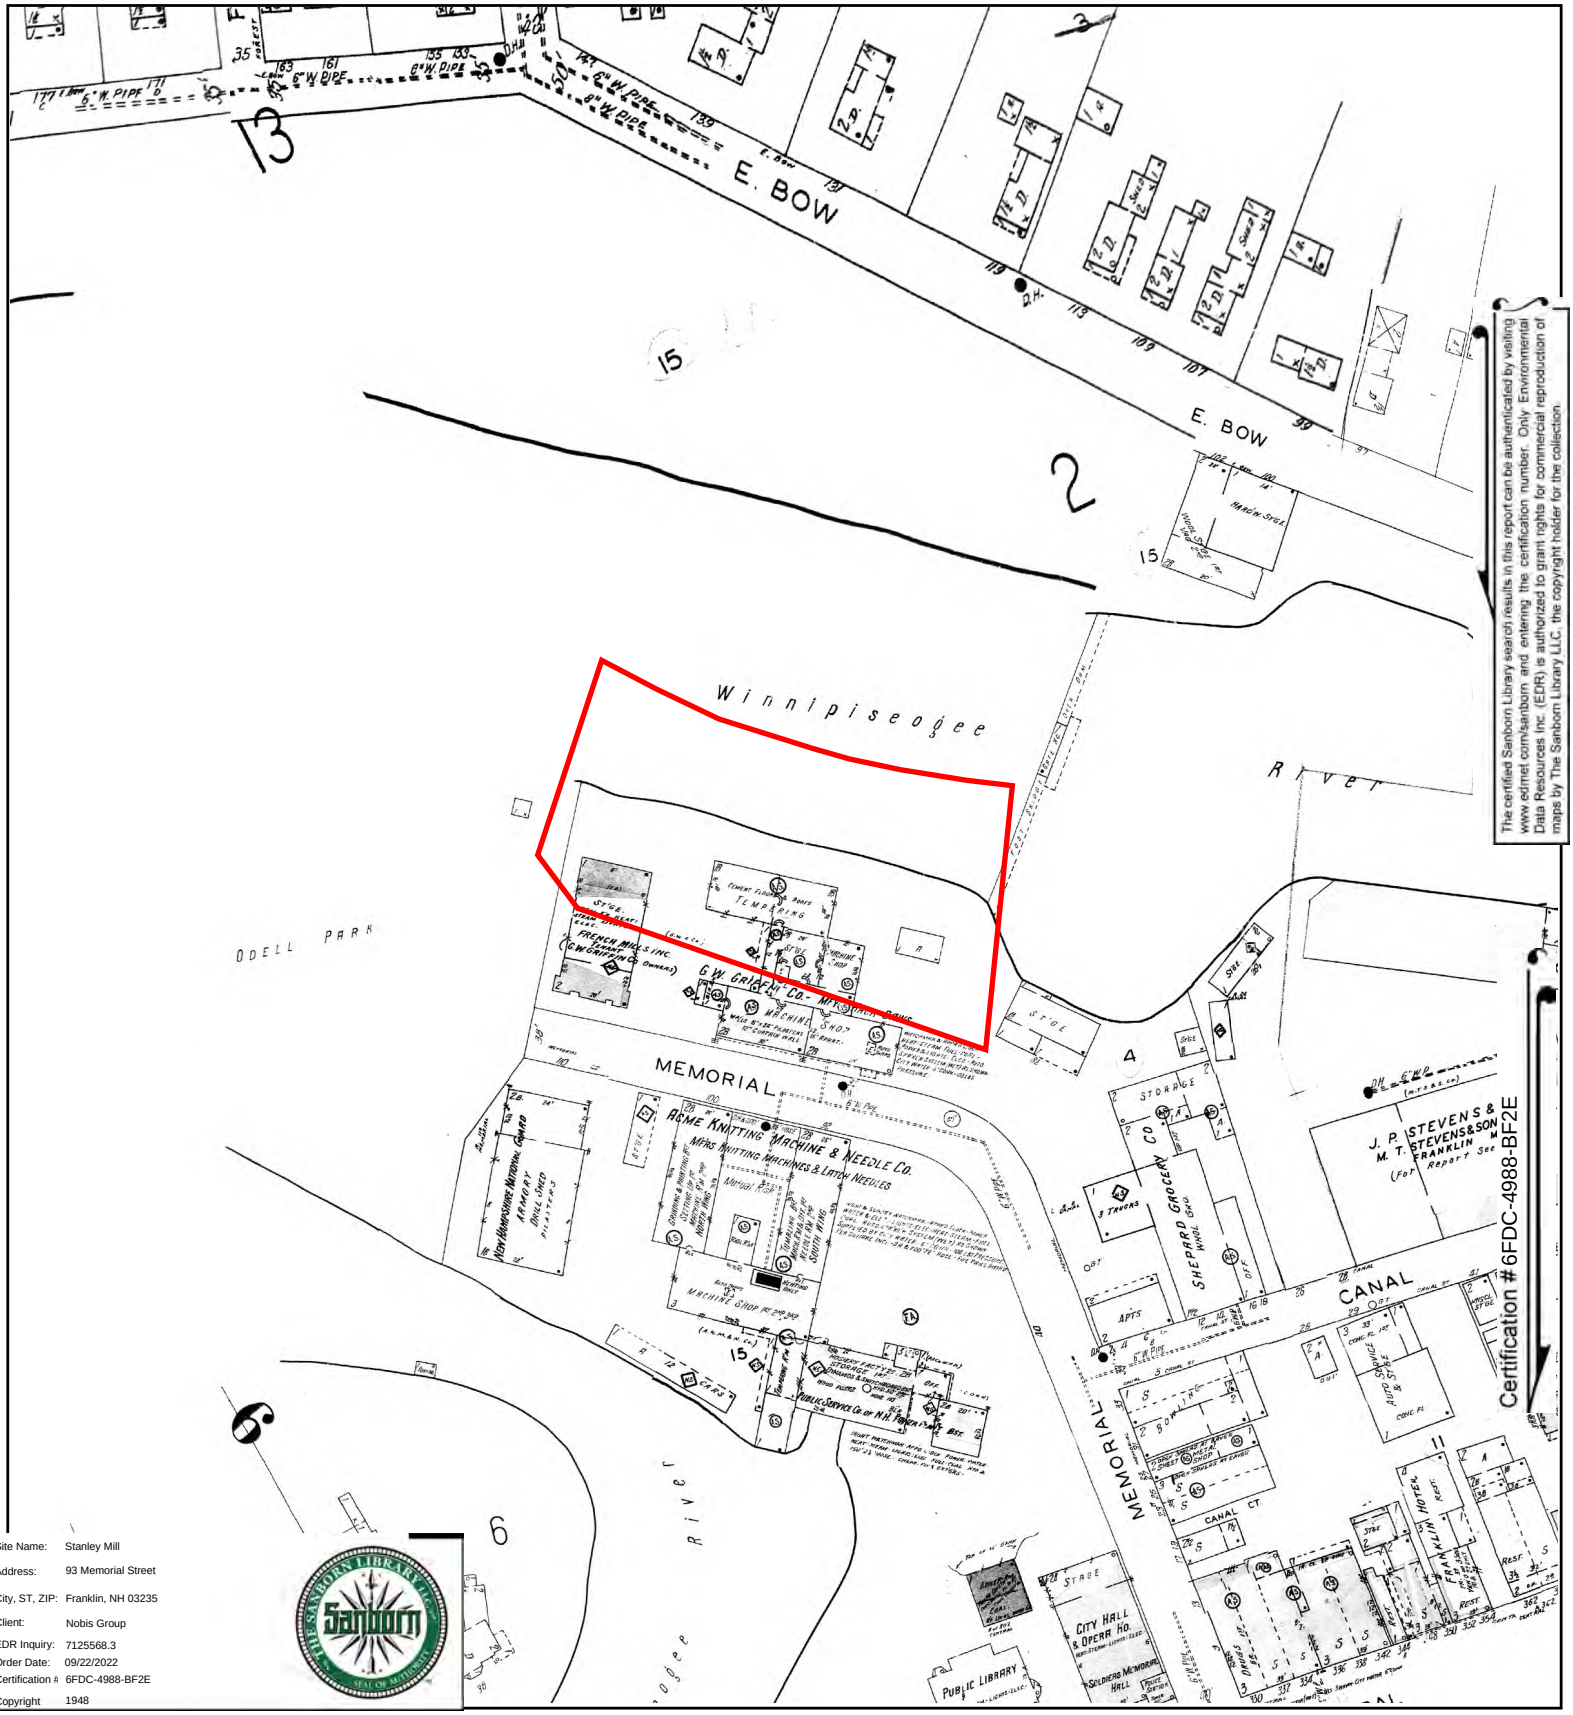

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Stanley Mill
Address:	93 Memorial Street
City, ST, ZIP:	Franklin, NH 03235
Client:	Nobis Group
EDR Inquiry:	7125568.3
Order Date:	09/22/2022
Certification #	6FDC-4988-BF2E
Copyright	1948

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 150 300 600

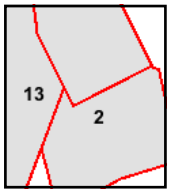

Volume 1, Sheet 13
Volume 1, Sheet 2

N

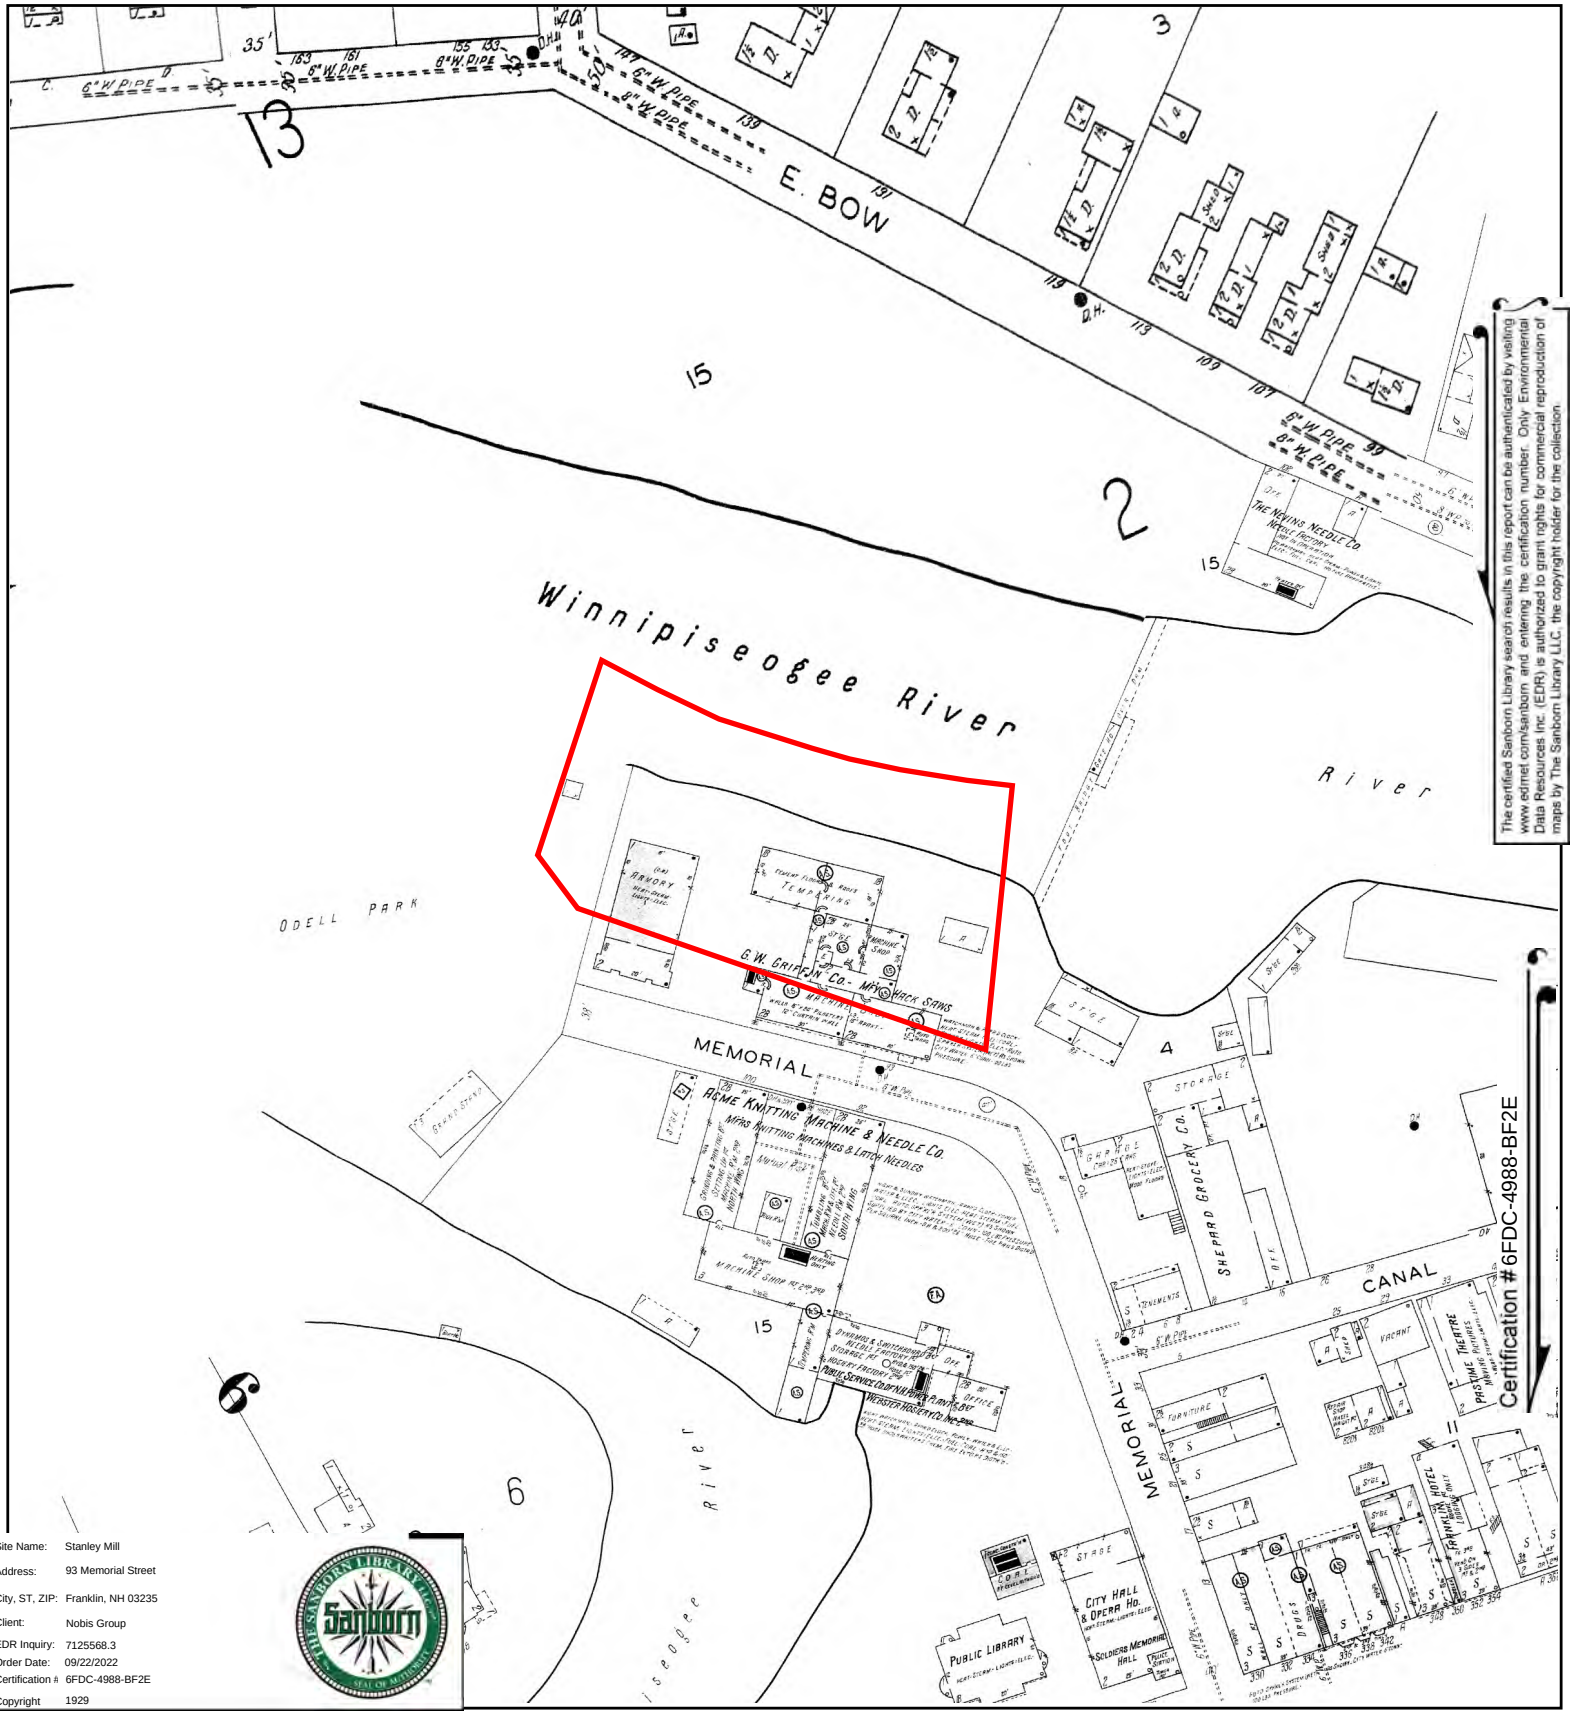

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #6FDC-4988-BF2E

Site Name:	Stanley Mill
Address:	93 Memorial Street
City, ST, ZIP:	Franklin, NH 03235
Client:	Nobis Group
EDR Inquiry:	7125568.3
Order Date:	09/22/2022
Certification #	6FDC-4988-BF2E
Copyright	1929

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 150 300 600

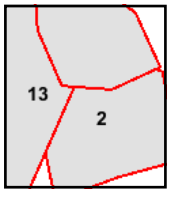

Volume 1, Sheet 13
Volume 1, Sheet 2

N

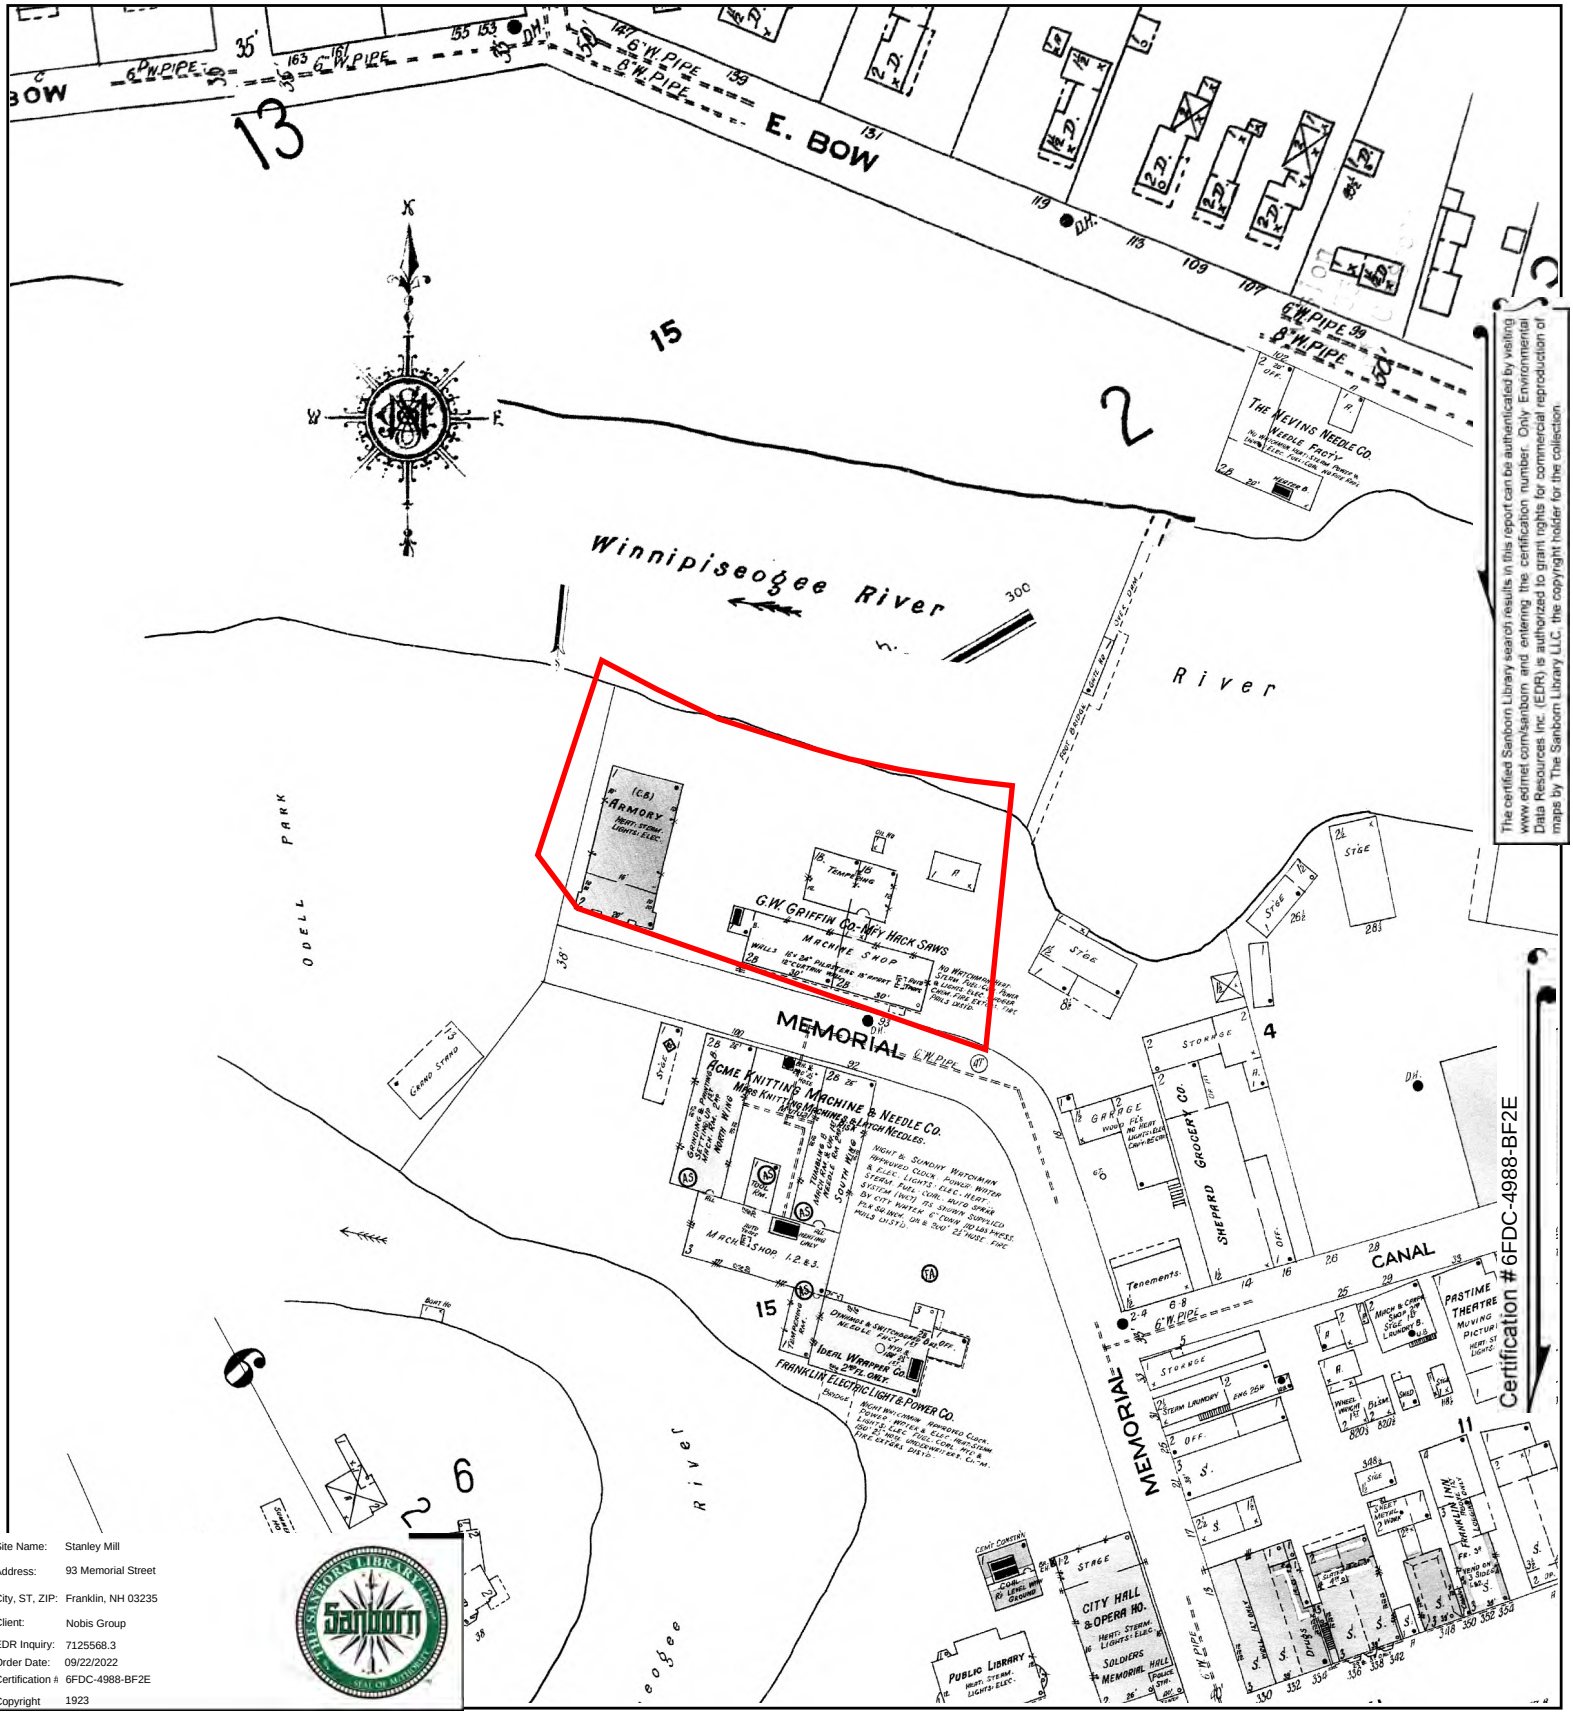

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Stanley Mill
Address:	93 Memorial Street
City, ST, ZIP:	Franklin, NH 03235
Client:	Nobis Group
EDR Inquiry:	7125568.3
Order Date:	09/22/2022
Certification #	6FDC-4988-BF2E
Copyright	1923

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

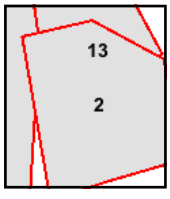

Volume 1, Sheet 2
Volume 1, Sheet 13

0 Feet 150 300 600

N

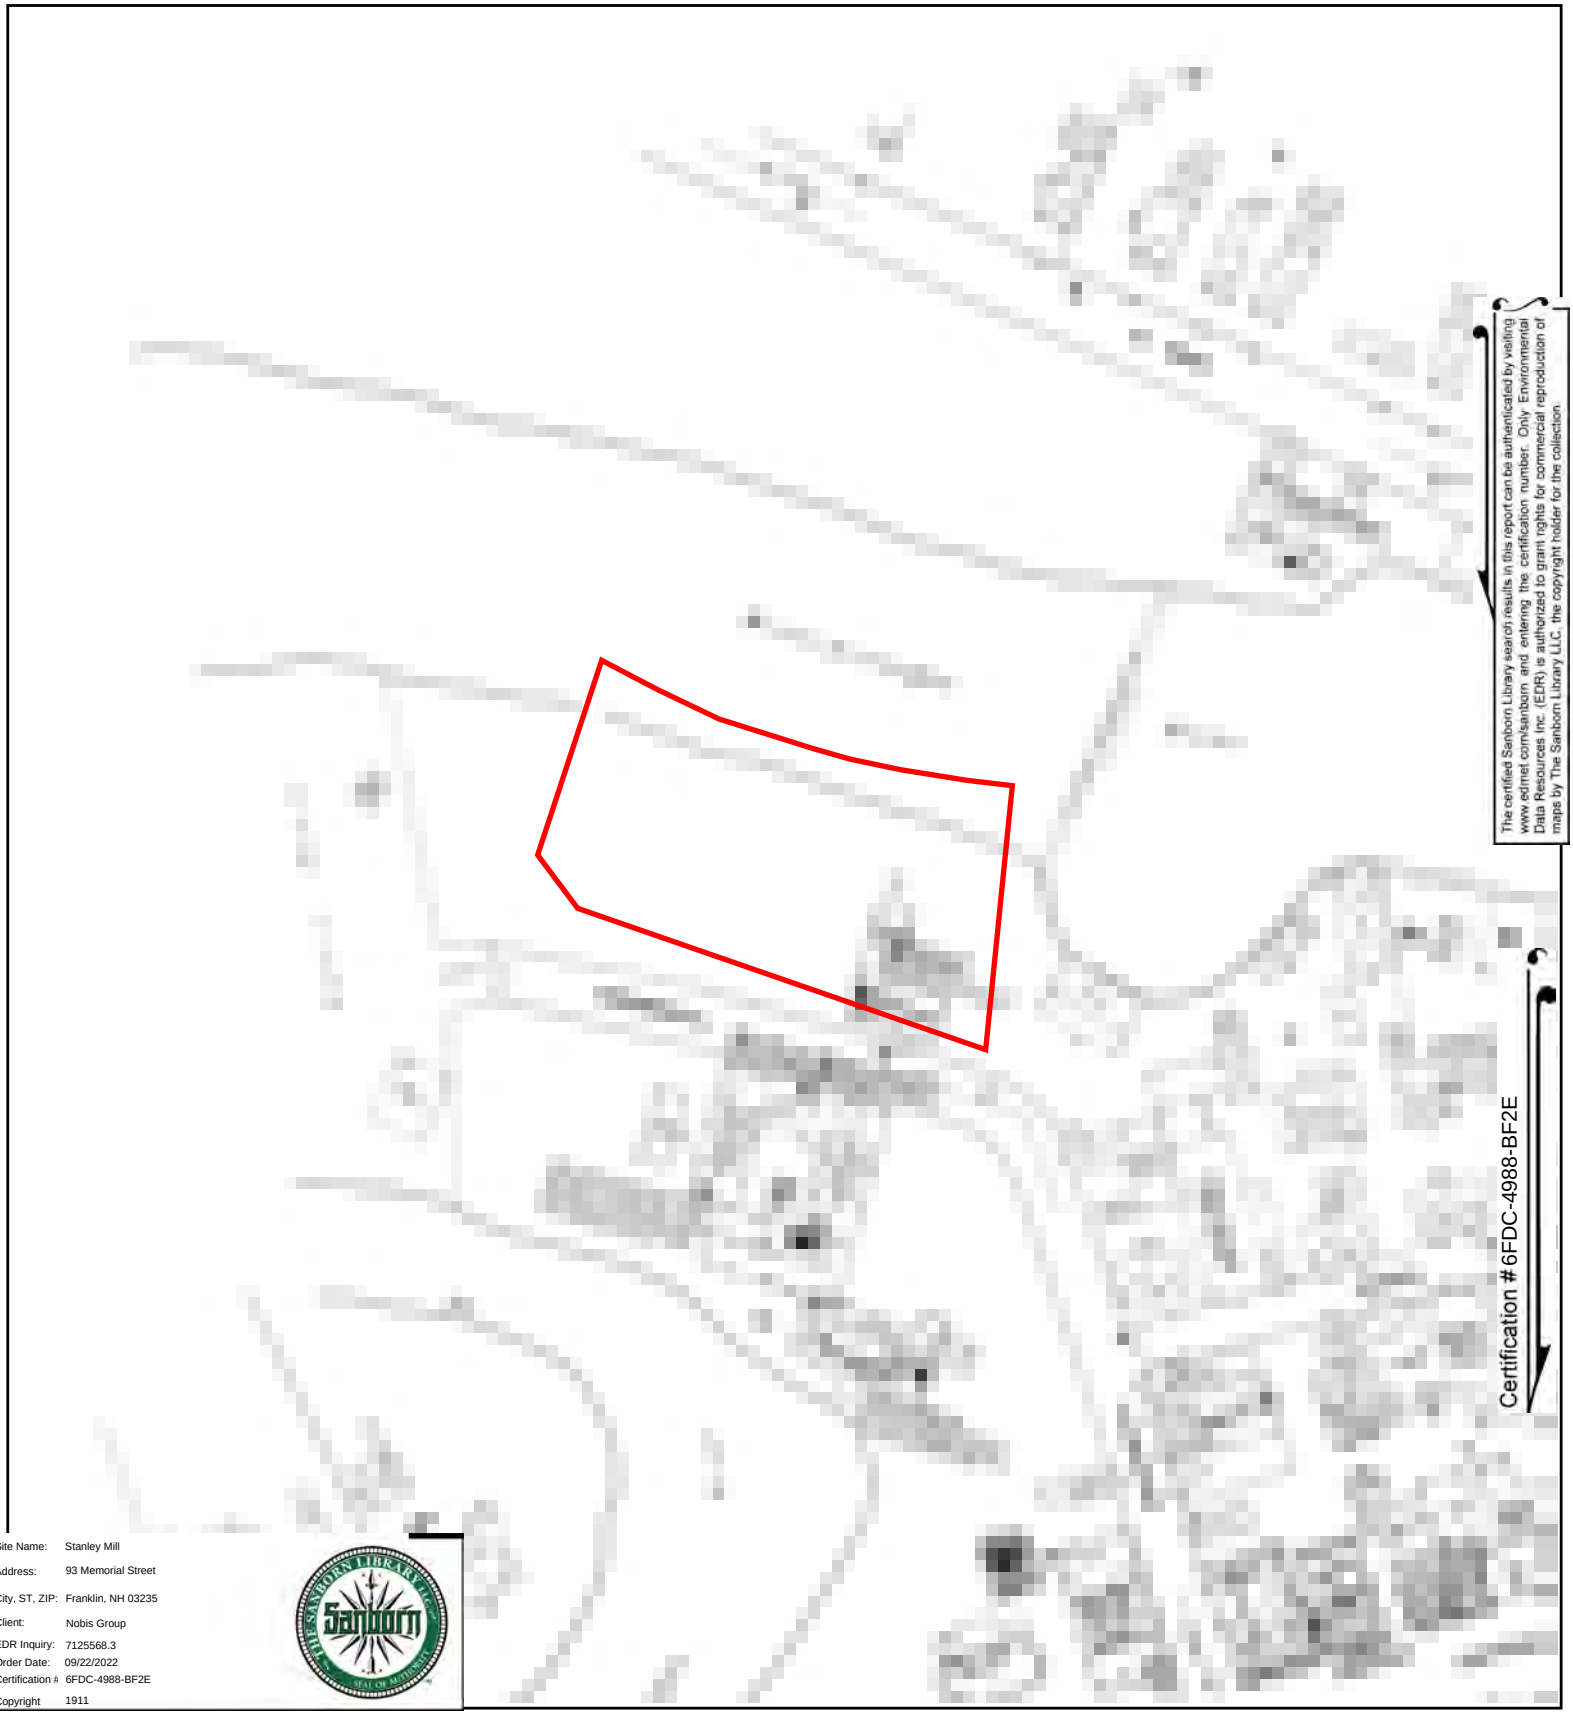

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 6FDC-4988-BF2E

Site Name:	Stanley Mill
Address:	93 Memorial Street
City, ST, ZIP:	Franklin, NH 03235
Client:	Nobis Group
EDR Inquiry:	7125568.3
Order Date:	09/22/2022
Certification #	6FDC-4988-BF2E
Copyright	1911

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 150 300 600

Volume 1, Sheet 4

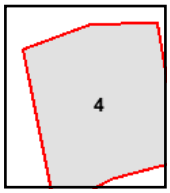

N

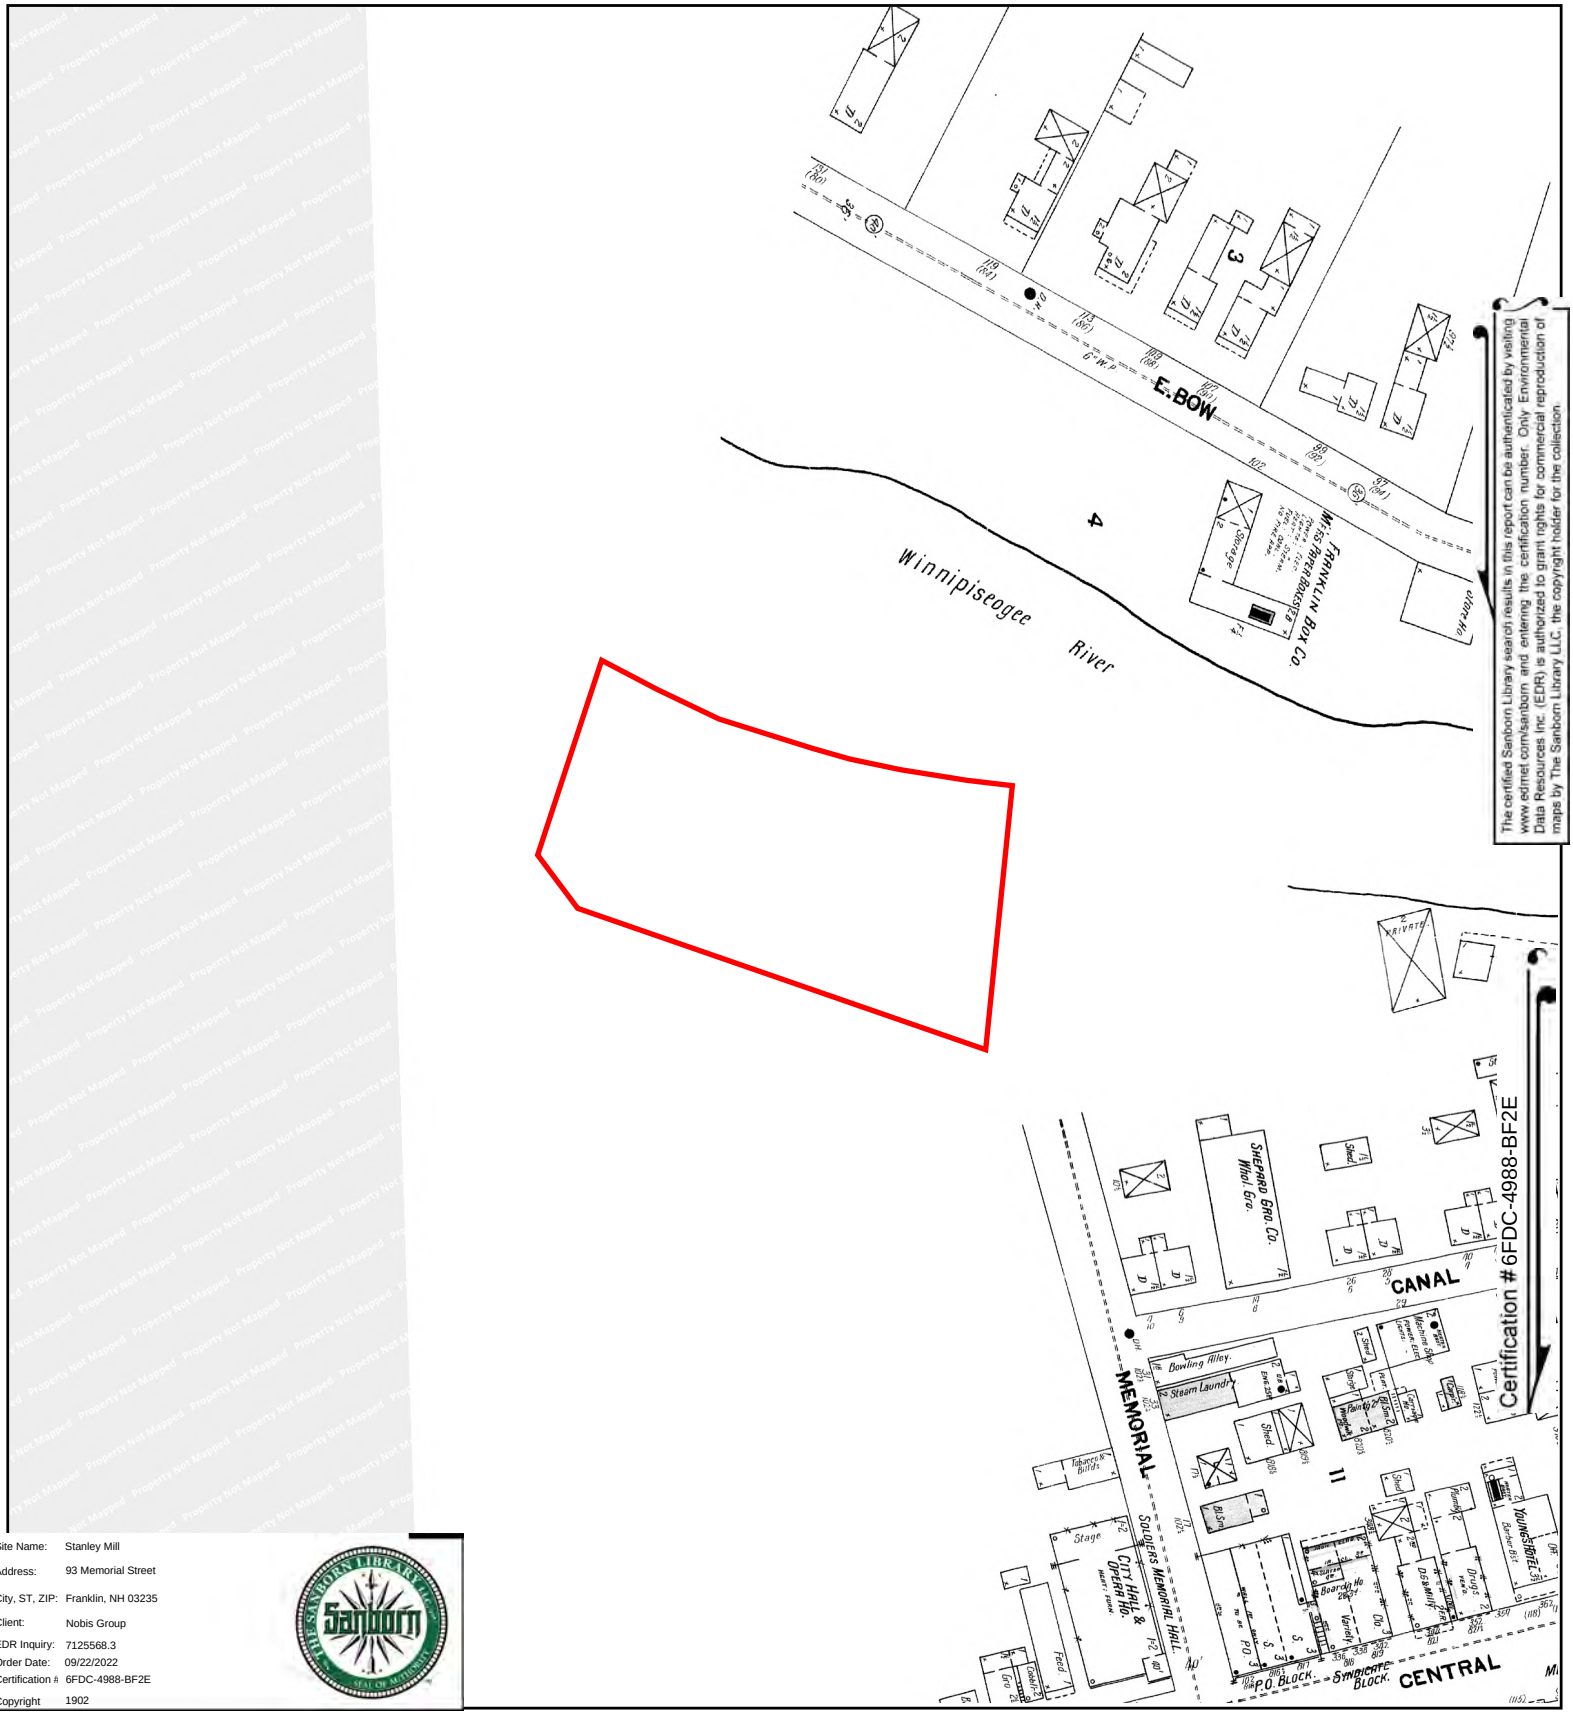

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Stanley Mill
Address:	93 Memorial Street
City, ST, ZIP:	Franklin, NH 03235
Client:	Nobis Group
EDR Inquiry:	7125568.3
Order Date:	09/22/2022
Certification #:	6FDC-4988-BF2E
Copyright	1902

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

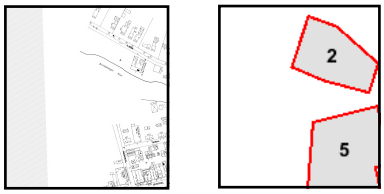

Volume 1, Sheet 2
Volume 1, Sheet 5

0 Feet 150 300 600

N

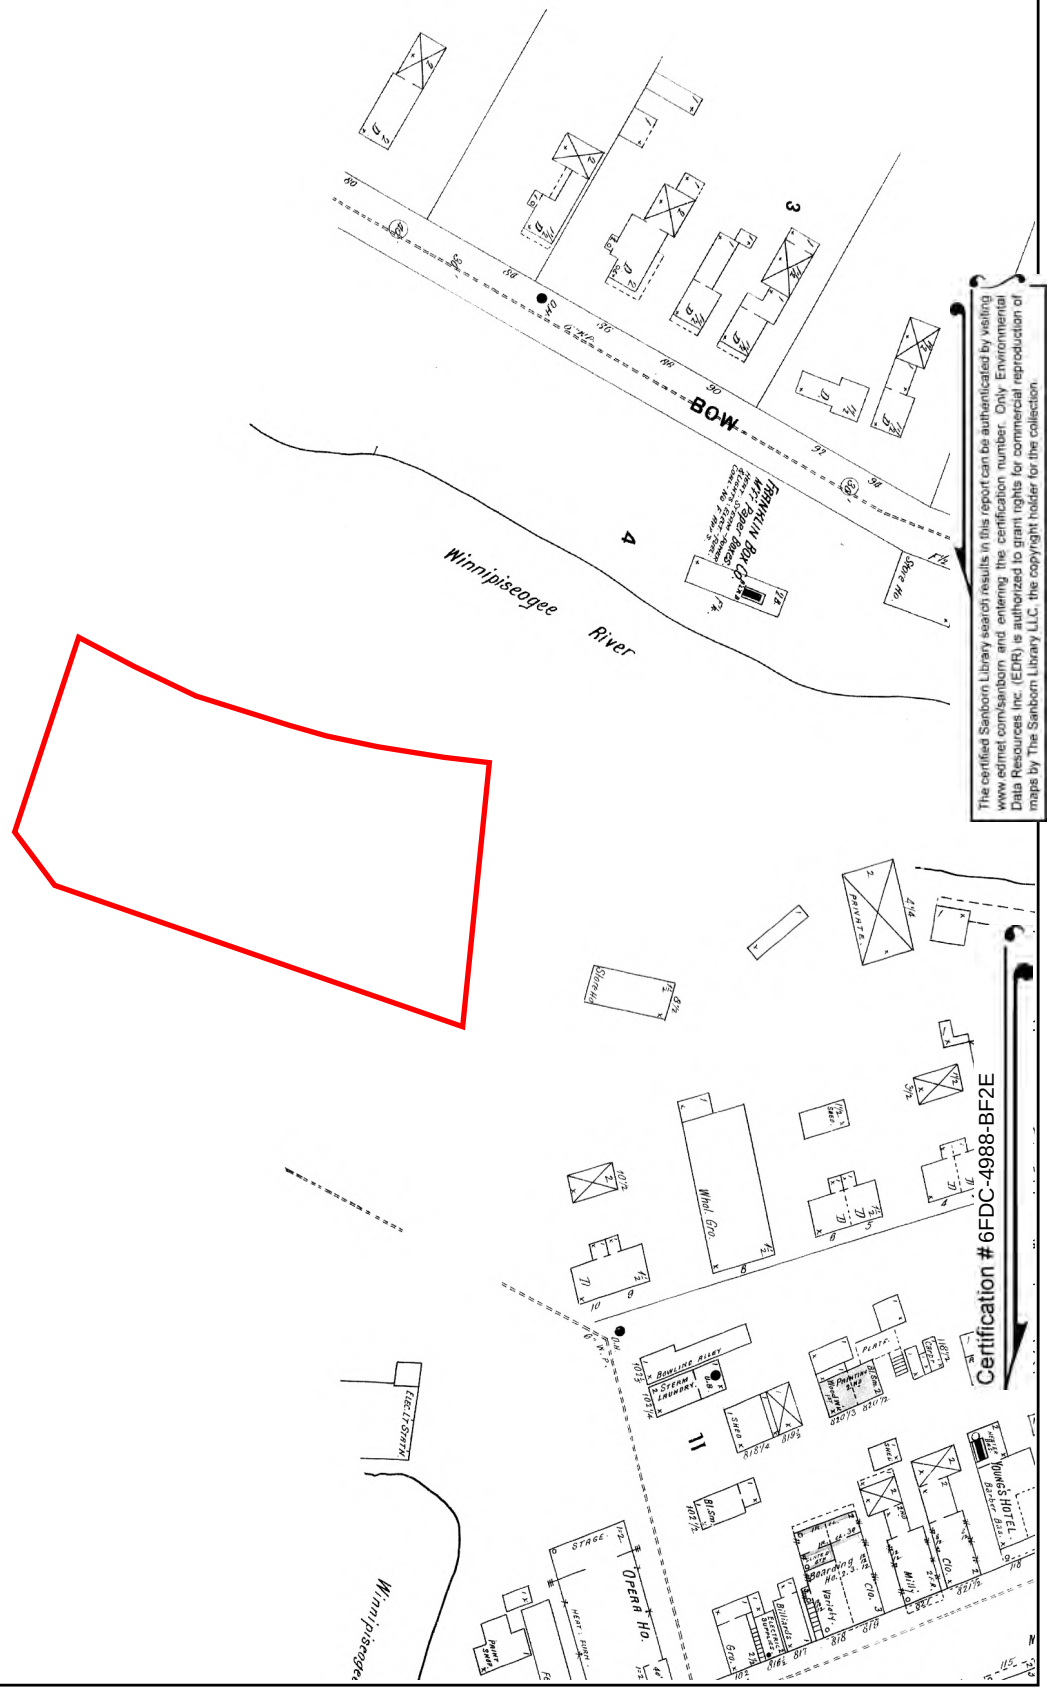

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Site Name:	Stanley Mill
Address:	93 Memorial Street
City, ST, ZIP:	Franklin, NH 03235
Client:	Nobis Group
EDR Inquiry:	7125568.3
Order Date:	09/22/2022
Certification #	6FDC-4988-BF2E
Copyright	1897

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

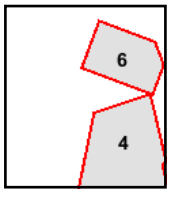

Volume 1, Sheet 6
Volume 1, Sheet 4

0 Feet 150 300 600

N

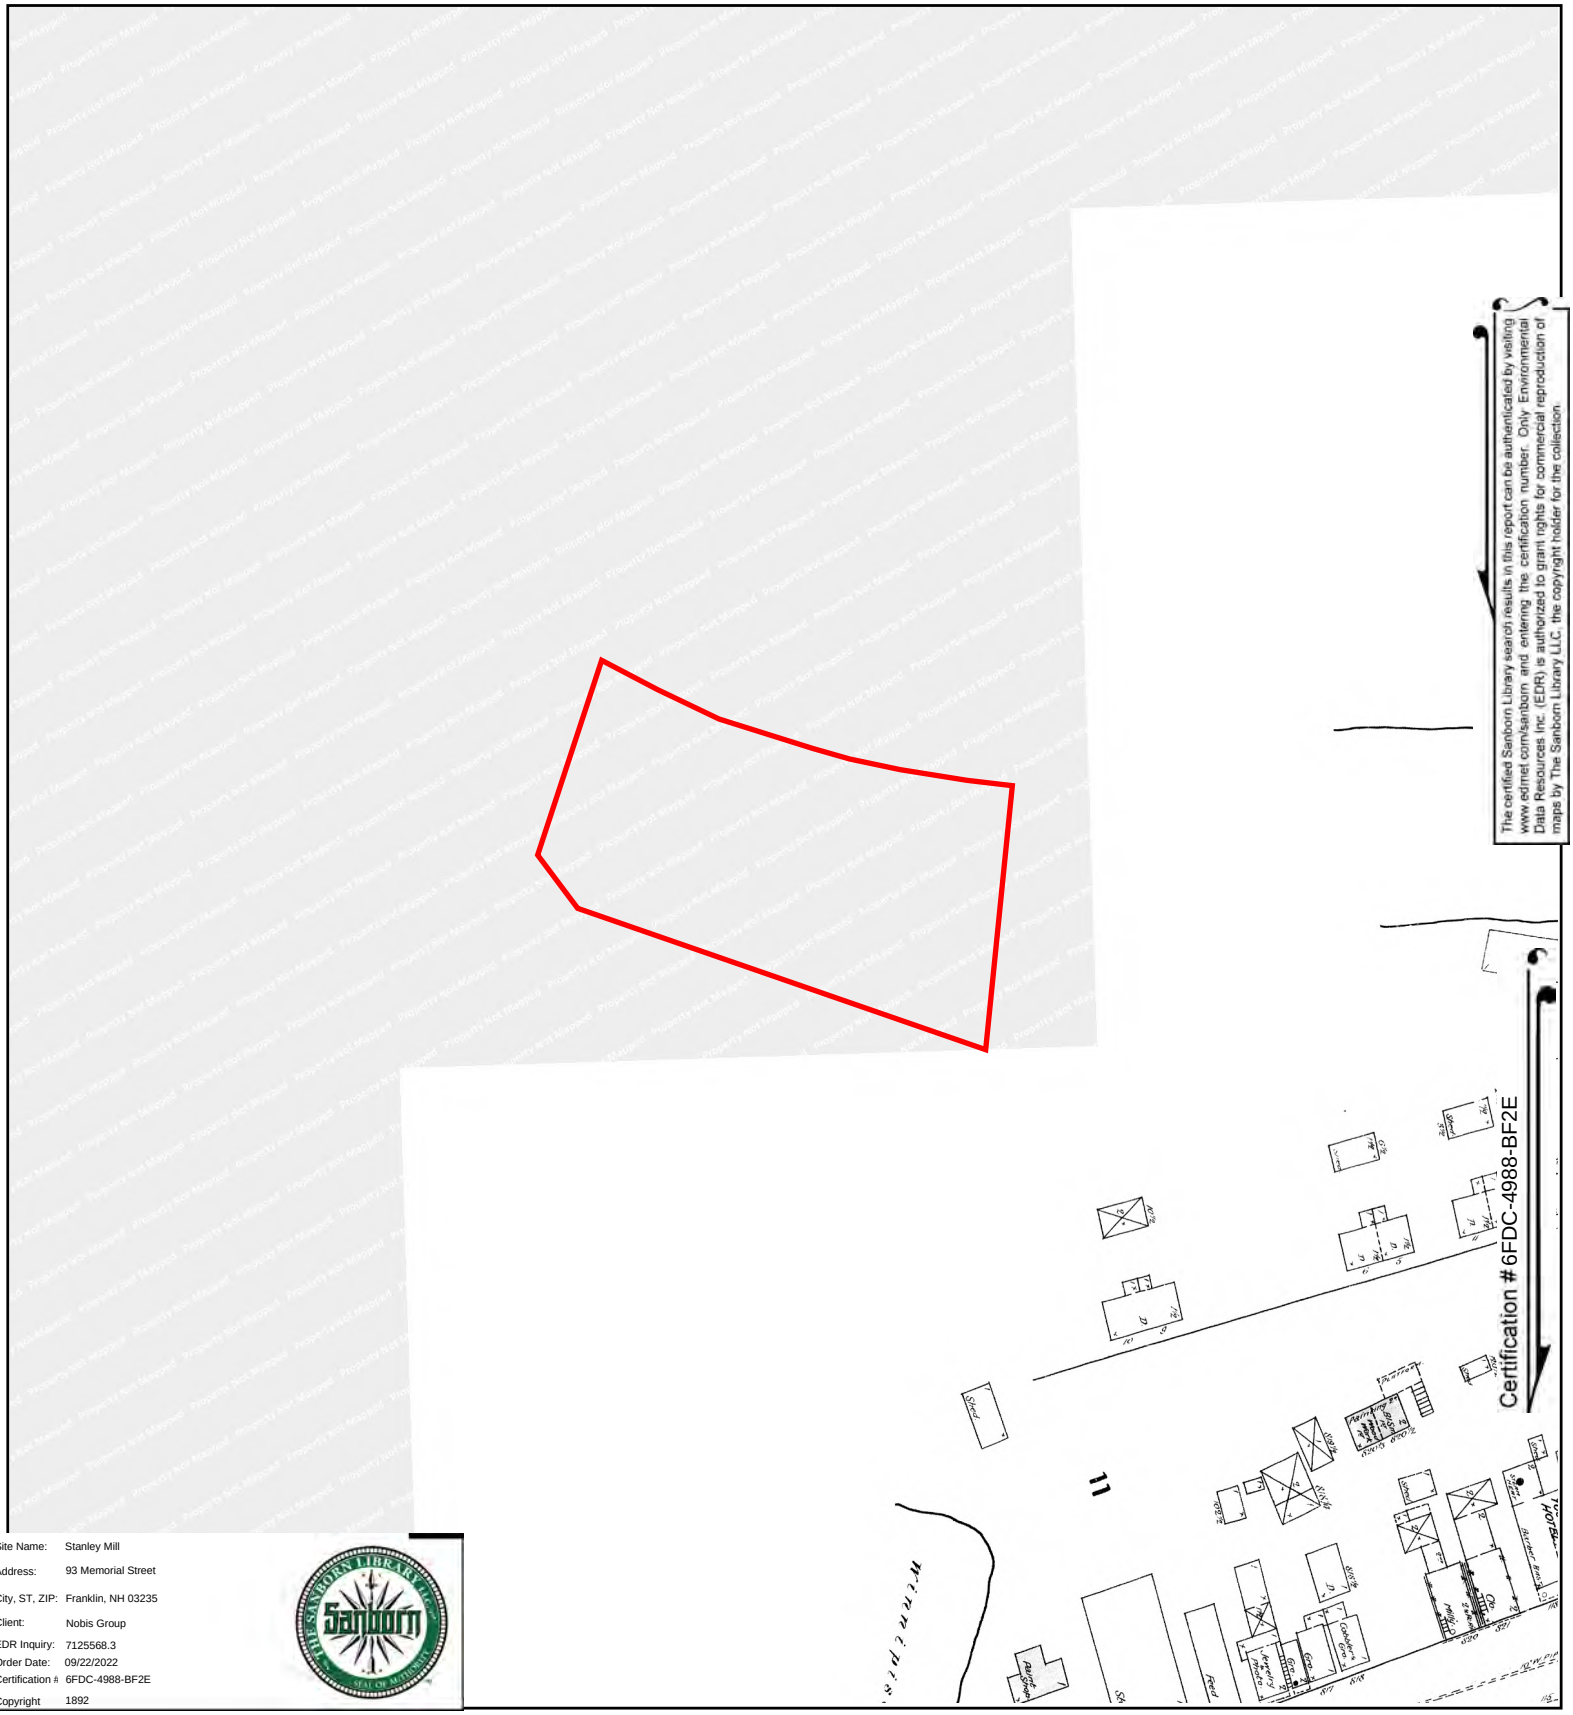

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #6FDC-4988-BF2E

Site Name:	Stanley Mill
Address:	93 Memorial Street
City, ST, ZIP:	Franklin, NH 03235
Client:	Nobis Group
EDR Inquiry:	7125568.3
Order Date:	09/22/2022
Certification #	6FDC-4988-BF2E
Copyright	1892

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

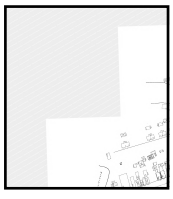

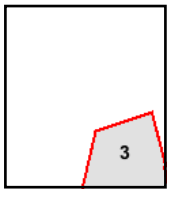

Volume 1, Sheet 3

0 Feet 150 300 600

N

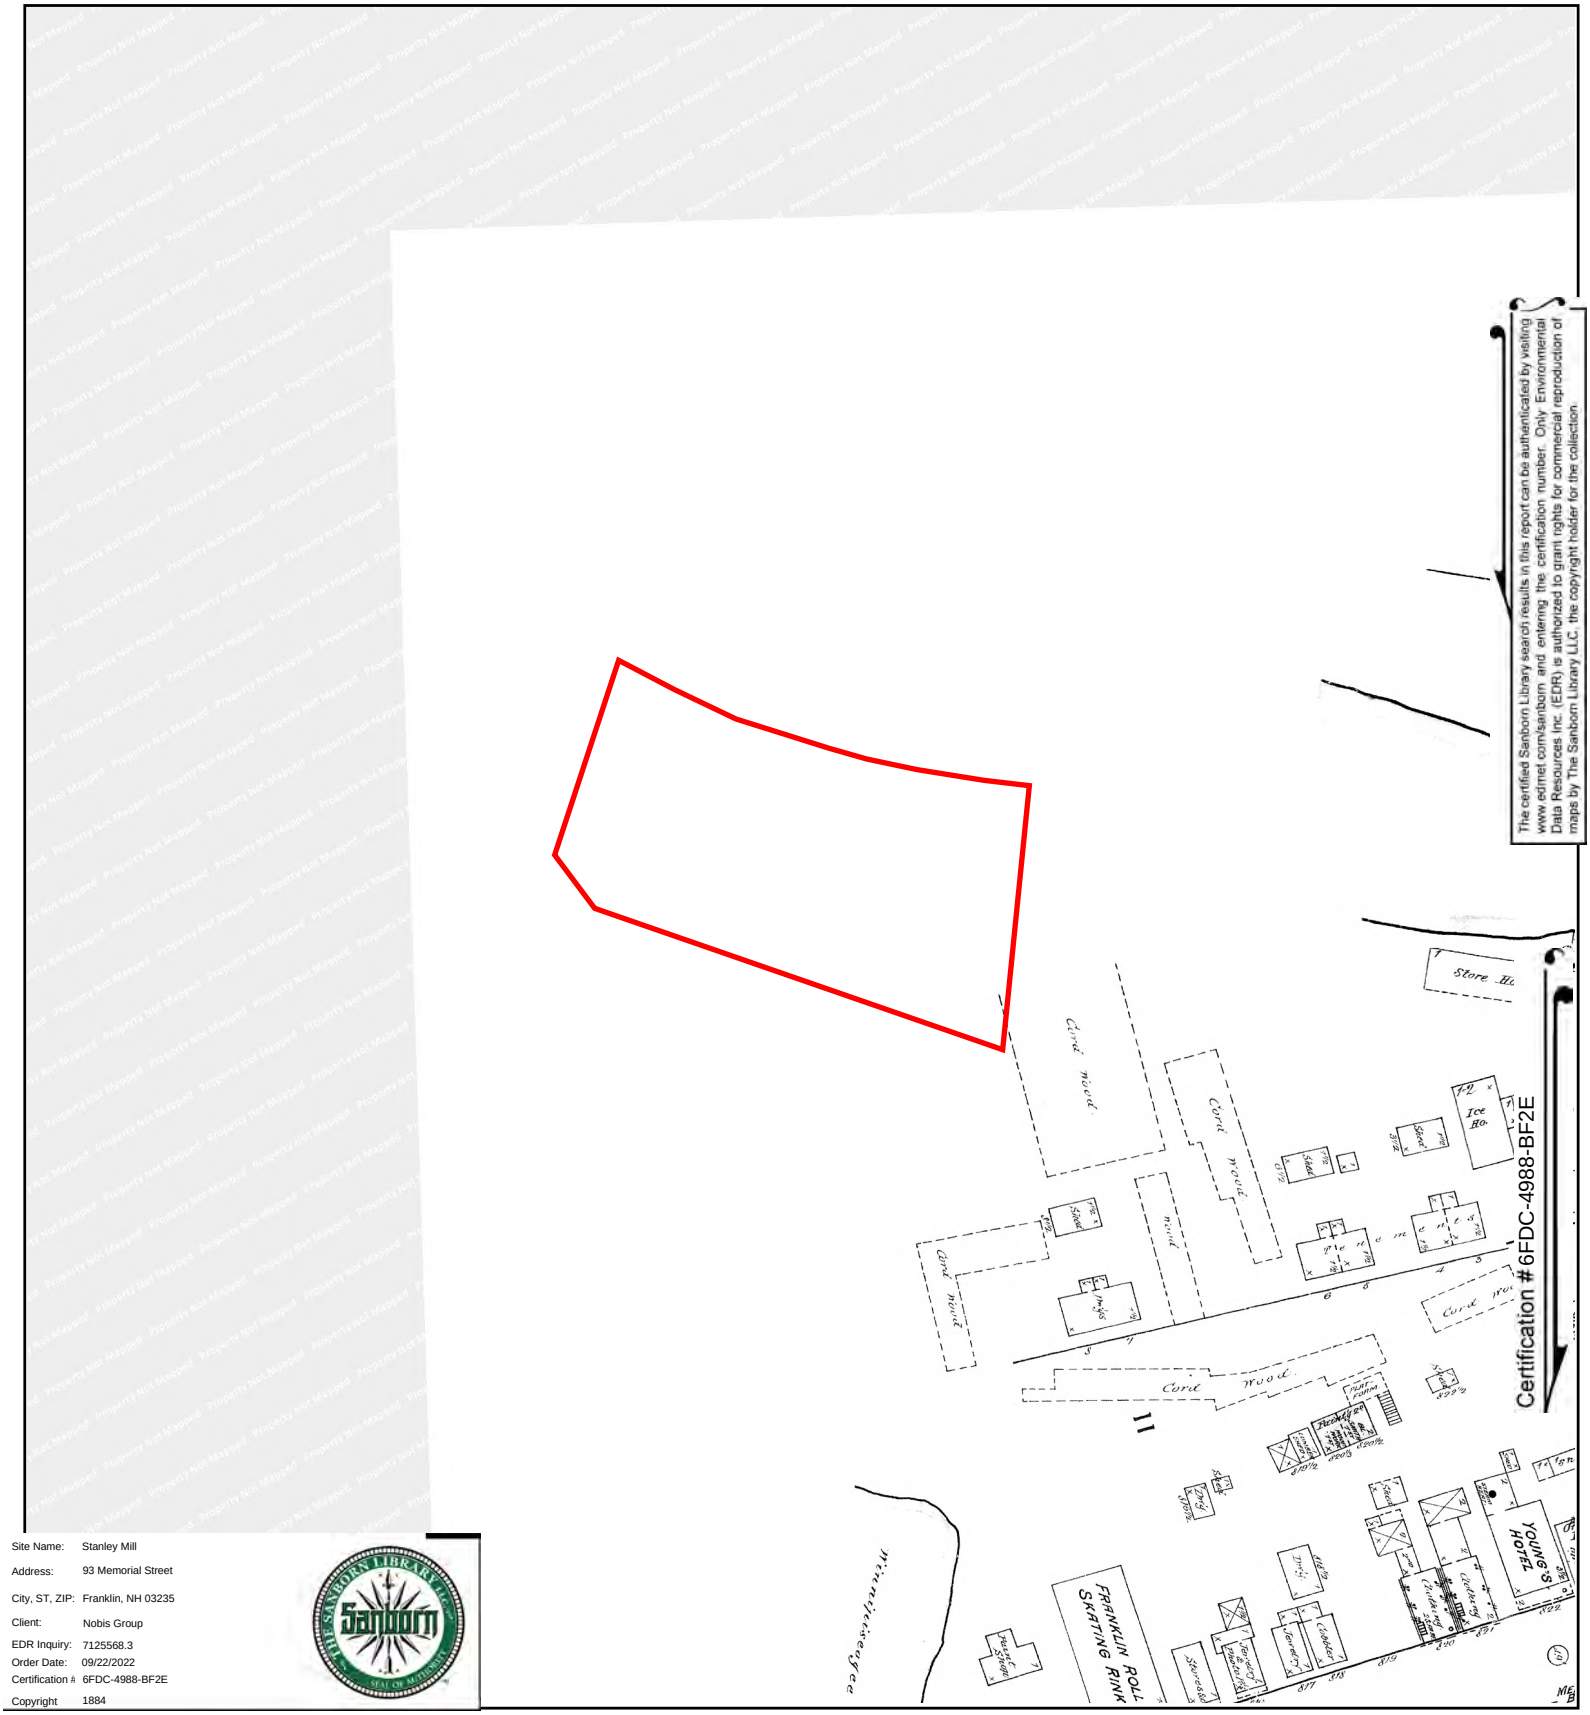
Store Hs
Ice Ho.
Shed
Shed
Shed

Stanley Mill

93 Memorial Street

Franklin, NH 03235

Inquiry Number: 7125568.8

September 23, 2022

The EDR Aerial Photo Decade Package

6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

EDR Aerial Photo Decade Package

09/23/22

Site Name:

Stanley Mill
93 Memorial Street
Franklin, NH 03235
EDR Inquiry # 7125568.8

Client Name:

Nobis Group
18 Chenell Drive
Concord, NH 03301
Contact: Karina Zawilinski

Environmental Data Resources, Inc. (EDR) Aerial Photo Decade Package is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's professional researchers provide digitally reproduced historical aerial photographs, and when available, provide one photo per decade.

Search Results:

Year	Scale	Details	Source
2016	1"=500'	Flight Year: 2016	USDA/NAIP
2012	1"=500'	Flight Year: 2012	USDA/NAIP
2009	1"=500'	Flight Year: 2009	USDA/NAIP
2006	1"=500'	Flight Year: 2006	USDA/NAIP
1998	1"=500'	Acquisition Date: April 12, 1998	USGS/DOQQ
1993	1"=500'	Flight Date: April 28, 1993	USGS
1986	1"=500'	Flight Date: May 13, 1986	USDA
1974	1"=500'	Flight Date: May 02, 1974	USGS
1960	1"=500'	Flight Date: May 01, 1960	USGS
1956	1"=500'	Flight Date: May 02, 1956	USGS
1951	1"=500'	Flight Date: May 05, 1951	USGS

When delivered electronically by EDR, the aerial photo images included with this report are for ONE TIME USE ONLY. Further reproduction of these aerial photo images is prohibited without permission from EDR. For more information contact your EDR Account Executive.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2022 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

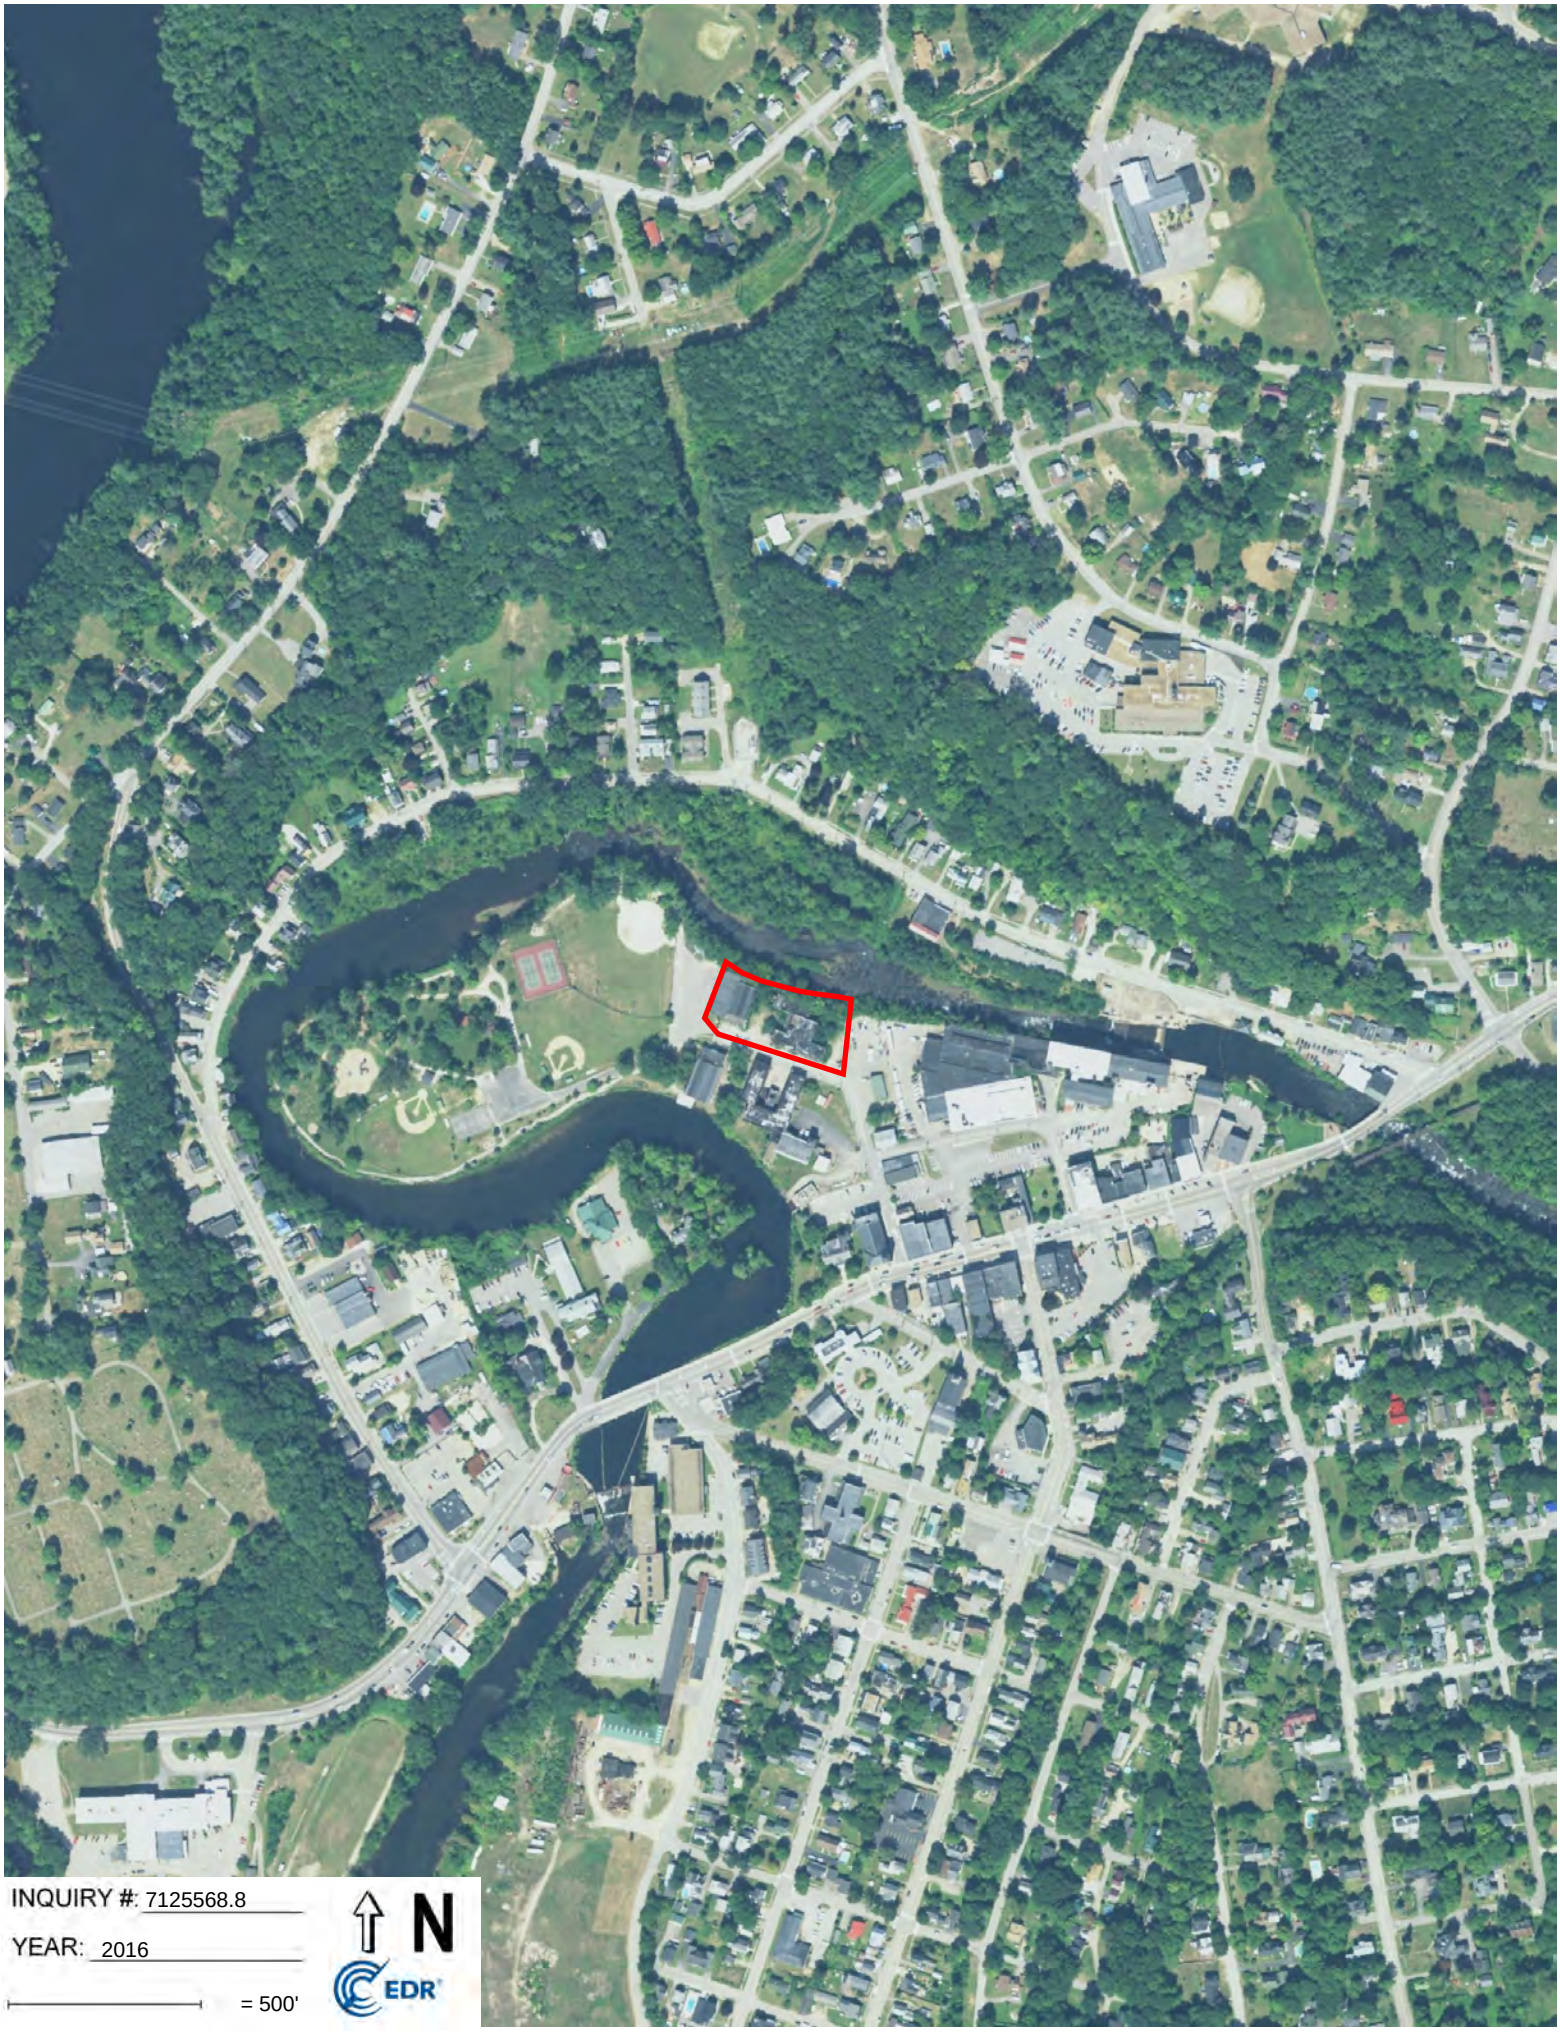
INQUIRY #: 7125568.8
YEAR: 2016
= 500'
N
EDR

INQUIRY #: 7125568.8
YEAR: 2012
= 500'
N
EDR

INQUIRY #: 7125568.8
YEAR: 2009
= 500'
N
EDR

INQUIRY #: 7125568.8
YEAR: 2006
= 500'
N
EDR

INQUIRY #: 7125568.8
YEAR: 1998
= 500'
N
EDR

INQUIRY #: 7125568.8

YEAR: 1993

= 500'

N

EDR

Subject boundary not shown because it exceeds image extent or image is not georeferenced.

INQUIRY #: 7125568.8
YEAR: 1986
= 500'
N
EDR

INQUIRY #: 7125568.8

YEAR: 1974

= 500'

N

EDR

INQUIRY #: 7125568.8
YEAR: 1960
= 500'
N
EDR

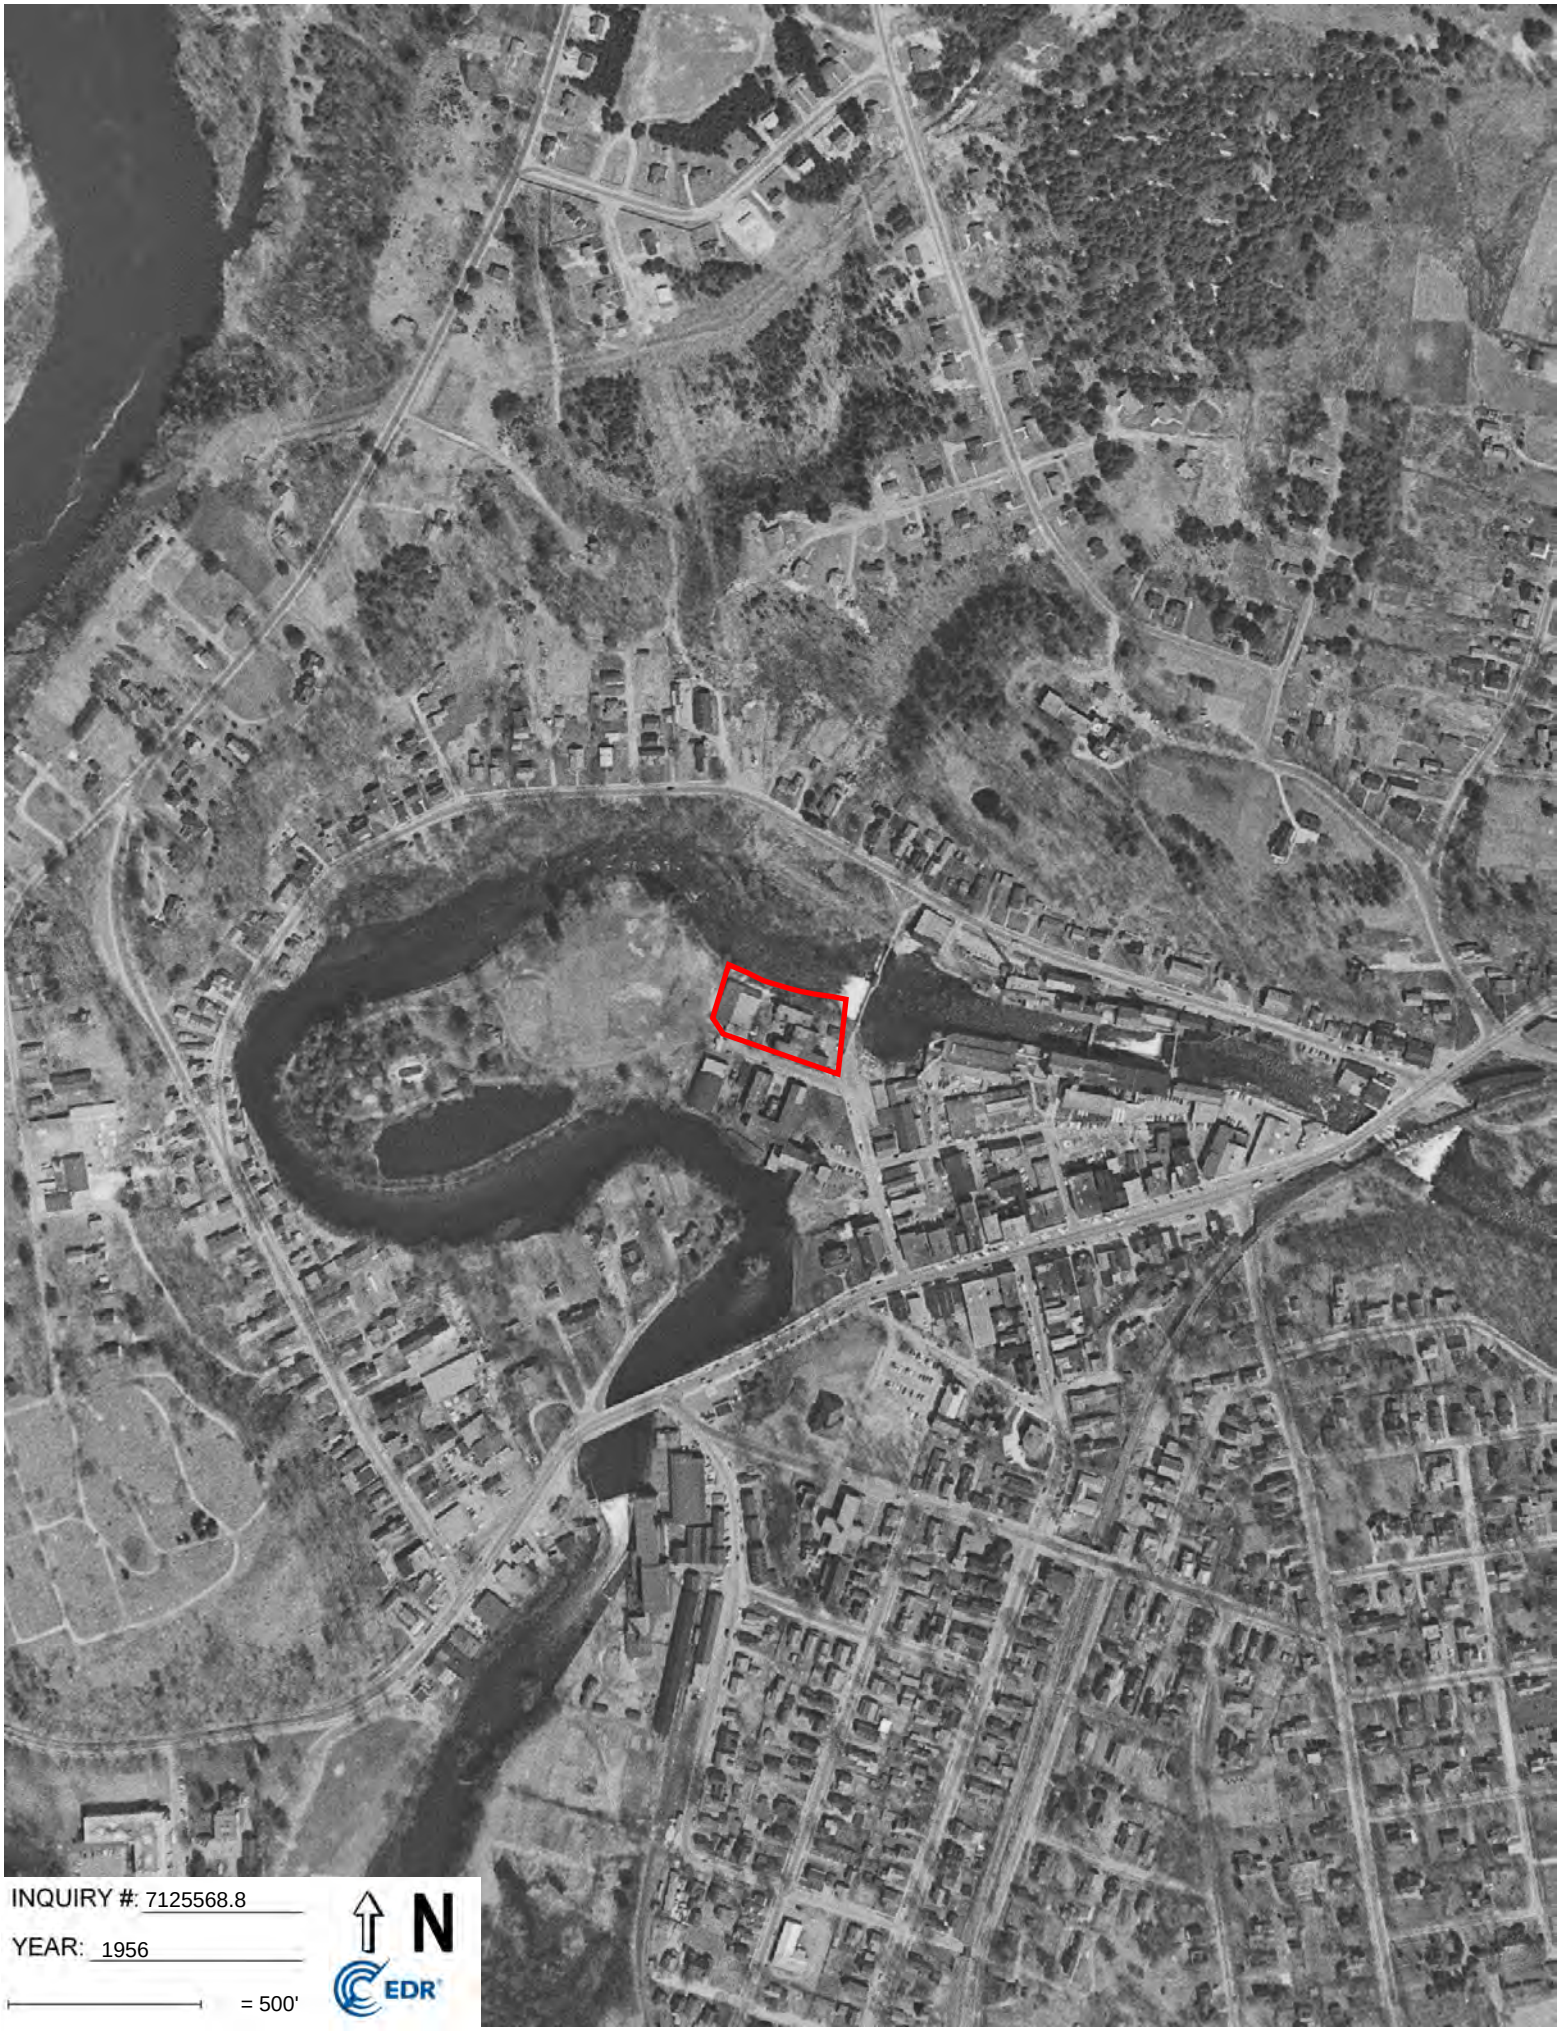
INQUIRY #: 7125568.8
YEAR: 1956
= 500'
N
EDR

INQUIRY #: 7125568.8
YEAR: 1951
= 500'
N
EDR

Stanley Mill
93 Memorial Street
Franklin, NH 03235

Inquiry Number: 7125568.5
September 21, 2022

The EDR-City Directory Image Report

EDR® Environmental Data Resources Inc

6 Armstrong Road
Shelton, CT 06484
800.352.0050
www.edrnet.com

TABLE OF CONTENTS

SECTION

Executive Summary

Findings

City Directory Images

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction orforecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2020 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc. or its affiliates is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

DESCRIPTION

Environmental Data Resources, Inc.'s (EDR) City Directory Report is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's City Directory Report includes a search of available city directory data at 5 year intervals.

RECORD SOURCES

EDR's Digital Archive combines historical directory listings from sources such as Cole Information and Dun & Bradstreet. These standard sources of property information complement and enhance each other to provide a more comprehensive report.

EDR is licensed to reproduce certain City Directory works by the copyright holders of those works. The purchaser of this EDR City Directory Report may include it in report(s) delivered to a customer. Reproduction of City Directories without permission of the publisher or licensed vendor may be a violation of copyright.

Data by
infoUSA®
Copyright©2008
All Rights Reserved

RESEARCH SUMMARY

The following research sources were consulted in the preparation of this report. A check mark indicates where information was identified in the source and provided in this report.

Year	Target Street	Cross Street	Source
2014	☑	☐	EDR Digital Archive
2010	☑	☐	EDR Digital Archive
2005	☑	☐	EDR Digital Archive
2000	☑	☐	EDR Digital Archive
1995	☑	☐	EDR Digital Archive
1992	☑	☐	EDR Digital Archive
1966	☑	☐	Manning's City Directory
1961	☑	☐	Manning's City Directory

FINDINGS

TARGET PROPERTY STREET

93 Memorial Street
Franklin, NH 03235

Year	*CD Image*	*Source*

MEMORIAL ST

2014	pg A1	EDR Digital Archive
2010	pg A2	EDR Digital Archive
2005	pg A3	EDR Digital Archive
2000	pg A4	EDR Digital Archive
1995	pg A5	EDR Digital Archive
1992	pg A6	EDR Digital Archive
1966	pg A7	Manning's City Directory
1961	pg A8	Manning's City Directory

FINDINGS

CROSS STREETS

No Cross Streets Identified

City Directory Images

Target Street	Cross Street	Source
✓	-	EDR Digital Archive

MEMORIAL ST 2014

17	LEFEBVRE, ALAN
19	LEFEBVRE ALAN CONSTRUCTION
	SMITH, RONALD L
33	LEVEILLE, STEVEN G
99	FORSTER, RON P
124	FRANKLIN BUSINESS & INDUSTRIAL DEVEL

Target Street	Cross Street	Source
✓	-	EDR Digital Archive

MEMORIAL ST 2010

17	LEFEBVRE, ALAN
19	LEFEBVRE, ALAN R
31	BLOMQUIST, DAVID W
	HANLON, KRISTI H
	LEONARD, ROBERT
	OLIVER, PAULA
99	FORSTER, RON P
124	PROULX COMMUNITY CTR

Target Street	Cross Street	Source
✓	-	EDR Digital Archive

MEMORIAL ST 2005

19	ALAN LEFEBVRE CONSTRUCTION
	LEFEBVRE, ALAN R
	SMITH, KIM
31	COLBURN, P
	GRGIC, ILIJA
	GRMUSA, MILOS
	ILISA, GRACIE
	MARKELIC, PREDRAG
	OLIVER, PAULA
	RUJAK, STOJAN
	SKILLIN, ROBERT
	WHITE, N
33	KAR Z KARMA MOTORS INC
99	FORSTER, RON P
100	ALLEN, JOSHUA
	CHAINEY, RONALD J
	DEPOUTOT, DIANE
	ENABLING SPORT FOUNDATION
	HARDEN, D
	HONEYWELL INTERNATIONAL
	KULACZ, MARY D
	LEBLANC, ARTHUR E
	OFF DROP AUCTIONS LLC
	QUIGLEY, A
	SALTMARSH, JOSHUA
	SANTOS, KATRINA H
	SHEPARD, T
	THOMAS ALLEN COFFEE CO
	VERMILLION, DAVID
	WALOGORSKY, A
	WEAVER, JAMES J
	WELLINGTON, JAMES W
	ZIMMERMAN, FREDERICK C
102	LANGER, STEPHEN G
124	HENRY J PROULX COMMUNITY CENTER

Target Street	Cross Street	Source
✓	-	EDR Digital Archive

MEMORIAL ST 2000

19	LEFEBVRE ALAN CONSTRUCTION
	PRECISION MILLWORK
22	AVATAR PROPERTIES
31	GRGIC, ILIJA
	MARKELIC, PREDRAG
33	SULDENSKI, JOHN
89	OCCUPANT UNKNOWN,
99	EDWARD, RON
	FORSTER, RON
100	CHARLES NON FERROUS CASTINGS
	CLOW, JANE H
	FRANKLIN NAUTILUS INCORPORATED
	GANDOR DEVELOPMENT
	NORPLEX OAK
	SOKUL JEAN E ATTORNEY
124	FRANKLIN CITY OF PARKS & RECREATION DEPARTMENT

Target Street	Cross Street	Source
✓	-	EDR Digital Archive

MEMORIAL ST 1995

31	RICHARD, R R, JR
	SULDENSKI, JOHN
93	PRETCO LTD
99	MULLIGAN, CALEB
100	BIGELOW, NATHAN D
	CHARLES NON-FERROUS CASTINGS
	FOODEE'S INC
	FRANKLIN NAUTILUS INC
	NORPLEX/OAK
	SANDOGARDY TRANSPORT
	SOKUL, JEAN E, ATTY
	TJS BROKERAGE & CO

Target Street	Cross Street	Source
✓	-	EDR Digital Archive

MEMORIAL ST 1992

99 MCBEY, THOS N
100 CHARLES NON-FERROUS CASTINGS
CREATIVE GYMNASTICS & FITNESS
FOODEE'S INC
NORPLEX/OAK

Target Street	Cross Street	Source
✓	-	Manning's City Directory

MEMORIAL ST 1966

Liberty Av—continued
15◎Kenneth Crosby (R) 🔔
16◎Geo C Michel 🔔
19◎Ronald R Westcott 🔔
22◎Alex Cooper 🔔
24◎Roger Day 🔔
23◎Bernard R Cote 🔔
25 Roger Desrochers

LINCOLN fr River rd nr N Main easterly
◎John T Smith (tr)
Smith's Trailer Pk
off Donald E Fales

LOIS LA fr Herbert to Clifford
No houses

MAPLE fr 40 Maple sq north to Proctor
13 Mrs Bertha E Langton 🔔
13 Vacant
13½ Arth A Desrosier Jr
17◎Francis J Young 🔔
20◎Dennis E Sullivan 🔔
— Park crosses
42◎Frances P Bennett 🔔
44 Robt Beaupre 🔔
44◎Donald A Thomann
49◎Jas J Collins 🔔

MAPLE SQ fr 582 Central to dead end
Right side odd numbers
9◎Edw H Hebert 🔔
13◎Mrs Melanie E Schiffner 🔔
28◎Mrs Nellie A Gerry 🔔
28 Harry C Varney 🔔
35 Henry C Prentice 🔔
37 Mrs Cora J Prentice
39 Vacant
— Maple begins left
40 Mrs Pauline J Hynes
40 Raymond C Dorval Jr
40 Harvey L Landfare
46◎Mrs Mathilda E O'Brien 🔔
48◎Kenneth C Phipps 🔔
50◎Alphonse E Pelletier
50◎Donat J Bergeron 🔔
63◎Ernest O St Pierre 🔔
62◎Raymond W Gosselin 🔔
62 Angus MacIver
◎Maurice J Laroche (L) 🔔

MEMORIAL fr 316 Central south to Odel PARK
Right side odd numbers
City Hall side entrance (L)
9 Grant's Billiard Room
17 Vacant
19 Vacant
— Canal ct begins right
23-29 Sawicki Block
23 Seventh Day Adventist Church
25 Vacant
27 Jess F Disey (A)
27 E May Driscoll (B)
27 Raymond Hutchins (D)
27 Walter F Theriault (E)
27 Vacant (F)
27 Mrs Alice M Jeanson (G)
27 Robt T Tinker (H)
27 Robt A Davis (I)
29 Willie Huntoon & Co sheet metal 🔔
31◎Aime J Lemire (1) 🔔
31 Wm L Prentice (2)
33◎Wash Brite Laundry 🔔
— Canal begins right
54 Public Service Co of N H light and power plant (L)
Garage right
92 Shepard Groc Corp office
93 G W Griffin Co hack saw blade mfrs
94 Henry J Proulx Community Center
95 Vacant
Odell Park

MIRIAM WAY fr Edith to Herbert
No houses

MORRILL CT W F (The Plains) fr Lawndale rd westerly
◎Clarence K Edmunds
◎Edw Bryson (R) 🔔
◎Wayne E Morrill poultry dlr (R) 🔔
◎Walter F Jordan (L) 🔔
◎Hollis A Morrill (L) 🔔
◎Arth Lewis (tr)
◎Sheldon E Morrill (L) 🔔

MUNROE fr 16 Pearl pl east to Green
Right side odd numbers
33◎John G LaVertu 🔔
43 John H Ouellette Jr
45 Thos Mango
59◎Leon Griffin Jr (R) 🔔
91◎Arley E LeBraney 🔔
95◎Mrs Myrtie M Gregg 🔔
99◎Mrs Angie M Douphinett 🔔

"SAVE WITH SAFETY" AT
GRIFFIN DRUG CO
Rexall TEL 934-2200

Target Street	Cross Street	Source
✓	-	Manning's City Directory

MEMORIAL ST 1961

LINCOLN fr River rd nr N Main easterly
John T Smith

LOIS LA fr Herbert to Clifford
No houses

MAPLE fr 40 Maple sq north to Proctor
13 △Clarence M Clifford ⓞ
13 Vacant
13½ △Kenneth L Coen ⓞ
17 △Gerard A Hebert ⓞ
20 △Dennis E Sullivan ⓞ
— **Park crosses**
37 △Ralph J Wentworth ⓞ
42 Francis H Dolan ⓞ
44 Donald A Thomann ⓞ
49 △Jas J Collins ⓞ

MAPLE SQ fr 582 Central to dead end
Right side odd numbers
9 △Edw H Hebert ⓞ
13 △Fritz E Schiffner ⓞ
28 △Mrs Nellie A Gerry ⓞ
28 △Harry C Varney ⓞ
35 △Robt Brown ⓞ
37 No Report
39 No Report
— **Maple begins left**
40 △Mrs Sarah M Macsata ⓞ
40 △Fred L Cook ⓞ
46 △Mrs Mathilda E O'Brien ⓞ
48 △Kenneth C Phepps ⓞ
50 △Lucien Pelletier ⓞ
50 △Donat J Bergeron ⓞ
53 △Ernest O St Pierre ⓞ
62 △Raymond W Gosselin ⓞ

MEMORIAL fr 316 Central south to Odel Park
Right side odd numbers
City Hall side entrance left
9 Buffington's Billiard Room
17 Vacant
19 Mrs June E Ricketts
— **Canal ct begins right**
23-29 Sawicki Block
23 Vacant
25 △Sylvester's Market
27 Vacant (A)
27 Mamie M Driscoll (B)
27 Elwood F Stewart (C)
27 Mrs Susie M Rice (D)
27 Albert L Yeaton custodian (E)
27 Vacant (F)
27 Chas H Westgate Jr (G)
27 Vacant (H)
27 Vacant (I)
29 △Willie Huntoon & Co sheet metal
31 △Aime J Lemire (1) ⓞ
31 Mrs Irene M Laramie (2)
31 Chester D Downes (3)
31 Vacant (4)
33 △Wash Brite Laundry ⓞ
— **Canal begins right**
54 △Public Service Co of N H light and power
Shepard Grocery Corp garage right
54 Vacant
54 Vacant
92 Vacant
92 Vacant
93 △G W Griffin Co hack saw blade mfrs
94 △State Armory
94 N H Motor State Vehicle Dept
95 △U S Govt Materials Purchase Depot Gen Service Administration Emergency Procurement Service
95 △Johnson Mica Processing Plant
Odell Park
△Ernest J Aube

MIRIAM WAY fr Earth to Herbert
No houses

MORRILL CT W F (The Plains) fr Lawndale rd westerly
△Mrs John Carr left ⓞ
△Edw L Bryson right ⓞ
Wayne E Morrill poultry dlr right
Walter F Jordan left
Vacant left
Vacant left
Sheldon E Morrill left

MUNROE fr Pearl pl east to Green
Right side odd numbers
31 Angus MacIver
33 John G LaVertu ⓞ
43 △Thos Mango ⓞ
45 △Raymond J Roy ⓞ
△Mrs Blanche G Murphy right ⓞ
91 Arley E Labraney ⓞ
95 △Edw W Gregg ⓞ
99 △Chas A Douphinett ⓞ
99 Caddy's Novelty Shop

MYRTLE AV fr 109 Pleasant Junction Orchard southerly
Right side odd numbers
18 △Harry W Sweenie ⓞ
— **Pine ends right**
36 Benj Stein Jr ⓞ
— **Beech ends right**
42 △Howard M Porter ⓞ
50 △Thos F Lane Jr ⓞ

NELSON W F fr opp 369 N Main westerly
Malcolm S Seaman ⓞ
△Leonard N Boomhower ⓞ
△Elmer G Keniston ⓞ
△Mrs Marion B Benson ⓞ

NESMITH fr 539 Central east to Cross rd
No houses
— **Railroad crossing**
— **Lancaster ends right**
— **Cross rd crosses**

NEW BOSTON RD fr New Hampton rd to Sanbornton line
△Harold Grover right ⓞ
△Constance Russell left ⓞ
Sui Hsin Tuhzik Kennel left
△John Fairbank ⓞ
△Mrs Everline Patten ⓞ
△Mrs Edith Lawry ⓞ
△Mrs Robt M Yerkes ⓞ
Wm Clark summer res right ⓞ
Mrs Cornelia G Cannon summer res right ⓞ
△Fred E Anair right ⓞ
Paul A Michel right
Howard E Leighton ⓞ
— **Town line crosses**

NEW HAMPTON RD fr Babbitt rd north to City line
— **Victory dr ends left**
△Forrest J Sargent left ⓞ
Off Vacant left
△Off Lougee L LaPage left ⓞ
△Off Walter F Krauz left ⓞ
△Off Mrs Yvonne M Pomerleau left ⓞ

APPENDIX E

117-142

CITY OF FRANKLIN, NEW HAMPSHIRE
Fire Department
"The Three Rivers City"

59 West Bow Street • 03235

Tel : (603) 934-2205
FAX: (603) 934-7408

Michael J Foss, Fire Chief/EMD

David J Hall, Deputy Chief

February 2nd, 2022

Ferrari Franklin Mills Reality
18 Broadway
Stoneham, MA 02180

Dear Mr. Ferrari,

I am writing as a follow-up to the conversation that I had with Liz Ferrari regarding your property at **93 Memorial Street, Map-Lot 117-142,** in the City of Franklin. Liz informed me that the potential buyer is looking at obtaining the property in the near future. Further, she asked for an **extension of the January 31st, 2022** deadline in which you previously agreed to obtain a City of Franklin Demolition Permit.

I have spoken to members of the City's leadership team, and we are willing to offer an extension, until **November 30th, 2022** based on the following criteria:

- **That you agree to work with the City's Code Enforcement Office to ensure that any immediate hazards are corrected.**
- **That all correspondence regarding the repair or razing of 93 Memorial Street be disclosed to the buyer prior to a final sale.**
- **That you maintain the exterior grounds to current City of Franklin codes and standards (2018 International Code Council Property Maintenance Code).**
- **So long that an active "Purchase and Sales" agreement remain in effect.**

The property owner as of November 30th, 2022 shall be aware of the following:

- **A Demolition Permit is to be submitted on or before November 30th, 2022; OR, if the owner chooses not to raze the structure, a Building Permit to rebuild the structure(s) will need to be submitted to the Planning and Zoning office on or before November 30th, 2022.**

If you agree to the above conditions surrounding the extension, then please respond to me in writing so that I can update our records. If I do not receive a written response to accept the terms of the extension by **February 22nd, 2022** then the City of Franklin will assume you do not wish to obtain the extension. It is our hope that the above conditions will allow for a successful project outcome at 93 Memorial Street. Feel free to reach out with any questions that you might have.

Sincerely,

Michael Foss
Fire Chief/EMD

Cc: Michael and Elizabeth Ferrari
Seth Creighton, Planning and Zoning
Judie Milner, Franklin City Manager

REQUEST FOR SERVICE

Request # SR____ - _____

CITY OF FRANKLIN, NEW HAMPSHIRE

Request / Complaint Information

Requestor's Information:

Name:	John Wheeler			
Address:	160 Franklin St. (Street Address)	Franklin (City)	NH (State)	03235 (Zip Code)
Telephone:	(Home Phone)	(Work Phone)	(Cell Phone) 344-8134	(email)

Location of Complaint: Gribbin

Name:	Old Britten Hackson Shop			
Address:	100 Memorial St (Street Address)	Franklin (City)	NH (State)	03235 (Zip Code)

Brief Description of Problem: Pic's 6b

Two berry metal from roof hanging over office porch. Feel could come down onto vehicle

John Wheeler — Signature

12-20-2018 — Date

maybe 93 Memorial

For City Use Only - Department Service Summary

Received by: S. Nichols Date: 12/20/18

Time: 1:30 ☑PM ☐AM

Department Responder: Poynton

Responded to Requestor? ☑ Yes ☐ No

Date Completed: 12/20/18

Method: ☑ Telephone ☐ Written ☐ In Person

Department(s) Responsible for Service:

- ☐ Municipal Services
- ☐ Police
- ☐ Fire
- ☐ Planning
- ☐ Finance
- ☐ Code Enforcement
- ☐ Parks and Recreation
- ☐ Library

Copy to:

- ☐ Mayor & Council
- ☐ City Manager
- ☐ Municipal Services
- ☐ Police
- ☐ Fire
- ☐ Planning
- ☐ Finance
- ☐ Code Enforcement
- ☐ Parks and Recreation
- ☐ Library

Action Narrative: 12/20/18 —

Spoke w PM about property concern. PM stated they would look into correcting. SN 12/20

(Please use reverse side for additional comments)

117-142-00

Franklin Fire & Emergency Services

Occupancy: **FERRARI FRANKLIN MILLS REALTY, LLC**
Occupancy ID: **MEMO ~~119~~ 93**
Address: **~~119~~ MEMORIAL ST**
93 FRANKLIN NH 03235

Form: Construction Inspections

Inspection Type: **Demolition**
Inspection Date: **6/4/2020** By: Reale, Steve (14215)
Time In: **10:30** Time Out: **10:30**
Authorized Date: **06/04/2020** By: Reale, Steve (14215)
Next Inspection Date:

Inspection Description:

A limited visual inspection of your facility was conducted in accordance with the City of Franklin Fire Prevention, Franklin City of Municipal Code CH-233, Life Safety Code 2015, Saf-C 6000 State Fire Code, and 2018 Int'l Property Maintenance Code, The items listed in this report were noted during this inspection and must be corrected as indicated no later than the follow-up inspection date. If these items cannot be corrected within the prescribed time you may submit, for approval, your corrective plan of action.

Inspection Topics:

Additional Time Spent on Inspection:

Category	Start Date / Time	End Date / Time

Notes: No Additional time recorded

Total Additional Time: 0 minutes
Inspection Time: 0 minutes
Total Time: 0 minutes

Summary:

Overall Result: Passed

Inspector Notes: Plans Review for demolition and clean up of property as outlined in NOV issued for conditions. Property Manager has contracted demolition of dilapidated loading dock, and remove trees growing on roof.

Closing Notes:

You may contest these orders at an Administrative Hearing. The request for a hearing must be in writing within 20 days after receipt of the order and addressed to: Franklin Fire Department Code Enforcement Division 59 West Bow Street, Franklin, NH 03235

NH RSA 153:24 Penalty for Violation applies

Inspector:

Name: Reale, Steve
Work Phone(s): 603-934-5680
Email(s): sreale@franklinnh.org

Signature *Date*

RECEIVED
JAN 30 2008

Mr. Chuck Goggins, Regional Engineer
FERC New York Regional Office
19 West 34th Street, Suite 400
New York, NY 10001

RE: Stevens Mill Dam FERC #037600101 (NH#087.07)
Franklin, NH

Dear Mr. Goggins (Chuck):

The Department of Environmental Services (DES) has been charged with reviewing hazard classifications for all dams where the FERC hazard classification and the NHDES hazard classification differ. In this particular case, the FERC hazard classification is "Low Hazard", and the NHDES has maintained the classification as "Non-Menace".

Based on a visit to the site in fall of 2007, it was found that there are multiple buildings on the downstream left bank which are active commercial enterprises. In the event of a breach, the buildings on the downstream left bank would be at least partially inundated with water, and their foundations subject to scour and possible undermining. Currently, the building on the left bank is a "Morgan Self-Storage" building. Further downstream, a multifamily is located on the right bank, and a paving company on the left bank.

Additionally, our records indicate that in January of 2003 an ice jam will at the bridge over the spillway resulted in flooding of multiple streets and businesses. In accordance with NHDES Env-Wr 101.08, a significant hazard dam is in a location and of a size that failure *or misoperation* of the dam could result in: (b) major economic loss to structures or property.

Given the data above, the NHDES Dam Bureau will reclassify this structure to a "Significant Hazard" dam. We would appreciate FERC reviewing this dam using the federal guidelines for dam classification, and confirming or reassessing the FERC hazard class of the dam based on this determination.

If you have any questions you can contact me by email at bdesfosses@des.state.nh.us, by phone at 271-3406, or write to the address listed below.

Sincerely,

BAD

Brian A. Desfosses
Dam Safety Engineer

cc: Mr. Gerry Cross, Dam Safety Supervisor
Mr. Sean Fairfield, Algonquin Power Systems, Inc.
Town of Franklin

BAD/was/h:/damfiles/08707/20080124 08707 FERCHZCLLTR

A Friendly City on the Move

03235

OFFICE OF PLANNING BOARD

November 14, 1985

Dear Property Owner:

The Franklin Planning Board will hold a public hearing at 7:30 P. M. on November 19, 1985 in the lower city hall conference room to consider the following request:

Burt & Michael Mills requesting approval of a Site Plan of land located on Memorial Street (formerly Stanley Mills) which proposes to construct a connecting building between the mill and the former armory and to establish a light manufacturing operation.

As an abutter, you are cordially invited to attend this meeting to offer your comments, both for or against the above-requested action-

Sincerely,

Ralph E. Tilton

Ralph E. Tilton
Chairman

RET/kal

REFER TO SH. 116
130'
310'
1.0 AC.
39'
142
43'
R.O.W. 40'
65'
301'
183'
60'
20'
170'
50'
4'

201500001119 Recorded in Merrimack County, NH In the Records of Kathi L. Guay,CPO, Register
~~BK: 3467~~ PG: 2235, 1/26/2015 11:22 AM LCHIP $25.00 TRANSFER TAX $40.00 RECORDING $30.00 SURCHARGE $2.00

MERRIMACK COUNTY RECORDS Kathi L. Guay, CPO, Register

Atty. Charles F. Houghton
271 Main Street, Suite 202
Stoneham, MA 02180

117-142-00 N8

117-142-00

Property Address: 93-119 Memorial Street, Franklin, NH 03235

30 20 25

Min. stamp

40.00

Warranty Deed

Statutory Short Form

We, **Louis Ferrari** and **Carolyn Jasiul Ferrari,** Trustees of the Ferrari Realty Trust u/d/t dated September 28, 1994, a Massachusetts Nominee Trust, having a mailings address of 18 Broadway, Stoneham, Massachusetts for consideration paid, grants to the **Ferrari Franklin Mills Realty LLC**, a New Hampshire Limited Liability Company with a principal address of 163 Sanbornton, New Hampshire

with Warranty Covenants:

The following described tracts or parcels of land, with the buildings thereon, situate in Franklin, Merrimack County, New Hampshire and bounded and described as follows:

Parcel 1

One tract beginning at the northeasterly terminal point of the highway leading from Memorial Street past land of W. H. & Geo. D. Mayo, or formerly of them;

thence westerly by said new street 110 feet to an iron pin;

thence by a line at right anglel with said last street about 120 feet to highwater mark of the Winnipiseogee River;

thence up said River by the line of highwater mark about 15 feet to a point in a line of an extension of the westerly side of Memorial Street;

thence southerly by a line which would be an extension of the westerly side of said Memorial Street in the same course to the point begun at.

245046 95 MAY 23 PM 2:02 BK1987 PG1881

Ferrari, Louis

40.00

117-142-00

WARRANTY DEED

STATUTORY SHORT FORM

Louis Ferrari, Trustee of Franklin Falls Trust, U/D/T dated 29 January 1986, of 18 Broadway, Stoneham, Massachusetts 02180, for consideration paid, grants to Louis Ferrari and Carolyn Jasiul Ferrari, Trustees of Ferrari Realty Trust, U/D/T dated 28 September 1994, a Massachusetts Nominee Trust, having a mailing address of 18 Broadway, Stoneham, Massachusetts 02180, with WARRANTY COVENANTS:

The following described tracts or parcels of land, with the buildings thereon, situate in Franklin, Merrimack County, New Hampshire and bounded and described as follows:

One tract beginning at the northeasterly terminal point of the highway leading from Memorial Street past land of W. H. & Geo. D. Mayo, or formerly of them;

thence westerly by said new street 110 feet to an iron pin;

thence by a line at right angles with said last street about 120 feet to highwater mark of the Winnipiseogee River;

thence up said River by the line of highwater mark about 15 feet to a point in a line of an extension of the westerly side of Memorial Street;

thence southerly by a line which would be an extension of the westerly side of said Memorial Street and in the same course to the point begun at.

Reserving to The Franklin Falls Company, its successors and assigns all rights whatsoever, to the use of the water of said river and to the river bed and the right to turn the river by penstock or other passageway from its present channel for the improvement of the power of the dam of the Franklin Light and Power Co. but conveying herewith the right to lay pipe in the bed of said river to carry away sewerage from said granted premises; conveying also the right to take from the river above said dam sufficient water for said grantee's use on said granted premises for tempering, for sprinkler service and for water closets and steam heating service, and to convey the same by pipe to said granted premises in such way and place as to do the least damage to the property of the Franklin Falls Company, or those holding under it.

Being the same premises conveyed to Parker C. Hancock and George W. Griffin by Warranty Deed of Franklin Falls Company dated 25 July 1895 and recorded in Merrimack County Registry of Deeds in Book 317, at Page 127.

REAL ESTATE TRANSFER TAX
DEPARTMENT OF REVENUE ADMINISTRATION
VOID IF ALTERED
THOUSAND 40 HUNDRED AND 40 DOLLARS
AMOUNT $ ######40.00
MO. 05 DAY 23 YR. 1995
167356

THOUSAND HUNDRED AND $
MO DAY YR 05/23/1995 167356
VOID IF ALTERED

pin;

thence by a line at right angles with said last street about 120 feet to highwater mark of the Winnipiseogee River;

thence up said River by the line of highwater mark about 15 feet to a point in a line of an extension of the westerly side of Memorial Street;

thence southerly by a line which would be an extension of the westerly side of said Memorial Street and in the same course to the point begun at.

Reserving to The Franklin Falls Company, its successors and assigns all rights whatsoever, to the use of the water of said river and to the river bed and the right to turn the river by penstock or other passageway from its present channel for the improvement of the power of the dam of the Franklin Light and Power Co. but conveying herewith the right to lay pipe in the bed of said river to carry away sewerage from said granted premises; conveying also the right to take from the river above said dam sufficient water for said grantee's use on said granted premises for tempering, for sprinkler service and for water closets and steam heating service, and to convey the same by pipe to said granted premises in such way and place as to do the least damage to the property of the Franklin Falls Company, or those holding under it.

Being the same premises conveyed to Parker C. Hancock and George W. Griffin by Warranty Deed of Franklin Falls Company dated 25 July 1895 and recorded in Merrimack County Registry of Deeds in Book 317, at Page 127.

Also another tract situate in said Franklin and bounded as follows, to wit:

Beginning at the southwest corner of land of the said grantor on the north side of Memorial Street;

thence westerly by said street 40 feet to an iron pin;

thence northerly by a line parallel to said grantor's westerly line to the Winnipiseogee River at highwater mark;

thence easterly by the line of highwater mark of said river to the northwest corner of land of said grantors;

thence southerly by land of said grantor to the bound begun at.

Reserving to the Franklin Light & Power Company, its successors or assigns, all rights whatsoever to the use of the water of said river and the river bed and the right to turn the river by penstock or other passageway from its old channel for the improvement of the power of said Franklin Light & Power Company's dam.

Being the same premises conveyed to G. W. Griffin and Parker C. Hancock, under the name of George W. Griffin & Co. by Warranty Deed of Franklin Light & Power Company dated 18 October 1906 and recorded in the Merrimack County Registry of Deeds in Book 369, at Page 524.

Reference is further made to Deed of George W. Griffin and Parker C. Hancock to G. W. Griffin Company dated 13 February 1908 and recorded in Merrimack County Registry of Deeds in Book 382, at Page 536.

Also another tract of land, with the buildings thereon, situated in said Franklin bounded and described as follows, to wit:

Beginning at the southwest corner of land of said grantor;

thence northerly by land of said grantor 100 feet, more or less, to the Winnipiseogee River at highwater mark;

thence westerly by said highwater mark of said river 60 feet to an iron bound;

thence southerly by a line parallel to and 60 feet from said first line to line of the proposed street;

thence easterly by said proposed street 60 feet to the bound begun at.

Reserving and excepting to The Franklin Light & Power Company the full use of the water of said river and the right to take the same by iron penstock, or otherwise, across the neck of land to its power station.

Being the same premises conveyed to G. W. Griffin Company by Warranty Deed of The Franklin Light & Power Company dated 14 March 1912 and recorded in the Merrimack County Registry of Deeds in Book 402, at Page 342.

Also a certain tract of land, with the buildings thereon, situated in said Franklin, bounded and described as follows, to• wit:

Beginning at an iron pin on the north side of Memorial Street and the easterly point of said grantor's land;

thence northwesterly to the iron pin at the westerly end of the concrete wall extending downstream from the Franklin Light & Power Company's dam;

thence by the line of highwater mark down said River to land of said grantor;

thence southeasterly by said grantor's land to the first bound.

Reserving to The Franklin Light & Power Company, its successors and assigns, the right to use said premiss so far as reasonably necessary to repair or rebuild the Franklin Light & Power Company's dam doing no unnecessary damage.

Being the same premises conveyed to G. W. Griffin Co. by Warranty Deed of Franklin Light & Power Company dated 22 October 1918 and recorded in Merrimack County Registry of Deeds in Book 439, at Page 227.

Also a certain tract of land, with the buildings thereon, situated in said Franklin, bounded and described as follows, to wit:

Beginning at the southwest corner of land now or formerly of said G. W. Griffin Company on the north side of Memorial Street;

thence running northerly by said G. W. Griffin Company's land to the Winnipiseogee River at the highwater mark;

thence running westerly by said highwater mark of said river to land of the City of Franklin, known as Odelle Park;

thence south by line of said Park land to said Memorial Street;

thence running easterly on said Street 126 1/2 feet, more or less, to the bound begun at.

Reserving the river bed and full use and enjoyment of the water in said river and the right to control the flow of said river at pleasure and to convey the same from the Power Company dam above said conveyed premises across the neck of land to the vicinity of the present power station.

Any and all improvements and buildings that may be located on the above premises are conveyed without warranty of any kind, as is, with all defects.

To the extent applicable, subject to the utility easement granted to Public Service Company of New Hampshire and New England Telephone and Telegraph Company by instrument dated 3 September 1986 and recorded in Book 1595, at Page 1123.

MEANING AND INTENDING to convey all the same premises conveyed to Louis Ferrari, Trustee of Franklin Falls Trust, by deed of The Stanley Works dated 3 January 1986 and recorded with the Merrimack County Registry of Deeds in Book 1547, at Page 453.

The undersigned, Louis Ferrari, as Trustee of Franklin Falls Trust, U/D/T dated 29 January 1986, has full and absolute power in said trust agreement to convey any interest in real estate and improvements thereon held in said trust and no purchaser or third party shall be bound to inquire whether the Trustee has said power, or is properly exercising said power, or to see to the application of any trust asset paid to the Trustee for conveyance thereof.

Signed this 17 day of May, 1995.

Franklin Falls Trust

By: Louis Ferrari
Louis Ferrari, Trustee
Duly Authorized

STATE OF Massachusetts
COUNTY OF Middlesex, SS.

The foregoing instrument was acknowledged before me this 17th day of May, 1995 by the above named, Louis Ferrari, Trustee of Franklin Falls Trust on behalf of the trust.

Rosanna McCormick (Seal)
Notary Public
My Commission Expires: 5/12/00

ROSANNA McCORMICK NOTARY PUBLIC COMMONWEALTH OF MASSACHUSETTS

Rosanna McCormick
NOTARY PUBLIC
My Commission expires May 12, 2000

MERRIMACK COUNTY RECORDS
Kathi L. Guay, Register

Stanley Works

003-117-142

B 1547P0453

QUITCLAIM DEED

The Stanley Works, a Connecticut corporation with principal place of business at 1000 Stanley Drive, New Britain, Connecticut, for consideration paid, grants to Louis Ferrari, Trustee of Franklin Falls Trust, a New Hampshire Trust, with place of business at Lower Bay Road, R.F.D. #1, Box 330, Laconia, New Hampshire 03246, with QUITCLAIM COVENANTS, the following described tracts or parcels of land, with the buildings thereon, situated in Franklin, Merrimack County, New Hampshire and bounded and described as follows:

STATE OF NEW HAMPSHIRE TAX ON TRANSFER OF REAL PROPERTY STATE TAX COMMISSION R.S.A. 78-B 592.50 JAN--'86 P.B. 10664 105610

STATE OF NEW HAMPSHIRE TAX ON TRANSFER OF REAL PROPERTY STATE TAX COMMISSION R.S.A. 78-B 592.50 JAN--'86 P.B. 10664 105610

One tract beginning at the North Easterly terminal point of the highway leading from Memorial Street past land of W. H. & Geo. D. Mayo, or formerly of them, thence westerly by said new street one hundred and ten feet to an iron pin; thence by a line at right angles with said last street about one hundred and twenty feet to highwater mark of the Winnipiseogee River; thence up said River by the line of highwater mark about fifteen feet to a point in a line of an extension of the Westerly side of Memorial Street; thence southerly by a line which would be an extension of the Westerly side of said Memorial Street and in the same course to the point begun at. Reserving to The Franklin Falls Company, its successors and assigns all rights whatsoever, to the use of the water of said river and to the river bed and the right to turn the river by penstock or other passageway from its present channel for the improvement of the power of the dam of the Franklin Light and Power Co. but conveying herewith the right to lay pipe in the bed of said river to carry away sewerage from said granted premises; conveying also the right to take from the river above said dam sufficient water for said grantee's use on said granted premises for tempering, for sprinkler service and for water closets and steam heating service, and to convey the same by pipe to said granted premises in such way and place as to do the least damage to the property of the Franklin Falls Company, or those holding under it.

Being the same premises conveyed to Parker C. Hancock and George W. Griffin by Warranty Deed of Franklin Falls Company dated July 25, 1895 and recorded in Merrimack County Records, Book 317, Page 127.

Also another tract situate in said Franklin and bounded as follows, to wit:

Beginning at the South West corner of land of the said grantor on the North side of Memorial Street; thence Westerly by said street forty feet to an iron pin; thence Northerly by a line parallel to said grantor's Westerly line to the Winnipiseogee River at highwater mark; thence Easterly by the line of highwater mark of said river to the North West corner of land of said grantors; thence Southerly by land of said grantor to the bound begun at. Reserving to the Franklin Light & Power Company, its successors or assigns, all rights whatsoever to the use of the water of said river and the river bed and the right to turn the river by penstock or other passageway from its old channel for the improvement of the power of said Franklin Light & Power Company's dam.

Being the same premises conveyed to G. W. Griffin and Parker C. Hancock, under the name of George W. Griffin & Co. by Warranty Deed of Franklin Light & Power Company dated October 18, 1906 and recorded in Merrimack County Records, Book 369, Page 524.

Reference is further made to Deed of George W. Griffin and Parker C. Hancock to G. W. Griffin Company dated February 13, 1908 and recorded in Merrimack County Records, Book 382, Page 536.

Also another tract of land, with the buildings thereon, situated in said Franklin bounded and described as follows, to wit:

Beginning at the South West corner of land of said grantor, thence Northerly by land of said grantor one hundred feet more or less to the Winnipisogee River at highwater mark: thence Westerly by said highwater mark of said river sixty feet to an iron bound; thence Southerly by a line parallel to and sixty feet from said first line to line of the proposed street; thence Easterly by said proposed street sixty feet to the bound begun at. Reserving and excepting to The Franklin Light & Power Company the full use of the water of said river and the right to take the same by iron penstock, or otherwise, across the neck of land to its power station.

Being the same premises conveyed to G. W. Griffin Company by Warranty Deed of The Franklin Light & Power Company dated March 14, 1912 and recorded in Merrimack County Records, Book 402, Page 342.

Also a certain tract of land, with the buildings thereon, situated in said Franklin, bounded and described as follows, to wit:

Beginning at an iron pin on the North side of Memorial Street and at the Easterly point of said grantor's land, thence North Westerly to the iron pin at the Westerly end of the concrete wall extending down stream from the Franklin Light &

B 1547P0454

Power Company's dam, thence by the line of highwater mark down said River to land of said grantor, thence South Easterly by said grantor's land to the first bound.

Reserving to The Franklin Light & Power Company, its successors and assigns, the right to use said premises so far as reasonably necessary to repair or rebuild the Franklin Light & Power Company's dam doing no unnecessary damage.

Being the same premises conveyed to G. W. Griffin Co. by Warranty Deed of Franklin Light & Power Company dated October 22, 1918 and recorded in Merrimack County Records, Book 439, Page 227.

Also a certain tract of land, with the buildings thereon, situated in said Franklin, bounded and described as follows, to wit:

Beginning at the Southwest corner of land now or formerly of said G. W. Griffin Company on the North side of Memorial Street; thence running Northerly by said G. W. Griffin Company's land to the Winnipiseogee River at the highwater mark; thence running Westerly by said highwater mark of said river to land of the City of Franklin known as Odelle Park; thence South by line of said Park land to said Memorial Street; thence running Easterly on said Street one hundred and twenty six and one-half feet (126 1/2) more or less, to the bound begun at.

Reserving the river bed and full use and enjoyment of the water in said river and the right to control the flow of said river at pleasure and to convey the same from the Power Company dam above said conveyed premises across the neck of land to the vicinity of the present power station.

Meaning and intending to describe the same premises conveyed to The Stanley Works by deed of G. W. Griffin Co. dated September 6, 1979, and recorded in the Merrimack County Registry of Deeds at Book 1355, Page 1066.

Any and all improvements and buildings that may be located on the above premises are conveyed without warranty of any kind, as is, with all defects.

2/28/2015 10:16:47 AM

CITY OF FRANKLIN, NH
ASSESSMENT FIELD RECORD

ACCOUNT DATA

PARCEL ID MAP	LOT	UNIT		CARD	PROPERTY LOCATION ST. NUMBER	STREET NAME	DESIG.	TYPE	USE	CLASS
				1 OF 2					400	1

RECORD OF OWNERSHIP AND MAILING ADDRESS

2309 Ferrari Franklin Mills Realty, LLC
~~FERRARI REALTY TRUST~~
117-142-00
93&119 MEMORIAL STREET

DATE	DEED BOOK	DEED PAGE	LOT NO.	SUBDIVISION	PURCHASE PRICE
1/26/15	3467	2225			Owner To Trust Min Stamp

LASER DISC # K-10

MEMORANDUM ABANDONED Mill

PROPERTY FACTORS

ZONE	MULTI	NC
B2		

NBHD	SECTION
304	

RES	# LIV UNITS
%	

CONDO #	DISTRICT

TOPOGRAPHY		UTILITIES		STREET OR ROAD		DWELLING SET BACK	
LEVEL	(1)	PUBLIC SEWER	(1)	PAVED	(1)	MORE THAN NEIGHBORHOOD AVG	1
ABOVE STREET	2	SEPTIC	2	SEMI-IMPROVED	2	SAME AS NEIGHBORHOOD AVG	(2)
BELOW STREET	3	PRIVATE WATER	3	UNPAVED	3	LESS THAN NEIGHBORHOOD AVG	3
ROLLING	4	WELL	4	PROPOSED	4	NONE	4
STEEP	5	LAKE WATER	5	CURB & GUTTER	5		
SWAMP	6			SIDEWALK	6	**FRONTING TRAFFIC**	
LEDGE	7			REAR LAND	7	LIGHT	(1)
LANDSCAPED	8			NONE	8	MEDIUM	2
						HEAVY	3
						NONE	4

APPRAISER		DATE	ACT. CODE	
APPRAISER	JLH	DATE 6/29/16	ACT. CODE	U
APPRAISER		DATE / /	ACT. CODE	
APPRAISER		DATE / /	ACT. CODE	

ENTRANCE CODES (CIRCLE 1)

0 ENTRANCE AND SIGNATURE GAINED
1 ENTRANCE GAINED
2 NOT APPLICABLE, UNIMPROVED PARCEL
3 ENTRANCE & INFO REFUSED
4 ENTRANCE REFUSED, INFO GIVEN AT DOOR
(5) CURRENTLY UNOCCUPIED
6 ESTIMATED FOR MISC. REASONS (SEE MEMO)
7 OCCUPANT NOT AT HOME

INFO CODES
1 OWNER
2 TENANT
3 OTHER

ACTIVITY CODES	
ABATEMENT INSPECTION	A
CYCLED INSPECTION	C
CONSTRUCTION PERMIT	P
QUALITY CONTROL	Q
FIELD REVIEW	R
TAXPAYER REQUEST	T
ASSESSMENT UPDATE	U
MISCELLANEOUS (See notes)	X

SALES DATA

YR.	MO.	TYPE	AMOUNT	SOURCE	VALID	O
15	01	2	4,000	4	44	

VALIDITY CODES

TYPE CODES
LAND
LAND & BLDG
BUILDING

SOURCE CODES
1 BUYER
2SELLER
3 AGENT
4 OTHER

0- VALID SALE
1- VALID, INCL ADD'L PARCELS
3- VALID, CHANGED AFTER SALE
6- VALID, SALE FROM BANK
A - RELATIVE SALE
B - RELATED CORPORATIONS
C - BY SHERIFF, COURT, FORCED SALE
D - PROPERTY LOCATED IN MORE THAN ONE TOWN
E - BY OR TO MORTGAGE OR FINANCIAL INSTITUTION
F - CEMETARY LOTS
G - INTEREST IN LIFE ESTATE
H - UNSPECIFIED UNDIVIDED INTEREST RETAINED
J - SPECIFIED UNDIVIDED INTEREST INCLUDED
J - MINERAL OR TIMBER RIGHTS
K - INVOLVES TRADE OF OR EXCHANGE OF OTHER PROPERTY
L - TO OR BY GOVERNMENT ENTITY
N - TO OR BY BENEVOLENT OR EDUCATIONAL INSTITUTION
O - TO OR BY ADMINISTRATORS, EXECUTORS OR TRUSTEES
P - SELLER RETAINS PROPERTY FOR MORE THAN ONE YEAR
Q - OTHER THAN QUITCLAIM OR WARANTEE COVENANTS
R - NOT OPEN MARKET DUE TO MISREPRESENTATION
S - ASSESSED UNDER RSA 79-A
T - CONSERVATION EASEMENT UNDER RSA 79-B
U - TIME SHARE PROPERTY
V - TO CLEAR A PROPERTY TITLE
W - EASEMENT OR RIGHT OF WAY
X - OTHER (EXPLAIN IN NOTES)
Z - NOT OPEN MARKET

BUILDING PERMIT RECORD

DATE	NUMBER	PRICE	PURPOSE

LAND DATA

O NONE	N	ACTUAL FRONTAGE	EFFECTIVE FRONTAGE	ACTUAL UNIT PRICE	DEPTH FACTOR	EFFECTIVE UNIT PRICE	INFLUENCE FACTOR	LAND VALUE
LOT 1 REGULAR LOT 2 SECONDARY SITE 3 APARTMENT SITE 4 OTHER 5 WATERFRONT	L L L L						[ ] %	
SF 1 PRIMARY LOT 2 SECONDARY SITE 3 UNDEVELOPED 4 RESIDUAL 5 WATERFRONT	S S S	SQ. FT.					[ ] %	
ACREAGE 1 PRIMARY SITE 2 SECONDARY SITE 3 UNDEVELOPED 4 MARSHLAND 5 WATERFRONT 6 RESIDUAL 7 BEACH RIGHTS 8 DOCK RIGHTS	A 5 A A A A A	1.000 ACRES ACRES ACRES ACRES ACRES ACRES					[ ] %	
0 TOTAL	A	1.000 ACRES						
GROSS 1 IRREGULAR LOT 2 SITE VALUE 3 RESIDUAL 4 HOMESITE 5 CONDO	G							

INFLUENCE FACTORS
1 UNIMPROVED
2 EXCESSIVE FRONT
3 TOPOGRAPHY
4 SHAPE OR SIZE
5 ECONOMIC MISIMPROVEMENT
6 RESTRICTIONS-NONCONFORMING
7 UNAPPROVED ROAD
8 VIEW (+)

Signature by owner or agent below indicates data on this form was collected in your presence. It does not mean that you have verified the information hereon.

INPECTION WITNESSED BY:

WATERFRONT INFO DEEDED NOW: YES_____ NO_____
TOPO: SHEER_____ STEEP_____✓ ROLLING_____ LEVEL_____
IMPROVED: BEACH_____ SEAWALL_____ RAMP_____

SUMMARY OF VALUES

TOTAL VALUE OF LAND	
TOTAL VALUE OF BUILDINGS	
TOTAL VALUE OF LAND AND BUILDINGS	

...ner tract situate in said Franklin and bounded as
...t:
...g at the South West corner of land

2/28/2015 10:16:47 AM

COMMERCIAL/INDUSTRIAL PROPERTY RECORD CARD / FRANKLIN, NEW HAMPSHIRE / EFFECTIVE DATE OF VALUE: APRIL 1, 2014

93 MEMORIAL STREET Parcel ID: 117-142-00 SHEET # N8 Number of Units: Class: I - 400 Zoning: B2 Card # 1 of 2

CURRENT OWNER/ADDRESS

FERRARI FRANKLIN MILLS REALTY LLC
FERRARI TTEES, LOUIS & CAROLYN J

% 18 BROADWAY
STONEHAM MA 02180
DEED BOOK: 3467
DEED PAGE: 2235
DEED DATE: 20150126
LAST UPDATE: 20150227
SALE DATA:

DATE	TYPE	PRICE	CODE
2015012	LAND + BLDG	4,000	44

LAND DATA:

TYPE	SIZE		LAND INFLUENCE(S)	FACTOR	LAND VALUE
		0	0		
		0			
WATERFRONT	1.000	0	0	-10	50,760
RESIDUAL	0.200	0	0		1,140
		0	0		
		0	0		

TOTAL ACREAGE: 1.200 TOTAL LAND VALUE: 51,900

Neighborhood ID: 303.00

ASSESSMENT INFORMATION:

	PRIOR	CURRENT
LAND	52,000	51,900
BUILDING	133,800	133,800
TOTAL	185,800	185,700

- DATA COLLECTION INFORMATION -

20110831	RS	FIELD REVIEW
20100928	RD	OCC.NOT HOME
20020701	WC	UNOCCUPIED

OTHER FEATURES/ATTACHED IMPROVEMENTS

NO	STR/C			IDENT. UNITS
2	LD1	LOAD STL	10 50	1
2	RS2	UTIL METAL	19 20	1
2	SS1	SPRINK WET	10744 1	1
2	OD1	OVHD WD/MTL	8 8	1
1	EE1	ENCLO ENTRY	6 4	1

SKETCH		AREA		AREA
*	2S BR / B	7320	H	
A	BR UTIL	399	I	
B	EVC LOAD D	500	J	
C	1S BR / B	2992	K	
D	RP2	32	L	
E	CP6	72	M	
F			N	
G				

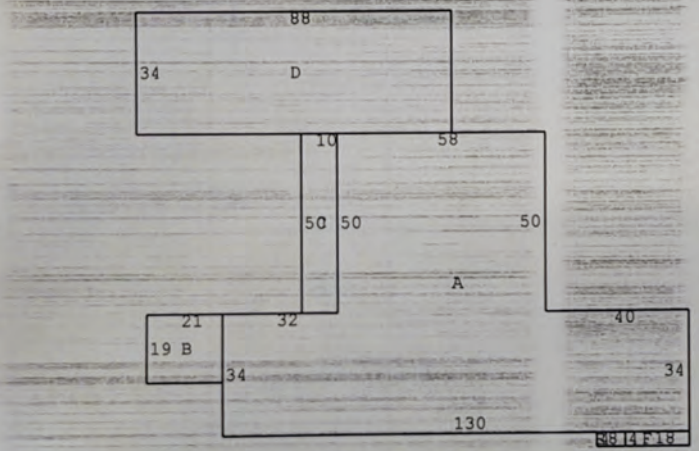

COST APPROACH DETAIL: | STRUCTURE TYPE: 401 MANUF PROCESSNG

LEVELS	USE	PERIMETER	HEATING	A/C	W/H	AREA	SF RATE	RCN	% GOOD	RCNLD
B1 TO B1	86	396	NONE	NONE	10	7320		256,300		25,630
01 TO 01	43	396	UNIT HEAT	NONE	12	7320		443,140		44,320
02 TO 02	84	396	UNIT HEAT	NONE	10	7320		354,170		35,420
B1 TO B1	86	212	NONE	NONE	8	2992		98,010		9,810
01 TO 01	43	212	UNIT HEAT	NONE	14	2992		190,010		19,010
TO			NONE	NONE				0		0
TO			NONE	NONE				0		0
TO			NONE	NONE				0		0

Building #	1	TOTAL UNADJ.RCNLD	74,550
Year Built	1930	AVE % GOOD	0.10
# Units		Grade Factor	1.00
QUALITY GRADE	C	# Ident Units	1
# IDENT UNITS	1	FUNC/ECON FACTOR	0.05
# Efficiencies		Rcnld	3,700
# 1-Bedrooms			
# 2-Bedrooms			
# 3-Bedrooms			

OUTBUILDING/YARD ITEM DETAIL:

DESCRIPTION	Width 1 OR SIZE	Length 1	QUAN.	YEAR BUILT	PHYS. COND.	FUNC. UTIL.	VALUE
						NONE	
						NONE	
						NONE	
						NONE	
						NONE	
						NONE	

Gross Building De

TOTAL OBY/YARD VALUE:

PERMIT DATA:

DATE	#	PRICE	PURPOSE

INCOME APPROACH SUMMARY:

TOTAL RENTABLE SQUARE FEET:
MARKET RENT/SQUARE FOOT:
POTENTIAL GROSS INCOME:
TOTAL EXPENSES (INCL. MNGMNT.):
TOTAL NET OPERATING INCOME:
OVERALL RATE:

NOTES: COST

CODE 2 = FF TIF DISTRICT

2/28/2015 10:16:47 AM

COMMERCIAL/INDUSTRIAL PROPERTY RECORD CARD / FRANKLIN, NEW HAMPSHIRE / EFFECTIVE DATE OF VALUE: APRIL 1, 2014

93 MEMORIAL STREET | Parcel ID: 117-142-00 | SHEET # N8 | Number of Units: | Class: I - 400 | Zoning: B2 | Card # 2 of 2

CURRENT OWNER/ADDRESS

FERRARI FRANKLIN MILLS REALTY LLC
FERRARI TTEES, LOUIS & CAROLYN J

% 18 BROADWAY
STONEHAM MA 02180
DEED BOOK: 3467
DEED PAGE: 2235
DEED DATE: 20150126
LAST UPDATE: 20150227
SALE DATA:

DATE	TYPE	PRICE	CODE

LAND DATA:

TYPE	SIZE	LAND INFLUENCE(S)	FACTOR	LAND VALUE
	0	0		
	0			
	0	0		
	0	0		
	0	0		
	0	0		

TOTAL ACREAGE: 1.200 TOTAL LAND VALUE: 51,900

Neighborhood ID: 303.00

ASSESSMENT INFORMATION:

	PRIOR	CURRENT
LAND	52,000	51,900
BUILDING	133,800	133,800
TOTAL	185,800	185,700

- DATA COLLECTION INFORMATION -

20110831	RS	FIELD REVIEW
20100928	RD	OCC.NOT HOME
20020701	WC	UNOCCUPIED

OTHER FEATURES/ATTACHED IMPROVEMENTS

NO	STR/C			IDENT. UNITS
1	RS1	UTIL FRAME	6 11	1
1	OD1	OVHD WD/MTL	8 10	1
1	SS1	SPRINK WET	1 9576	1
1	CP5	CANOPY ONLY	4 25	1
1	CP6	CNPY RF/SLB	4 18	1

SKETCH		AREA		AREA
*	1S CB	4680	H	
A	1S CB	3990	I	
B	1S CB	780	J	
C	2S CB	588	K	
D	RS1	66	L	
E	CP5	100	M	
F	CP6	72	N	
G				

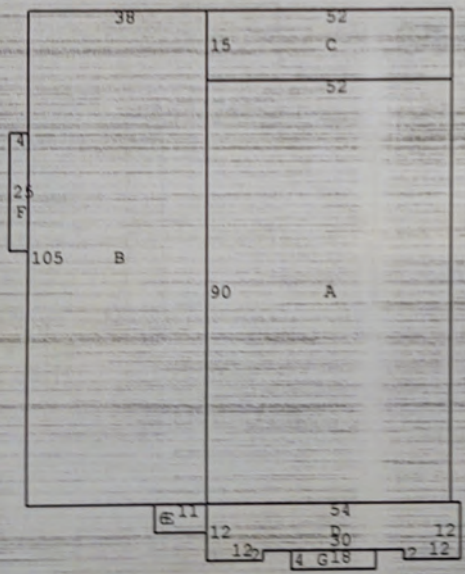

STRUCTURE TYPE: 401 MANUF PROCESSNG

COST APPROACH DETAIL:

LEVELS	USE	PERIMETER	HEATING	A/C	W/H	AREA	SF RATE	RCN	% GOOD	RCNLD
01 TO 01	82	110	HW/STEAM	NONE	10	588		104,850		41,940
02 TO 02	82	110	HW/STEAM	NONE	10	588		73,400		29,360
01 TO 01	44	187	UNIT HEAT	NONE	16	4680		219,370		87,750
01 TO 01	44	101	UNIT HEAT	NONE	10	780		48,470		19,390
01 TO 01	44	234	UNIT HEAT	NONE	14	3990		204,480		81,790
TO			NONE	NONE				0		0
TO			NONE	NONE				0		0
TO			NONE	NONE				0		0

Building #	2	TOTAL UNADJ.RCNLD	144,570
Year Built	1930	AVE % GOOD	0.40
# Units	1	Grade Factor	1.00
QUALITY GRADE	C	# Ident Units	1
# IDENT UNITS	1	FUNC/ECON FACTOR	0.90
# Efficiencies		Rcnld	130,100
# 1-Bedrooms			
# 2-Bedrooms			
# 3-Bedrooms			

OUTBUILDING/YARD ITEM DETAIL:

DESCRIPTION	Width 1	Length 1 OR SIZE	QUAN.	YEAR BUILT	PHYS. COND.	FUNC. UTIL.	VALUE
						NONE	
						NONE	
						NONE	
						NONE	
						NONE	
						NONE	

Gross Building De

TOTAL OBY/YARD VALUE:

PERMIT DATA:

DATE	#	PRICE	PURPOSE

INCOME APPROACH SUMMARY:

TOTAL RENTABLE SQUARE FEET:
MARKET RENT/SQUARE FOOT:
POTENTIAL GROSS INCOME:
TOTAL EXPENSES (INCL. MNGMNT.):
TOTAL NET OPERATING INCOME:
OVERALL RATE:

NOTES: COST

CODE 2 = FF TIF DISTRICT

COMMERCIAL/INDUSTRIAL PROPERTY RECORD CARD / FRANKLIN, NEW HAMPSHIRE / EFFECTIVE DATE OF VALUE: APRIL 1, 2015

93 MEMORIAL STREET Parcel ID: 117-142-00 SHEET # N8 Number of Units: Class: I - 400 Zoning: B2 Card # 1 of 2

CURRENT OWNER/ADDRESS

FERRARI FRANKLIN MILLS REALTY LLC
FERRARI TTEES, LOUIS & CAROLYN J

% 18 BROADWAY
STONEHAM MA 02180
DEED BOOK: 3467
DEED PAGE: 2235
DEED DATE: 20150126
LAST UPDATE: 20150821
SALE DATA:

DATE	TYPE	PRICE	CODE
2015012	LAND + BLDG	4,000	44

LAND DATA:

TYPE	SIZE		LAND INFLUENCE(S)	FACTOR	LAND VALUE
		0	0		
		0			
WATERFRONT	1.000	0	0	-10	50,760
RESIDUAL	0.200	0	0		1,140
		0	0		
		0	0		

TOTAL ACREAGE: 1.200 TOTAL LAND VALUE: 51,900

Neighborhood ID: 303.00

ASSESSMENT INFORMATION:

	PRIOR	CURRENT
LAND	52,000	51,900
BUILDING	133,800	133,800
TOTAL	185,800	185,700

- DATA COLLECTION INFORMATION -

20150506	RS	ESTIMATED
20110831	RS	FIELD REVIEW
20100928	RD	OCC.NOT HOME

OTHER FEATURES/ATTACHED IMPROVEMENTS

NO	STR/C			IDENT. UNITS
2	LD1	LOAD STL	10 50	1
2	RS2	UTIL METAL	19 20	1
2	SS1	SPRINK WET	10744 1	1
2	OD1	OVHD WD/MTL	8 8	1
1	EE1	ENCLO ENTRY	6 4	1

SKETCH		AREA		AREA
A	2S BR / B	7320	I	
B	BR UTIL	399	J	
C	EVC LOAD D	500	K	
D	1S BR / B	2992	L	
E	RP2	32	M	
F	CP6	72	N	
G			O	
H				

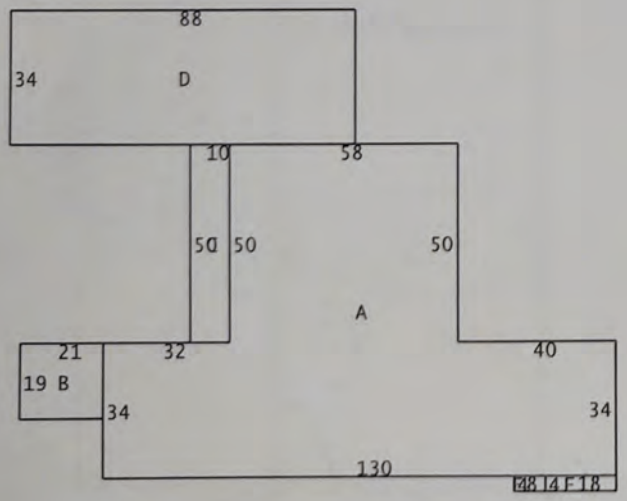

COST APPROACH DETAIL:

STRUCTURE TYPE: 401 MANUF PROCESSNG

LEVELS	USE	PERIMETER	HEATING	A/C	W/H	AREA	SF RATE	RCN	% GOOD	RCNLD
B1 TO B1	86	396	NONE	NONE	10	7320	35.01	256,300	.10	25,630
01 TO 01	43	396	UNIT HEAT	NONE	12	7320	60.53	443,140	.10	44,320
02 TO 02	84	396	UNIT HEAT	NONE	10	7320	48.38	354,170	.10	35,420
B1 TO B1	86	212	NONE	NONE	8	2992	32.76	98,010	.10	9,810
01 TO 01	43	212	UNIT HEAT	NONE	14	2992	63.50	190,010	.10	19,010
TO			NONE	NONE			0.00	0	.00	0
TO			NONE	NONE			0.00	0	.00	0
TO			NONE	NONE			0.00	0	.00	0

Building #	1	TOTAL UNADJ.RCNLD	74,550
Year Built	1930	AVE % GOOD	0.10
# Units		Grade Factor	1.00
QUALITY GRADE	C	# Ident Units	1
# IDENT UNITS	1	FUNC/ECON FACTOR	0.05
# Efficiencies		Rcnld	3,700
# 1-Bedrooms			
# 2-Bedrooms			
# 3-Bedrooms			

OUTBUILDING/YARD ITEM DETAIL:

DESCRIPTION	Width 1	Length 1 OR SIZE	QUAN.	YEAR BUILT	PHYS. COND.	FUNC. UTIL.	VALUE
						NONE	
						NONE	
						NONE	
						NONE	
						NONE	
						NONE	

Gross Building De

TOTAL OBY/YARD VALUE:

PERMIT DATA:

DATE	#	PRICE	PURPOSE

INCOME APPROACH SUMMARY:

TOTAL RENTABLE SQUARE FEET:
MARKET RENT/SQUARE FOOT:
POTENTIAL GROSS INCOME:
TOTAL EXPENSES (INCL. MNGMNT.):
TOTAL NET OPERATING INCOME:
OVERALL RATE:
INCOME INDICATED VALUE: 366,100

NOTES: COST

CODE 2 = FF TIF DISTRICT
COMM NOTE: 1/12: FS MLS #4093237 $295,000

1:15 PM

COMMERCIAL/INDUSTRIAL PROPERTY RECORD CARD / FRANKLIN, NEW HAMPSHIRE / EFFECTIVE DATE OF VALUE: APRIL 1, 2015

93 MEMORIAL STREET Parcel ID: 117-142-00 SHEET # N8 Number of Units: Class: I - 400 Zoning: B2 Card # 2 of 2

CURRENT OWNER/ADDRESS

FERRARI FRANKLIN MILLS REALTY LLC
FERRARI TTEES, LOUIS & CAROLYN J

% 18 BROADWAY
STONEHAM MA 02180
DEED BOOK: 3467
DEED PAGE: 2235
DEED DATE: 20150126
LAST UPDATE: 20150821
SALE DATA:
DATE TYPE PRICE CODE

LAND DATA:

TYPE	SIZE	LAND INFLUENCE(S)	FACTOR	LAND VALUE
	0	0		
	0			
	0	0		
	0	0		
	0	0		
	0	0		

TOTAL ACREAGE: 1.200 TOTAL LAND VALUE: 51,900

Neighborhood ID: 303.00

ASSESSMENT INFORMATION:

	PRIOR	CURRENT
LAND	52,000	51,900
BUILDING	133,800	133,800
TOTAL	185,800	185,700

- DATA COLLECTION INFORMATION -

20150506 RS ESTIMATED
20110831 RS FIELD REVIEW
20100928 RD OCC.NOT HOME

OTHER FEATURES/ATTACHED IMPROVEMENTS

NO	STR/C			IDENT.	UNITS
1	RS1	UTIL FRAME	6	11	1
1	OD1	OVHD WD/MTL	8	10	1
1	SS1	SPRINK WET	1	9576	1
1	CP5	CANOPY ONLY	4	25	1
1	CP6	CNPY RF/SLB	4	18	1

SKETCH		AREA		AREA
A	1S CB	4680	I	
B	1S CB	3990	J	
C	1S CB	780	K	
D	2S CB	588	L	
E	RS1	66	M	
F	CP5	100	N	
G	CP6	72	O	
H				

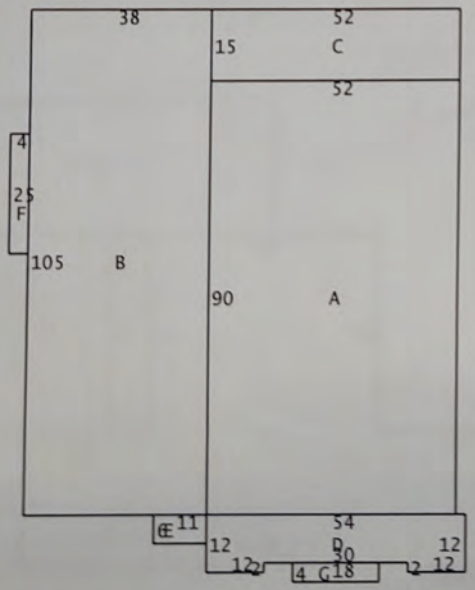

COST APPROACH DETAIL:

STRUCTURE TYPE: 401 MANUF PROCESSNG

LEVELS	USE	PERIMETER	HEATING	A/C	W/H	AREA	SF RATE	RCN	% GOOD	RCNLD
01 TO 01	82	110	HW/STEAM	NONE	10	588	178.31	104,850	.40	41,940
02 TO 02	82	110	HW/STEAM	NONE	10	588	124.83	73,400	.40	29,360
01 TO 01	44	187	UNIT HEAT	NONE	16	4680	46.87	219,370	.40	87,750
01 TO 01	44	101	UNIT HEAT	NONE	10	780	62.15	48,470	.40	19,390
01 TO 01	44	234	UNIT HEAT	NONE	14	3990	51.25	204,480	.40	81,790
TO			NONE	NONE			0.00	0	.00	0
TO			NONE	NONE			0.00	0	.00	0
TO			NONE	NONE			0.00	0	.00	0

Building #	2	TOTAL UNADJ.RCNLD	144,570
Year Built	1930	AVE % GOOD	0.40
# Units	1	Grade Factor	1.00
QUALITY GRADE	C	# Ident Units	1
# IDENT UNITS	1	FUNC/ECON FACTOR	0.90
# Efficiencies		Rcnld	130,100
# 1-Bedrooms			
# 2-Bedrooms			
# 3-Bedrooms			

OUTBUILDING/YARD ITEM DETAIL:

DESCRIPTION	Width 1	Length 1 OR SIZE	QUAN.	YEAR BUILT	PHYS. COND.	FUNC. UTIL.	VALUE
						NONE	
						NONE	
						NONE	
						NONE	
						NONE	
						NONE	

Gross Building De

TOTAL OBY/YARD VALUE:

PERMIT DATA:
DATE # PRICE PURPOSE

INCOME APPROACH SUMMARY:

TOTAL RENTABLE SQUARE FEET:
MARKET RENT/SQUARE FOOT:
POTENTIAL GROSS INCOME:
TOTAL EXPENSES (INCL. MNGMNT.):
TOTAL NET OPERATING INCOME:
OVERALL RATE:
INCOME INDICATED VALUE: 366,100

NOTES: COST

CODE 2 = FF TIF DISTRICT
COMM NOTE: DBA: PRETCO VACANT